



Technical Service Bulletin

Technical Service Bulletin: tsb100282

Released Date: 28-Jun-2004

New Direct Drive Fan Hub Washer

New Direct Drive Fan Hub Washer

Warranty Statement


The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Contents

This Technical Service Bulletin introduces a new hardened fan hub bearing washer for the direct drive type fan hub used on QSK45 and QSK60 series engines equipped with a direct drive fan hub. The new washer has increased material hardness. The washer is located between the two bearings in the fan hub. Its purpose is to maintain preload on the bearings within the fan hub to increase durability.

The washer is denoted by item 3 in Figure 1 below.

Fan Hub Washers	
Part Number	Washer Status
3171138	Superseded
3635836	Current for production and service

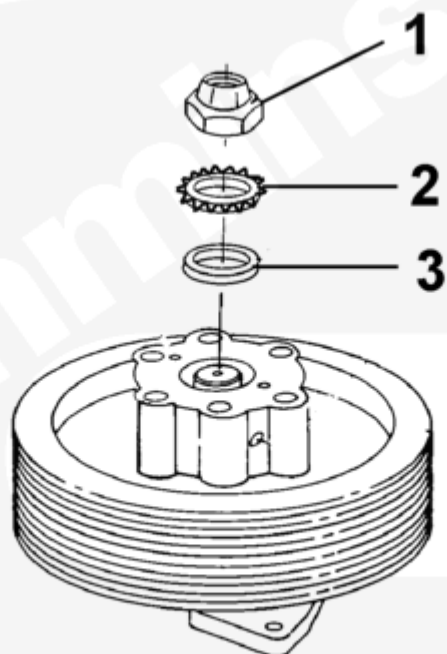

08600337

Figure 1.

Engine Serial Number first is 33156262.

Note : This is a product improvement and is not subject to campaign.