



Technical Service Bulletin

Technical Service Bulletin: tsb100418

Released Date: 14-Dec-2005

Revised Fan Idler Assembly

Revised Fan Idler Assembly

Warranty Statement


The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Contents

This parts topic introduces a revised fan idler arrangement for the QSK45, QSK60 and QSK78 series engines. The revised design will improve fan hub reliability and durability.

The revised fan idler went into production in August 2004 at the Daventry Engine plant. Engine serial number first was 33157417.

©Cummins Inc

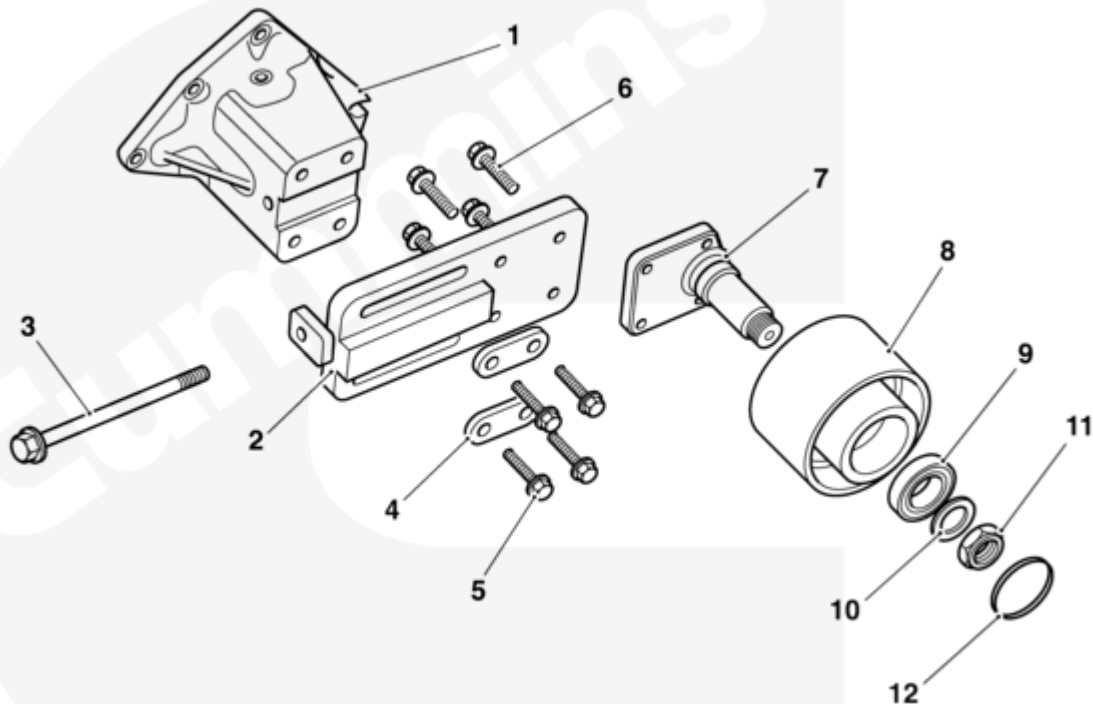

08500775

Item Number	Part Description	Part Number	Quantity
1	Idler Pulley Bracket	3636285	1
2	Adjusting Bracket	3636278	1

3	Adjusting Screw	4101288	1
4	Mounting Spacer	4101256	2
5	Capscrew	4001226	4
6	Capscrew	206391	4
7	Fan Hub Shaft	3637488	1
8	Idler Pulley	3637487	1
-	Oil Seal	3048625	1
9	Roller Bearing	3048626	2
-	Bearing Spacer	3627676	1
10	Washer	205168	1
11	Nut, Lock	206506	1
12	Expansion Plug	4101292	1

Last Modified: 14-Dec-2005
