



Technical Service Bulletin

Technical Service Bulletin: tsb100822

Released Date: 07-May-2009

Eliminator™ Centrifuge Service Bushing

Eliminator™ Centrifuge Service Bushing


Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Contents

This Technical Service Bulletin provides information on a service bushing for the Eliminator™ centrifuge. The service bushing, Part Number 3640564, can be used on QSK38/45/50/60/78 and KV38/50 engines. It can **not** be used on the QSK19 or K19 engines or on Fleetguard® centrifuges.

Excessive sludge or improper alignment can cause the bushing to become out of round. Be sure to clean the entire disk stack if there is excessive sludge in the centrifuge, to prevent future damage.

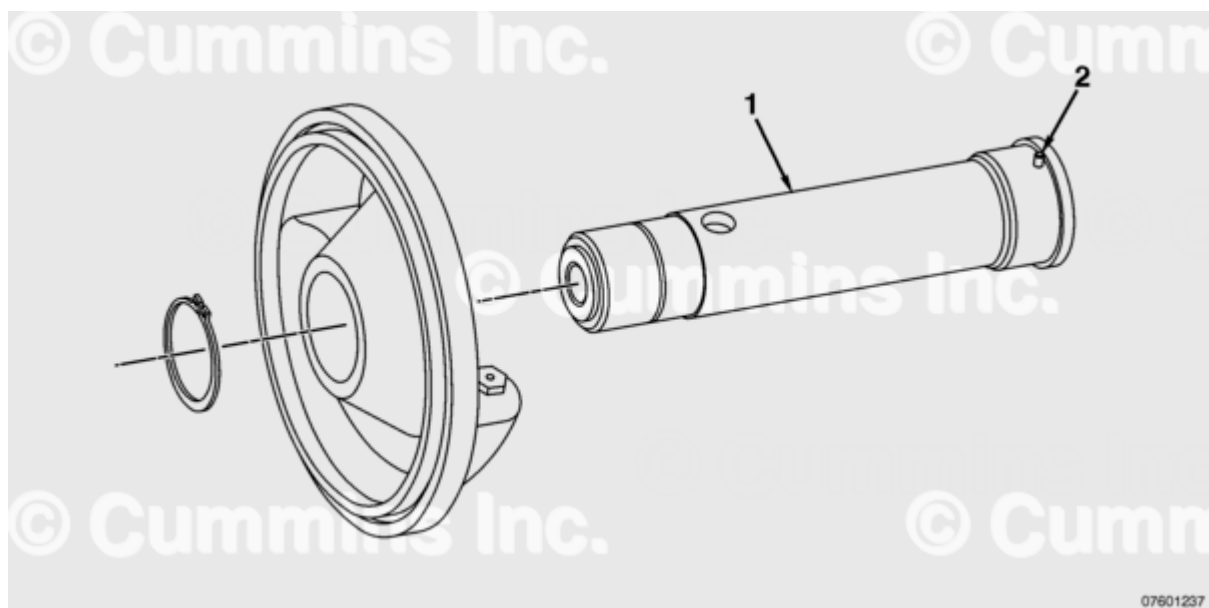

1. Service bushing
2. Alignment pin

