



Technical Service Bulletin

Technical Service Bulletin: TSB100977

Released Date: 06-Aug-2010

Service Part for LTA Water Pump Reuse

Service Part for LTA Water Pump Reuse


Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Contents

This document announces the service part number used when replacing the o-ring installed inside the low-temperature aftercooler (LTA) water pump for QSK45 and QSK60 engines. Every time the LTA water pump, Part Number 3638083, is disassembled for inspection or repair, the internal o-ring, Part Number 4919909, **must** be replaced. The o-ring, Part Number 4919909, is labeled as (3) in the Figure 1 below.

©Cummins Inc

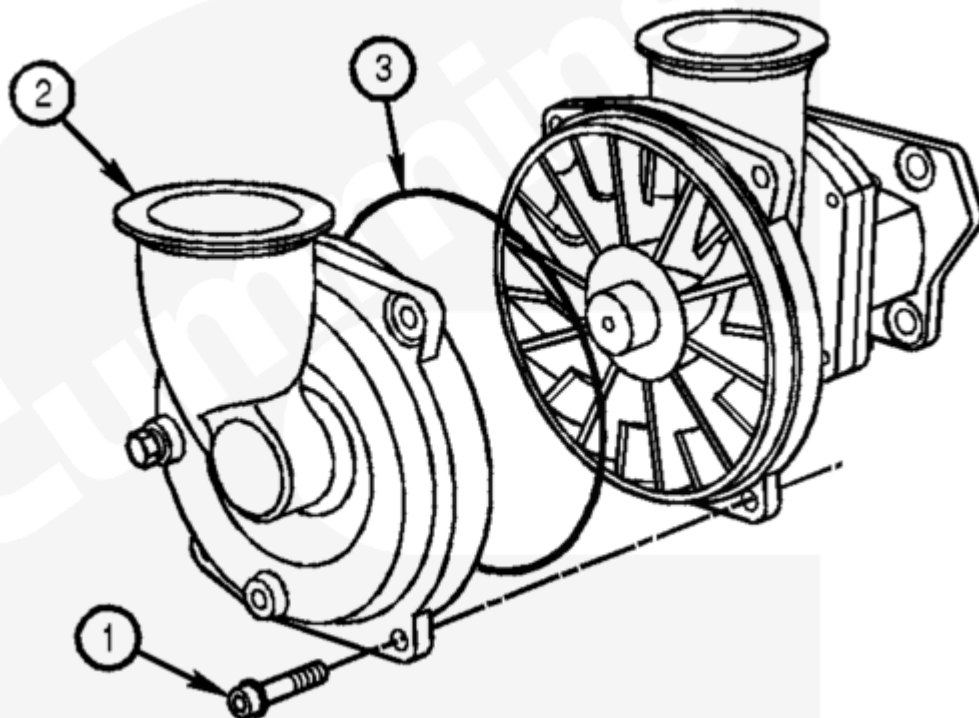

08600357

Figure 1. LTA Water Pump With O-ring Visible

Document History

Date	Details
2010-7-22	Module Created

Last Modified: 06-Aug-2010
