



Technical Service Bulletin

Technical Service Bulletin: TSB260042

Released Date: 05-Mar-2026

Fuel Pump Improvement

Fuel Pump Improvement

Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Contents

Product Affected

- QSK23 CM500
- QSK23 CM2250 K109
- QSK45 CM500
- QSK60 CM500
- QSK78 CM500

Description of Change

This Technical Service Bulletin informs the field of improvement made to the fuel pump used on QSK23, QSK45, QSK60, QSK78 HPI Engines.

Reason for Change

This improvement reduces the potential for damage to the maximum pressure relief valve small o-ring installed in the regulator housings on fuel pumps built after and including fuel pump Serial Number P4097076S512521300004 (built after 01 August 2025 at Cummins Fuel Systems - Columbus).

Part Inventory Action

This improvement is a running change to the current fuel pump(s) regulator housings and part numbers (PN) did **not** change. Improved fuel pumps may be identified by fuel pump Serial Number as described but no specific inventory actions required at this time. See Figure 1.

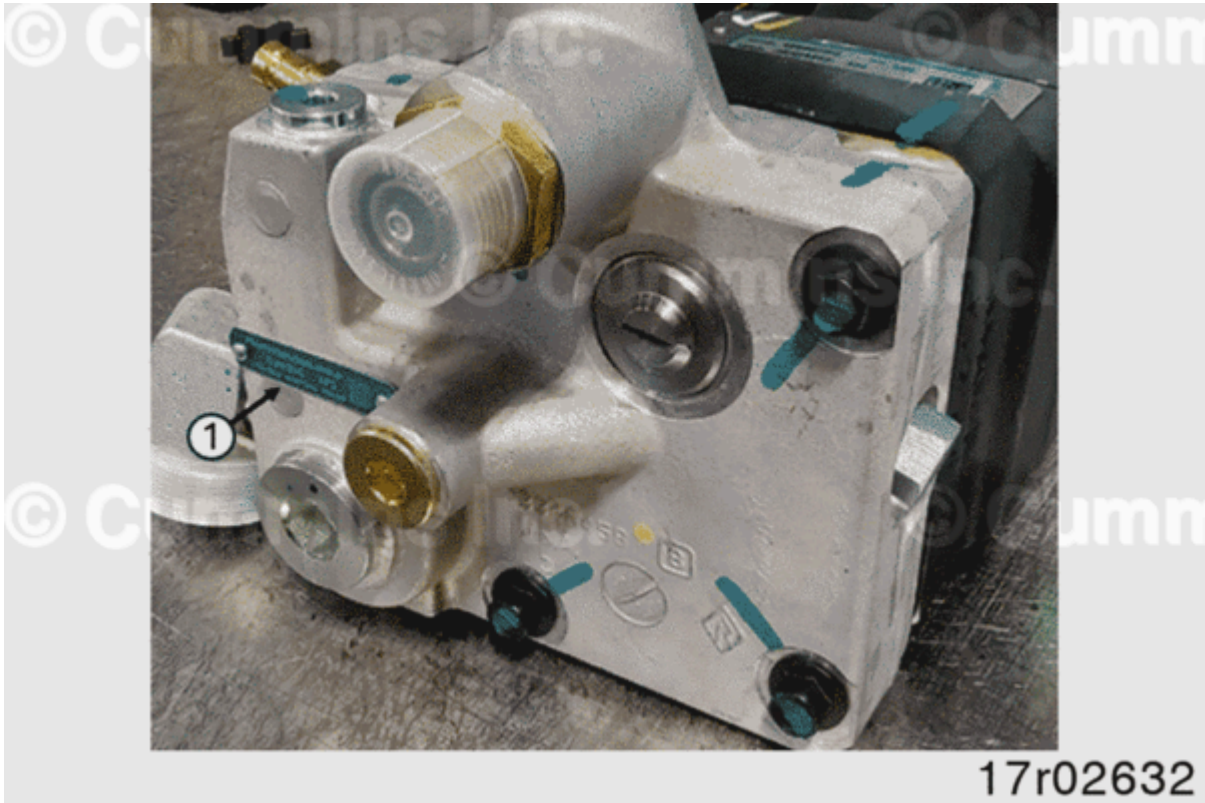


Figure 1, Assembly with fuel pump serial number location

No.	Name
1	Fuel Pump Serial Number Tag Location

Production Status

Implemented for production. See Table 1.

Table 1, Production Information			
Engine	ESN First	Build Date ¹	Plant
QSK23	85028553	10 January 2026	Phaltan Engine Plant
QSK60	85027276	11 November 2025	Phaltan Engine Plant
¹ Engine build date can be found on the engine dataplate.			

Document History

Date	Details
2026-3-4	Module Created

Last Modified: 05-Mar-2026