



Technical Service Bulletin

Technical Service Bulletin: TSB110116

Released Date: 28-Apr-2011

QSK78 New Generation Flexplate

QSK78 New Generation Flexplate

Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Contents

This document announces the release of a new generation flexplate for use in QSK78 diesel engines.

The part number has **not** been changed. The new generation flexplate, Part Number 4015791, supersedes the previous generation flexplate. The new flexplate has an improved material characteristic for better reliability.

Both generations of flexplates can be installed on the engine as a new part.


Use the following procedure in the QSK78 Troubleshooting and Repair Manual, Bulletin 3666727, for reuse criteria. Refer to Procedure 016-004 in Section 16.

(/qs3/pubsys2/xml/en/procedures/50/50-016-004.html)

The flexplate installation process remains the same. Installation of the new flexplate does **not** affect the torque sequence or value. If the incorrect torque sequence or values are used, engine damage will occur.

ESN first for this change in the Daventry Engine Plant (DAV) is 66301717.

The identification method for flexplate generations is:

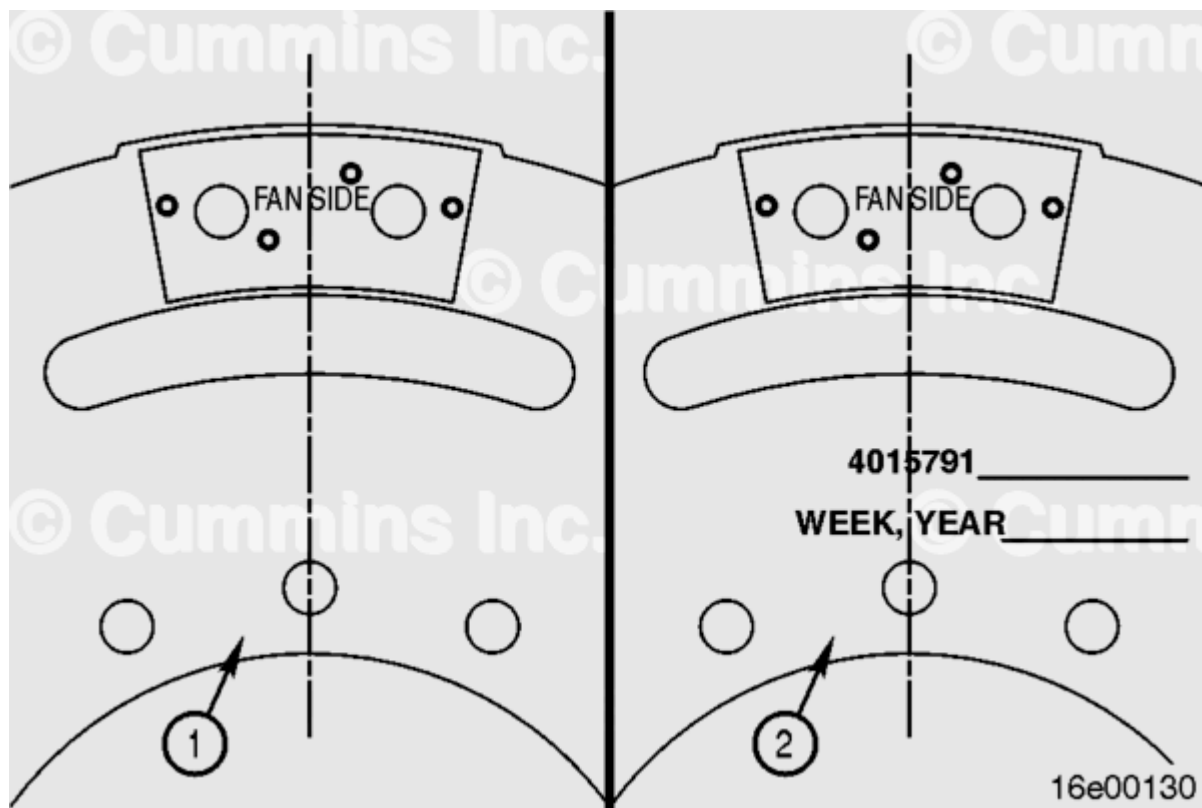

Old and New Generation Flexplates

1. Old Generation Flexplate - The **only** marking indicating "FAN SIDE" is stamped or etched close to the outer edge of the flexplate. There are no markings indicating part number and week/year of production.
2. New Generation Flexplate - The part number and production week/year are etched centrally under the stamped or etched marking indicating "FAN SIDE" which is located close to the outer edge of the flexplate.

Note : A correctly installed flexplate will have the "FAN SIDE" marking facing outward from the engine block, towards the generator fan.

Document History

Date	Details
2011-4-15	Module Created

Last Modified: 28-Apr-2011