



Technical Service Bulletin

Technical Service Bulletin: TSB110148

Released Date: 12-May-2011

K19, K38 and K50 Rocker Housing Gasket Change

K19, K38 and K50 Rocker Housing Gasket Change

Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Contents

This document was originally released between 1994 and 2001. It has been added to QSOL for informational purposes

This document introduces a new rocker lever housing gasket for use on all current and past K19, K38, and K50 engines. The new gasket, Part No.


3630839 **replaces** Part No. 3628330.

The new gasket is edge-molded and based on a modified version of the original edge-molded rocker lever housing gasket. The profile of the gasket was altered, but the material of the gasket remains the same. It is designed to fit **both** current production engines and older engines built with non-STC rocker lever housings. The old gasket, Part No. 3628330 released on 24Oct1994 did not seal the older non-STC engines.

The new gasket went into production in the third quarter of 1996 for all K19, K38, and K50 engines.

Note : All gasket sets packaged after 24Jul1996 will have gasket Part No. 3630839 in them.


New

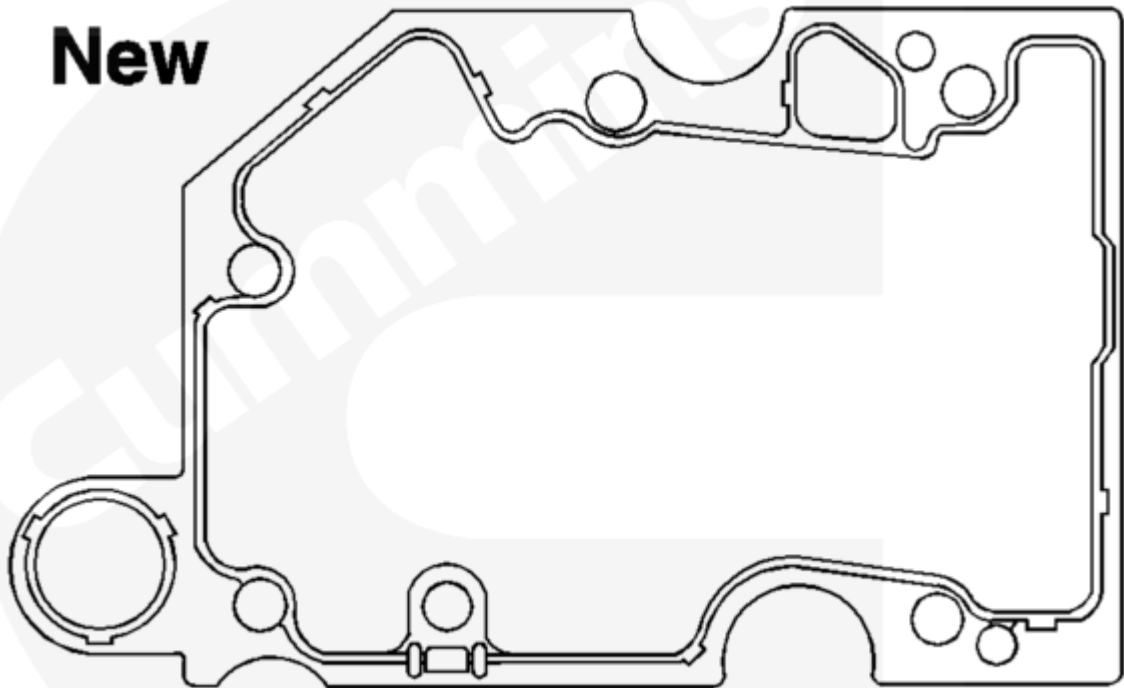

03400028

New Gasket, Part No. 3630839

Old

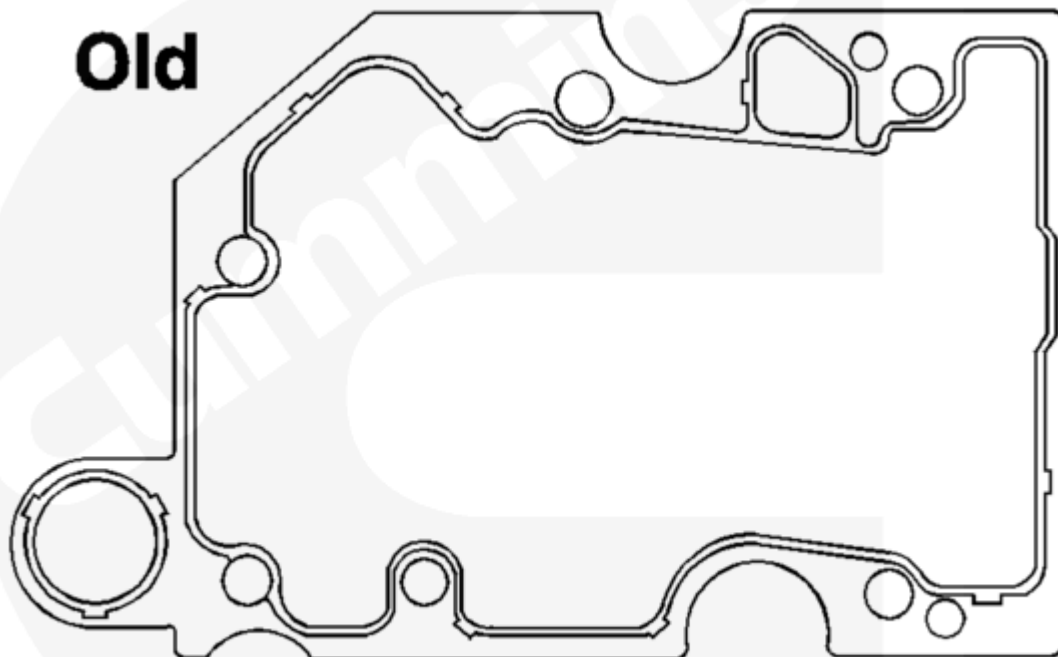

03400029

Old Gasket, Part No. 3628330

Date	Details
2011-5-11	Module Created

Last Modified: 12-May-2011
