



Technical Service Bulletin

Technical Service Bulletin: TSB150046

Released Date: 16-Apr-2015

New Low Temperature Aftercooling Coolant Hose

New Low Temperature Aftercooling Coolant Hose

Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Contents

This document introduces a new Low Temperature Aftercooling (LTA) coolant hose for two stage QSK60 engines.

Product Affected

- QSK60 CM500 (Two Stage Only)
- QSK60 CM850 MCRS (Two Stage Only)
- QSK60 CM2150 MCRS (Two Stage Only)

Description of Change

The new LTA coolant hose, Part Number 4381485, has a four ply woven aramid reinforced internal material with a silicon outer wrap.

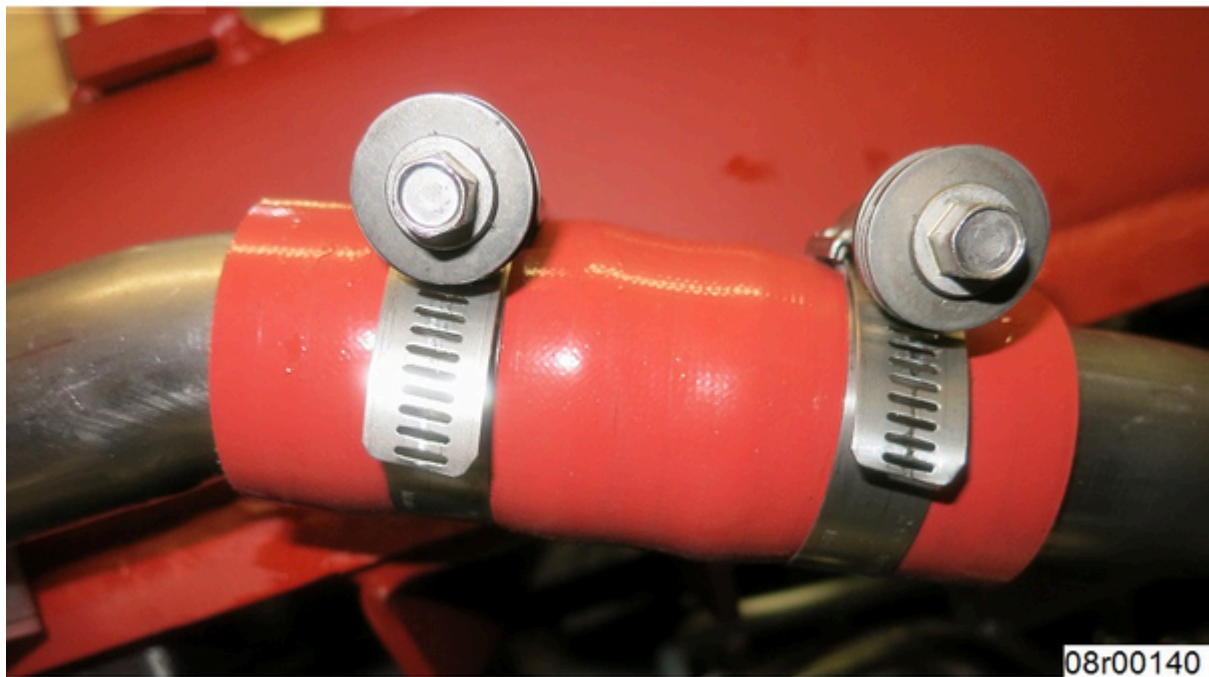


Figure 1, New LTA Coolant Hose with New Hose Clamp

Service Instructions

Hose clamp, Part Number 3922846, **must** be used with the new LTA coolant hose, Part Number 4381485.

Service Parts Availability

Service parts are available. See table 1.

Table 1, Part Information

Part Description	Obsolete Part Number	New Part Number
Coolant Hose	4080549	4381485

Part Structure

The existing coolant hose part number has been obsoleted and superseded by the new coolant hose part number.

Part Inventory Action

Use existing part inventory before using the new part number.

Production Status

Implemented for production. See Table 2.

Table 2, Production Information			
Product	Engine Serial Number (ESN) First	Build Date ¹	Plant
QSK60 CM2150 MCRS	33204171	9-Mar-14	Daventry Engine Plant
¹ Engine build date can be found on the engine dataplate.			

Document History

Date	Details
2015-4-6	Module Created