



Technical Service Bulletin

Technical Service Bulletin: TSB200013

Released Date: 25-Aug-2020

New QSK60 Lube Filter

New QSK60 Lube Filter

Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Contents

Product Affected

- QSK60 CM2150
- QSK60 CM850

Description of Change

A new lube filter is available that has improved filtration capabilities and filter life.

Reason for Change

There have been multiple reports of filter plugging across QSK60 construction engines. This filter improved filter debris capacity that will improve the hours until plugging allowing engines to meet service intervals.

Service Parts Availability

Service parts are available. See Table 1 for part numbers.

Customer Communication

This change only applies to Marine and Construction engines. Generator sets must still use the original part number.

Table 1, Service Parts

Part Description	Existing Part Number	Obsolete	Superseded	New Part Number
QSK60 Lube Filter	4920071	No	No	LF14005NN 5375337

Part Compatibility

Full compatibility. The new lube filters will fit the original filter heads with no changes to the installation procedure and service intervals.

Part Identification

All lube filters will have a Cummins label clearly displaying filter part numbers.

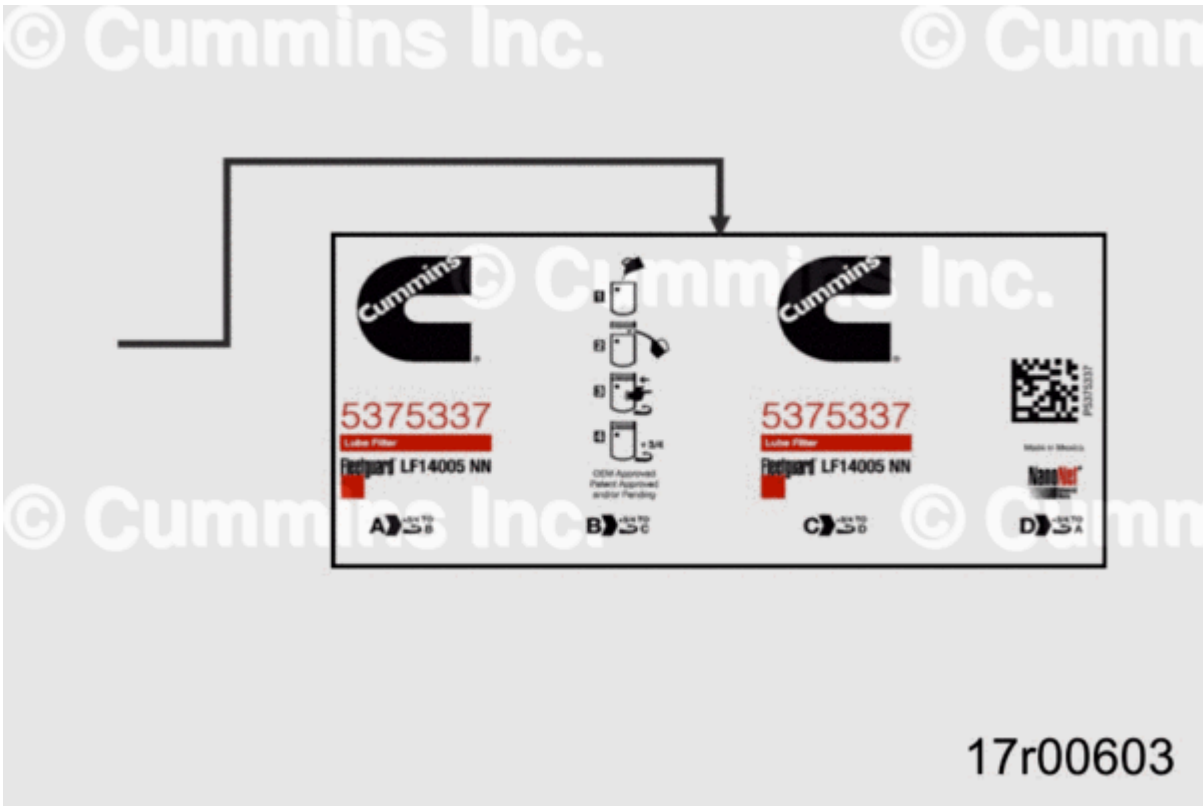


Figure 1, Filter Part Number Label

Part Inventory Action

Use current part number for PowerGen applications only. Marine and Construction require use of the new part number.

Production Status

Implemented for production. See Table 2.

Table 2, Production Information		
ESN First	Build Date ¹	Plant
33222289	23 July 2020	Daventry

Table 2, Production Information
¹ Engine build date can be found on the engine dataplate.

Document History

Date	Details
2020-1-16	Module Created
2020-8-25	Added production status table to the TSB.

Last Modified: 25-Aug-2020
