



# Technical Service Bulletin

Technical Service Bulletin: tsb100242

Released Date: 31-Oct-2003

New FS1006 Fuel Filter

## New FS1006 Fuel Filter

### Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

### Contents

This Service Parts Topic introduces the new-style FS1006 fuel filter as the replacement to the old-style FS1006. The new-style fuel filter now incorporates a droptube to help prevent hard start events on some High Horsepower engines due to air in the fuel filters being allowed to flow to the fuel pump.

There are no external differences in appearance between the old and new-style filters.


Old and new style filters may be intermixed.

The old Part Number 3089916, (figure 1), has been made obsolete and supersedes to Part Number 4095189 (figure 2).

A non-droptube version is no longer in production.


| Old Part Number | New Part Number |
|-----------------|-----------------|
| 3089916         | 4095189         |

**Note :** Although the addition of a droptube will greatly reduce, or eliminate, the amount of air going to the fuel pump, the new droptube fuel filter is not a substitute for the Troubleshooting Symptoms Charts. Follow the appropriate Troubleshooting Symptoms Charts available in the Troubleshooting and Repairs Manual.

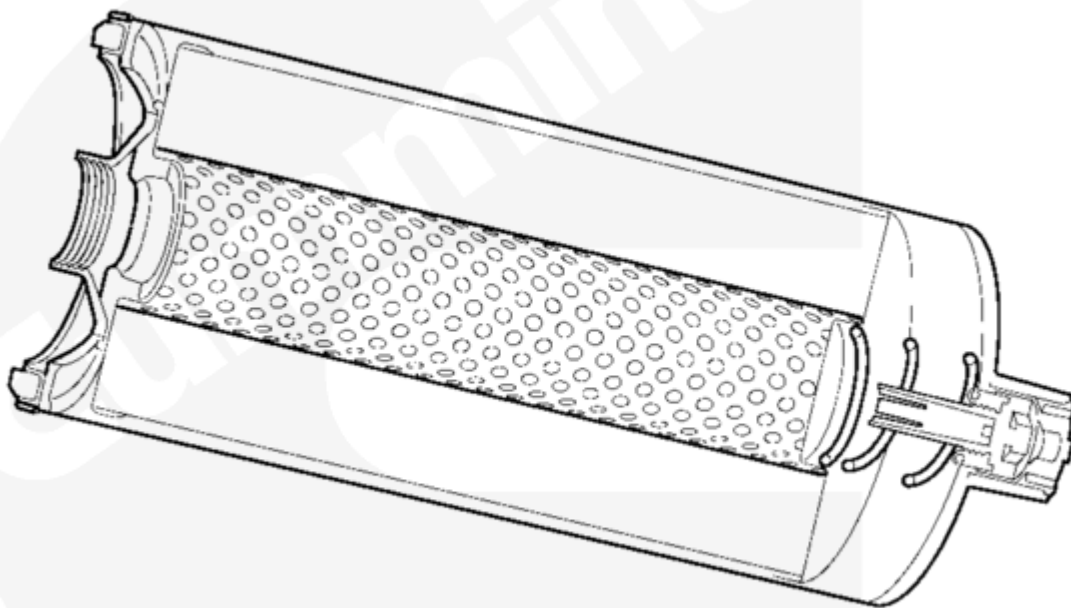

06800007

Figure 1. Non-droptube

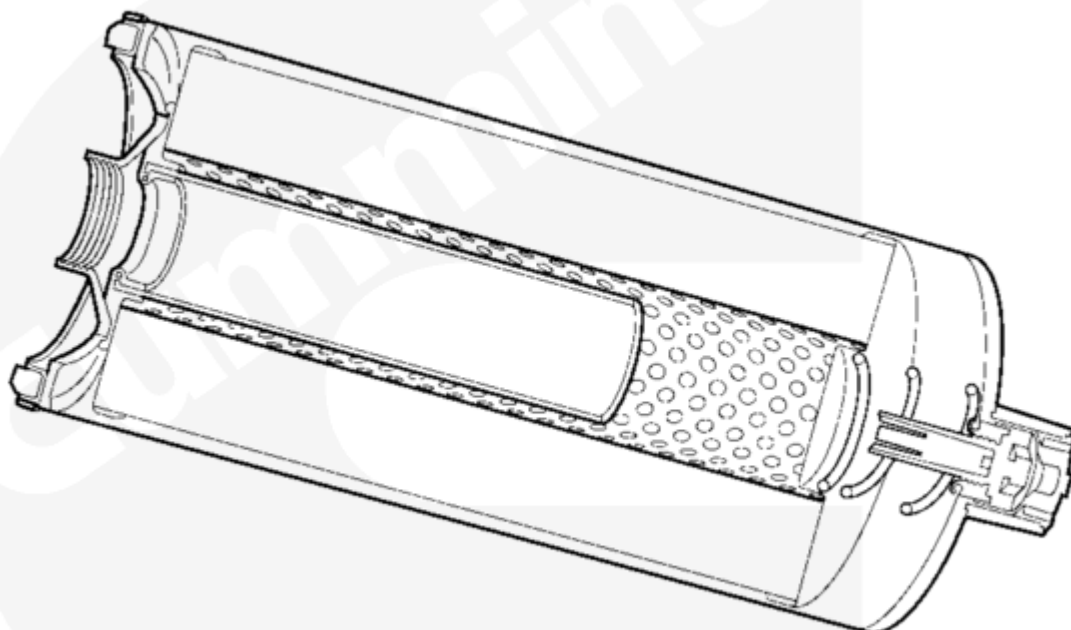

06800008

Figure 2. With droptube

This is a product improvement **not** subject to campaign.

