



Technical Service Bulletin

Technical Service Bulletin: TSB150118

Released Date: 29-Sep-2015

Implementation of Coolant Tee Adapter to Reduce Engine Shutdown Complaints

Implementation of Coolant Tee Adapter to Reduce Engine Shutdown Complaints

Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Contents

Description of Change

This document announces the factory installation of a tee adaptor to mount both the engine coolant temperature sensor and engine coolant temperature switch farther from the engine.

Reason for Change

Engines can shut down as a result of false high coolant temperature readings caused by the engine coolant temperature sensor and engine coolant temperature switch being exposed to excessive levels of radiant engine heat. Mounting the engine coolant temperature sensor and engine coolant temperature switch on the coolant tee adaptor limits their exposure to the radiant engine heat.

Product Affected

- NTA-855-C (Air Compressor Applications **Only**)

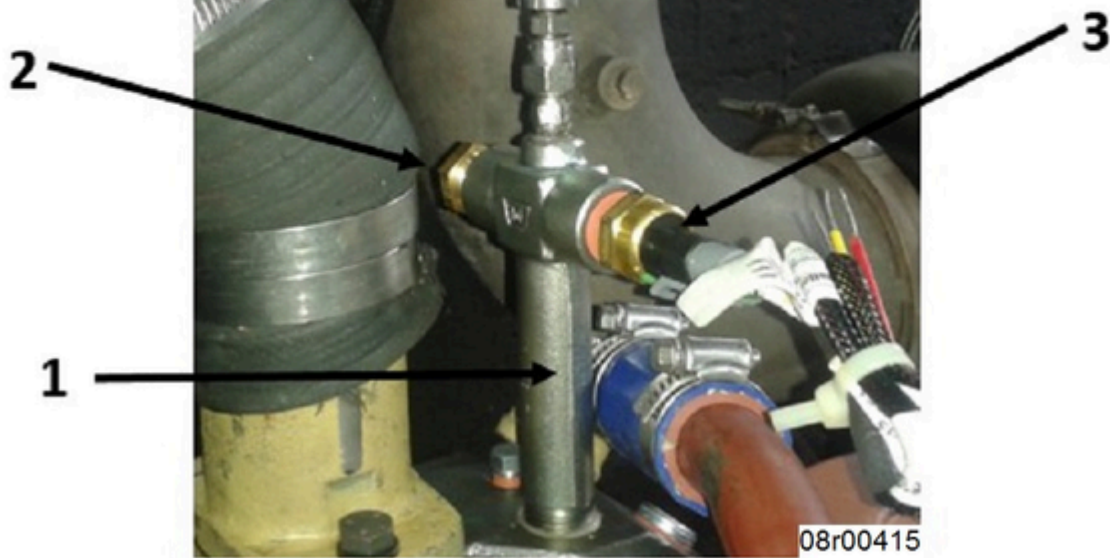


Figure 1, Coolant Tee Adapter with Engine Coolant Temperature Sensor and Engine Coolant Temperature Switch

1. Coolant tee adapter
2. Engine coolant temperature sensor
3. Engine coolant temperature switch

Service Parts Availability

Service parts are **not** available.

Service Instructions

This is a change implemented at the factory level **only**.

Production Status

Table 2, Production Information

ESN First	Build Date*	Plant
25390589	11 June 2013	Cummins India Limited
*Engine build date can be found on the engine dataplate.		

Document History

Date	Details
2015-7-22	Module Created

Last Modified: 29-Sep-2015
