



Technical Service Bulletin

Technical Service Bulletin: TSB190193

Released Date: 11-Nov-2019

INLINE™ 7 J1939 Communication Issue

INLINE™ 7 J1939 Communication Issue

Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.


Contents

Products Affected

- ISX CM870
- ISX CM871
- ISB CM2150
- ISC CM2150
- ISL CM2150

Issue

INSITE™ electronic service tool 5200 Error when using INLINE™ 7. See Figure 1 for 5200 Error displayed.

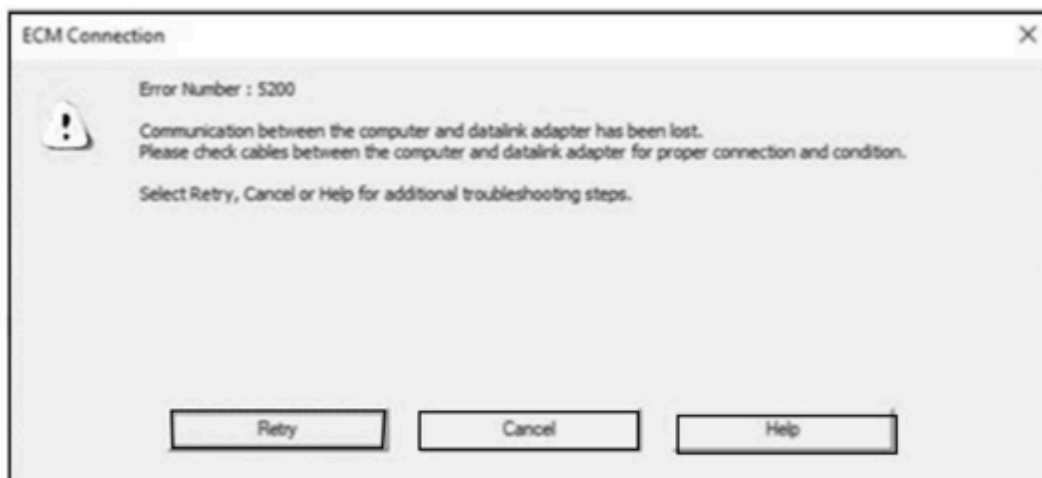


22r00348

Figure 1, INSITE™ Electronic Service Tool 5200 Error.

Resolution

- Use J1708 protocol: User can create an INLINE™ 7 J1708 connection using the ECM Connection Wizard in the INSITE™ electronic service tool. See Figure 2.

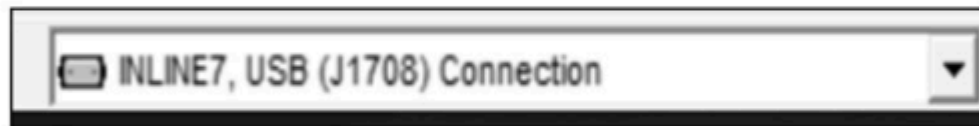

22r00349

Figure 2, INLINE™ 7 J1708 Connection.

- Use an INLINE™ 6.
- New INLINE™ 7 firmware and drivers are being developed and tested.

Document History

Date	Details
2019-11-8	Module Created

Last Modified: 11-Nov-2019
