



Technical Service Bulletin

Technical Service Bulletin: TSB200195

Released Date: 13-Oct-2020

Insite Data Monitor Exhaust Temperature Sensor Display Issue

Insite Data Monitor Exhaust Temperature Sensor Display Issue

Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Contents

Product Affected

- QSK38 CM850
- QSK38 CM2150
- QSK45 CM500
- QSK50 CM850
- QSK50 CM2150
- QSK50 CM2350
- QSK60 CM500
- QSK60 CM850
- QSK60 CM2150
- QSK60 CM2350
- QSK78 CM500
- QSK78 CM2350

Note : All SMNs with these engines and control models are affected.

Issue

There is an issue getting individual exhaust temperature sensor information to display in Insite data monitor.

Root Cause: Insite version 8.6.1.96 does not have the ability to display exhaust temperature sensors individually.

Verification/Confirmation

The Insite version mentioned above produces a display as shown.

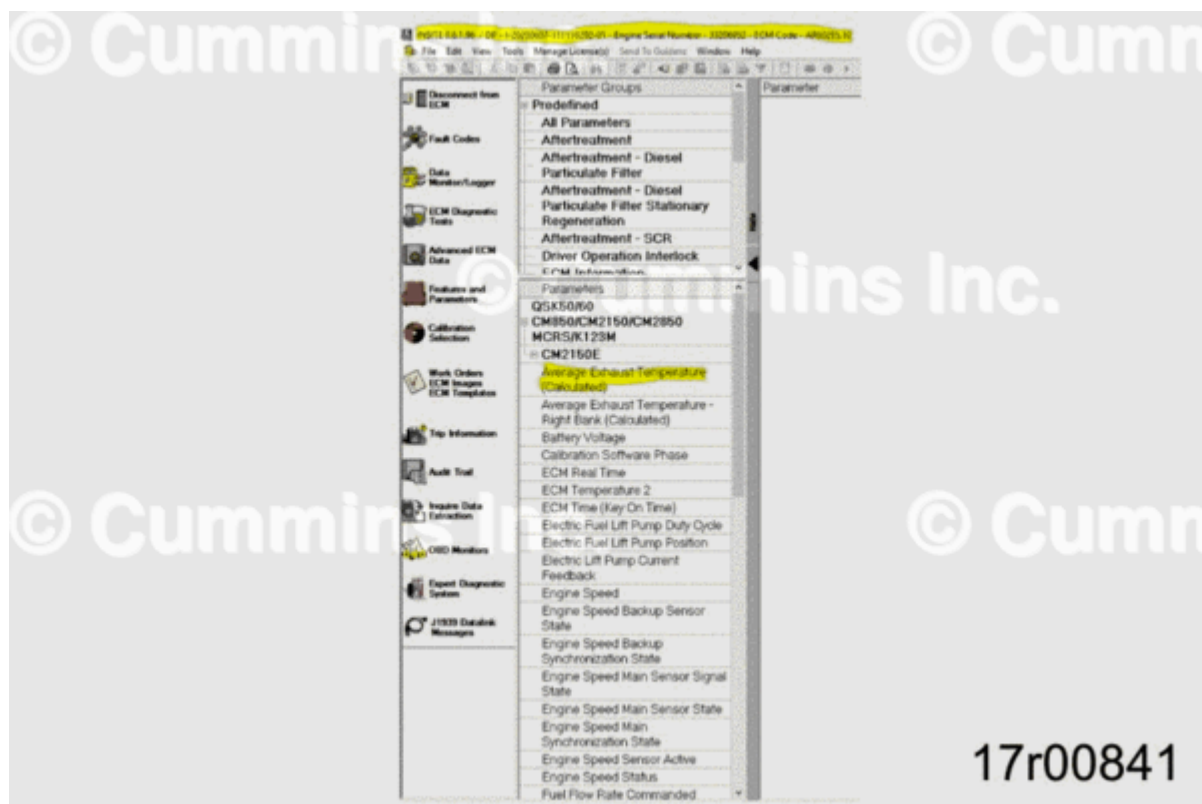


Figure 1, Individual Exhaust Temperature Sensors Not Visible

Resolution

Contact Cummins IT to downgrade Insite to previous version 8.6.0.104 or 8.6.0.116 to display individual exhaust temperature sensors.

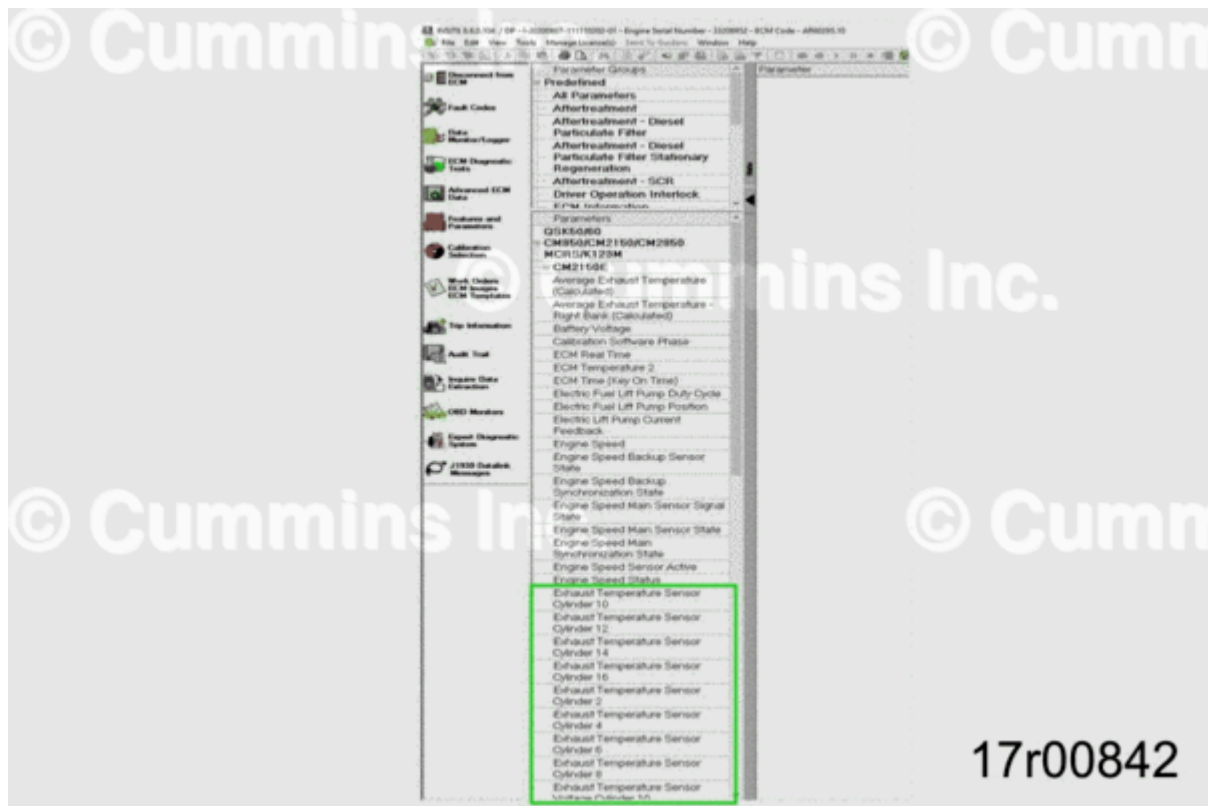


Figure 2, Visible Individual Exhaust Temperature Sensors

The ability to view individual exhaust temperature sensors will work when Insite 8.7.0 is released.

Document History

Date	Details
2020-9-25	Module Created

Last Modified: 13-Oct-2020