



Technical Service Bulletin: TSB250118

Released Date: 07-Jul-2025

Obsoleting the Re-use Criteria for Crankshaft Adapter Capscrews

Obsoleting the Re-use Criteria for Crankshaft Adapter Capscrews

Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Contents

Product Affected

- K50
- QSK50 CM850 MCRS
- QSK50 CM2150 MCRS
- QSK50 CM2350 K108
- QSK50 CM2350 K130


Issue Summary

Symptom:

- Crankshaft adapter capscrews have been found broken upon inspection and during engine rebuilds.

Resolution

- **Always** replace crankshaft adapter capscrews during rebuilds and mid-life events.

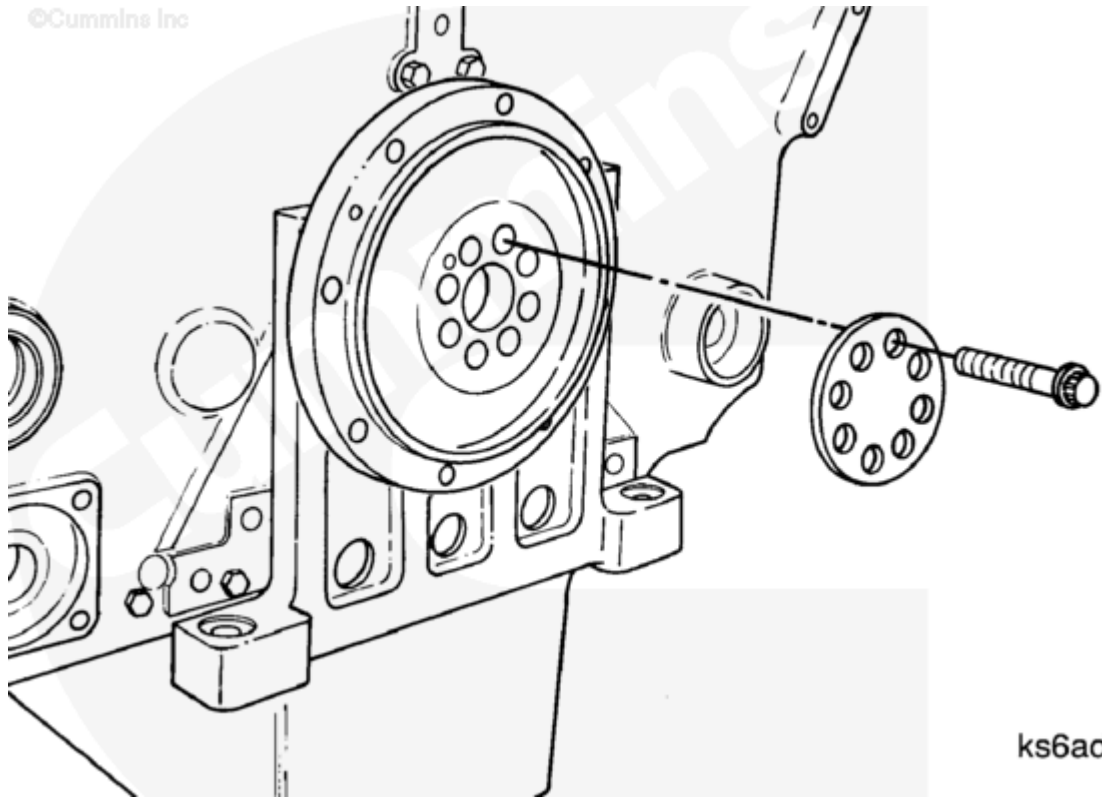

ks6adma

Figure 1, Crankshaft Adapter Capscrews.

Publications Affected**Table 1, Publications Affected**

Manual Type	Engine	Bulletin Number	Procedure Title	Procedure	Section
Service Manual	K50	4021528	Crankshaft Adapter	Refer to Procedure 001-017 (/qs3/pubsys2/xml/en/procedures/303/303-001-017-tr.html)	1
Service Manual	QSK50 CM850 MCRS	4021528	Crankshaft Adapter	Refer to Procedure 001-017 (/qs3/pubsys2/xml/en/procedures/303/303-001-017-tr.html)	1

Table 1, Publications Affected					
Manual Type	Engine	Bulletin Number	Procedure Title	Procedure	Section
Service Manual	QSK50 CM2150 MCRS	4021528	Crankshaft Adapter	Refer to Procedure 001-017 (/qs3/pubsyss2/xml/en/procedures/303/303-001-017-tr.html)	1
Service Manual	QSK50 CM2350 K108	4332823	Crankshaft Adapter	Refer to Procedure 001-017 (/qs3/pubsyss2/xml/en/procedures/303/303-001-017-tr.html)	1
Service Manual	QSK50 CM2350 K130	5504180	Crankshaft Adapter	Refer to Procedure 001-017 (/qs3/pubsyss2/xml/en/procedures/303/303-001-017-tr.html)	1

Document History

Date	Details
2025-6-3	Module Created
2025-7-2	Updated Resolution section for clarity.