
VIEW FROM BELOW (−Z), parting face up — scale 1:1

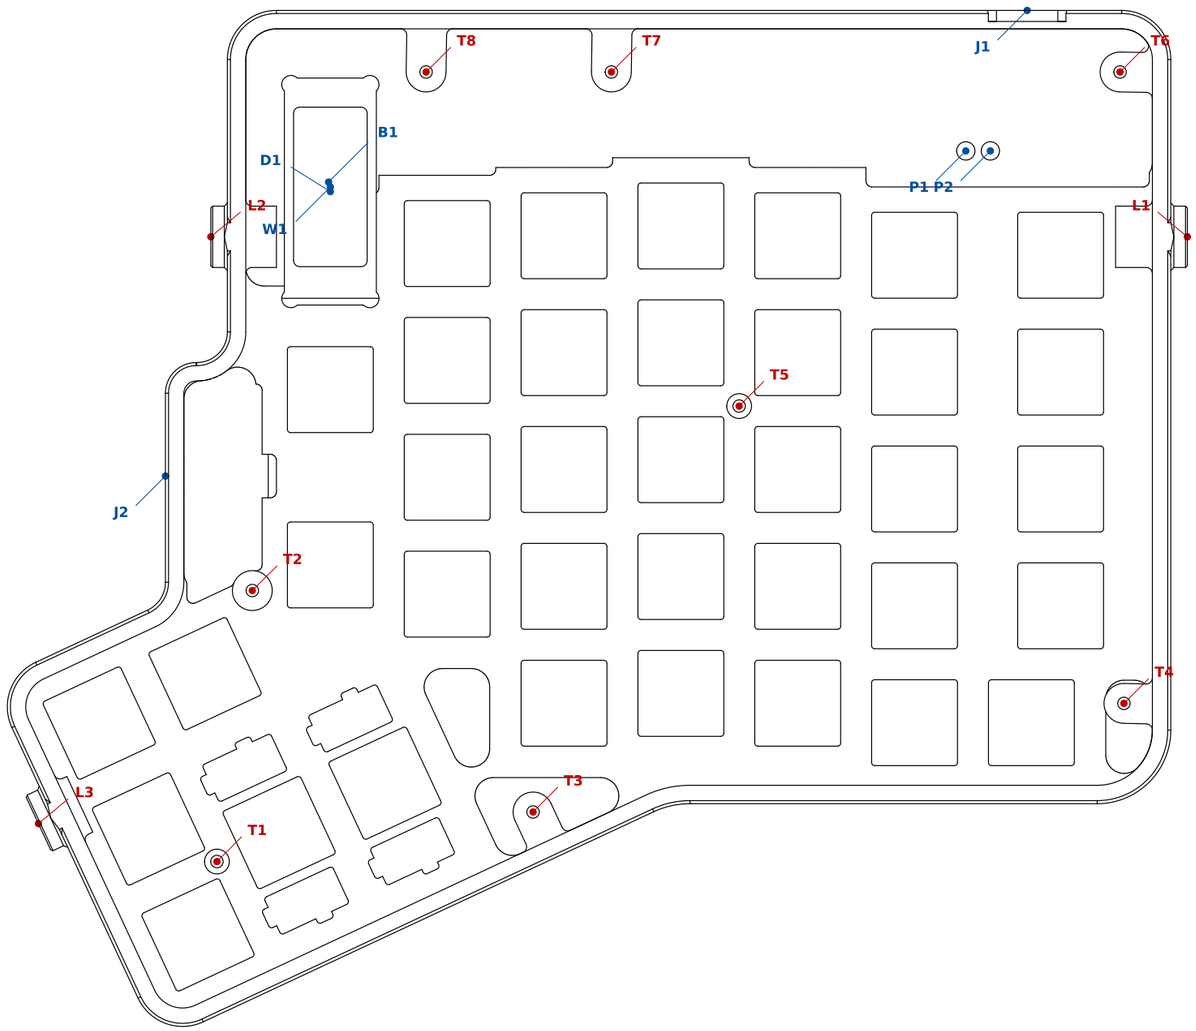

ID	Thread	Hand	Cls	Tap drill	Drill depth	Min full thr.	Screw	X	Y	Z	Note
T1	M2.5x0.45	RH	6H	Ø2.05	3.6	2.3	M2.5x10 CSK	76.10	-65.84	8.6	BLIND under key well, 0.78 skin: no break-through
T2	M2.5x0.45	RH	6H	Ø2.05	6.0	4.5	M2.5x12 CSK	70.34	-21.67	8.6	blind
T3	M2.5x0.45	RH	6H	Ø2.05	6.0	4.5	M2.5x12 CSK	24.56	-57.76	8.6	blind
T4	M2.5x0.45	RH	6H	Ø2.05	6.0	4.5	M2.5x12 CSK	-71.78	-40.06	8.6	blind
T5	M2.5x0.45	RH	6H	Ø2.05	3.6	2.3	M2.5x10 CSK	-9.04	8.41	8.6	BLIND under key well, 0.78 skin: no break-through
T6	M2.5x0.45	RH	6H	Ø2.05	6.0	4.5	M2.5x12 CSK	-71.14	62.87	8.6	blind
T7	M2.5x0.45	RH	6H	Ø2.05	6.0	4.5	M2.5x12 CSK	11.79	62.87	8.6	blind
T8	M2.5x0.45	RH	6H	Ø2.05	6.0	4.5	M2.5x12 CSK	42.00	62.87	8.6	blind
L1	M3x0.5	RH	6H	Ø2.5	5.5	4.0	M3 leg thumbscrew	-82.12	36.00	12.0	blind, in the flat leg boss, see sheet 2
L2	M3x0.5	RH	6H	Ø2.5	7.5	6.0	M3 leg thumbscrew	77.10	36.00	12.0	blind, in the flat leg boss, see sheet 2
L3	M3x0.5	RH	6H	Ø2.5	5.5	4.0	M3 leg thumbscrew	105.21	-59.66	12.0	blind, in the flat leg boss, see sheet 2

X/Y/Z = hole start point in STEP coordinates. T holes: drilled +Z from the PCB face of the boss. L holes: drilled into the part, normal to the wall, from the boss face.
Drill depth = full-diameter depth; the 118° drill point is extra (modelled). Every hole is BLIND and keeps at least D/2 unthreaded at its bottom (JLCCNC threaded-hole guideline).

ID	Feature (no thread)	X	Y
W1	display window 12 x 26 R1.0 THRU the bezel skin, 0.5 x 45° chamfer on the top edge	57.61	44.13
D1	display pocket 15.0 x 37.0, Z 8.6-18.6 (bezel skin 1.0), corners relieved by R1.5 dog-bones; front end open into the key well	57.61	43.37
B1	raised display bezel 18.43 x 37.90, top Z 19.6 (2.0 above the top face), top edges 0.5 x 45°, R2.0 free corners; flush with the key-well walls on its well sides	57.90	44.93
J1	USB-C notch 9.4 x 3.6 R1.6 thru back wall at Z 10.2; outside recess 13 x 8 x 1.8 deep	-56.00	72.90
J2	TRRS hole Ø6.5 thru inner bump wall, axis Z 11.1	84.50	-3.00
P1	Ø3.0 THRU top skin (SW_BOOT pin-hole)	-46.00	50.00
P2	Ø3.0 THRU top skin (SW_RST pin-hole)	-50.00	50.00

GENERAL NOTES


1. Geometry per worxboard_left_top.step. Dimensions not shown are taken from the STEP model.
2. Material: Aluminium 6061-T6 (7075-T6 acceptable).
3. THREADS: 8x M2.5x0.45-6H and 3x M3x0.5-6H, ISO metric coarse, ALL RIGHT-HAND (clockwise to tighten), all blind. Holes are modelled at tap-drill diameter in the STEP; tap them per the table to at least the minimum full-thread depth. The screw column names the screw each hole takes; its tip stops at least 0.3 short of the end of the full thread.
4. This is a LEFT-hand part: a mirror image of the right-hand part. Threads stay RIGHT-HAND; do not mirror the thread direction.
5. Holes marked BLIND under key well: drill 3.6 deep (full diameter); 0.78 mm of material remains between the drill point and the cosmetic key-well floor. Must not break through or leave witness marks on the top surface.
6. Switch cutouts (37x): 14.00 +0.05/-0 square, corner R0.5 max, plus 4 stabiliser cutouts. Plate thickness 1.50 ±0.05. Plate flatness 0.2 over the part.
7. Display bezel B1 stands 2.0 mm above the top face (part height 12.6). Pocket D1 runs from the parting side up to 1.0 mm under the bezel top; window W1 opens it. USB-C notch J1 and TRRS hole J2 are side operations (see table).
8. Leg bosses L1-L3: plain Ø10 bosses with a FLAT face (no teeth), see sheet 2.
9. Cosmetic surfaces: top face, display bezel, key well, outer walls, leg bosses: no tool marks, scratches or clamp marks. Inside (cavity) surfaces are non-cosmetic.
10. Break sharp edges 0.1-0.2 mm, except switch-cutout edges (0.1 max).
11. Finish: Fine bead blast + anodize Type II, colour per order. Mask threads during anodizing, or re-tap after anodizing.

worxboard CNC aluminium case


worxboard_left_top — https://github.com/w0rxbend/worxboard

Drawing no.: WXB-TOP-L Material: Aluminium 6061-T6 (7075-T6 acceptable) Finish: Fine bead blast + anodize Type II, colour per order	Sheet 1 of 2 Scale 1:1 Units: mm
Revision A1 Date 2026-11-04 General tolerance ISO 2768-mK. Threads ISO metric, RIGHT-HAND, 6H. The STEP file governs geometry; this drawing governs threads, tolerances, finish.	Do not scale drawing


VIEW FROM +X — scale 1:1



VIEW FROM −X — scale 1:1




DETAIL C — SECTION THROUGH THE DISPLAY BEZEL at the window centre (X-Z, real section), scale 3:1

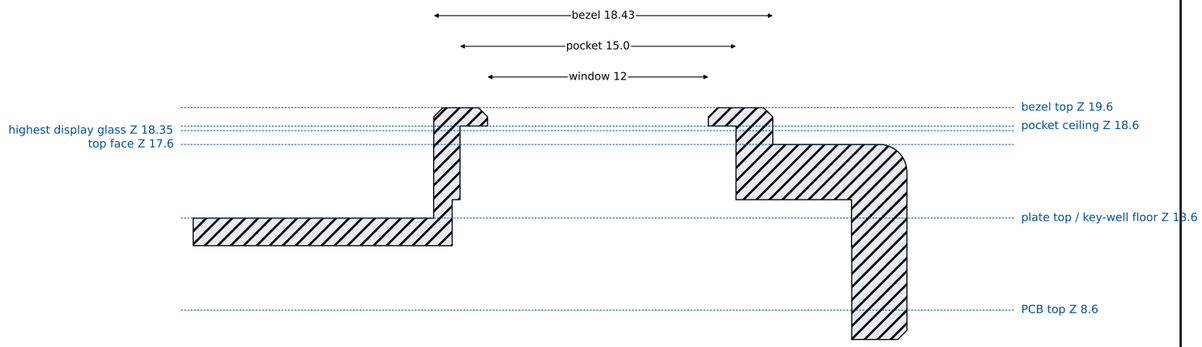


bezel skin 1.0; top edges 0.5 x 45°; window edge 0.5 x 45°. The bezel side wall on the key-well side is flush with the well wall.

DETAIL A — LEG BOSS L1-L3, face view, scale 5:1 (FLAT FACE, NO TEETH)

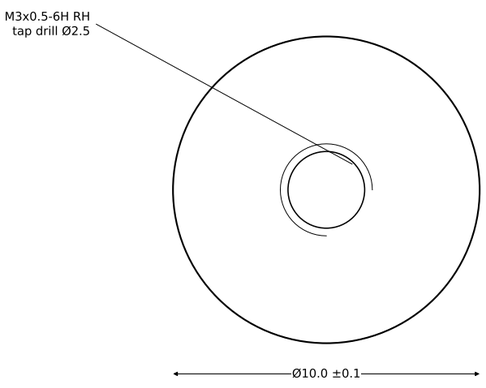

SECTION B-B through boss axis, scale 5:1 (schematic)

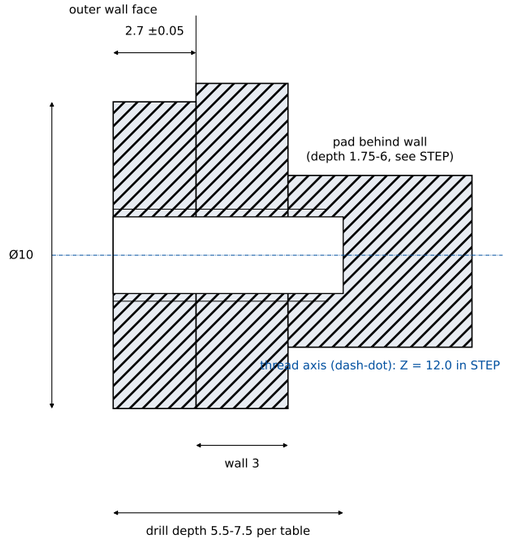

Leg boss specification	
Boss	Ø10.0 ±0.1, 2.7 ±0.05 proud of the outer wall face
Bearing face	FLAT, no teeth. Flatness 0.05, perpendicular to the thread axis within 0.05. Ra 1.6 max
Function	the leg hub is clamped against this face by the M3 spring thumbscrew (friction)
Thread	M3x0.5-6H RIGHT-HAND, blind, concentric with boss within Ø0.05; tap drill Ø2.5; depths per the table below
Quantity	3 bosses per part (L1-L3), identical
Machining hint	side op (4th axis, right-angle head or a setup per wall): face the boss, profile Ø10, drill and tap M3
Mating part	custom leg worxboard_leg (drawing WXB-LEG, flat hub face) + M3 thumbscrew

Boss	X face	Y face	Z	Thread direction (into part)	Drill depth	Min full thr.	Screw reach max
L1	-82.12	36.00	12.0	into part (+1.000, -0.000, 0)	5.5	4.0	3.7
L2	77.10	36.00	12.0	into part (-1.000, -0.000, 0)	7.5	6.0	5.7
L3	105.21	-59.66	12.0	into part (-0.906, +0.423, 0)	5.5	4.0	3.7

X/Y/Z: centre of the boss face (tooth tip plane) in STEP coordinates. Depths from the boss face; the drill point is extra. >= 1.5 (D/2) stays unthreaded.

worxboard CNC aluminium case

worxboard_left_top — https://github.com/w0rxbend/worxboard

Drawing no.: WXB-TOP-L	Sheet 2 of 2
Material: Aluminium 6061-T6 (7075-T6 acceptable)	Scale 1:1, 3:1, 5:1
Finish: Fine bead blast + anodize Type II, colour per order	Units: mm
Revision A1 Date 2026-11-04	Do not scale drawing
General tolerance ISO 2768-mK. Threads ISO metric, RIGHT-HAND, 6H.	
The STEP file governs geometry; this drawing governs threads, tolerances, finish.	