# Trial Assembly Quality Inspection Standard

| DOCUMENT NUMBER | VERSION | EFFECTIVE DATE |
| --- | --- | --- |
| YS-ZZZX-005 | A/0 | 21 March 2026 |

Workstation: Trial assembly station

Operator requirements: Operators must be trained and qualified, and must be proficient in trial assembly procedures, structures, lighting details, hardware and drawings.

## Cabinet information verification

1. Use the drawings and production traveler to confirm the customer address, color, base material and other basic information.
2. Arrange cabinets according to the design drawings, labels and cabinet numbers. Measure the overall external dimensions.
3. For panels reworked during trial assembly, shaped panels edge-banded after drilling, and panels with special processes, cross-check the drawings, barcodes and production traveler together. Mark and record the review.

## Overall appearance and construction

1. Edge banding must be flat and firmly bonded, with no debonding, chipping, missed or incomplete banding, misalignment, uneven edge height or obvious glue lines. Rounded corners must be smooth and evenly proportioned.
2. Panels must be free from scratches, impact damage, chipped edges, broken corners and blistering.
3. Banding must be smooth, with no excess adhesive, debonding or lifted edges. Complete banding around openings and hardware locations as required.
4. Check that the cabinet bodies, doors, exposed panels and side filler panels have consistent colors and grain.
5. Compare the assembled product with the drawings and verify that the workmanship meets the drawing requirements.
6. Check that structural hole positions are accurate.

# Inspection and Release

Trial Assembly

## Lighting and hardware inspection

1. Check the lighting quantities against the drawings, supporting production sheet and hardware list.
2. Verify that the lighting is fitted smoothly and securely to the panels and that the left and right sides are level.
3. Verify the left/right positions of the side cable grooves, the required lighting color temperature in kelvin, and the front/back direction of angled lighting strips.
4. Leave trial assembly notes on the drawings by circling, ticking or adding written comments.

## Stacking and panel protection

1. Do not place processed panels directly on the floor. Place them on support boards and keep them within the support-board footprint.
2. Keep hard objects out of stacked panels to prevent scratches to the panel surfaces.
3. Stack panels no higher than 0.8 m.
4. Transfer complete sets to the designated lane for the next operation according to the panel processing route.

## Document control

| Prepared by / Date | Reviewed by / Date | Approved by / Date |
| --- | --- | --- |
| | | |

This document and its contents must not be disclosed to unauthorized organizations or individuals without prior written permission from CIRMANO.

# Inspection Examples

Trial Assembly / Acceptance and defect references



**ACCEPTABLE**

Acceptable trial assembly



**ACCEPTABLE**

Acceptable trial assembly



**ACCEPTABLE**

Inverted assembly with lighting on



**ACCEPTABLE**

Complete assembly with lighting on

# Inspection Examples

Trial Assembly / Acceptance and defect references




**ACCEPTABLE**

Upright trial assembly




**NONCONFORMING**

Trial assembly with missing panels

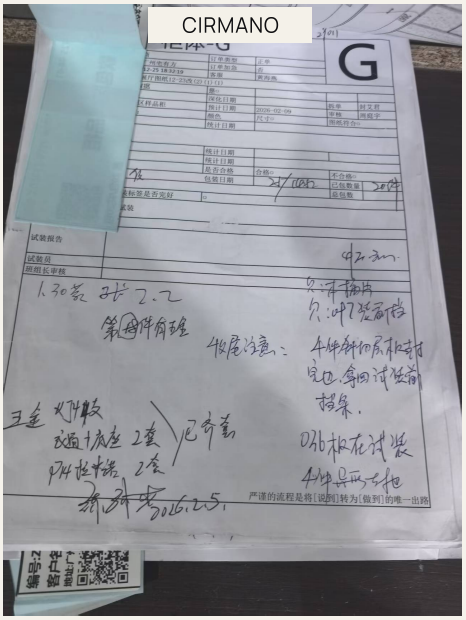


**ACCEPTABLE**

Signed production traveler

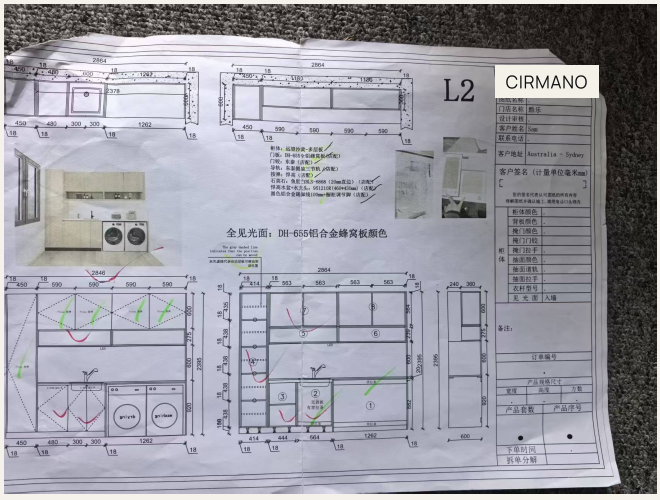


**ACCEPTABLE**

Dimension-check notes on the drawing