
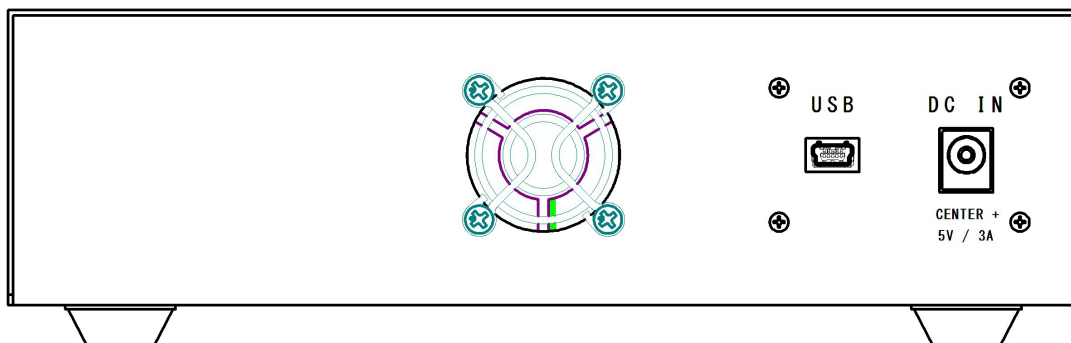


Installation

1. Connect DC 5V power cable to an outlet.
2. Connect USB cable to a personal computer.
3. Turn on power key to activate USB driver in PC.
4. Copy two program files to any folder in PC. (LDController***.exe tmHIDLD.dll)
5. Run LDController***.exe.

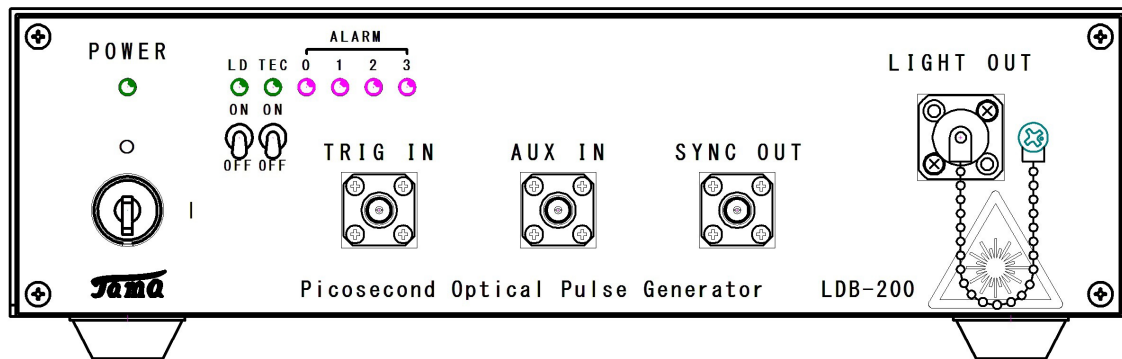

Interlock connector must be installed like above.

Connectors

AUX IN, SYNC OUT, TRIG IN	SMA
USB	USB Mini

TEC,LD Switches

No USB connection	TEC or LD switch on = TEC or LD enable.
USB connection	.TEC switch on AND TEC software button on = TEC enable. LD switch on AND LD software button on = LD enable.

+5V DC IN

Center = +5V

TRIG IN singal

50 ohm terminating.

Threshold voltage 0.47V.

Tolerance voltage -3V to +3V.

SYNC OUT

1V pulse with 50 ohm terminating. 2V pulse with no terminating.

AUX IN

No connection.