



Model: BT-100
LOAD ON TEST
TEST DE CHARGE

O - TEST

- Connect clamps.
- Press LOAD switch.
- Hold MAXIMUM 10 SEC.
- Press metric.
- Connect clamps.
- Press LOAD switch.
- Hold MAXIMUM 10 SEC.
- Press metric.

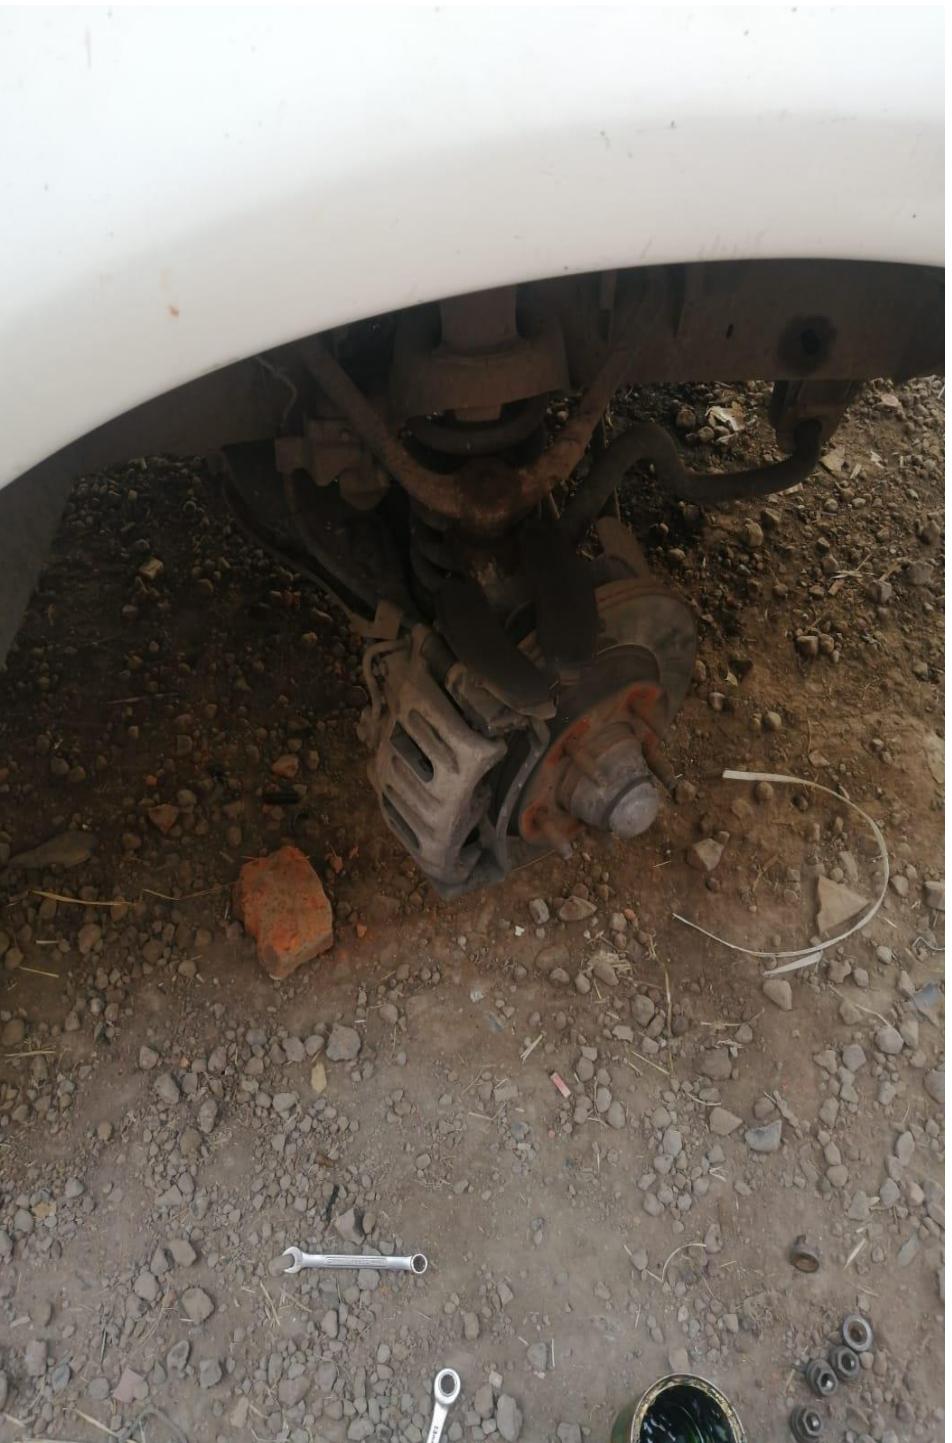

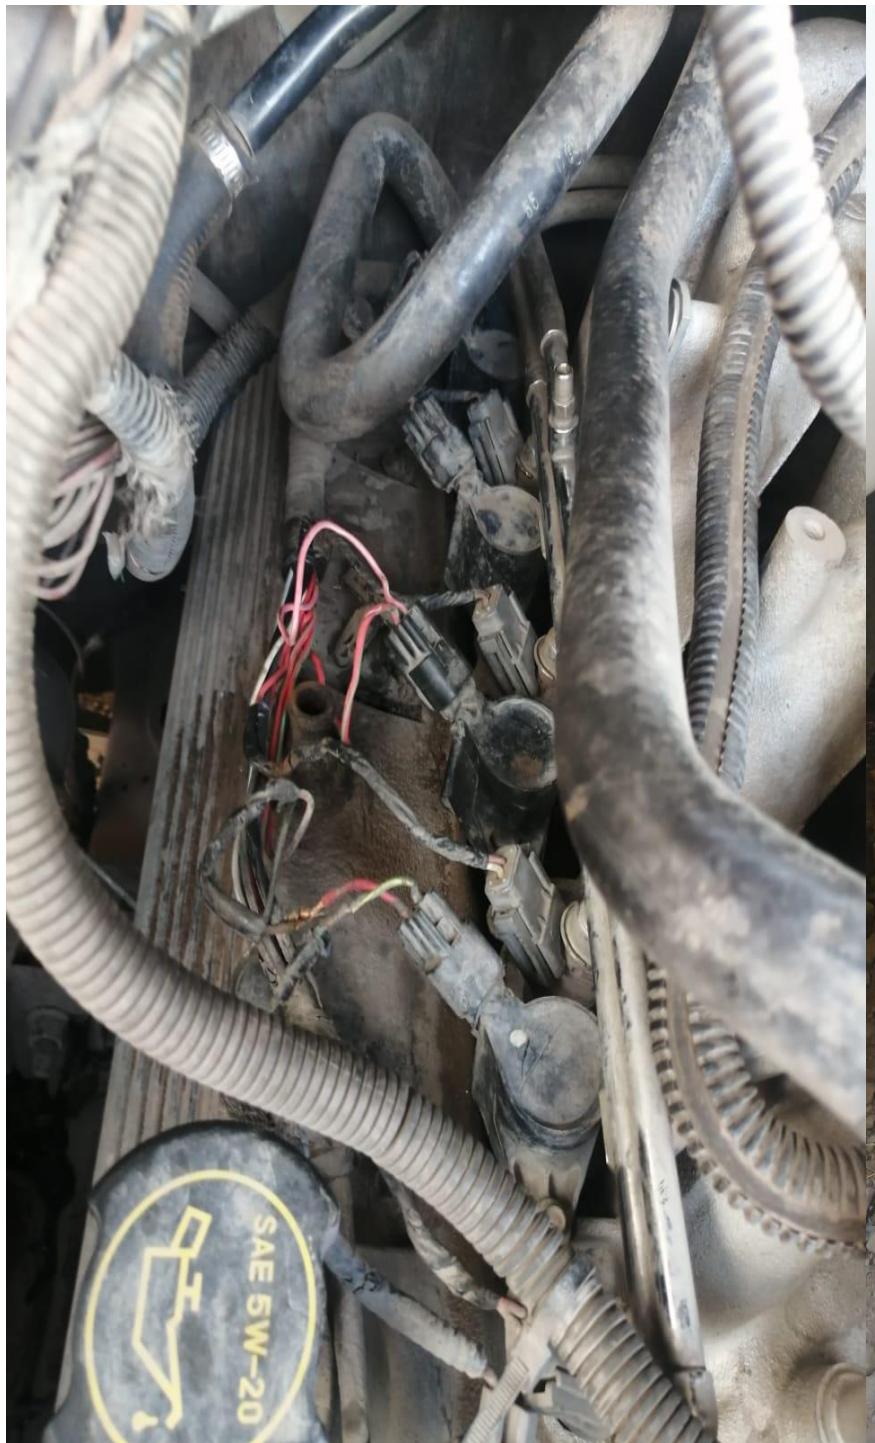



84545

F250















84545

F250

G











