

© Copyright 2012, Micriµm

All Rights reserved

New Features and Services since

µC/OS-II V2.00

(Current Version: V2.92.07)

www.Micrium.com

Introduction

This document describes all the features and services added to **µC/OS-II** since the introduction of the hard cover book *MicroC/OS-II*, *The Real-Time Kernel*, ISBN 0-87930-543-6. The software provided with the book was version 2.00 or V2.04. The version number of the change is shown when appropriate.

Added 'Task Registers' (V2.92)

μC/OS-II now allows the user to store task-specific values in 'task registers'. Task registers are different than CPU registers and are used to save such information as "errno" which is common in software components. Task registers can also store task-related data to be associated with the task at run time such as I/O register settings, configuration values, etc. A task may have as many as OS_TASK_REG_TBL_SIZE registers, and all registers have a data type of INT32U. A task register is changed by calling OSTaskRegSet() and read by calling OSTaskRegGet(). The desired task register is specified as an argument to these functions and can take a value between 0 and OS_TASK_REG_TBL_SIZE-1.

OSTaskRegGet()
OSTaskRegGetID()
OSTaskRegSet()

Version number skipped (V2.91)

There is no version 2.91.

Added 'OSSafetyCriticalStart()' (V2.90)

 μ C/OS-II now allows your application to 'tell' μ C/OS-II that your application is no longer allowed to delete kernel objects such as tasks, semaphores, queues, etc.

Delete task on incorrect return (V2.89)


 μ C/OS-II now contains a new function called OS_TaskReturn(). All μ C/OS-II tasks are not allowed to return. If a task returns by mistake, OS_TaskReturn() catches those and deletes the task.

 $\begin{tabular}{ll} OS_TaskReturn() & calls \\ App TaskReturnHook(). \\ \end{tabular}$

Pend on Multiple Events (V2.86)

pc/OS-II now contains a new function called OSEventPendMulti() which allows a task to pend on multiple events (semaphores, mailboxes and queues) in any combination (see example diagram below). This new function is found in OS_CORE.C and is enabled by setting OS_EVENT_MULTI_EN to 1 in OS_CFG.H.

With OSEventPendMulti() it's possible to pend on any number of semaphores, mailboxes and message queues at the same time (we don't support Mutex and Event Flags at this time). If a task pends on a combination of the above 'events' then, as soon an event is posted (and the pending task is the highest priority task pending on the event), the waiting task will wake up and be 'handed' the event. If events are present as the task pends then ALL the available events will be provided to the task.

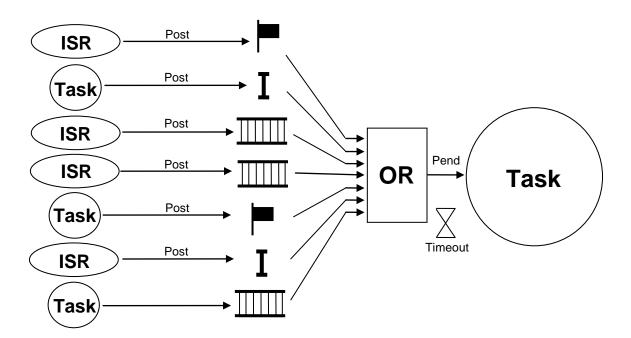

Timer Manager (V2.81)

µC/OS-II now provides support for periodic as well as one-shot timers. This functionality is found in OS_TMR.C and is enabled by setting OS_TMR_EN to 1 in OS_CFG.H. Your application can have any number of timers (up to 65500). When a timer times out, an optional callback function can be called allowing you to perform any action (signal a task, turn on/off a light, etc.). Each timer has its own callback function.

IMPORTANT

The APIs for the Timer Manager were changed in V2.83 from what they were in V2.81 and V2.82. This was necessary to correct some issues with the Timer Manager. Please consult the Reference Manual for the new APIs.

When timer management is enabled, $\mu\text{C/OS-II}$ creates a timer task (OSTmrTask()) which is responsible for updating all the timers. The priority of this task is determined by OS TASK TMR PRIO which should be defined in your application's APP CFG.H.


The timer manager provides a number of services to your applications. Specifically, you can call one of the following functions (see the μ C/OS-II reference manual for a description of these functions) from your tasks:

```
OSTmrCreate() Create a timer
OSTmrDel() Delete a timer
OSTmrRemainGet() Determine how much time before a timer expires
OSTmrNameGet() Get the name of a timer
OSTmrStateGet() Get the state of a timer (UNUSED, STOPPED, RUNNING, COMPLETED)
OSTmrStart() Start a timer
OSTmrStop() Stop a timer
```


You should note that you **CANNOT** call these functions from ISRs.

The drawing below shows the task model of the Timer Manager. You should note that semaphore management needs to be enabled (you need to set OS_SEM_EN to 1 in OS_CFG.H) for the timer manager to work. The timer manager requires two (2) semaphores.

- (1) An ISR or an application task needs to 'signal' a counting semaphore by calling OSTmrSignal() at the rate specified in OS_TMR_CFG_TICK_RATE (see OS_CFG.H). The counting semaphore is called OSTmrSemSignal that is initialized to 0 by \(\mu C/OS-II\) when OSInit() is called. You should note that you should ONLY call OSTmrSignal() and not worry about the semaphore; it's encapsulated by OSTmrSignal().
- (2) The timer management task (OSTmrTask()) pends forever on the counting semaphore waiting for it to be signaled. When the semaphore is signaled, OSTmrTask() acquires another semaphore (a binary semaphore in this case, OSTmrSem) to gain exclusive access to timer data structures. When OSTmrTask() is the owner of the semaphore it updates all the timers created by your application.
- (3) Your application accesses timer data structure via interface functions. These functions allow you to create, delete, start and stop timers as well as examine the amount of time remaining before a timer times out.

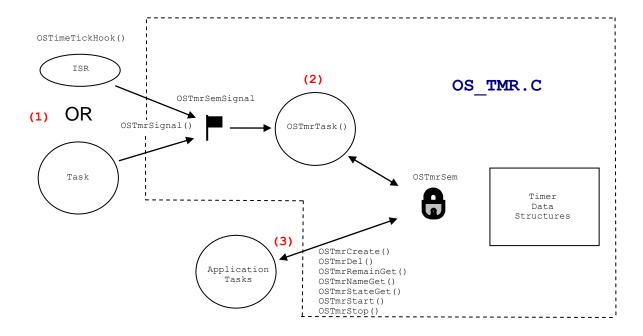

The drawing below shows the data structures used in the timer manager.

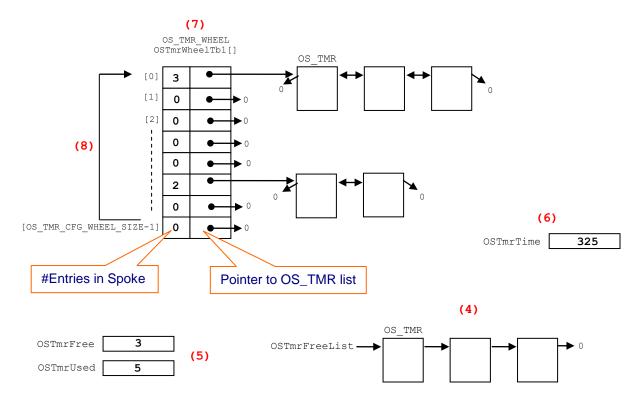

(4) Each timer is characterized by a data structure of type OS_TMR (see ucos_ii.h). Each timer contains the 'period' of the timer (if the timer is to operate in periodic mode), the name of the timer, a timer 'match' value (described later) and other fields used to link the timer. Free timers are placed in a singly linked list of 'unused' timers pointed to by OSTmrFreeList.

- (5) The number of free timers is held in OSTmrFree and the number of used (or allocated) timers is held in OSTmrUsed. Of course, the total number of timers is the sum of these two fields and, unless you don't properly use the timer management services, that sum should always equal OS TMR CFG MAX.
- (6) Every time OSTmrSignal() is called, the unsigned 32-bit variable OSTmrTime is incremented by one and used to see if timers have expired.
- The timer manager keeps track of which timer it needs to update using a 'timer wheel'. The wheel is basically an array of structures of type OS_TMR_WHEEL (see ucos_ii.h) that wraps around. This structure contains two fields: a pointer to a doubly-linked list of OS TMR structures and, the number of entries in that list.
- (8) The 'wheel' contains OS TMR CFG WHEEL SIZE entries or spokes.

OS_TMR structures are inserted in the wheel when you call OSTmrStart(). The position (i.e. spoke) in OSTmrWheelTbl[] for a specific timer is given by:

```
match = OSTmrTime + period;
spoke = match % OS TMR CFG WHEEL SIZE;
```

The 'match' corresponds to the value that OSTmrTime needs to reach before the timer expires. For example, let's say that OSTmrTime is 0 (just initialized) and we want to create a timer that will expire every second (assuming OS_TMR_CFG_TICKS_PER_SEC is set to 10). Also, let's assume that OS TMR CFG WHEEL SIZE is 8 (as shown in the diagram above).

```
match = OSTmrTime + period;
match = 0 + 10;
match = 10;
spoke = match % OS_TMR_CFG_WHEEL_SIZE;
spoke = 10 % 8;
spoke = 2;
```

This means that OSTmrStart() will obtain a free OS_TMR data structure from the free list of timers and the place this data structure in OSTmrWheelTbl[] at position #2 in the table. OSTmrStart() will then store the 'match' value in the OS_TMR data structure.

Every time OSTmrTime is incremented by OSTmrTask(), OSTmrTask() goes through ALL the OS_TMR structures placed at spoke (OSTmrTime % OS_TMR_CFG_WHEEL_SIZE) to see if OSTmrTime 'matches' the value store in the OS_TMR structure. If a match occurs, the timer is removed from the list. If the timer was started by OSTmrStart() with a 'periodic' option then, the OS_TMR structure is placed in the OSTmrWheelTbl[] by calculating its new position, again using OSTmrTime + period. In our example, the new 'spoke' would be:

```
match = OSTmrTime + period;
match = 10 + 10;
match = 20;
spoke = match % OS_TMR_CFG_WHEEL_SIZE;
spoke = 20 % 8;
spoke = 4;
```

The use of a timer wheel basically reduces the execution time of the timer task so that it only handles a few of the timers. Of course, the worst case is such that all timers are placed in the same spoke of the timer wheel. However, statistically, this will occur rarely. It's generally recommended to keep the size of the wheel a fraction of the total number of times. In other words, you should set:

```
OS TMR CFG WHEEL SIZE <= Fraction of (OS TMR CFG MAX)
```

A fraction of 2 to 8 should work well.


RAM usage (in bytes) for the timer manager is shown below:

Because INT8Us and BOOLEANs are typically 1 byte, INT16Us are 2 bytes and INT32Us are 4 bytes, we can simplify the above equation as follows:

2 * 2 +

Support for 255 tasks (V2.80)

µC/OS-II can now support up to 255 tasks. To support up to 255 tasks, we simply increased the ready list and event wait lists to a matrix of 16x16 instead of 8x8. In fact, the actual size of the matrix (whether 8x8 or 16x16) depends on the value of OS_LOWEST_PRIO in OS_CFG.H. If OS_LOWEST_PRIO is less than or equal to 63, we use an 8x8 matrix and thus **µC/OS-II** behaves exactly the same as it used to. If you specify a value for OS_LOWEST_PRIO to be greater than 63, we use the 16x16 matrix as show below.

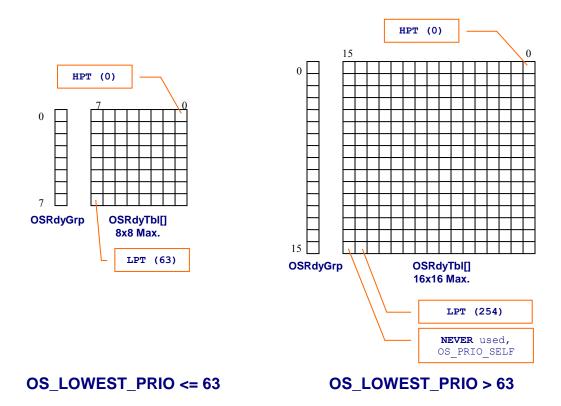

You should note that the actual size of the matrix depends on OS_LOWEST_PRIO. For example, if OS_LOWEST_PRIO is 10 then the matrix is actually 2x8 (two bytes of 8 bits). Similarly, if OS_LOWEST_PRIO is set to 47, the matrix will be 6x8. When OS_LOWEST_PRIO is above 63, we use 16-bit wide entries. For example, if you specify OS_LOWEST_PRIO to be 100 then the matrix will be 7x16 (7 entries of 16 bits each). You CANNOT set OS LOWEST_PRIO to 255 because this value is reserved for OS_PRIO_SELF.

New Files

APP_CFG.H (Added in V2.80)

We now assume the presence of a file called APP_CFG.H which is declared in your application. The purpose of this file is to assign task priorities, stack sizes and other configuration information for your application.

OS_CFG_R.H (Added in V2.70)

This file is 'reference' file so that you don't have to create this file from scratch. OS_CFG_R.H has been added in V2.70 and is found in the 'Source' directory of the microprocessor independent portion of **µC/OS-II**. It is recommended that you *copy* OS CFG R.H to OS CFG.H of your project directory.

OS_TMR.C (Added in V2.81, revised in V2.83)

We added a timer manager function in μ C/OS-II. You can now define any number of timers. The timers can be periodic or one-shots. A user definable function can be called when the timer expires. One such function is definable for each timer in your application.

New Port Files

OS_DBG.C (Added in V2.62 but renamed from OS_DEBUG.C in V2.70)
OS_DBG_R.C (Added in V2.70)

This file should be placed in the same directory as OS_CPU_C.C, OS_CPU.H and OS_CPU_A.ASM of the port you are using. OS_DBG.C defines a series of variables that are placed in ROM (code space). These variables are used by some Kernel Aware Debuggers to get information about \(\pu C/OS-II\) and its configuration. If you DON'T use a Kernel Aware Debugger that requires this file, you DON'T need to have it. Check you Kernel Aware Debugger documentation. OS_DBG.C used to be called OS_DEBUG.C in V2.62.

OS_DBG_R.C is a 'reference' file so that you don't have to create this file from scratch. OS_DBG_R.C has been added in V2.70 and is found in the 'Source' directory of the microprocessor independent portion of μ C/OS-II.

Changes

uCOS_II.H

(Changed in V2.70, V2.80 and V2.84)

This file now includes #include statements to include APP_CFG.H, OS_CPU.H and OS_CFG.H. This allows you to compile μ C/OS-II without the needs of any other library functions.

Chaned error codes to make them more consistent. Specifically, all error codes start with OS_ERR_. The old error codes have been kept for backward compatibility but you should now use and check for the new error codes.

Time delays and Timeouts

(Changed in V2.87)

All time delays and timeouts are now implemented using an unsigned 32-bit variable. This actually simplified OSTimeDlyHMSM() and allowed OSTimeDlyResume() to work with any delay. Of course, this means that additional storage is needed in the tasks OS_TCBs (2 extra bytes) but that should not be a problem with most applications. It turns out that close to 90% of μ C/OS-II users use 32-bit CPUs.

Names of objects stored as pointers

(Changed in V2.87)

Names of objects were previously stored in RAM inside the different kernel objects. Specifically, RAM storage was allocated in the OS_TCB, for example, to store the name of a task. As of V2.87, all such names are now referenced using pointers. This drastically reduces the amount of RAM needed to store ASCII names since names are now typically allocated by the compiler as constant strings and thus placed in ROM. This was done to reduce the amount of RAM needed (a processor typically has more ROM than RAM) and also to lift the limit of the length of a kernel object name.

Stack check usage in number of entries

(Changed in V2.92)

To be consistent with OSTaskCreate() and OSTaskCreateExt(), OSTaskStkChk() reports stack usage in number of stack entries (or elements) as opposed to number of bytes. To convert number of entries in number of bytes, multiply the value by sizeof(OS STK).

New #define Constants and Macros

OS APP HOOKS EN (OS CFG.H, V2.85)

This constant specifies whether μ C/OS-II's hook functions will call application defined hooks. Specifically, when set to 1 ...

The μC/OS-II hook	Calls the Application-define hook
OSTaskCreateHook()	App_TaskCreateHook()
OSTaskDelHook()	App_TaskDelHook()
OSTaskIdleHook()	App_TaskIdleHook()
OSTaskStatHook()	App_TaskStatHook()
OSTaskSwHook()	App_TaskSwHook()
OSTCBInitHook()	App_TCBInitHook()
OSTimeTickHook()	App_TimeTickHook()

OS_ARG_CHK_EN (OS_CFG.H, V2.04)

This constant is used to specify whether argument checking will be performed at the beginning of most of μ C/OS-II services. You should always choose to turn this feature on (when set to 1) unless you need to get the best performance possible out of μ C/OS-II or, you need to reduce code size.

```
OS CRITICAL METHOD #3 (OS CPU.H, V2.04)
```

This constant specifies the method used to disable and enable interrupts during critical sections of code. Prior to V2.04, OS_CRITICAL_METHOD could be set to either 1 or 2. In V2.04, I added a local variable (i.e. cpu_sr) in most function calls to save the processor status register which generally holds the state of the interrupt disable flag(s). You would then declare the two critical section macros as follows:

```
#define OS_ENTER_CRITICAL() (cpu_sr = OS_CPUSR_Save())
#define OS_EXIT_CRITICAL() (OS_CPU_SR_Restore(cpu_sr))
```

Note that the functions $OS_CPU_SR_Save()$ and $OS_CPU_SR_Restore()$ would be written in assembly language and would typically be found in $OS_CPU_A.ASM($ or equivalent).

```
OS DEBUG EN (OS CFG.H, V2.60)
```

This constant is used to enable ROM constants used for debugging using a kernel aware debugger. The constants are found in OS CORE.C.

```
OS EVENT MULTI EN (OS CFG.H, V2.86)
```

This constant determines whether the code to support pending on multiple events will be enabled (1) or not (0). This constant thus enables code for the function OSEventPendMulti(). This #define was added in V2.86.

OS_EVENT_NAME_EN (OS CFG.H, V2.60 and changed in V2.87)

This constant determines whether names can be assigned to a semaphore, a mutex, a mailbox or a message queue. If OS EVENT NAME EN is set to 0, this feature is disabled.

OS FLAG EN (OS CFG.H, V2.51)

This constant is used to specify whether you will enable (when 1) code generation for the event flags.

OS FLAG NAME EN (OS CFG.H, V2.60 and changed in V2.87)

This constant determines whether names can be assigned to event flag groups. If OS_FLAG_NAME_EN is set to 0, this feature is disabled.

OS FLAG WAIT CLR EN (OS CFG.H, V2.51)

This constant is used to enable code generation (when 1) to allow to wait on cleared event flags.

OS MAX FLAGS (OS CFG.H, V2.51)

This constant is used to determine how many event flags your application will support.

OS MBOX PEND ABORT EN (OS CFG.H, V2.84)

This constant is used to determine whether you will enable (when 1) code generation for the OSMboxPendAbort() function.

OS MEM NAME EN (OS CFG.H, V2.60 and changed in V2.87)

This constant determines whether names can be assigned to memory partitions. If OS_MEM_NAME_EN is set to 0, this feature is disabled and no RAM is used in the OS MEM for the memory partition.

OS MUTEX EN (OS CFG.H, V2.04)

This constant is used to specify whether you will enable (when 1) code generation for mutual exclusion semaphores.

OS Q PEND ABORT EN (OS CFG.H, V2.84)

This constant is used to determine whether you will enable (when 1) code generation for the OSQPendAbort() function.

OS SEM PEND ABORT EN (OS CFG.H, V2.84)

This constant is used to determine whether you will enable (when 1) code generation for the OSSemPendAbort() function.

```
OS TASK NAME EN (OS CFG.H, V2.60 and changed in V2.87)
```

This constant determines whether names can be assigned to tasks. If OS_TASK_NAME_EN is set to 0, this feature is disabled and no RAM is used in the OS TCB for the task name.

```
OS_TASK_PROFILE_EN (OS_CFG.H, V2.60)
```

This constant allows variables to be allocated in each task's OS_TCB that hold performance data about each task. Specifically, if OS_TASK_PROFILE_EN is set to 1, each task will have a variable to keep track of the number of context switches, the task execution time, the number of bytes used by the task and more.

```
OS TASK STAT STK CHK EN (OS CFG.H, V2.60)
```

This constant allows the statistic task to determine the actual stack usage of each active task. If $OS_TASK_STAT_EN$ is set to 0 (the statistic task is not enabled), you can call $OS_TaskStatStkChk$ () yourself from one of your tasks. If $OS_TASK_STAT_EN$ is set to 1, stack sizes will be determined every second.

```
OS TASK SW HOOK EN (OS CFG.H, V2.60)
```

Normally, \(\mu C/OS-II \) requires that you have a context switch hook function called OSTaskSwHook(). When set to 0, this constant allows you to omit OSTaskSwHook() from your code. This configuration constant was added to reduce the amount of overhead during a context switch in applications that doesn't require the context switch hook. Of course, you will also need to remove the calls to OSTaskSwHook() from OSTaskStartHighRdy(), OSCtxSw() and OSIntCtxSw() in OS CPU A.ASM.

```
OS TASK TMR STK SIZE (OS CFG.H, V2.81)
```

This #define determines the stack size (in number of stack-size elements, i.e. OS_STK) of the timer task. The size of the timer task's stack greatly depends on the processor architecture and the functions that are called when timers expire. Note that if you set OS_TMR_EN to 0 in OS_CFG.H then the value you set for OS_TASK_TMR_STK_SIZE is irrelevant because the timer functionality would be disabled.

```
OS TICK STEP EN (OS CFG.H, V2.60)
```

 μ C/OS-View can now 'halt' μ C/OS-II's tick processing and allow you to issue 'step' commands from μ C/OS-View. In other words, μ C/OS-View can prevent μ C/OS-II from calling OSTimeTick() so that timeouts and time delays are no longer processed. However, though a keystroke from μ C/OS-View, you can execute a single tick at a time. If OS_TIME_TICK_HOOK_EN (see below) is set to 1, OSTimeTickHook() is still executed at the regular tick rate in case you have time critical items to take care of in your application.

```
OS TIME TICK HOOK EN (OS CFG.H, V2.60)
```

Normally, **µC/OS-II** requires the presence of a function called OSTimeTickHook() which is called at the very beginning of the tick ISR. When set to 0, this constant allows you to omit OSTimeTickHook() from your code. This configuration constant was added to reduce the amount of overhead during a tick ISR in applications that doesn't require this hook.

OS TMR EN (OS CFG.H, V2.81)

This #define enables (when set to 1) or disables (when set to 0) the timer management code.

OS TMR CFG MAX (OS CFG.H, V2.81)

This #define determines the maximum number of timers that can exist in the application. If OS TMR EN is set to 1, you should declare AT LEAST two (2) timers.

OS TMR CFG NAME EN (OS CFG.H, V2.81 and changed in V2.87)

This #define determines whether names can be assigned to timers.

OS_TMR_CFG_WHEEL_SIZE (OS_CFG.H, V2.81)

This #define determines the number of entries in the timer wheel. This value should be a number between 2 and 1024. Timer management overhead is somewhat determined by the size of the wheel. A large number of entries might reduce the overhead for timer management but would require more RAM. Each entry requires a pointer and a count (16-bit value). We recommend a number that is NOT a multiple of the tick rate. If your application has many timers then it's recommended that you have a high value. As a starting value, you could use OS_TMR_CFG_MAX / 4.

OS TMR CFG_TICKS_PER_SEC (OS_CFG.H, V2.81)

This #define determines the rate at which timers will be updated. You would typically set to a fraction of the tick rate (i.e. OS_TICKS_PER_SEC). We recommend that you set OS TMR CFG TICKS PER SEC to 10 (i.e. 10 Hz).

The following table summarizes some of the new $\#define\ constants\ in\ OS_CFG.H$ which were all added in since V2.00.

#define name in OS_CFG.H	to enable the function(s):
OS_APP_HOOKS_EN	App_TaskCreateHook()
	App_TaskDelHook()
	App_TaskIdleHook()
	App_TaskStatHook()
	App_TaskSwHook()
	App_TCBInitHook()
	App_TimeTickHook()
OS_DEBUG_EN	Enable debug constants in OS_CORE.C. If you
	are using a kernel aware debugger, you should
	enable this feature.
OC EVENU NAME EN	OSEventNameGet()
OS_EVENT_NAME_EN	OSEventNameSet()
	And, to allow naming semaphores, mutexes,
OG DIJENE MILEET DI	mailboxes and message queues.
OS_EVENT_MULTI_EN	OSEventPendMulti()
OS FLAG ACCEPT EN	OSFlagAccept()
OS FLAG DEL EN	OSFlagDel()
OS FLAG NAME EN	OSFlagNameGet()
	OSFlagNameSet()
	And, to allow naming event flag groups.
OS FLAG QUERY EN	OSFlagQuery()
OS MBOX ACCEPT EN	OSMboxAccept()
OS MBOX DEL EN	OSMboxDel()
OS MBOX PEND ABORT EN	OSMboxPendAbort()
OS MBOX POST EN	OSMboxPost()
OS MBOX POST OPT EN	OSMboxPostOpt()
OS_MBOX_QUERY_EN	OSMBoxQuery()
OG MEN NAME TO	
OS_MEM_NAME_EN	OSMemNameGet()
OC MEM OHERY EN	OSMemNameSet()
OS MEM QUERY EN	OSMemQuery()
OS MUTEX ACCEPT EN	OSMutexAccept()
OS MUTEX DEL EN	OSMutexDel()
OS MUTEX QUERY EN	OSMutexQuery()

00.0.7000000000000000000000000000000000	0007	
OS Q ACCEPT EN	OSQAccept()	
OS Q DEL EN	OSQDel()	
OS_Q_FLUSH_EN	OSQFlush()	
OS Q PEND ABORT EN	OSQPendAbort()	
OS_Q_POST_EN	OSQPost()	
OS_Q_POST_FRONT_EN	OSQPostFront()	
OS_Q_POST_OPT_EN	OSQPostOpt()	
OS Q QUERY EN	OSQQuery()	
	_	
OS SEM ACCEPT EN	OSSemAccept()	
OS SEM DEL EN	OSSemDel()	
OS SEM PEND ABORT EN	OSSemPendAbort()	
OS SEM QUERY EN	OSSemQuery()	
OS SEM SET EN	OSSemSet()	
OS TASK NAME EN	OSTaskNameGet()	
	OSTaskNameSet()	
OC MACK DECELLE EN	And, to allow naming tasks.	
OS_TASK_PROFILE_EN	To allocate variables in OS_TCB for performance	
	monitoring of each task at run-time.	
OS_TASK_QUERY_EN	OSTaskQuery()	
OS_TASK_STAT_STK_CHK_EN	OS_TaskStatStkChk()	
OS_TASK_SW_HOOK_EN	OSTaskSwHook()	
OS TASK TMR STK SIZE	Size in OS STK elements of the Timer	
	Management task.	
OS TICK STEP EN	To support the stepping feature of	
	μC/OS-View.	
OS_TIME_DLY_HMSM_EN	OSTimeDlyHMSM()	
OS TIME DLY RESUME EN	OSTimeDlyHMSM() OSTimeDlyResume()	
OS TIME DLY RESUME EN OS TIME GET SET EN	OSTimeDlyHMSM() OSTimeDlyResume() OSTimeGet() and OSTimeSet()	
OS TIME DLY RESUME EN	OSTimeDlyHMSM() OSTimeDlyResume()	
OS TIME DLY RESUME EN OS TIME GET SET EN	OSTimeDlyHMSM() OSTimeDlyResume() OSTimeGet() and OSTimeSet()	
OS TIME DLY RESUME EN OS TIME GET SET EN	OSTimeDlyHMSM() OSTimeDlyResume() OSTimeGet() and OSTimeSet()	
OS TIME DLY RESUME EN OS_TIME_GET_SET_EN OS_TIME_TICK_HOOK_EN	OSTimeDlyHMSM() OSTimeDlyResume() OSTimeGet() and OSTimeSet() OSTimeTickHook() Enables (1) or Disables (0) timer management	
OS TIME DLY RESUME EN OS_TIME_GET_SET_EN OS_TIME_TICK_HOOK_EN OS_TMR_EN	OSTimeDlyHMSM() OSTimeDlyResume() OSTimeGet() and OSTimeSet() OSTimeTickHook() Enables (1) or Disables (0) timer management functions.	
OS TIME DLY RESUME EN OS_TIME_GET_SET_EN OS_TIME_TICK_HOOK_EN	OSTimeDlyHMSM() OSTimeDlyResume() OSTimeGet() and OSTimeSet() OSTimeTickHook() Enables (1) or Disables (0) timer management functions. Determines the maximum number of timers in	
OS TIME DLY RESUME EN OS_TIME_GET_SET_EN OS_TIME_TICK_HOOK_EN OS_TMR_EN OS_TMR_CFG_MAX	OSTimeDlyHMSM() OSTimeDlyResume() OSTimeGet() and OSTimeSet() OSTimeTickHook() Enables (1) or Disables (0) timer management functions. Determines the maximum number of timers in your application.	
OS TIME DLY RESUME EN OS_TIME_GET_SET_EN OS_TIME_TICK_HOOK_EN OS_TMR_EN	OSTimeDlyHMSM() OSTimeDlyResume() OSTimeGet() and OSTimeSet() OSTimeTickHook() Enables (1) or Disables (0) timer management functions. Determines the maximum number of timers in your application. Determines whether names can be assigned to	
OS_TIME_DLY_RESUME_EN OS_TIME_GET_SET_EN OS_TIME_TICK_HOOK_EN OS_TMR_EN OS_TMR_CFG_MAX OS_TMR_CFG_NAME_EN	OSTimeDlyHMSM() OSTimeDlyResume() OSTimeGet() and OSTimeSet() OSTimeTickHook() Enables (1) or Disables (0) timer management functions. Determines the maximum number of timers in your application. Determines whether names can be assigned to timers.	
OS TIME DLY RESUME EN OS_TIME_GET_SET_EN OS_TIME_TICK_HOOK_EN OS_TMR_EN OS_TMR_CFG_MAX	OSTimeDlyHMSM() OSTimeDlyResume() OSTimeGet() and OSTimeSet() OSTimeTickHook() Enables (1) or Disables (0) timer management functions. Determines the maximum number of timers in your application. Determines whether names can be assigned to	
OS_TIME_DLY_RESUME_EN OS_TIME_GET_SET_EN OS_TIME_TICK_HOOK_EN OS_TMR_EN OS_TMR_CFG_MAX OS_TMR_CFG_NAME_EN	OSTimeDlyHMSM() OSTimeDlyResume() OSTimeGet() and OSTimeSet() OSTimeTickHook() Enables (1) or Disables (0) timer management functions. Determines the maximum number of timers in your application. Determines whether names can be assigned to timers.	
OS_TIME_DLY_RESUME_EN OS_TIME_GET_SET_EN OS_TIME_TICK_HOOK_EN OS_TMR_EN OS_TMR_CFG_MAX OS_TMR_CFG_NAME_EN	OSTimeDlyHMSM() OSTimeDlyResume() OSTimeGet() and OSTimeSet() OSTimeTickHook() Enables (1) or Disables (0) timer management functions. Determines the maximum number of timers in your application. Determines whether names can be assigned to timers. Determines the size of the timer wheel (in number of entries).	
OS TIME DLY RESUME EN OS TIME GET SET EN OS TIME TICK HOOK EN OS TMR EN OS TMR CFG MAX OS TMR CFG NAME EN OS TMR CFG WHEEL SIZE	OSTimeDlyHMSM() OSTimeDlyResume() OSTimeGet() and OSTimeSet() OSTimeTickHook() Enables (1) or Disables (0) timer management functions. Determines the maximum number of timers in your application. Determines whether names can be assigned to timers. Determines the size of the timer wheel (in number	
OS TIME DLY RESUME EN OS TIME GET SET EN OS TIME TICK HOOK EN OS TMR EN OS TMR CFG MAX OS TMR CFG NAME EN OS TMR CFG WHEEL SIZE	OSTimeDlyHMSM() OSTimeDlyResume() OSTimeGet() and OSTimeSet() OSTimeTickHook() Enables (1) or Disables (0) timer management functions. Determines the maximum number of timers in your application. Determines whether names can be assigned to timers. Determines the size of the timer wheel (in number of entries).	

New Data Types

OS CPU SR

(OS CPU.H, V2.04)

This data type is used to specify the size of the CPU status register which is used in conjunction with OS_CRITICAL_METHOD #3 (see above). For example, if the CPU status register is 16-bit wide then you would typedef accordingly.

OS FLAGS

This data type determines how many bits an event flag group will have. You can thus typedef this data type to either INT8U, INT16U or INT32U to give event flags either 8, 16 or 32 bits, respectively.

OS_TMR

This data type is a timer object which contains information about a specific timer that you started (see OS TMR.C).

New Hook Functions

void OSInitHookBegin(void)

(OS CPU.C, V2.04)

This function is called at the very beginning of OSInit() to allow for port specific initialization BEFORE **µC/OS-II** gets initialized.

void OSInitHookEnd(void)

```
(OS CPU.C, V2.04)
```

This function is called at the end of OSInit() to allow for port specific initialization AFTER μ C/OS-II gets initialized.

void OSTCBInitHook(OS TCB *ptcb)

```
(OS CPU.C, V2.04)
```

This function is called by OSTCBInit () during initialization of the TCB assigned to a newly created task. It allows port specific initialization of the TCB.

void OSTaskIdleHook(void)

```
(OS CPU.C, V2.51)
```

This function is called by OSTaskIdle(). This allows you to STOP the CPU and thus reduce power consumption while there is nothing to do.

New Functions

The following table provides a list of all the new functions (i.e. services) that YOUR application can call. The list also includes functions that used to exist but, if these are in this list, it's because their API may have changed.

Refer to the *Reference Manual* of the current release for a description of these functions.

Function Name	File	Enabled By
OSEventNameGet()	OS CORE.C	OS EVENT NAME EN
OSEventNameSet()	OS CORE.C	OS EVENT NAME EN
OSEventPendMulti()	OS CORE.C	OS EVENT MULTI EN
OSFlagAccept()	OS FLAG.C	OS FLAG EN && OS FLAG ACCEPT EN
OSFlagCreate()	OS FLAG.C	OS FLAG EN
OSFlagDel()	OS FLAG.C	OS FLAG EN && OS FLAG DEL EN
OSFlagNameGet()	OS FLAG.C	OS FLAG NAME EN
OSFlagNameSet()	OS FLAG.C	OS FLAG NAME EN
OSFlagPend()	OS FLAG.C	OS FLAG EN
OSFlagPendGetFlagsRdy()	OS FLAG.C	OS FLAG EN
OSFlagPost()	OS FLAG.C	OS FLAG EN
OSFlagQuery()	OS FLAG.C	OS FLAG EN
OSMboxDel()	OS MBOX.C	OS MBOX EN && OS MBOX DEL EN
OSMboxPendAbort()	OS MBOX.C	OS MBOX EN && OS MBOX PEND ABORT EN
OSMboxPostOpt()	OS MBOX.C	OS MBOX EN && OS MBOX POST OPT EN
OSMutexAccept()	OS MUTEX.C	OS MUTEX EN && OS MUTEX ACCEPT EN
OSMutexCreate()	OS MUTEX.C	OS MUTEX EN
OSMutexDel()	OS MUTEX.C	OS MUTEX EN && OS MUTEX DEL EN
OSMutexPend()	OS MUTEX.C	OS MUTEX EN
OSMutexPost()	OS MUTEX.C	OS MUTEX EN
OSMutexQuery()	OS MUTEX.C	OS MUTEX EN && OS MUTEX QUERY EN
OSQAccept()	OS Q.C	OS Q EN && OS Q ACCEPT EN
OSQDel()	OS Q.C	OS Q EN && OS Q DEL EN
OSQFlush()	OS Q.C	OS Q EN && OS Q FLUSH EN
OSQPend()	OS Q.C	OS Q EN
OSQPendAbort()	OS Q.C	OS Q EN && OS Q PEND ABORT EN
OSQPost()	OS Q.C	OS Q EN
OSQPostFront()	OS Q.C	OS Q EN && OS Q POST FRONT EN
OSQPostOpt()	OS Q.C	OS Q EN && OS Q POST OPT EN
OSSafetyCriticalStart()	OS CORE.C	OS SAFETY CRITICAL IEC61508
OSSemDel()	OS SEM.C	OS SEM EN && OS SEM DEL EN
OSSemPendAbort()	OS SEM.C	OS SEM EN && OS SEM PEND ABORT EN
OSSemSet()	OS SEM.C	OS SEM EN && OS SEM SET EN
OSTaskNameGet()	OS TASK.C	OS TASK NAME EN
OSTaskNameSet()	OS TASK.C	OS TASK NAME EN
OSTmrGetName()	OS_TMR.C	OS_TMR_EN
OSTmrGetRemain()	OS TMR.C	OS TMR EN
OSTmrStart()	OS TMR.C	OS TMR EN
OSTmrStop()	OS TMR.C	OS TMR EN
OSTmrSignal()	OS TMR.C	OS TMR EN

References

μC/OS-II, The Real-Time Kernel, 2nd Edition
Jean J. Labrosse
CMP Books, 2002
ISBN 1-57820-103-9

Contacts

Micriµm

949 Crestview Circle Weston, FL 33327 954-217-2036 954-217-2037 (FAX)

e-mail: <u>Jean.Labrosse@Micrium.com</u>

WEB: www.Micrium.com

CMP Books, Inc.

1601 W. 23rd St., Suite 200 Lawrence, KS 66046-9950 (785) 841-1631 (785) 841-2624 (FAX)

WEB: http://www.cmpbooks.com
e-mail: rdorders@cmpbooks.com