



Site Name: Wreys Bush 3



Item Number	ACTIVITY DES	CRIPTION	VERIFICATION ACTIVITY	METHODS OR REFERENCE	FREQ.	ACCEPTANCE CRITERIA		INSPECTORATE W/H  w=witness, H=HOLD		Responsible Person	RECORDS / REMARKS incl NCR ref
							Туре	Assessor	Description		Sign & date if appropriate
1						Preliminary and General					
1.1	Construction Program	me Completion	Confirmation	Best Practice Contract Specific MMP	Before work commences	Construction Completion will be the lesser of the completion date according to the pavement classificaiton risk profile (documented in the contract specific MMP) or the contract completion date.	w			Renewals Manager	
1.2	Approved	RQP	Confirmation	Contract Specification	Before work commences	Principal Acceptance according to guidelines in appendix 6.3	н		Hold point - No physical work is to be commenced on site until notification has been sent no later than 24 hours of establishing on site. NZTA to approve	Renewals Manager	
1.3	Traffic Management	ТМР	Visual check	СоРТТМ	Before traffic management set up	TMP checked and approved Plans approved Current EED (if applicable)	н		Hold point - No traffic management is to be set up until TMP has been checked and approved	Paving Supervisor	
1.4	Mix Design Verificati Check Laydown Trials a complia	ire complete and	Confirmation	NZTA M/10, P/11, P23	Before planning commences	Mix Design compliant, current and relevant. Batching plant production capability is confirmed	н		Hold point - No planning of on-site works shall commenced until the mix design is verified.	Paving Supervisor	
1.5	Notification of intention	on to start work	Notification		Before work commences	Letter drop to local residents. Greater consultation where required	н		Hold point - No physical work is to be commenced on site until notification has been sent no later than 24 hours of establishing on site.	Paving Supervisor	
1.6	Works Ext	ents	Confirmation	Site Visit	Before work commences	Renewals Manager and/or Client to agree extents of project	н		Hold point - Walk over site with Renewals Engineer and/or Renewals Manager and/or NZTA	Paving Supervisor	
1.7	Pavement Marki	ng Records	Measurment Data	Site Measure or Video Viewer	Before work commences	Measure existing markings to aid reinstatement	н		Hold point - No physical work is to be commenced on site until notification has been sent no later than 24 hours of establishing on site.	Paving Supervisor	

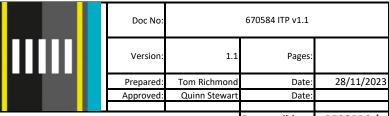


Site Name: Wreys Bush 3

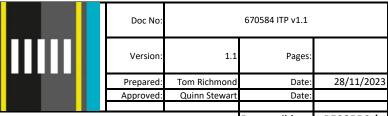

Item Number	ACTIVITY DES	CRIPTION	VERIFICATION ACTIVITY	METHODS OR REFERENCE	FREQ.	ACCEPTANCE CRITERIA		INSPECTORATE W/H  W=WITNESS, H=HOLD			RECORDS / REMARKS incl NCR ref
							Туре	Assessor	Description		Sign & date if appropriate
2					Mill	ing and Preparation					
2.1	Services (includes Traffic Count Loops and Traffic Signal Detector Loops)		Visual plan BeforeUDig Cable locate (electronic or pothole for line & depth)	NZAUAG Guide to Working on the Road	Before work commences	Zero service strikes	н		Hold point - No excavation/milling is to be commenced until services are located and accounted for	Paving Supervisor	
2.2	Stormwater Ma	nagement	Visual check	On Site	Before work commences	Mudtanks bunded or filtered to prevent mix from dropping in or runoff entering	н		Hold point - No work to be commenced until protections in place	Paving Supervisor	
2.3	Traffic Management	Setup	Visual check	Traffic Management Plan	Before work commences each day	Traffic management complies with TMP	н		Hold point - No physical works are to be commenced until necessary traffic management is in place	Site Foreperson	
2.4	Milling Depths		Measurement	On Site	Measure each side of milling machine cut	Every 10m. Depth matches target	н		Milling String Sheets or photos of depths taken and uploaded to CONQA	Site Foreperson / QA	
2.5	Service Covers P	reparation	Visual	On site measurements & photos	All Covers	Hand excavation around ironwork and adjustment to desired level (if required)	н			Site Foreperson	
2.6	Additional Surfacing Preparation - Side Roads - Accesses - Driveways - Dish Channels - High Shoulders		Visual Check	Per Design	Before Membraning and Paving	Have all areas of additional surfacing on the design been prepared, membraned and marked for paving?	Ξ		Hold Point – All areas planned for AC are prepared ready for surfacing layer	Site Foreperson	
2.7	Milling Surface inspection / walkover		Visual Check, proof roll with loaded truck to check deflections	On site measurements & photos	Prior to surfacing	Renewals Manager and NZTA invited to inspect milled surface and agree if any additional overmilling is required	н		Hold point - Inspection and agreement by NZTA	Paving Supervisor / Paving Manager	
2.8	Over-Milling		Measurement	On site measurements & photos	Prior to pre-level	Renewals Manager and NZTA invited to inspect milled surface and agree need and extent of over-milling and infill.	н			Paving Supervisor	
2.9	Pre-Lev	el	Measurement	On site measurements & photos	Prior to surfacing	Renewals Manager and NZTA invited to inspect milled surface and agree pre-level extents	Н		Hold point - Inspection and agreement by NZTA	Paving Supervisor / Paving Manager	




Site Name: Wreys Bush 3

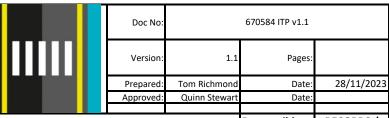

Item Number	ACTIVITY DESCRIPTION		VERIFICATION METHODS OR ACTIVITY REFERENCE		FREQ.	ACCEPTANCE CRITERIA			JKATE W/H	Responsible Person	RECORDS / REMARKS incl NCR ref
							Туре	Assessor	Description		Sign & date if appropriate
3						Paving Structural					
	Sieve analysis of fine and coarse aggregates and material finer than 75µm by washing  Sieve analysis of fine and coarse aggregates and material finer than 75µm by washing  ASTM C136-06 / C 117-14										
3.1	Production Properties	Binder Content	Quantitiive Extraction of Bitumen from Bituminous Paving Mixtures by Bowl Centrifuge Method	B19 Issue 6 - 2009	1 per 200t or maximum of 3 per production lot	Table 5.3 tolerances	W		IANZ Lab Reports. Becomes a Hold Point for future paving if there is non- comformance	Paving Supervisor	
		Maximum Specific Gravity	Gravity & Density of	ASTM D2041/D2041M - 2011		Per Mix design					
3.2	Preparati	ion	Visual	NZTA M/10		Paving plan to be completed for every shift, with dimensions	w		Paving Plan and Crew Briefing Plan completed prior	Paving Supervisor	
3.3	Joins		Visual	NZTA M/10	Prior to Shift	Joins are outside of trafficked wheel paths where possible.	w			Paving Supervisor	
3.4	Mix Inconsistency a	nd Deficiency	Visual	NZTA M/10	Continuous	Visually check asphalt surface during paving for areas of segregation	Н			Site Foreperson	




Site Name: Wreys Bush 3

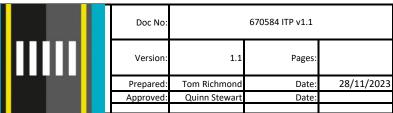

Item Number	ACTIVITY DESCRIPTION	ACTIVITY DESCRIPTION VERIFICATION METHODS OR REFERENCE FREQ. ACCEPTANCE CRITERIA				JKATE W/H	Responsible Person	RECORDS / REMARKS incl NCR ref		
						Туре	Assessor	Description		Sign & date if appropriate
3.5	Load Locate	Measurement		Every Load	Each load can be indentified to a location using a diagram. Record includes:  - Truck ID/Rego/Driver  - Depart Plant Time  - Arrive Site Time  - AC Temp on Arrival  - Ground Temp on Arrival  - Tonnage  - Run Width  - Estimated Run Length  - Calculated Area  - Calculated Average Depth	W		Per standard practice	Quality Assurance Engineer	
3.6	Laying Temperature	Confirmation	NZTA M/10	Every Load	Arrival temperature 150°C (±10°) checked for every load	Н			Quality Assurance Engineer	
3.7	Compaction	NDM Testing	NZTA M/10	Minimum: 1 Test per 300m² within Mat. 1 Test per 100m of joint.	Mat: Air voids JMF +3,-2 Join: Air voids JMF +5,-2	Н		POL/ Core recorded with RP. Jane.	Quality Assurance Engineer	




Site Name: Wreys Bush 3

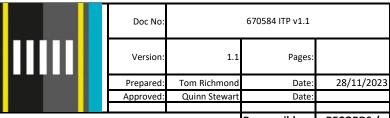

Item Number	ACTIVITY DES	CRIPTION	VERIFICATION ACTIVITY	METHODS OR REFERENCE	FRFO.	ACCEPTANCE CRITERIA			DRATE W/H	Responsible Person	RECORDS / REMARKS incl NCR ref
							Туре	Assessor	Description		Sign & date if appropriate
4						Paving Wearing Course					
		PSD (Particle Size Distribution)	Sieve analysis of fine and coarse aggregates and material finer than 75µm by washing	ASTM C136-06 / C 117-14		Job Mix Formula and NZTA M/10					
4.1	Production Properties	Binder Content	Quantitiive Extraction of Bitumen from Bituminous Paving Mixtures by Bowl Centrifuge Method	B19 Issue 6 - 2009	1 per 200t or maximum of 3 per production lot	Table 5.3 tolerances	w		IANZ Lab Reports. Becomes a Hold Point for future paving if there is non- comformance	Paving Supervisor	
		Maximum Specific Gravity	Gravity & Density of	ASTM D2041/D2041M - 2011		Per Mix design					
4.2	Preparati	ion	Visual	NZTA M/10	Prior to Shift	Paving plan to be completed for every shift, with dimensions	w		Paving Plan and Crew Briefing Plan completed prior	Paving Supervisor	
4.3	Joins		Visual	NZTA M/10	Prior to Shift	Joins are outside of trafficked wheel paths where possible.	w			Paving Supervisor	
4.4	Membrane S	Gealing	Visual	NZTA M/10	Prior to Paving	Membrane seal meets design and extent. Sealing Docket record kept	н		Hold Point - No paving until Membrane Done. Ensure correct application of chip & emulsion	Paving Supervisor	
4.5	Mix Inconsistency and Deficiency		Visual	NZTA M/10	Continuous	Visually check asphalt surface during paving for areas of segregation	Н			Site Foreperson	




Site Name: Wreys Bush 3

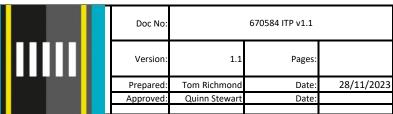

Item Number	ACTIVITY DESCRIPTION	VERIFICATION ACTIVITY	METHODS OR REFERENCE	I FREO.	ACCEPTANCE CRITERIA			JKATE W/H	Responsible Person	RECORDS / REMARKS incl NCR ref Sign & date if appropriate
						Туре	Assessor	Description		
4.6	Load Locate	Measurement		Every Load	Each load can be indentified to a location using a diagram. Record includes:  - Truck ID/Rego/Driver  - Depart Plant Time  - Arrive Site Time  - AC Temp on Arrival  - Ground Temp on Arrival  - Tonnage  - Run Width  - Estimated Run Length  - Calculated Area  - Calculated Average Depth	W			Quality Assurance Technician.	
4.7	Laying Temperature	Confirmation	NZTA M/10	Every Load	Based on Mix design	н		Hold point - Reject mix for non- compliant temperatures.	Quality Assurance Technician	
4.8	Compaction	PQI Non-Nuclear Gauge/Cores. Or Non Distrctive Method Testing.	NZTA M/10	As per Agreed on Contract.	Mat: Air voids JMF +3,-2 Join: Air voids JMF +5,-2	w		offset, date, air voids. Core results	Quality Assurance Technician / Paving Manager	
4.9	Roughness	Visual	On Site	Post Construction	Agreement with WK as per M10	н		Site walkover with client to determine ability to comply with straight edge measurement outlined in M10	Paving Supervisor	



Site Name: Wreys Bush 3

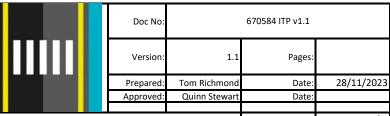

Item Number	ACTIVITY DES	CRIPTION	VERIFICATION ACTIVITY	METHODS OR REFERENCE	FREQ.	ACCEPTANCE CRITERIA	INSPECTORATE W/H  W=WITNESS, H=HOLD  Type Assessor Description		Responsible Person	RECORDS / REMARKS incl NCR ref Sign & date if appropriate	
5						Site Reinstatement / Cleara	nce				
5.1	Shoulder Reinstatemen	t (where no K&C)	Measurement/Visua I	On Site	All low shoulder created by paving edge	Shoulders reinstated to between 1:4 and 1:6	Ξ		Low shoulder created by rural paving is corrected using AP20/40 or DG Mix. Not relevant in kerb and channel scenario.  Hold Point - Site TTM/TSL should not be removed until these hazards possible are attended to.	Paving Supervisor	
5.2	Post-seal Area	a Check	Measurement	On Site tape- measure	After Surfacing	Check sealed area meets design	w		Notify Renewals Engineer or Renewals Manager	Paving Supervisor	
5.3	Service Co	vers	Measurement/Visua I	On Site	After Surfacing	All service covers are checked and adjusted (if necessary) to finished level (+10mm, -0mm)	w			Paving Supervisor	
5.4	Joint Seal	ling	Visual	On Site	After Surfacing	Check cold joints are bandage sealed	w			Paving Supervisor	
5.5	Road Marl	king	MOTSAM	Visual inspection	All markings	Replaced in same position, or per design	н		Hold point – Site TTM cannot be removed until markings reinstated	Paving Supervisor	
5.6	Other Traffic Services	Marker pegs/ Signs/Markings/RRP Ms Replaced	TNZ C/20: 2003	Visual inspection	All signs/markers	Replaced in same position, height etc	Н		Hold point – Site TTM cannot be removed until marker pegs, signs, markings and RRPMs reinstated	Paving Supervisor	
5.7	Stormwater Management C	Controls removed	Visual check		All installed measures	Installed controls are removed	Н			Paving Supervisor	
5.8	Traffic Management Remov	ved	Visual check		When safe, after all physical works completed	All traffic management removed from site safely	w			Paving Supervisor	
5.9	Site left clean & tidy		Visual check		After vacating site	<ul><li>Stockpiles removed</li><li>Plant removed</li><li>Litter cleared from site</li></ul>	W		Invite NZTA to carry out joint site inspection to inspect site.	Paving Supervisor	

		SURFACING	ш			Doc No:		670584 ITP v1.1					
Downer Relationships creating success		Site Name:		V	Ш	Ш		Version:	1.1	Pages:			
reductionalings	o creating addeds				SS DD 40 <b>7</b> 50	10010				Prepared:	Tom Richmond	Date:	28/11/2023
		Location:		SH 96 RS 0	66 RP 10760 t	to 10840				Approved:	Quinn Stewart	Date:	
Item Number	ACTIVITY DES	CRIPTION	VERIFICATION ACTIVITY	ICATION METHODS OR FREQ.		. ACCEPTANCE CRITERIA		INSPECTORATE W/H  W=WITNESS, H =HOLD				Responsible Person	RECORDS / REMARKS incl NCR ref
	Number						Туре	Asse	ssor	Desc	ription		Sign & date if appropriate
6						As Built Records							
6.1	Collect asset	t data	SHDOM (SM050)		During construction	All relevant as built information collected.	W					Paving Supervisor	
6.2	Enter asset data into RAMI	M and/or register(s)	SHDOM (SM050)	RAMM	At completion of	All data entered into RAMM and/or register(s). Design Report & Drawings attached to RAMM site record as a media file.	W				20th of follow month of completion	Asset Information Manager	
6.3	Construction Compl	letion Report	Confirmation		At completion of work.	Checked and approved	W		·	•		Renewals Engineer/ Renewals Manager	

Quality Assurance Close Out by:		Date:
,	(name)	
	(signature)	

This record to contract file.