


payShield® Monitor

Customer Release Notes for V2.5.7

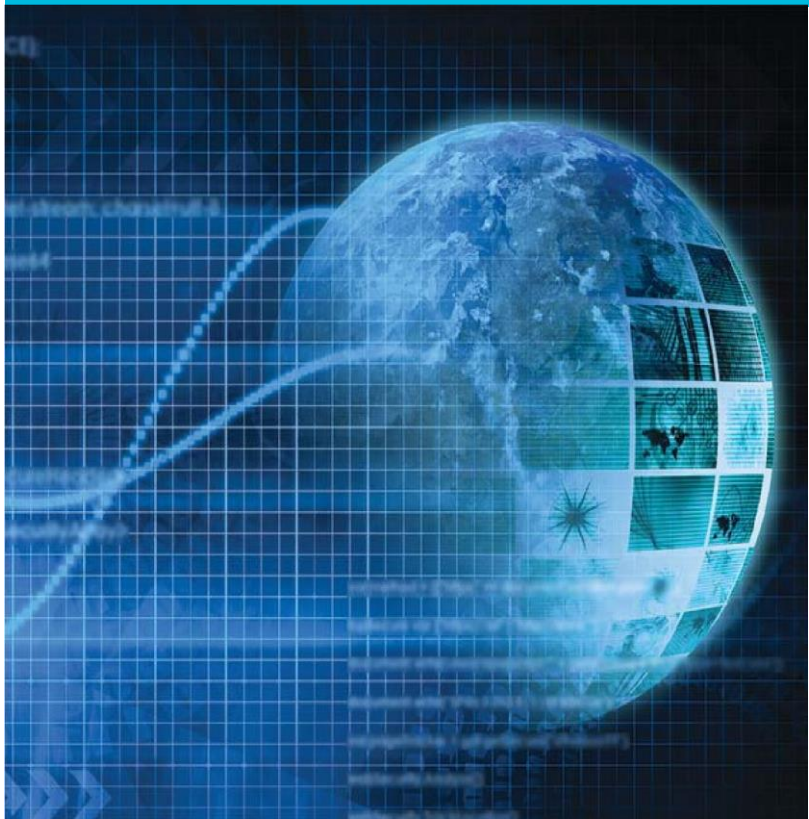

INTRODUCTION

Thales payShield® Monitor is a monitoring solution delivered as a virtual appliance (OVA form factor) to operate in a VMware virtualization environment.

RELEASE SUMMARY

Software Version: 2.5.7

Part Number: 007-000972-001

Build: 513

Release Date: May 2021

NEW FEATURES AND ENHANCEMENTS

payShield® Monitor V2.5.7 includes the following changes:

- > Updated the number of Groups that can be created from 32 to 100
- > Updated custom time and date ranges for one-time reports
- > Removed support for SHA1
- > Updated HSM operational status to UNKNOWN when its connection with payShield Monitor disrupts
- > Updated payShield Monitor MIB files to meet Structure of Management Information (SMI) compliance standards
- > Updated the performance numbers in payShield 10K to reflect reporting status as CPS. For administrators, they will be reported as CPS/TPS
- > Fixed an issue enrolling pS10K units that are using a custom string in the MIB2system "sysDescr" value
- > Fixed an issue displaying payShield HSM Host network port details

payShield® Monitor V2.5.6 includes the following changes:

- > SNMPv3 support
- > Added a button to launch payShield Manager for the specific HSM
- > Added display of payShield 10K auxiliary port details
- > Added display of host command descriptions when hovering over the command
- > Removed “CipherTrust” references from the payShield Monitor MIB files
- > Updated MIB files to add new OID for payShield 9000 Async server traps

payShield® Monitor V2.5.5 includes the following changes:

- > Renamed CipherTrust Monitor to payShield Monitor
- > Removed monitoring of the nShield HSM
- > Added monitoring of the Thales eSecurity payShield 10K HSM

NOTE: There is no CipherTrust Monitor v2.5.4 nor are there any previous versions of payShield Monitor v2.5.5. Customers who are upgrading to payShield Monitor v2.5.5 must first install CipherTrust Monitor v2.5.3 or data loss could occur. Please contact Thales support to ensure the correct upgrade path is understood.

CipherTrust® Monitor V2.5.3 includes the following changes:

- > Support to customize Ethernet Interface name (when eth0 not available)
- > Fixed losing of “Manager” privilege when max enterprise license count is reached
- > Fixed Login Time out issue when email notification severity set to error or above
- > Fixed “User encountered a web UI error”. Users manually reboot payShield Monitor, reload master key, and then each user resets their “GUI Persistence Profile”

CipherTrust® Monitor V2.5.2 includes the following changes:

- > Support new payShield HSM device-state-change SNMP TRAP
- > Support up to 64 CipherTrust Monitor users
- > Allow CTM users to configure Email sender “from” address

CipherTrust® Monitor V2.5.1 includes the following changes:

- > Resolves the issue with Microsoft internet Explorer compatibility

CipherTrust® Monitor V2.5 includes the following changes:

- > The maximum number of monitored HSMs has increased to 500.
- > Added a selectable time zone feature to the Logs and Alarms pages to assist with global collaboration and troubleshooting activities

CipherTrust® Monitor V2.4.1 added the following new features or enhancements:

- > CTM Static IP setup in CLI Setup Wizard is fixed.
- > Open VMWare Tools (OVT) package is included with CipherTrust Monitor (Note: OVT defaults to Disabled)
- > CLI added to allow System Administrator to enable/disable OVT Service. (OVT defaults to Disabled)
- > OVT log will be included in CipherTrust Monitor 'Export Support Data/Debug Logs'.

COMPATIBILITY INFORMATION

payShield® Monitor is provided in Open Virtual Appliance (OVA) format. The OVA includes a 64-bit Linux based OS and OVT.

For the latest information on compatibility and system requirements, see the payShield® Monitor Installation and User Guide.

HYPERVERSOR COMPATIBILITY

The OVA can be installed on vSphere ESXi and VMware Workstation. This release was installed and tested on the following versions:

- > vSphere ESXi 6.7
- > VMware Workstation Pro 16
- > VMware Workstation Player 16

SERVER REQUIREMENTS

- > Must support 64-bit OS
- > CPU: 2 cores of 2.0GHz multicore CPU (can be increased as needed)
- > Memory: 8GB dedicated memory for payShield® Monitor (can be increased)
- > Network: Single network attached interface to bridged or physical network
- > Disk size to sufficiently accommodate a minimum OVA Download size of 833.3 MB. Size on disk:
 - » 2.3 GB (thin provisioned)
 - » 326.0 GB (thick provisioned)

PAYSHIELD COMPATIBILITY

payShield® Monitor can communicate with payShield 9000 HSMs running any version of firmware from V1.1 onwards with SNMPv3 enabled and with payShield 10K.

UPGRADE

- > If upgrading from V1.0 or V1.1, you must first upgrade to V2.0.
- > After upgrading to V2.0, you can upgrade to V2.5.3.
- > After upgrading to V2.5.3, you can upgrade to V2.5.7.

Note: The omission of a V2.5.4 is intentional.

Customers who have upgraded from V1.0/V1.0.1 can encounter an issue that prevents subsequent modification of network settings if the Host name contains a “.” character. To address this issue, please change the Host name to remove the “.” character and then proceed to modify network settings.

- > If upgrading to payShield Monitor® 2.5.5 or above, systems must have had CipherTrust® Monitor 2.5.3 installed.

Warning: Failure to upgrade from CipherTrust® Monitor V2.5.3 to payShield® Monitor could result in loss of data. Please contact Thales Support before upgrading to payShield® Monitor V2.5.5 or above.

RELEASE HISTORY

Known issues and workarounds:

- > If the browser certificate expires, data in the GUI will not be refreshed. Please close the browser tab and open a new tab to connect to the CipherTrust® Monitor again to accept the new browser certificate.
- > OVA is now signed using SHA-256.
 - » VMware only supports deploying SHA-256 signed OVAs through the version 6.0 and 6.5 web interfaces.
 - » If the OVA does not deploy in the Firefox browser, try another browser such as Chrome. We have experienced some issues deploying OVAs in vCenter with ESX versions 6.0 and 6.5.

CONTACTING SUPPORT

To obtain support for your product, visit:

<https://supportportal.thalesgroup.com/csm>

> thalesgroup.com <



Americas – Ardourum Plaza II, 5442 Capital of Texas Highway North, Suite 100, Austin, TX 78759 USA • Tel: +1 888 343 5773 or +1 512 257 3900 • Fax: +1 954 888 4311 • E-mail: sales@thalessec.com
Asia Pacific – Thales Transport & Security (HK) Co., Unit 4101-3, 41/E Sunlight Tower, 249 Queen's Road East, Wanchai, Hong Kong • Tel: +852 2815 8638 • Fax: +852 2815 8141 • E-mail: asia.sales@thales-sec.com
Europe, Middle East, Africa – 350 Longwater Ave, Green Park, Reading, Berkshire, UK RG2 4GF • Tel: +44 (0)1844 201800 • Fax: +44 (0)1844 208550 • E-mail: emea.sales@thales-sec.com

© Thales