PROBLEM CL7

Industrial Dryer: Velocities, Force, Power and Torque


Original statement · CL7.pdf

Axisymmetric | Angular momentum | Energy | Ideal gas

OFFICIAL PROBLEM STATEMENT

The axisymmetric industrial dryer of the figure in CL7.pdf is designed to provide a steady hot jet of radius R, mass flux G, and temperature T_s. Air enters the dryer from the ambient, at temperature and pressure T_a and p_a, through a radial inlet of surface A. Inside the dryer there exists an electric resistance that releases an amount of heat Q per unit time, as well as a fan of power W (work per unit time). Because of the presence of the fan, the air velocity at the exit has both azimuthal and axial components, v_θ and v_z, such that $v_\theta / v_z = \tan(\beta)$. In the analysis, assume that the fan and the inner walls of the dryer are thermally insulated, that the air behaves as an ideal gas with constant R_g and specific heat at constant pressure c_p, that gravity has a negligible effect on the fluid motion, and that the flow properties are uniform at the inlet and outlet sections. For given values of G, T_s, T_a, p_a, A, R, R_g, c_p and $\tan(\beta)$, determine:

- The velocity at the entrance section v_r as well as the two velocity components at the exit v_θ and v_z.
- The force acting on the dryer, indicating clearly its magnitude and direction.
- The total power required to run the dryer $Q + W$.
- The torque acting on the dryer.

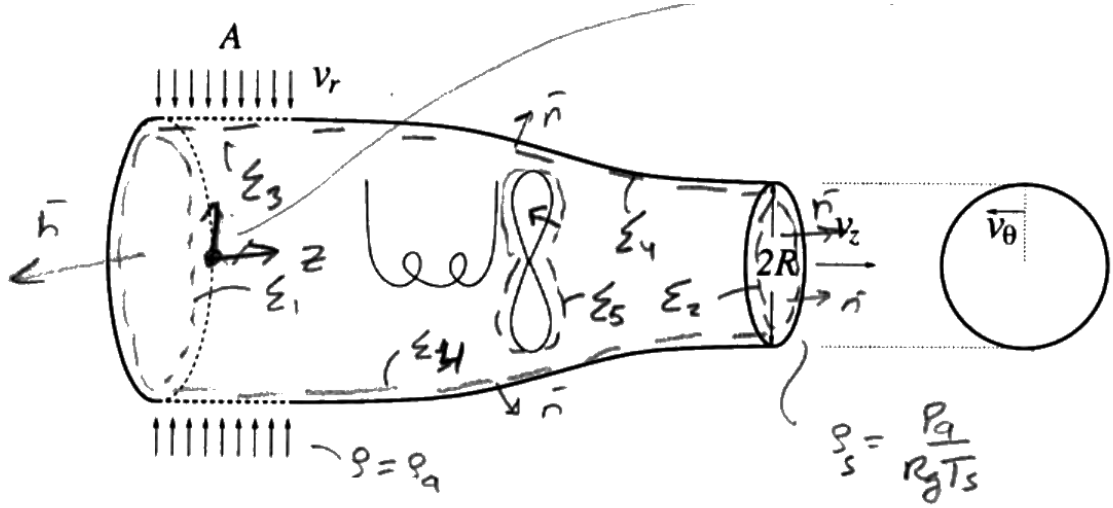

Statement figure (CL7.pdf, p. 1, cropped): radial inlet A (v_r, ρ_a), resistance and fan, exit of diameter $2R$ with v_z and v_θ; the surface names and notes are handwritten on the official sheet

`Source: CL7.pdf (page 1). Notes.pdf, Chapter 3: integral mass balance Eq. 3.11, integral momentum balance Eq. 3.35, integral angular momentum balance Eq. 3.38, integral total energy balance Eq. 3.46.`

Worked solution (4-phase method)

`PHASE 1`

Hypotheses, Data and Unknowns

- Steady (on average) axisymmetric flow; ideal gas $p = \rho R_g T$, so $h = e + p/\rho = c_p T$; neglect $\bar{g}$; uniform properties at inlet and outlet.
- Inlet: air taken from the ambient, with $p = p_a$, $T = T_a$, $\rho_a = p_a/(R_g T_a)$ and radial velocity v_r pointing inwards (as in the official solution). Exit: free jet, $p = p_a$, $T = T_s$, $\rho_s = p_a/(R_g T_s)$, velocity $v_z \bar{e}_z + v_\theta \bar{e}_\theta$ uniform over the disc of radius R.
- G is the mass flow rate of the jet (kg/s), as used in the official solution ($G = \rho_a v_r A$). Fan and inner walls insulated; the resistance releases $\dot{Q}$; the fan delivers the power $\dot{W}$ to the air.
- Data: $[G,\ T_s,\ T_a,\ p_a,\ A,\ R,\ R_g,\ c_p,\ \tan\beta]$. Unknowns: $[v_r,\ v_z,\ v_\theta,\ \bar{F},\ \dot{Q}+\dot{W},\ \bar{M}]$.


Symbol	Meaning	SI unit
G	mass flow rate	kg/s
A, R	inlet area, jet radius	m^2, m

Symbol	Meaning	SI unit
v_r, v_z, v_θ	inlet and exit velocities	m/s
R_g, c_p	gas constant, specific heat	J/(kg·K)
$\bar{F}, \bar{M}$	force and torque on the dryer	N, N·m
T_s, T_a, p_a	exit and ambient temperatures, ambient pressure	K, K, Pa
$\tan\beta = v_\theta / v_z$	swirl ratio at the exit	1

PHASE 2

Frames, Control Volume and Surfaces

- Frame fixed to the dryer; cylindrical basis $(\bar{e}_r, \bar{e}_\theta, \bar{e}_z)$ with $\bar{e}_z$ along the axis in the jet direction; origin on the axis. By axisymmetry the integrals of the unit vectors over a full turn vanish: with two fixed unit vectors $\bar{e}_x, \bar{e}_y$ normal to the axis ($\bar{e}_x \wedge \bar{e}_y = \bar{e}_z$), $\bar{e}_r = \cos\theta\,\bar{e}_x + \sin\theta\,\bar{e}_y$ and $\bar{e}_\theta = -\sin\theta\,\bar{e}_x + \cos\theta\,\bar{e}_y$, so $\int_0^{2\pi} \bar{e}_r\,d\theta = [\sin\theta]_0^{2\pi}\,\bar{e}_x + [-\cos\theta]_0^{2\pi}\,\bar{e}_y = \bar{0}$ and $\int_0^{2\pi} \bar{e}_\theta\,d\theta = [\cos\theta]_0^{2\pi}\,\bar{e}_x + [\sin\theta]_0^{2\pi}\,\bar{e}_y = \bar{0}$.
- Surfaces: Σ_1 (radial inlet, area A, $\bar{n} = \bar{e}_r$, $\bar{v} = -v_r\bar{e}_r$), Σ_2 (exit disc, $\bar{n} = \bar{e}_z$), Σ_w (fixed casing and resistance, $\bar{v} = 0$) and Σ_m (fan blades, $\bar{v} = \bar{v}_c$).

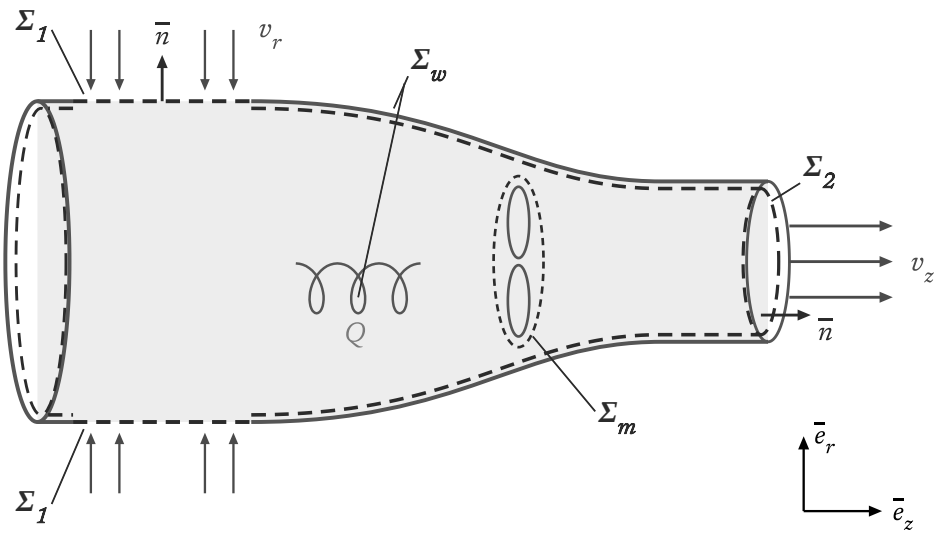

Control volume of the solution (schematic axial section): Σ_1 (radial inlet of area A, $\bar{n} = \bar{e}_r$, $\bar{v} = -v_r\bar{e}_r$), Σ_2 (exit disc of radius R, $\bar{n} = \bar{e}_z$), Σ_w (fixed casing and resistance) and Σ_m (fan blades, dashed around them); the heat Q is released by the resistance

Force and torque of the air (inside, and ambient outside) on the dryer, and the heat and work exchanged:

$$\boxed{\bar{F} = \int_{\Sigma_w, \Sigma_m} \left[(p - p_a)\, \bar{n} - \bar{\bar{\tau}}' \cdot \bar{n} \right] d\sigma}$$

$$\boxed{\bar{M} = \int_{\Sigma_w, \Sigma_m} \bar{x} \wedge \left[(p - p_a)\, \bar{n} - \bar{\bar{\tau}}' \cdot \bar{n} \right] d\sigma}$$

PHASE 3

Balances, Surface by Surface

Mass (Notes Eq. 3.11)

$$\underbrace{\frac{d}{dt}\cancel{\int_{V_c} \rho \, dV}}_{0 \text{ (steady)}} + \int_{\Sigma_c} \rho \, (\bar{v} - \bar{v}_c) \cdot \bar{n} \, d\sigma = 0$$

Each surface integral, surface by surface (the vertical line drawn under each integral in class):

Surface	$\int \rho \, (\bar{v} - \bar{v}_c) \cdot \bar{n} \, d\sigma$
Σ_1	$\rho_a (-v_r) A = -\rho_a v_r A$
Σ_2	$\rho_s v_z \pi R^2$
$\Sigma_w,\ \Sigma_m$	0

$$G = \frac{p_a}{R_g T_a} v_r A = \frac{p_a}{R_g T_s} v_z \pi R^2 \implies \boxed{v_r = \frac{G R_g T_a}{p_a A}, \qquad v_z = \frac{G R_g T_s}{p_a \pi R^2}, \qquad v_\theta = v_z \tan\beta} \quad (1)$$

Linear momentum (Notes Eq. 3.35)

$$\underbrace{\frac{d}{dt}\cancel{\int_{V_c}\rho\bar{v}\,dV}}_{0\ \text{(steady)}}+\int_{\Sigma_c}\rho\bar{v}\,[(\bar{v}-\bar{v}_c)\cdot\bar{n}]\,d\sigma=-\int_{\Sigma_c}(p-p_a)\,\bar{n}\,d\sigma+\int_{\Sigma_c}\bar{\bar{\tau}}'\cdot\bar{n}\,d\sigma+\underbrace{\cancel{\int_{V_c}\rho\bar{g}\,dV}}_{\text{neglect }\bar{g}}$$

Each surface integral, surface by surface (the vertical line drawn under each integral in class):

Surface	$\int \rho\bar{v}\,[(\bar{v}-\bar{v}_c)\cdot\bar{n}]\,d\sigma$	$-\int(p-p_a)\,\bar{n}\,d\sigma$	$\int\bar{\bar{\tau}}'\cdot\bar{n}\,d\sigma$
Σ_1	$\rho_a v_r^2\int_{\Sigma_1}\bar{e}_r\,d\sigma=0$ (axisymmetric)	0 ($p=p_a$)	0
Σ_2	$\rho_s v_z\int_{\Sigma_2}(v_z\bar{e}_z+v_\theta\bar{e}_\theta)\,d\sigma=\rho_s v_z^2\pi R^2\,\bar{e}_z$	0 (free jet)	0
$\Sigma_w,\ \Sigma_m$	0	$-\int(p-p_a)\,\bar{n}\,d\sigma$	$\int\bar{\bar{\tau}}'\cdot\bar{n}\,d\sigma$

Boxed terms: $-\bar{F}$. On Σ_2, $\int_{\Sigma_2}\bar{e}_\theta\,d\sigma=0$, so the swirl gives no force.

$$\rho_s v_z^2\pi R^2\,\bar{e}_z=-\bar{F}\implies\boxed{\bar{F}=-\frac{p_a}{R_gT_s}\,v_z^2\,\pi R^2\,\bar{e}_z=-G\,v_z\,\bar{e}_z}\qquad(2)$$

Total energy (Notes Eq. 3.46; $Q_R\equiv Q_c+Q_r$ is the volumetric heat release)

$$\underbrace{\frac{d}{dt}\cancel{\int_{V_c}\rho\left(e+\frac{v^2}{2}\right)dV}}_{0\ \text{(steady)}}+\int_{\Sigma_c}\rho\left(e+\frac{v^2}{2}\right)[(\bar{v}-\bar{v}_c)\cdot\bar{n}]\,d\sigma=-\int_{\Sigma_c}p\,\bar{v}\cdot\bar{n}\,d\sigma+\int_{\Sigma_c}\bar{v}\cdot(\bar{\bar{\tau}}'\cdot\bar{n})\,d\sigma+\underbrace{\cancel{\int_{V_c}\rho\bar{g}\cdot\bar{v}\,dV}}_{\text{neglect }\bar{g}}-\int_{\Sigma_c}\bar{q}\cdot\bar{n}\,d\sigma+\underbrace{\cancel{\int_{V_c}Q_R\,dV}}_{0}$$

Each surface integral, surface by surface (the vertical line drawn under each integral in class):

Surface	$\int\rho\left(e+\frac{v^2}{2}\right)(\bar{v}\cdot\bar{n})\,d\sigma$	$-\int p\,\bar{v}\cdot\bar{n}\,d\sigma$	$\int\bar{v}\cdot(\bar{\bar{\tau}}'\cdot\bar{n})\,d\sigma$	$-\int\bar{q}\cdot\bar{n}\,d\sigma$
Σ_1	$-G\left(e_a+\frac{v_r^2}{2}\right)$	$+p_a v_r A$	0	0
Σ_2	$+G\left(e_s+\frac{v_\theta^2+v_z^2}{2}\right)$	$-p_a v_z\pi R^2$	0	0
Σ_m	0	$-\int_{\Sigma_m}p\,\bar{v}\cdot\bar{n}\,d\sigma$	$\int_{\Sigma_m}\bar{v}\cdot(\bar{\bar{\tau}}'\cdot\bar{n})\,d\sigma$	0 **(insulated)**
Σ_w	0	0	0	$-\int_{\Sigma_w}\bar{q}\cdot\bar{n}\,d\sigma$

Boxed terms: the work on Σ_m is the fan power $\dot{W}$; the heat through Σ_w (only the resistance, the walls are insulated) is $\dot{Q}$. With $p_a v_r A=G\,p_a/\rho_a$ and $p_a v_z\pi R^2=G\,p_a/\rho_s$, $e+p/\rho=c_pT$:

$$\boxed{\dot{Q} + \dot{W} = G\left[\left(c_p T_s + \frac{v_\theta^2 + v_z^2}{2}\right) - \left(c_p T_a + \frac{v_r^2}{2}\right)\right]} \qquad (3)$$

Angular momentum about the origin, z component (Notes Eq. 3.38)

$$\underbrace{\frac{d}{dt}\int_{V_c} \rho\, \bar{x} \wedge \bar{v}\, dV}_{0} + \int_{\Sigma_c} \rho\,(\bar{x} \wedge \bar{v})[(\bar{v} - \bar{v}_c)\cdot \bar{n}]\, d\sigma = -\int_{\Sigma_c} \bar{x} \wedge (p - p_a)\bar{n}\, d\sigma + \int_{\Sigma_c} \bar{x} \wedge (\bar{\bar{\tau}}' \cdot \bar{n})\, d\sigma$$

Each surface integral, surface by surface (the vertical line drawn under each integral in class):

Surface	$\int \rho\,(\bar{x} \wedge \bar{v})_z\,[(\bar{v} - \bar{v}_c)\cdot \bar{n}]\, d\sigma$	pressure and viscous moments
Σ_1	0 ($\bar{x} \wedge (-v_r \bar{e}_r) = -z v_r\, \bar{e}_\theta$, no z component)	0
Σ_2	$\int_0^R \rho_s v_z\,(r v_\theta)\, 2\pi r\, dr = \rho_s v_z v_\theta\, \frac{2\pi R^3}{3}$	0
$\Sigma_w,\ \Sigma_m$	0	$-\bar{M}\cdot \bar{e}_z$

On Σ_2, $\bar{x} = r\bar{e}_r + z_2 \bar{e}_z$ and $\bar{x} \wedge \left(v_z \bar{e}_z + v_\theta \bar{e}_\theta\right) = -r v_z \bar{e}_\theta + r v_\theta \bar{e}_z - z_2 v_\theta \bar{e}_r$; only $r v_\theta \bar{e}_z$ survives the integral. The antiderivative of r^2 is $r^3/3$, and Barrow's rule between 0 and R gives $R^3/3$.

$$\boxed{\bar{M} = -\rho_s v_z v_\theta\, \frac{2\pi R^3}{3}\, \bar{e}_z = -\frac{2}{3}\, R\, G\, v_\theta\, \bar{e}_z} \qquad (4)$$

Erratum in the official solution (slip in the boxed result)

CL7.pdf writes the momentum balance as $\frac{p_a}{R_g T_s} v_z^2 \pi R^2 \bar{e}_z = -\bar{F}$ but boxes $\bar{F} = -\frac{p_a}{R_g T_s} v_z^2 \bar{e}_z$, without the area πR^2. That expression has units of pressure, not force; the correct result is (2).

PHASE 4

Interpretation, Limits and Dimensional Check

- The radial inflow gives no net momentum (axisymmetry), so the force is the reaction to the jet: magnitude Gv_z, direction $-\bar{e}_z$ (opposite to the jet).
- The swirl gives no force but gives a torque: the fan sets the air rotating, and the air reacts on the dryer with $\bar{M}$ opposite to the swirl. For $\beta = 0$, $v_\theta = 0$ and $\bar{M} = 0$.
- (3): the electric and mechanical power go into heating the air from T_a to T_s and into its kinetic energy.
- Dimensions (SI): $[Gv_z] = \mathrm{N}$; $[RGv_\theta] = \mathrm{m} \cdot (\mathrm{kg/s})(\mathrm{m/s}) = \mathrm{N} \cdot \mathrm{m}$; $[Gc_pT] = \mathrm{W}$.
- Numerical illustration (hypothetical data): $G = 0.5$ kg/s, $T_s = 350$ K, $T_a = 293$ K, $p_a = 101325$ Pa, $A = 0.05$ m^2, $R = 0.05$ m, $R_g = 287$ J/(kg K), $c_p = 1005$ J/(kg K), $\tan\beta = 0.5$ give $v_r = 8.2991$ m/s, $v_z = 63.112$ m/s, $v_\theta = 31.556$ m/s, $|\bar{F}| = 31.556$ N, $\dot{Q} + \dot{W} = 29870$ W and $|\bar{M}| = 0.52594$ N·m (a midpoint quadrature of the torque integral gives the same value).