Problem 3 | Problems T4_PhaseDiagrams I.pdf #3 | Pb-Sn · hypereutectic

Phases and Microconstituents of a Pb-80 wt% Sn Alloy

Original statement · Problems T4_PhaseDiagrams I.pdf

3. Using the Pb-Sn phase diagram for an alloy composition of Pb-80%Sn, indicate at the temperatures of $T_1 = 250$ ºC, $T_2 = 183 + \Delta T$ ºC, $T_3 = 183 - \Delta T$ ºC, $T_4 = 100$ ºC: a) The phases present, chemical composition of the phases and mass fraction. b) The micro constituents, chemical composition and mass fractions. Note the agreement that exists between the data obtained in (a) and (b).

Official Solution: a) T_1**:** $C_L = 80\%$ **Sn,** $w_L = 1$**;** T_2**:** $C_L = 61.9\%$ **Sn,** $C_\beta = 97.5\%$ **Sn,** $w_L = 0.49$**;** T_3**:** $C_\alpha = 19.2\%$ **Sn,** $C_\beta = 97.5\%$ **Sn,** $w_\alpha = 0.22$**;** T_4**:** $C_\alpha = 5\%$ **Sn,** $C_\beta = 100\%$ **Sn,** $w_\alpha = 0.21$**; b)** $C_{\beta'} = 97.5\%$ **Sn,** $C_E = 61.9\%$ **Sn,** $w_E = 0.49$**,** $w_{\beta'} = 0.51$

PHASE 1 · HYPOTHESES & PARAMETERS

Hypotheses

1. **Equilibrium cooling**, Pb-Sn diagram of the problem sheet (p. 1): eutectic at 61.9 wt% Sn and 183 °C; at 183 °C, α of 19.2 and β of 97.5 wt% Sn.
2. Values at 250 °C and 100 °C are **readings of the figure**: at 250 °C the alloy is above the liquidus on the Sn side (which goes from 183 °C at 61.9 wt% Sn to 232 °C at 100 wt% Sn); at 100 °C the solvus lines give α of about 5 and β of about 100 wt% Sn.
3. $C_0 = 80$ wt% Sn lies between 61.9 and 97.5: a **hypereutectic** alloy, so the primary phase is β [Session 7 Slide 31].

Data

Temperature	Region	Phase compositions (wt% Sn)
$T_1 = 250$ °C	L	$C_L = 80$
$T_2 = 183 + \Delta T$	β + L	$C_L = 61.9$, $C_\beta = 97.5$
$T_3 = 183 - \Delta T$	α + β	$C_\alpha = 19.2$, $C_\beta = 97.5$
$T_4 = 100$ °C	α + β	$C_\alpha = 5$, $C_\beta = 100$

PHASE 2 · FRAMES & STRATEGY

The frame is the Pb-Sn diagram (wt% Sn, °C). At each temperature the work is on one horizontal tie line, so it is one-dimensional; no change of basis is needed.

Method. (a) Tie line for the compositions, lever rule for the fractions [Session 7 Slides 15-16]. (b) Below the eutectic temperature, the lever rule on the short tie line (β to eutectic liquid) gives the microconstituents, and the long tie line (α to β) gives the phases [Session 7 Slide 32]; comparing both answers part (b)'s "agreement".

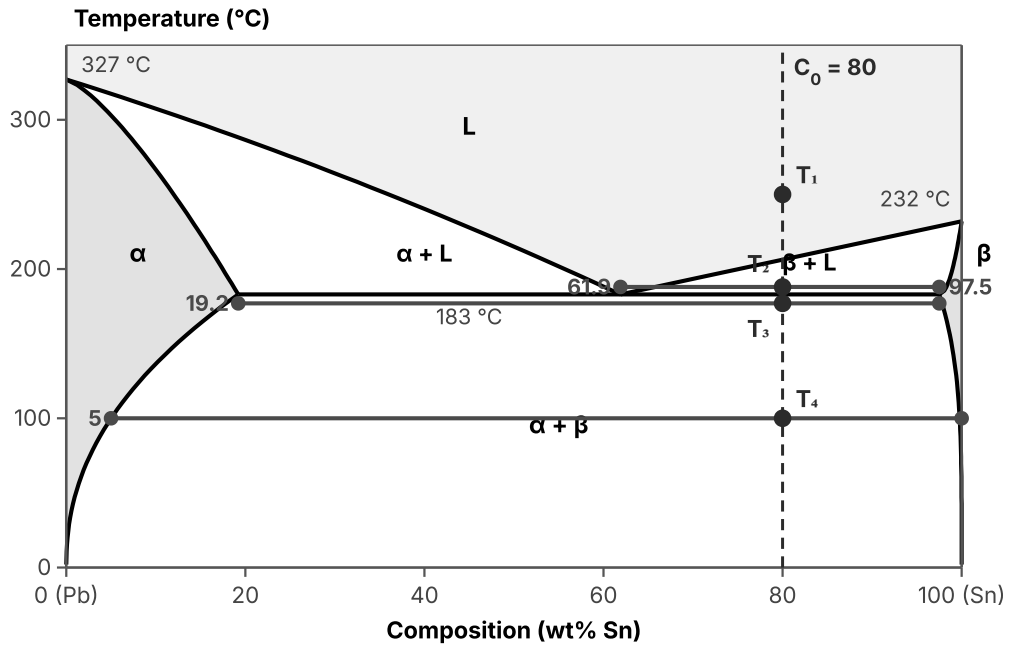


Figure 3. Pb-80 wt% Sn at T_1 = 250 °C (liquid), T_2 = 183 + ΔT (β + L), T_3 = 183 − ΔT (α + β) and T_4 = 100 °C (α + β, with α of 5 and β of 100 wt% Sn, a reading of the figure). Problem sheet diagram.

PHASE 3 · STEP-BY-STEP DERIVATION

a) Phases $T_1 = 250$ °C. Above the liquidus: one phase, liquid with the composition of the alloy. $C_L = 80$ wt% Sn, $W_L = 1$.

$T_2 = 183 + \Delta T$. Region β + L; tie line from $C_L = 61.9$ to $C_\beta = 97.5$ (length $97.5 - 61.9 = 35.6$):

$$W_\beta = \frac{C_0 - C_L}{C_\beta - C_L} = \frac{80 - 61.9}{97.5 - 61.9} = \frac{18.1}{35.6} = 0.508 \qquad W_L = \frac{C_\beta - C_0}{C_\beta - C_L} = \frac{97.5 - 80}{35.6} = \frac{17.5}{35.6} = 0.492$$

$T_3 = 183 - \Delta T$. Region α + β; tie line from 19.2 to 97.5 (length 78.3):

$$W_\alpha = \frac{C_\beta - C_0}{C_\beta - C_\alpha} = \frac{97.5 - 80}{97.5 - 19.2} = \frac{17.5}{78.3} = 0.224 \qquad W_\beta = \frac{C_0 - C_\alpha}{C_\beta - C_\alpha} = \frac{80 - 19.2}{78.3} = \frac{60.8}{78.3} = 0.776$$

$T_4 = 100$ °**C.** Region α + β; tie line from 5 to 100 (length 95):

$$W_\alpha = \frac{100 - 80}{100 - 5} = \frac{20}{95} = 0.211 \qquad W_\beta = \frac{80 - 5}{95} = \frac{75}{95} = 0.789$$

b) Microconstituents At T_1 and T_2 the microconstituents are the phases themselves (liquid; primary β + liquid).

At T_3 there are two microconstituents: **primary β** (97.5 wt% Sn), formed in the β + L region, and **eutectic** (overall 61.9 wt% Sn), formed from the liquid present at T_2. With $P = C_0 - C_e$ and $Q = C_\beta - C_0$ on the short tie line:

$$W_{\beta'} = \frac{C_0 - C_e}{C_\beta - C_e} = \frac{80 - 61.9}{97.5 - 61.9} = 0.508 = W_\beta(T_2) \qquad W_E = \frac{C_\beta - C_0}{C_\beta - C_e} = \frac{17.5}{35.6} = 0.492 = W_L(T_2)$$

Phases inside the eutectic:

$$W_{\beta,E} = W_\beta(T_3) - W_{\beta'} = 0.776 - 0.508 = 0.268 \qquad W_{\alpha,E} = W_\alpha(T_3) = 0.224$$

(all the α is in the eutectic, since the primary phase is β).

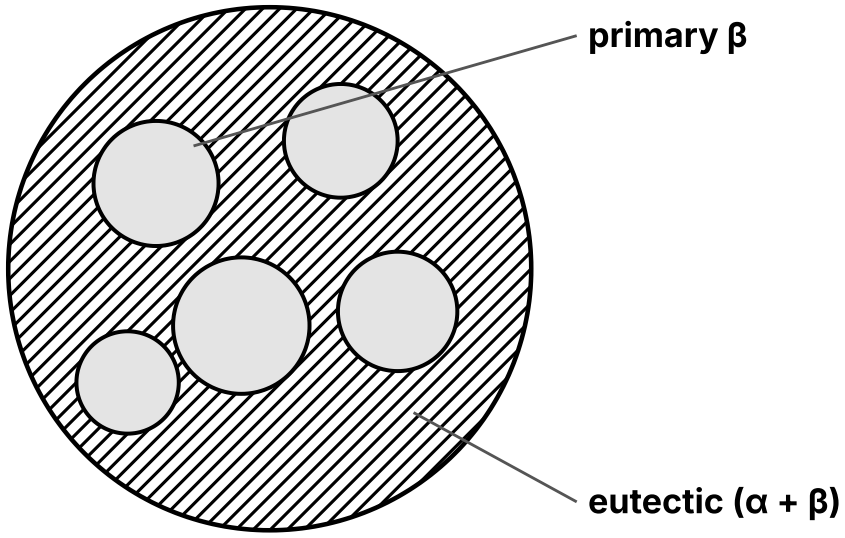


Figure 4. Pb-80 wt% Sn below the eutectic temperature: primary β (51 %) in the eutectic α + β (49 %).

PHASE 4 · CHECKS & INTERPRETATION

Agreement between (a) and (b)

- $W_{\beta,E} + W_{\alpha,E} = 0.268 + 0.224 = 0.492 = W_E$: the phases of the eutectic add up to the eutectic.
- Inside the eutectic, α is $0.224/0.492 = 0.455$, the same as the eutectic product of the sheet diagram, $(97.5 - 61.9)/(97.5 - 19.2) = 35.6/78.3 = 0.455$.
- Mass balance at T_3: $0.224 \times 19.2 + 0.776 \times 97.5 = 4.30 + 75.66 = 80.0$ wt% Sn.

Interpretation Below 183 °C the alloy is about half primary β and half eutectic. On further cooling to 100 °C the solvus lines move outwards (α purer in Pb, β practically pure Sn) and the amounts of the phases change slightly (α from 0.224 to 0.211) by solid-state precipitation, while the microconstituents keep their shape.

Check against the official solution

All the values agree with the key ($w_L = 0.49$, $w_\alpha = 0.22$, $w_\alpha = 0.21$; $w_E = 0.49$, $w_{\beta'} = 0.51$).

ERRATUM IN THE WORKED SOLUTION

Solution problems Phase diagrams I.pdf, p. 7, writes "T2; phases α and L"; the phases at T_2 are **β and L** (the alloy is hypereutectic). On the same page the T_3 formula is printed with the denominator $97.5 - 61.9$, but the value 0.22 corresponds to $97.5 - 19.2 = 78.3$: $17.5/35.6$ would give 0.49, while $17.5/78.3 = 0.22$. The numbers of the page are right; the labels and that denominator are not.