HYPERX.COM

Outlaw SI1 UI Behavior

2024/10/22

AGENDA

01 DAC Overview

02 Headset Overview

03 DAC Button Behavior

04 Headset Button Behavior

Known Issue List

HyperX DE Team Confidential

01 DAC Overview

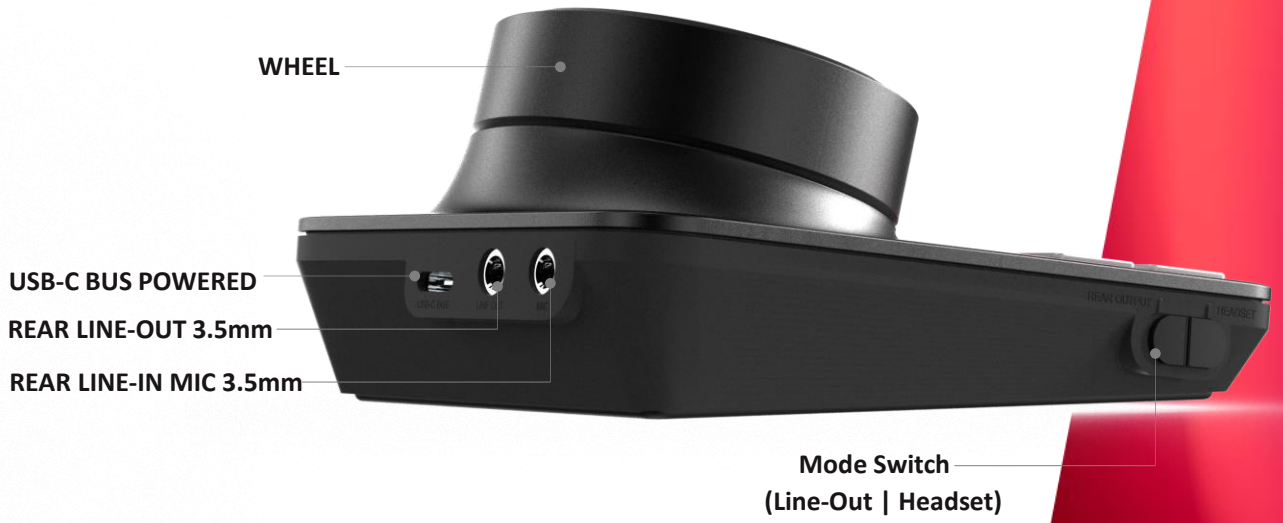

02 Headset Overview

03 DAC Button Behavior

[1] Mic Gain
Button Behavior
- Short Press: Enter setting page

LED Ring
- From 0 (One LED) to 100 (Full)

[2] Game/Chat Mix
Button Behavior
- Short Press: Enter setting page
- Long Press: Balance

LED Ring
- Left: Game Channel
- Right: Chat Channel

[3] Sidetone
Button Behavior
- Short Press: Enter setting page
- Long Press: Toggle sidetone on/off

LED Ring
- From 0 (One LED) to 100 (Full)

[4] Audio Mute
Button Behavior
- Short Press: Toggle playback mute on/off

LED Ring
- Light up RED with full LED ring

[5] EQ Preset
Button Behavior
- Short Press: Enter setting page
- Long Press: Toggle EQ on/off

LED Ring
- Music ↔ Game ↔ Voice

[6] Media
Button Behavior
- Short Press: Toggle host media play/pause

LED Ring
- NA

Combo Key
- Key [1-3] 10 seconds for DAC Re-pairing
- Key [4-6] 10 seconds for Factory Reset

04 Headset Button Behavior

Event	Functions	Button Press Duration	Button
Power	Toggle headset on/off	Long Press (2s)	Power
2.4GHz Pairing Mode	To enter ULL pairing mode when connection mode is ULL or dual, while HS is off	Very Long Press (10s)	Power
Bluetooth Pairing Mode	Enter the pairing mode with following condition - Headset is under Dual mode - Headset boot up. - ULL connection is not in pairing mode	Long Press (2s)	Power + MFB
Battery level	Toggle voice prompt for battery level status check	Single Press	Power
Mode Switching	Switch through 2 connection mode - 2.4GHz mode / Dual Mode	Slide (2positions)	Slider Switch
Mic Mute	Toggle mic mute/unmute	Single Press	Mic Mute
Sidetone	Toggle mic monitoring on/off	Long press (3s)	Mic Mute
Volume Wheel	Adjust master volume	Wheel/Dial Rotation	Volume Wheel
Answer Call	Answer Call (BT Mode)	Single Press (300ms)	MFB
End Call	End Call (BT mode and while call in progress)	Double Press (300ms)	MFB
Reject Call	Reject Call (BT Mode)	Double Press (300ms)	MFB
Play/Pause	Play/Pause music	Single Press (300ms)	MFB
Next Song	Skips to next song	Double Press (300ms)	MFB
Previous Song	Skips to last song	Triple Press (300ms)	MFB
Voice Assistant	Activates mobile voice assistant (BT Mode)	Long Press (2s)	MFB
Factory Reset	All functions are reset to default	Very Long Press (10s)	Power + MFB
Hardware Reset	Trigger the hardware reset on the headset	Long press (5s)	Mic Mute + MFB

05 Known Issue List

- Sidetone is not able to standalone enable without microphone streaming enabled.
- DAC may not able to enumerate randomly when connected to host.
- Not able to full charge the headset.
- Audio configuration will un-sync after DAC and headset re-connect.

Thank You
HYPERX