

# SCA3000-D01 3-AXIS LOW POWER ACCELEROMETER WITH DIGITAL SPI INTERFACE

#### **Features**

- 2.35 V 3.6 V supply voltage,
   1.7 V 3.6 V digital I/O voltage
- ±2 g measurement range
- · SPI digital interface
- Selectable frequency response
- Very low current consumption (2.5 V, 480 μA typ)
- Temperature output
- 64 samples/axis buffer memory for output acceleration data and advanced features enable significant power and resource savings at system level
- Interrupt signal triggered by motion and free fall
- Size 7x7x1.8 mm
- Proven capacitive 3D-MEMS technology
- · High shock durability
- RoHS compliant / lead free soldering

#### **Applications**

SCA3000-D01 is targeted to battery operated devices. Typical applications are but not limited

- Motion activated functions in mobile terminals and antitheft systems
- Inertial navigation
- Inclination sensing in digital inclinometers
- Tilt compensation in electronic compass

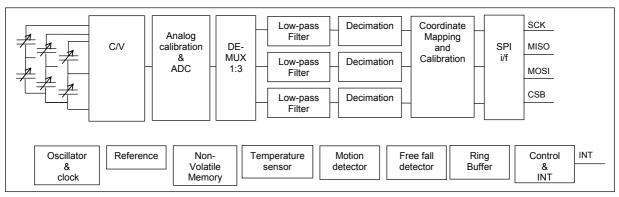


Figure 1 SCA3000-D01 Block Diagram



Inselkammerstr. 10 82008 Unterhaching Tel.: 089/614503 - 30

E-Mail: sensortec@hy-line.de

Postfach 12 22 82002 Unterhaching Fax: 089/614 503 - 34 www.hy-line.de



### Performance Characteristics 1)

Parameter	Condition		cal supply ra – 2.7 V	ange	range	nded supp e 2.7 – 3.0		Units
		Min	Typ <sup>2)</sup>	Max	Min	Typ 2)	Max	
Analog and digital Vdd		2.35	2.5	2.7	-	3.3	-	V
Digital I/O Vdd	Vdd ≥ Digital I/O Vdd	1.7	1.8 / 2.5	2.7	-	3.3	-	V
Operating temperature **	2)	-40	-	85	-40	-	85	°C
Current consumption *	Reset 3)	-	<7		-	<9	-	μΑ
	Active	-	480		-	650	-	μΑ
	Motion Detection mode	-	300		-	400	-	μΑ
Acceleration range * 4)	Nominal	-2	-	2	-	± 2	-	g
Offset calibration error *	Z-axis +1g position	-20	-	20	-	± 50	-	mg
Offset temperature error ** 5)	-40 +85 °C	-	±0.5		-	±0.5	-	mg/°C
Sensitivity * 6)		-	1333	-	-	1333	-	Count/g
Sensitivity calibration error *		-1	-	+1	-	± 1	-	%
Sensitivity temperature error	-40 +85 °C	-	±0.01		-	±0.01	-	%/°C
Non-Linearity ** 8)		-	±1		-	±1	-	% FS
Cross-Axis sensitivity ** 9)		-	±3	-	-	±3	-	%
Bandwidth ** 10)	Measurement mode	36	45	54	-	45	-	Hz
	Bypass measurement mode	56	70	84	-	70	-	Hz
Noise ** 11)	Measurement mode	-	3		-	3	-	mg RMS
	Bypass measurement mode	-	5		-	5	-	mg RMS
Output data rate **		200	250	300	-	260	-	Hz
Temperature output	T=+23 °C		256		-	256	-	Count
40)	Sensitivity		1.8		-	1.8	-	Count/°C
Turn on time ** 12)	Measurement mode	-	35		-	35	-	ms
	Bypass measurement mode	-	35		-	35	-	ms
Output load **		-	-	35	-	-	35	pF
SPI clock rate **		-	-	1.6	-	-	1.6	MHz

- \* 100% tested in production
- \*\* Qualified during product validation
- The product is factory calibrated at 2.5 V in room temperature.
- 2) Typical values are not guaranteed.
- Includes the current through the internal 400 k $\Omega$  pull-up resistor connected to digital I/O Vdd.
- Range defined as  $\sqrt{x^2+y^2+z^2} \le 2g$ . The measuring range is tested on sensing element level. FS = 2g.
- Offset temperature error = {Count(0g)-Offset} / Sensitivity [ g ]. Sensitivity = Calibrated sensitivity. Offset= Calibrated offset.
- 6) Sensitivity = {Count(+1g) Count(-1g)}/2 [Count/g].
- Sensitivity temperature error = {[Count(+1g)-Count(-1g)]/2 Sensitivity x 100% [%]. Sensitivity = Calibrated sensitivity.
- From straight line through sensitivity calibration (+1g, -1g) points.
- The cross-axis sensitivity determines how much acceleration, perpendicular to the measuring axis, couples to the output. The total cross-axis sensitivity is the geometric sum of the sensitivities of the two axes which are perpendicular to the measuring axis. The angular alignment error
- between X, Y and Z axis is included into the cross axis sensitivity.
  Frequency responses according to Figure 3 and Figure 4.
- Average noise/axis over the measurement bandwidth defined as  $\sqrt{\frac{1}{3}(n_x^2+n_y^2+n_z^2)}$ , where nx, ny and nz are
- the measured signal's standard deviation due to noise in x, y and z directions.
- Settling error less than 1% of FS.



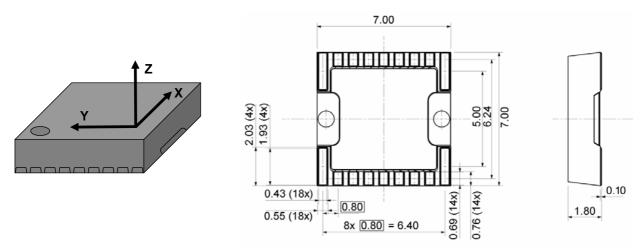
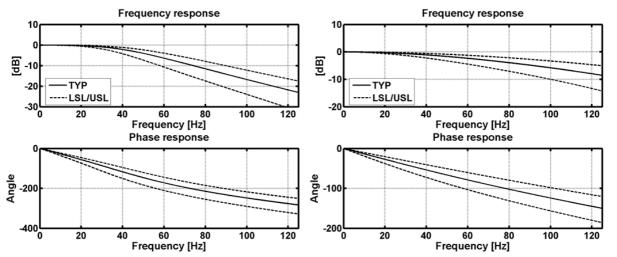


Figure 2 Sensing directions and package dimensions in mm with ±50 µm tolerance.



**Figure 3** Frequency response of SCA3000-D01 in measurement mode

**Figure 4** Frequency response of SCA3000-D01 in bypass measurement mode



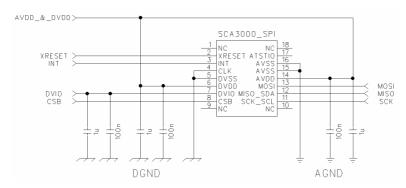


Figure 5 Application schematic

Pin #	Name	Function
1	NC	Not connected
2	XRESET	External reset, active low
3	INT	Interrupt output
4	CLK	Digital ground
5	DVSS	Digital ground
6	DVDD	Digital supply
7	DVIO	Digital I/O supply
8	CSB	Chip select
9	NC	Not connected
10	NC	Not connected
11	SCK_SCL	SPI serial clock (SCK)
12	MISO_SDA	SPI data out (MISO)
13	MOSI	SPI data in (MOSI)
14	AVDD	Analog supply
15	AVSS	Analog ground
16	AVSS	Analog ground
17	ATSTIO	Not connected
18	NC	Not connected

Table 1 Pin descriptions

## **Document Change Control**

Rev.	Date	Change Description
Α	21-Apr-06	1 <sup>st</sup> official release
A.01	13-Jun-06	Dimensions updated



Inselkammerstr. 10 82008 Unterhaching Tel.: 089/614503-30

E-Mail: sensortec@hy-line.de

Postfach 1222 82002 Unterhaching Fax: 089/614503-34 www.hy-line.de