


Raptor series camera failed to obtain parameters or device verification failure error message issue

1. Why does camera parameter acquisition fail?


Every time you open Creality Scan and connect the scanner device, after initialization is complete, it will obtain and verify relevant parameters from the scanner's camera. Only when these parameters are correct can good scanning results be obtained.

Generally, if the scanner's USB connection is unstable, the firmware does not start normally, or the parameters themselves are abnormal causing verification failure, you may receive this failure prompt.

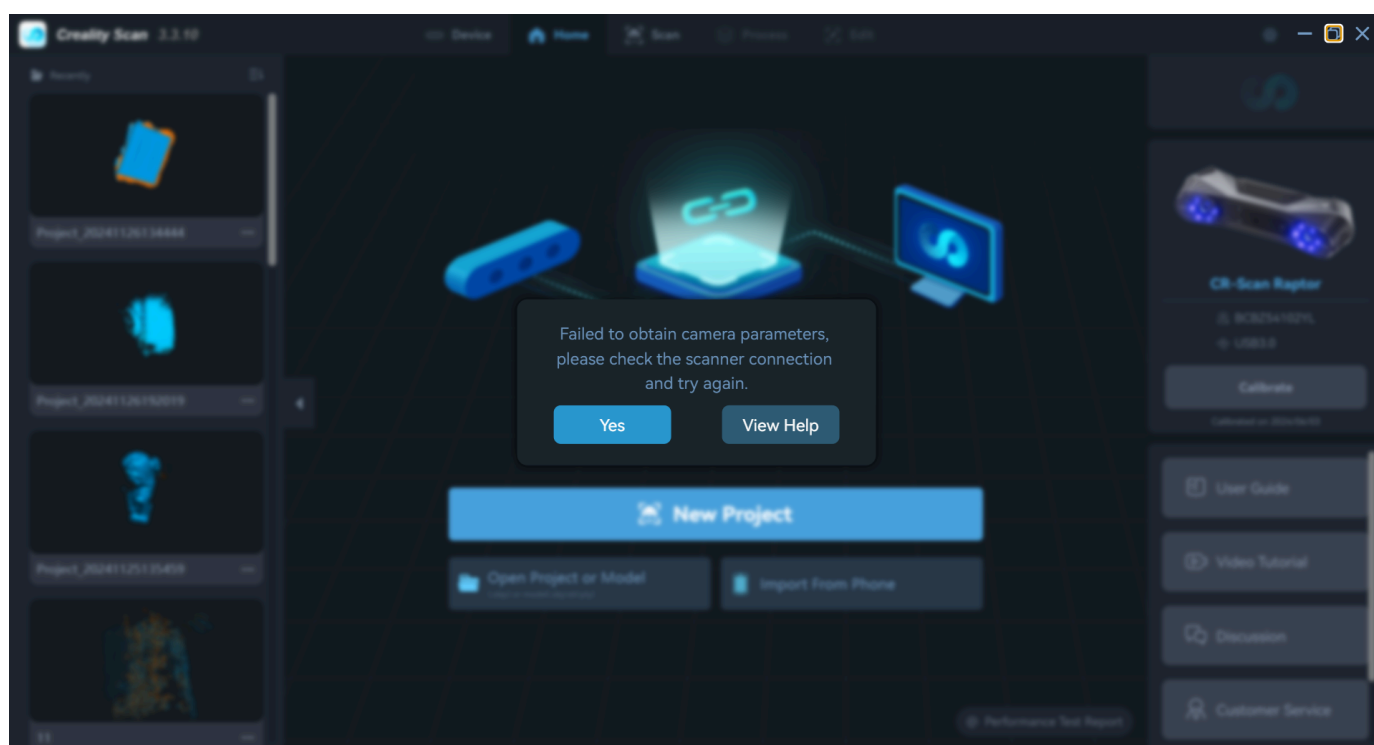

If this exception occurs, users can try the following:

(1) Confirm that the USB cable connection is stable (the screws on the scanner's USB port are tightened)

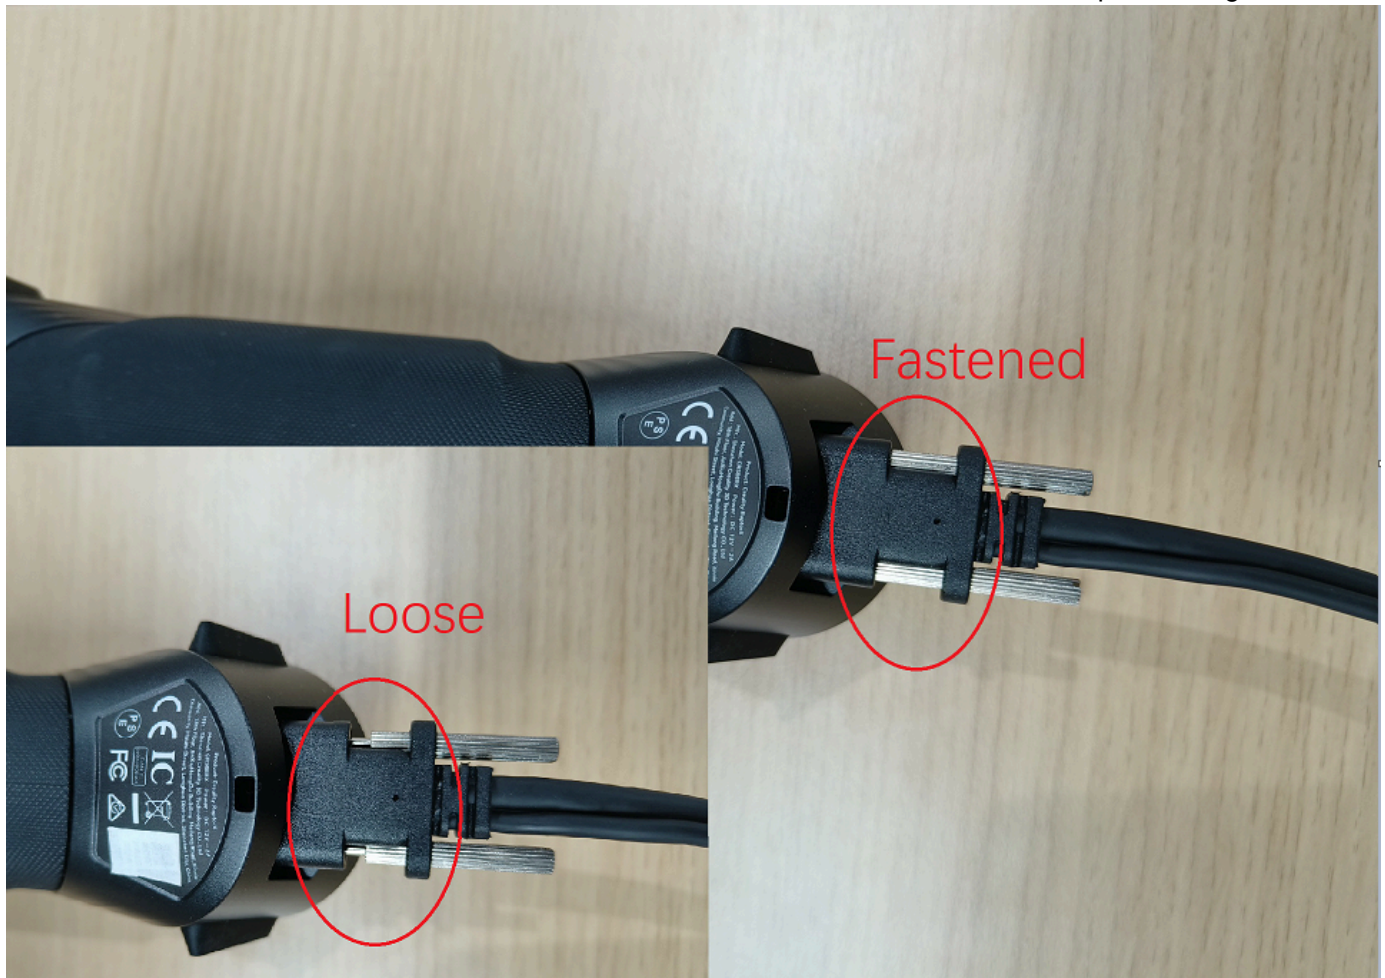


(2) Long press the button in the upper left corner of the scanner to restart the firmware. At this time, the scanner will disconnect and reconnect. After successfully reconnecting, obtain the parameters again



(3) Run the factory reset operation in the settings.


Note: Factory reset cannot be performed when connected via WiFi. Factory reset is only allowed via USB.

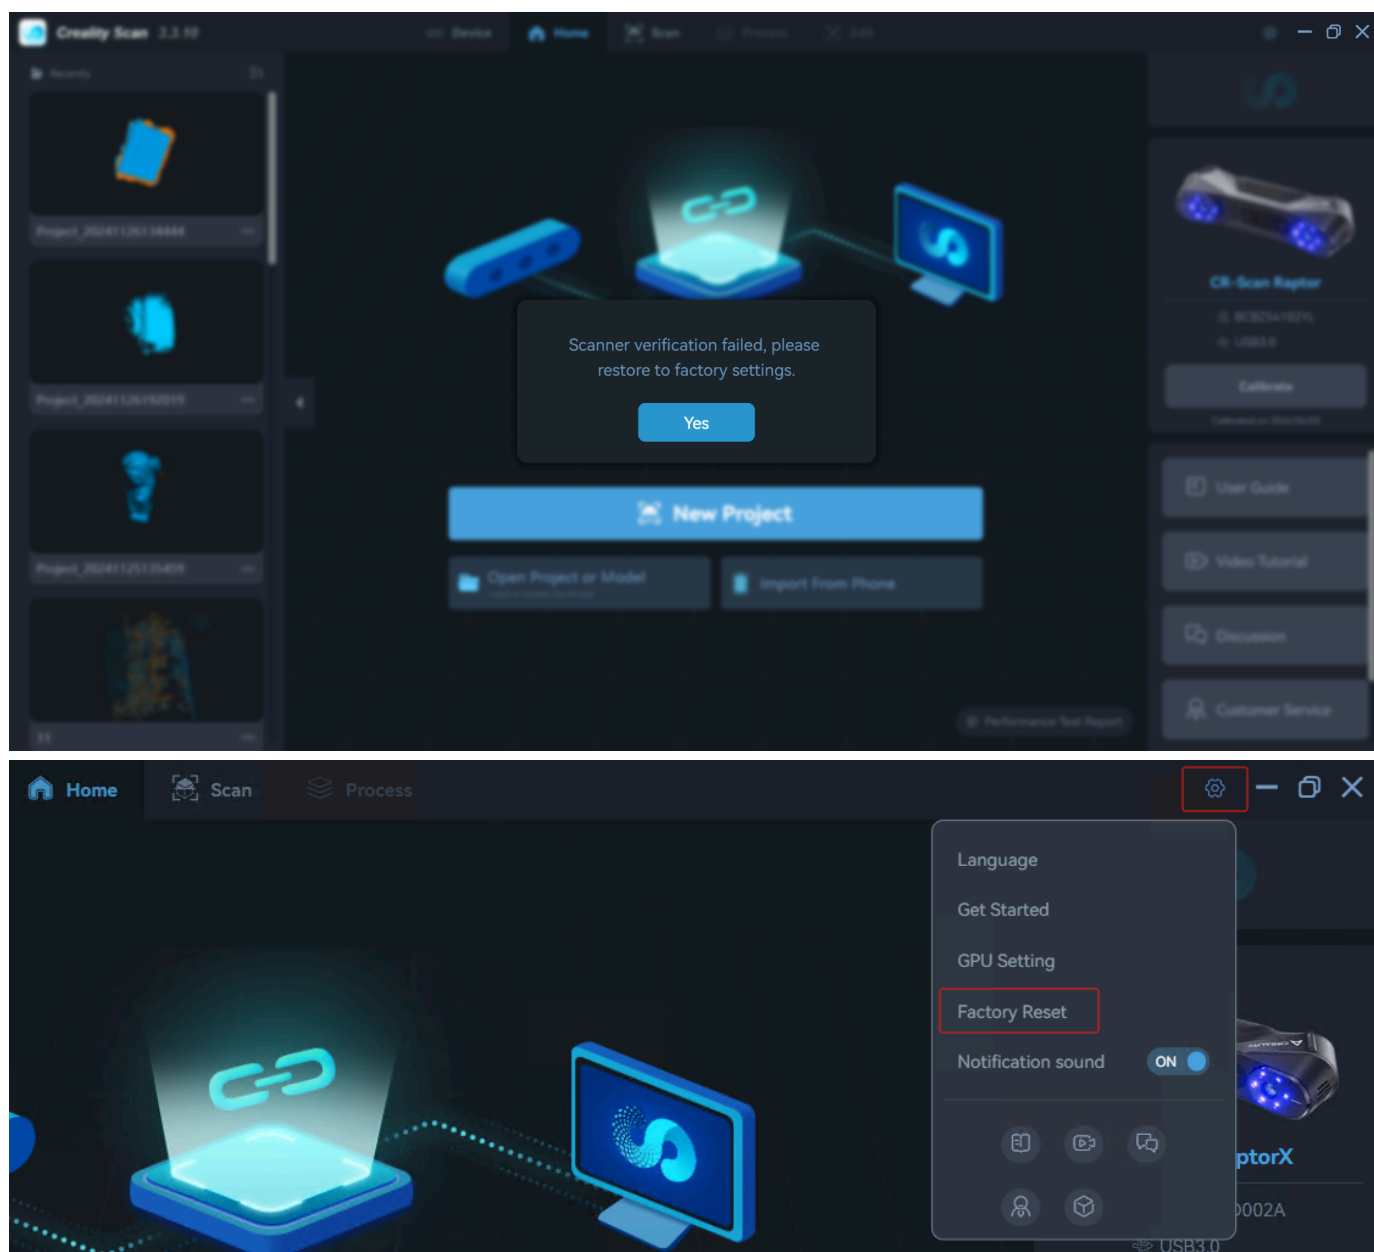


During factory reset, the software will obtain the best backup parameters based on the scanner's SN code. The software may need to obtain parameters from the Creality service so please ensure a **stable network** connection during factory reset.

If the software cannot find matching data on the server for the obtained SN, it will prompt an SN code error. In this case, please contact Creality customer service via email at cs@creality.com. Please include the scanner's SN, scanner log, and operations performed before the anomaly occurred, such as calibration,

firmware upgrade, etc., in your email.

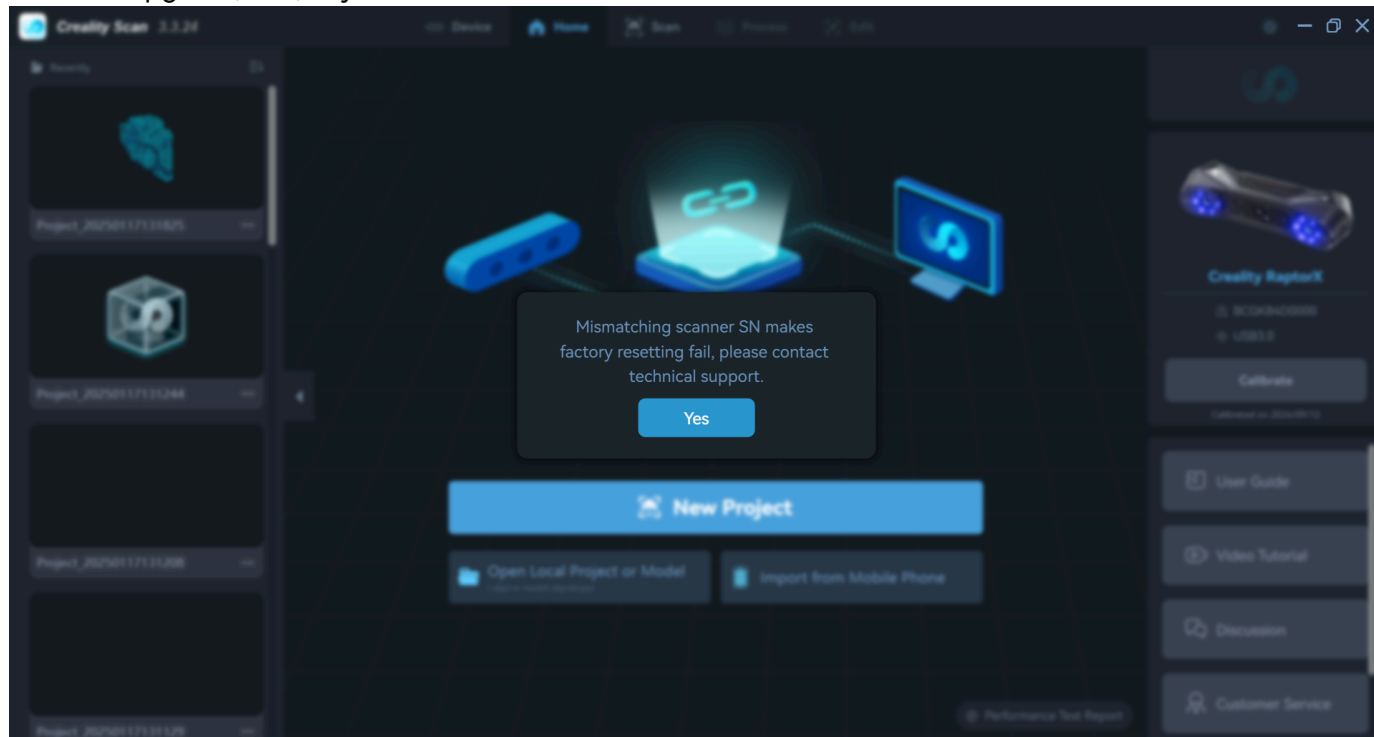

2. What is device verification failure?

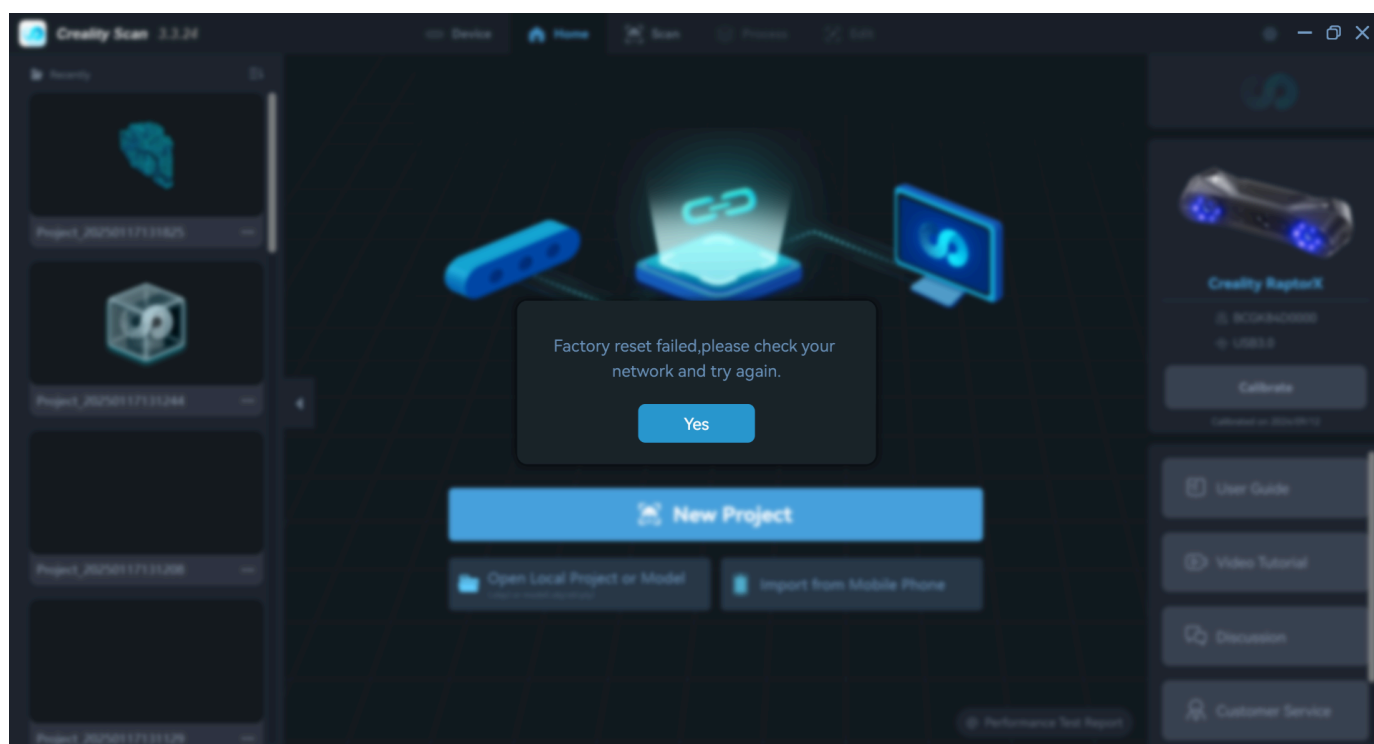

Creality Scan software uses CRC verification to confirm whether the parameters are correct. CRC verification is a cyclic redundancy check algorithm, which is very common in the computer field. The CRC algorithm can quickly generate a short fixed-digit check code based on the parameters read from the scanner to detect or verify possible errors in the parameters.

If you see this error after performing a factory reset on your Raptor or RaptorX scanner, please contact Creality customer service via email at cs@creality.com. Please include the scanner's SN code, scanner log, and operations performed before the anomaly occurred, such as calibration, firmware upgrade, etc., in your email.

USB Disconnection Issues with Raptor Series Scanners due to Windows updates

1. Issues

Critical Notice: USB Disconnection Issue

Affected Models: Raptor, RaptorX Scanners

Issue: Scanner fail to connect via USB, also the Device Manager-> Cameras-> CR-Scan Raptor Depth Camera" or/and "CR-Scan Raptor IR Camera" shows errors ⚠. This is likely caused by recent Windows updates.

Immediate action required: Update your scanner firmware to resolve the issue.

Note: Please do not disconnect scanner during firmware update.

If you have other disconnection issue, please visit:

<https://wiki.creality.com/en/3d-scanner/cr-scan-raptor/troubleshooting/disconnection>

2. How to Verify the Issue?

(1) Press **Win + R**, type **devmgmt.msc**, then click **OK** to open **Device Manager**.



Type the name of a program, folder, document, or Internet resource, and Windows will open it for you.

Open:




This task will be created with administrative privileges.

OK

Cancel

Browse...

(2) In the Device Manager > Cameres, check if **CR-Scan Raptor Depth Camera** or/and **CR-Scan Raptor IR Camera** display a ⚠ warning symbol.

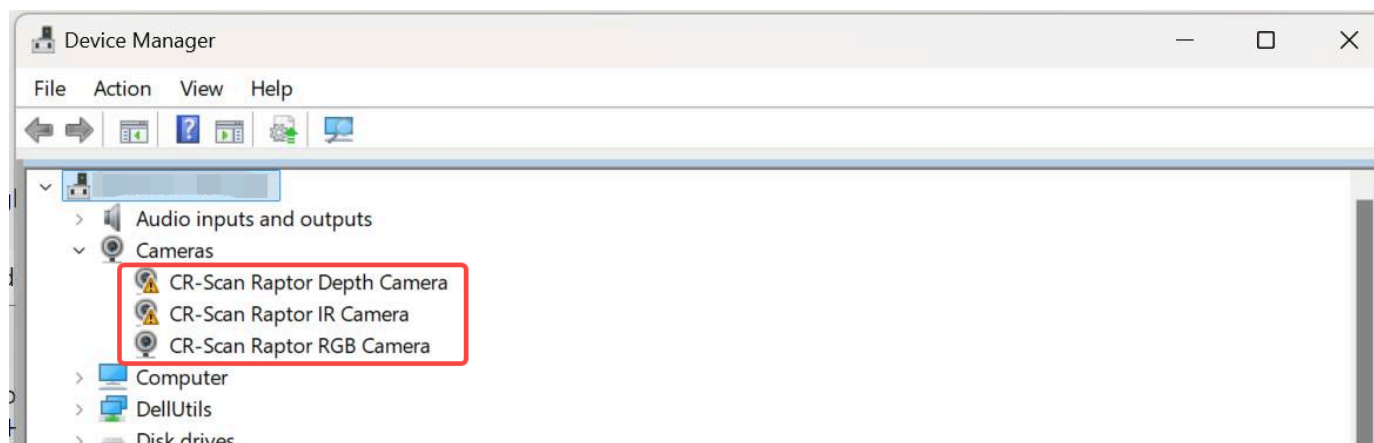

3. How to solve this Issue ?

We provide **four** methods for updating the firmware.

Method 1: If you are using a **RaptorX** scanner or have purchased **Raptor's Scan Bridge**, you can resolve this issue by **updating the scanner firmware via Wireless Connection**.



Method 2: If you have an **Android Phone**


(1) Download the "Creality Scan" APP

APP Download Link: https://drive.google.com/file/d/1EXluduBgiQB8_AVvNSp4jFwh06BZqt0f/view?usp=sharing 

(2) Connect the phone to the scanner by **Type A port cable with an adapter**.

(3) Open Creality Scan. If a firmware update prompt appears, click "Firmware Update" to complete the process.



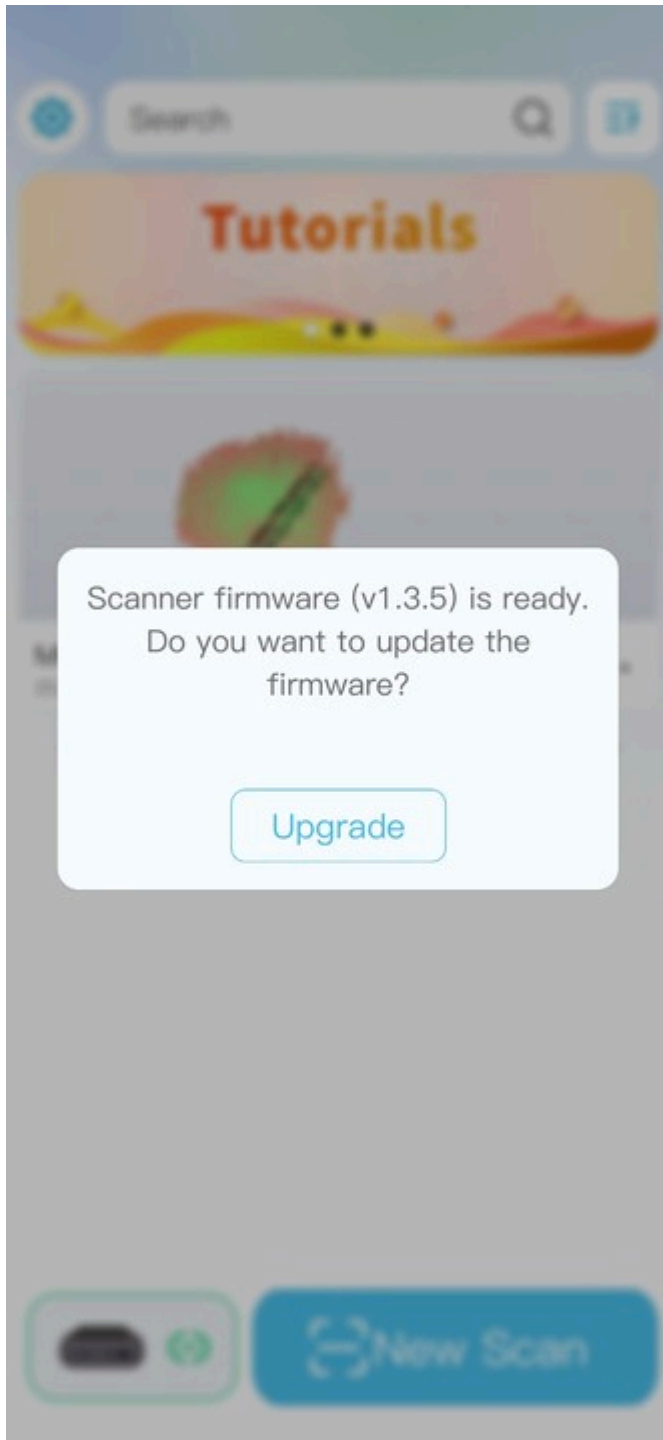

Method 3: -If you have a Mac, You can update the firmware on the Mac and continue to use the scanner with Windows PC.

Download link: <https://www.crealitycloud.com/downloads/software/creality-scan> 


Method 4: Uninstall Windows Update & Update Firmware

Requirements: Windows computers only (update package installed ≤ 10 days ago)

Steps:

(1) Uninstall the Update:

- Open Creality Scan, go to Settings > Uninstall Windows Update Package in the top-right corner.

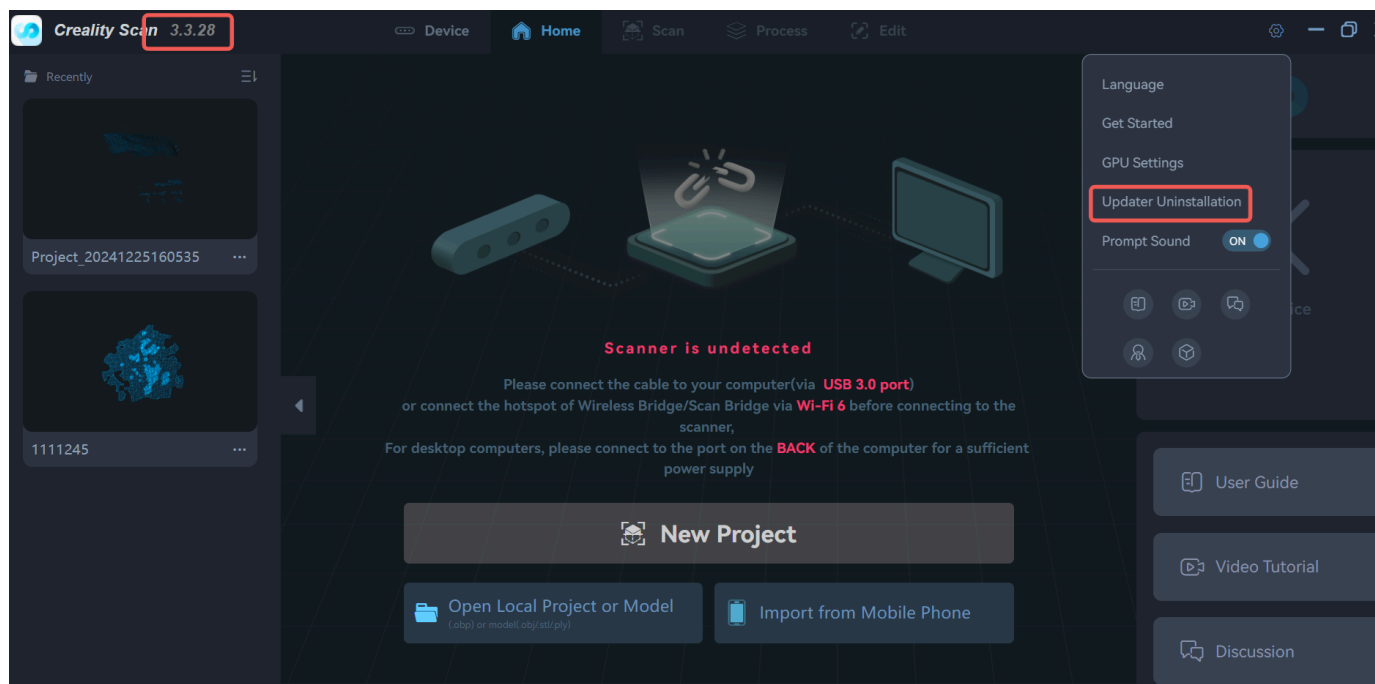

(2) Click Confirm to proceed.


Tips for manually uninstalling the update package

In addition, you can also follow the steps below to manually uninstall the update package yourself

Step1: Temporarily Uninstall Windows Cumulative Update Package


(1) For Windows 10 Users

Open Windows Settings -> Updates & Security -> View update history -> Uninstall updates. At this time, a program and function window will open, find Microsoft Windows on the right, click KB5049981, an Uninstall button will appear at the top, click the popup box to ask, and select Yes to uninstall;

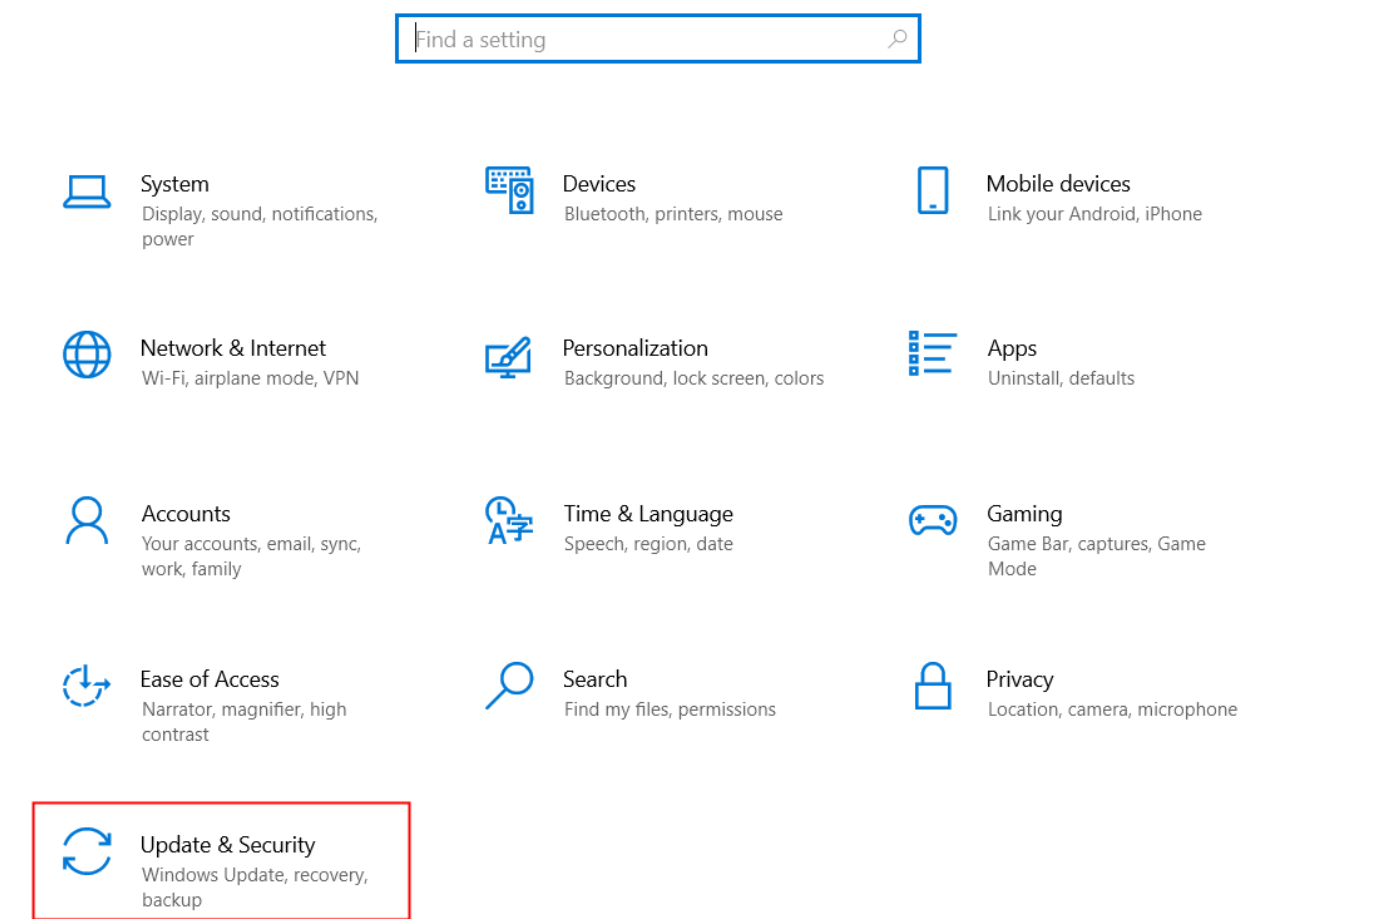

The top screenshot shows the Windows Settings application. The 'Update & Security' category is highlighted with a red rectangular box. The search bar at the top contains the text 'Find a setting'.

Update & Security
Windows Update, recovery, backup

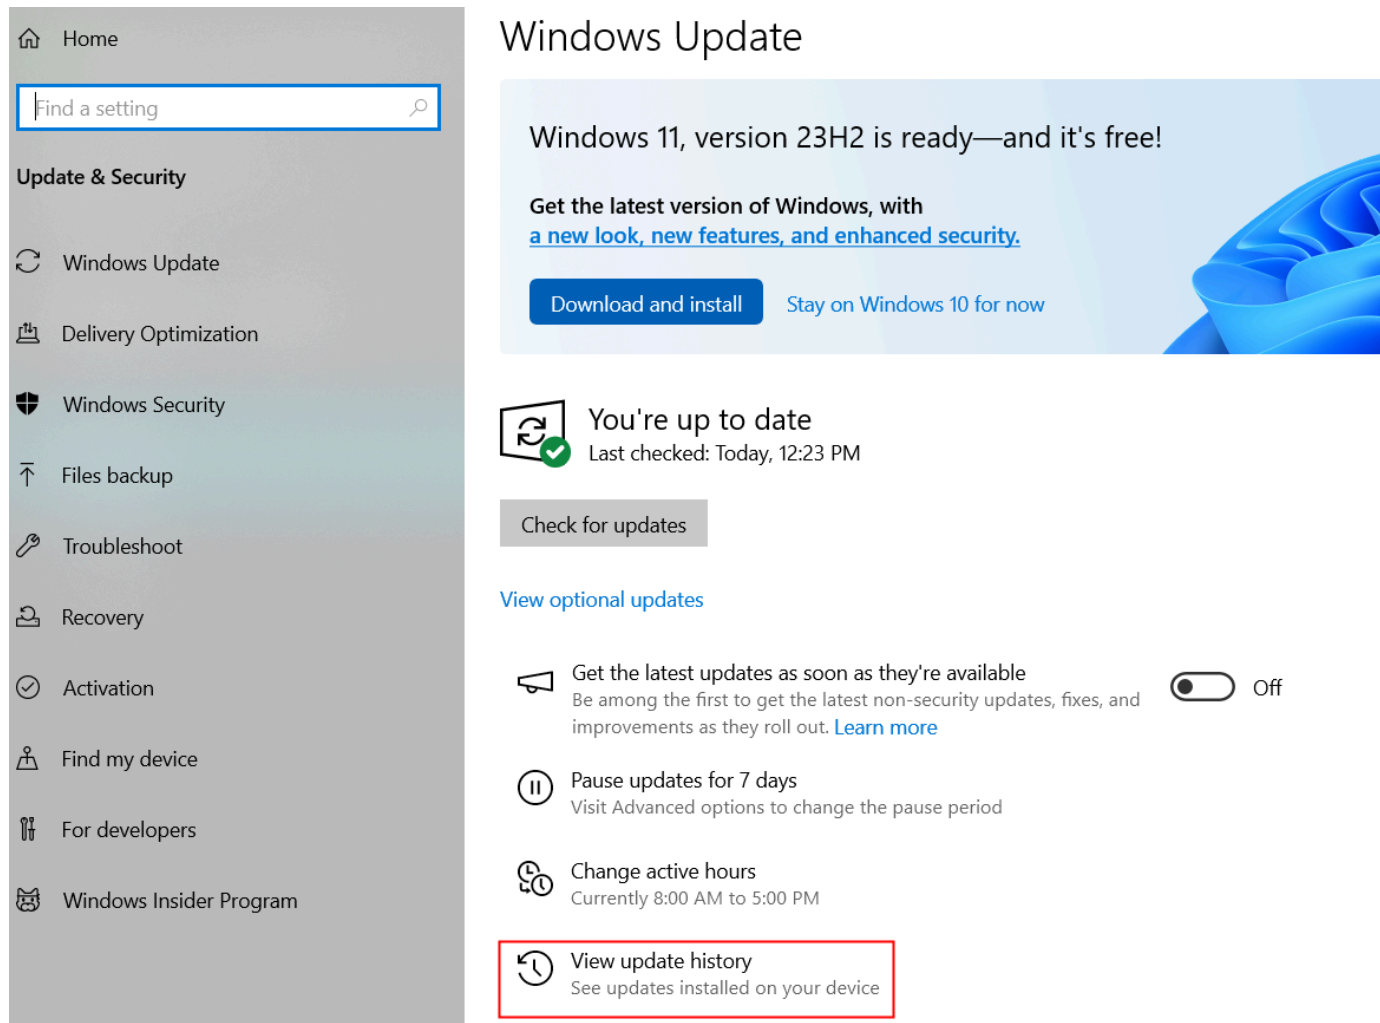

The bottom screenshot shows the Windows Update page. The left sidebar is titled 'Update & Security' and lists various options. The main area displays the Windows Update status, including a banner for Windows 11 version 23H2 and a section for update settings.

Windows Update

Windows 11, version 23H2 is ready—and it's free!

Get the latest version of Windows, with [a new look, new features, and enhanced security.](#)

[Download and install](#) [Stay on Windows 10 for now](#)

You're up to date
Last checked: Today, 12:23 PM

[Check for updates](#)

[View optional updates](#)

☐ Get the latest updates as soon as they're available
Be among the first to get the latest non-security updates, fixes, and improvements as they roll out. [Learn more](#)

☐ Pause updates for 7 days
Visit Advanced options to change the pause period

☐ Change active hours
Currently 8:00 AM to 5:00 PM

[View update history](#)
See updates installed on your device

[← Settings](#)

View update history

[Uninstall updates](#)[Recovery options](#)

Update history

✓ Quality Updates (6)

[2025-01 Cumulative Update for Windows 10 Version 22H2 for x64-based Systems \(KB5049981\)](#)

Successfully installed on 1/16/2025

[2025-01 Cumulative Update for .NET Framework 3.5, 4.8 and 4.8.1 for Windows 10 Version 22H2 for x64 \(KB5050188\)](#)

Successfully installed on 1/16/2025

[Update for Windows Defender Antivirus antimalware platform - KB4052623 \(Version 4.18.2001.10\)](#)

Successfully installed on 1/15/2025

[2024-10 Update for Windows 10 Version 22H2 for x64-based Systems \(KB5001716\)](#)

Successfully installed on 1/15/2025

[2024-05 Update for Windows 10 Version 22H2 for x64-based Systems \(KB5001716\)](#)

Successfully installed on 1/15/2025

[2023-10 Update for Windows 10 Version 22H2 for x64-based Systems \(KB4023057\)](#)

Successfully installed on 1/15/2025

Installed Updates

[←](#) [→](#) [↓](#) [↑](#) [Control Panel](#) > [Programs](#) > [Programs and Features](#) > [Installed Updates](#)[Control Panel Home](#)[Uninstall a program](#)[Turn Windows features on or off](#)

Uninstall an update

To uninstall an update, select it from the list and then click Uninstall or Change. Uninstalling update

Organize ▾

[Uninstall](#)

Name

Program

Version

Microsoft Windows (8)

 Security Update for Microsoft Windows (KB5049981)	Microsoft Windows	
 Update for Microsoft Windows (KB5049621)	Microsoft Windows	
 Update for Microsoft Windows (KB5011048)	Microsoft Windows	
 Servicing Stack 10.0.19041.5363	Microsoft Windows	
 Update for Microsoft Windows (KB5049613)	Microsoft Windows	
 Feature Update to Windows 10 22H2 via Enablement ...	Microsoft Windows	
 Servicing Stack 10.0.19041.3745	Microsoft Windows	
 Servicing Stack 10.0.19041.1704	Microsoft Windows	

(2) For Windows 11 Users

Open Windows Update -> Update History -> Uninstall Update, find the corresponding cumulative update

package, and click Uninstall.

Windows Update



No updates available

We'll continue to check daily for newer updates.

[Check for updates](#)

More options



Get the latest updates as soon as they're available

Be among the first to get the latest non-security updates, fixes, and improvements as they roll out. [Learn more](#)

Off ☐



Pause updates

Pause for 1 week 



Update history





Advanced options

Delivery optimization, optional updates, active hours, other update settings



 Windows Update is committed to helping reduce carbon emissions. [Learn more](#)

 [Get help](#)

 [Give feedback](#)

<https://wiki.creality.com/en/3d-scanner/troubleshooting/raptorconnection>

8/11

Windows Update > Update history

Driver Updates (13)



Other Updates (1)



Related settings




Uninstall updates



Recovery



[Get help](#)

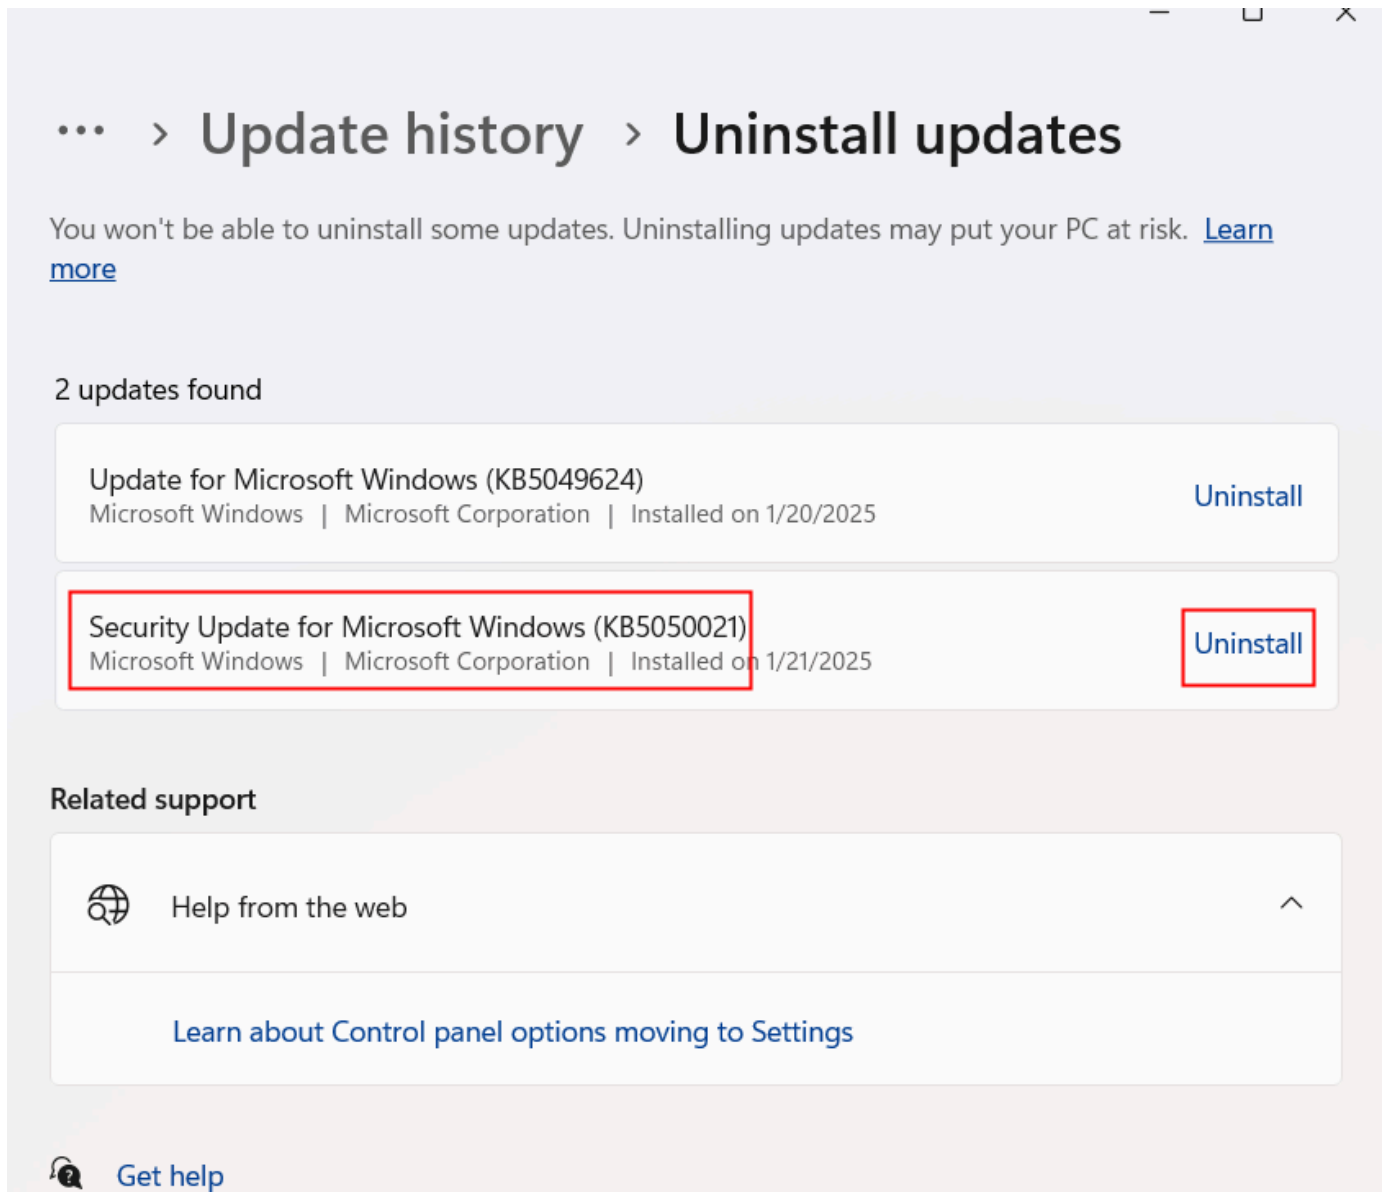

Note 1: To prevent automatic updates from affecting subsequent steps, you can temporarily turn off automatic updates.

Note 2: If your Windows system update policy is managed by an organization such as a business or school, contact your system administrator.

Step 2: Update the firmware version of the Raptor series scanner to 1.3.5 or above

(1) Automatic update (recommend)

If you use a Mac computer or Windows computer has uninstalled the above updates, you can receive a new Raptor firmware upgrade notification after opening Creality Scan and connecting the scanner through **USB3.0**. Please upgrade the firmware to 1.3.5 and above.

(2) Manual update

Download Scanner firmware version ****1.3.5**** from Creality Cloud <https://www.crealitycloud.com/software-firmware/other/type-26> . In the Device-firmware upgrade of the Creality Scan software, upgrade the firmware.

Step 3: Resuming Windows Updates

Download the security update package again from Windows update.

If you previously used Automatic Updates and turned it off temporarily, you can turn Automatic Updates back on.

3. The cause of the problem

In the security update of January 14, 2025, Windows has more stringent requirements on the content of UVC device descriptors, which causes the firmware of the Raptor series scanners to which run normally before, cannot pass the verification of the Windows after update. Therefore, the yellow exclamation marks appear on the Depth and IR cameras of Raptor, causing the enumeration of scanner fails. The Creality Scan software prompts that the device is not recognized.

© 2026 Creality. All rights reserved. | Powered by [Wiki.js](#)