

USB Disconnection Issues with Raptor Series Scanners due to Windows updates

1. Issues

Critical Notice: USB Disconnection Issue

Affected Models: Raptor, RaptorX Scanners

Issue: Scanner fail to connect via USB, also the Device Manager-> Cameras-> CR-Scan Raptor Depth Camera" or/and "CR-Scan Raptor IR Camera" shows errors ⚠. This is likely caused by recent Windows updates.

Immediate action required: Update your scanner firmware to resolve the issue.

Note: Please do not disconnect scanner during firmware update.

If you have other disconnection issue, please visit:

<https://wiki.creality.com/en/3d-scanner/cr-scan-raptor/troubleshooting/disconnection>

2. How to Verify the Issue?

(1) Press **Win + R**, type **devmgmt.msc**, then click **OK** to open **Device Manager**.



Type the name of a program, folder, document, or Internet resource, and Windows will open it for you.

Open:

devmgmt.msc




This task will be created with administrative privileges.

OK

Cancel

Browse...

(2) In the Device Manager > Cameres, check if **CR-Scan Raptor Depth Camera** or/and **CR-Scan Raptor IR Camera** display a ⚠ warning symbol.

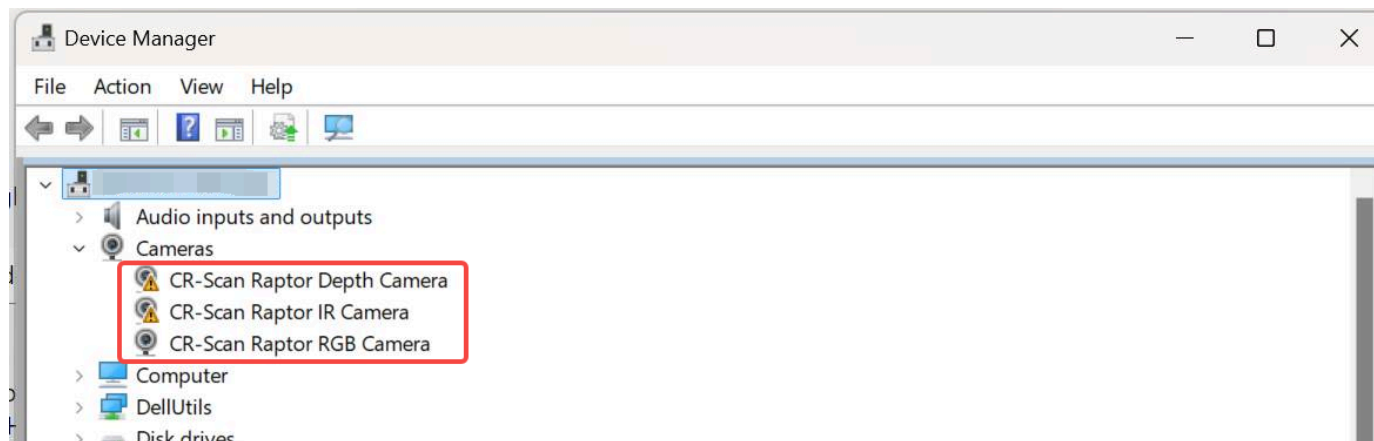

3. How to solve this Issue ?

We provide **four** methods for updating the firmware.

Method 1: If you are using a **RaptorX** scanner or have purchased **Raptor's Scan Bridge**, you can resolve this issue by **updating the scanner firmware via Wireless Connection**.



Method 2: If you have an **Android Phone**


(1) Download the "Creality Scan" APP

APP Download Link: https://drive.google.com/file/d/1EXluduBgiQB8_AVvNSp4jFwh06BZqt0f/view?usp=sharing 

(2) Connect the phone to the scanner by **Type A port cable with an adapter**.

(3) Open Creality Scan. If a firmware update prompt appears, click "Firmware Update" to complete the process.



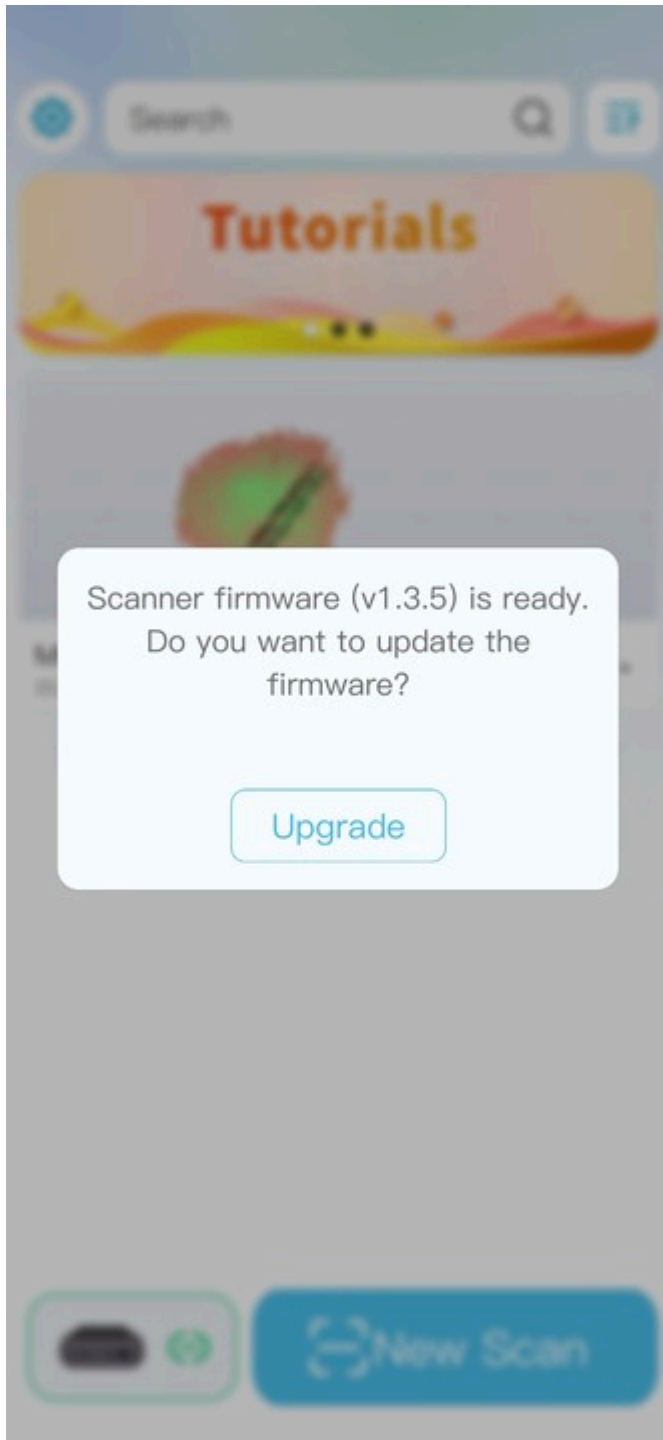

Method 3: -If you have a Mac, You can update the firmware on the Mac and continue to use the scanner with Windows PC.

Download link: <https://www.crealitycloud.com/downloads/software/creality-scan> 


Method 4: Uninstall Windows Update & Update Firmware

Requirements: Windows computers only (update package installed ≤ 10 days ago)

Steps:

(1) Uninstall the Update:

- Open Creality Scan, go to Settings > Uninstall Windows Update Package in the top-right corner.

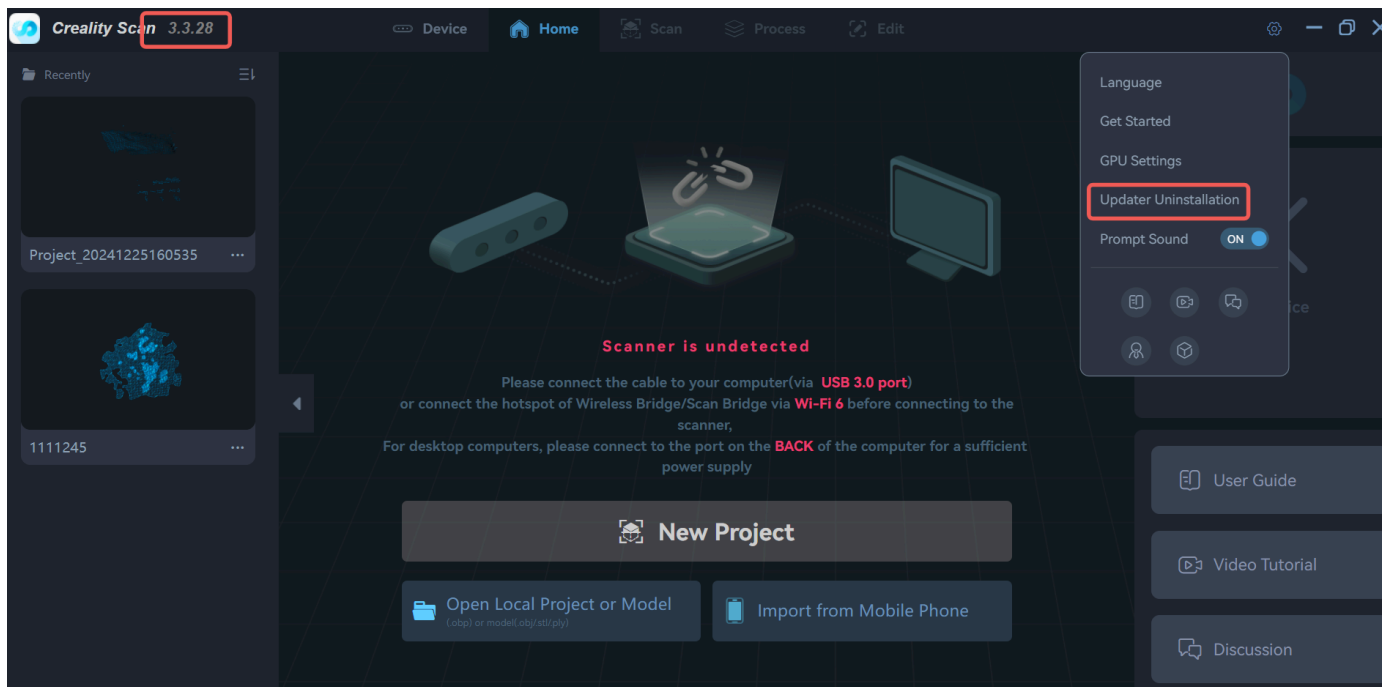

(2) Click Confirm to proceed.

Tips for manually uninstalling the update package

In addition, you can also follow the steps below to manually uninstall the update package yourself

Step1: Temporarily Uninstall Windows Cumulative Update Package

(1) For Windows 10 Users

Open Windows Settings -> Updates & Security -> View update history -> Uninstall updates. At this time, a program and function window will open, find Microsoft Windows on the right, click KB5049981, an Uninstall button will appear at the top, click the popup box to ask, and select Yes to uninstall;

Find a setting

**System**

Display, sound, notifications, power

**Devices**

Bluetooth, printers, mouse

**Mobile devices**

Link your Android, iPhone

**Network & Internet**

Wi-Fi, airplane mode, VPN

**Personalization**

Background, lock screen, colors

**Apps**

Uninstall, defaults

**Accounts**

Your accounts, email, sync, work, family

**Time & Language**

Speech, region, date

**Gaming**

Game Bar, captures, Game Mode

**Ease of Access**

Narrator, magnifier, high contrast

**Search**

Find my files, permissions

**Privacy**

Location, camera, microphone

**Update & Security**

Windows Update, recovery, backup

Windows Update

Windows 11, version 23H2 is ready—and it's free!

Get the latest version of Windows, with [a new look, new features, and enhanced security.](#)

Download and install

Stay on Windows 10 for now

**You're up to date**

Last checked: Today, 12:23 PM

Check for updates

[View optional updates](#)



Get the latest updates as soon as they're available

Be among the first to get the latest non-security updates, fixes, and improvements as they roll out. [Learn more](#)

☐ Off



Pause updates for 7 days

Visit Advanced options to change the pause period



Change active hours

Currently 8:00 AM to 5:00 PM



View update history

See updates installed on your device

Home

Find a setting

Update & Security

- Windows Update
- Delivery Optimization
- Windows Security
- Files backup
- Troubleshoot
- Recovery
- Activation
- Find my device
- For developers
- Windows Insider Program

[← Settings](#)

View update history

[Uninstall updates](#)[Recovery options](#)

Update history

Quality Updates (6)

[2025-01 Cumulative Update for Windows 10 Version 22H2 for x64-based Systems \(KB5049981\)](#)

Successfully installed on 1/16/2025

[2025-01 Cumulative Update for .NET Framework 3.5, 4.8 and 4.8.1 for Windows 10 Version 22H2 for x64 \(KB5050188\)](#)

Successfully installed on 1/16/2025

[Update for Windows Defender Antivirus antimalware platform - KB4052623 \(Version 4.18.2001.10\)](#)

Successfully installed on 1/15/2025

[2024-10 Update for Windows 10 Version 22H2 for x64-based Systems \(KB5001716\)](#)

Successfully installed on 1/15/2025

[2024-05 Update for Windows 10 Version 22H2 for x64-based Systems \(KB5001716\)](#)

Successfully installed on 1/15/2025

[2023-10 Update for Windows 10 Version 22H2 for x64-based Systems \(KB4023057\)](#)

Successfully installed on 1/15/2025

Installed Updates

[←](#) [→](#) [↓](#) [↑](#) [Control Panel](#) > [Programs](#) > [Programs and Features](#) > [Installed Updates](#)[Control Panel Home](#)[Uninstall a program](#)[Turn Windows features on or off](#)

Uninstall an update

To uninstall an update, select it from the list and then click Uninstall or Change. Uninstalling update

Organize ▾

[Uninstall](#)

Name

Program

Version

Microsoft Windows (8)

[Security Update for Microsoft Windows \(KB5049981\)](#)

Microsoft Windows

[Update for Microsoft Windows \(KB5049621\)](#)

Microsoft Windows

[Update for Microsoft Windows \(KB5011048\)](#)

Microsoft Windows

[Servicing Stack 10.0.19041.5363](#)

Microsoft Windows

[Update for Microsoft Windows \(KB5049613\)](#)

Microsoft Windows

[Feature Update to Windows 10 22H2 via Enablement ...](#)

Microsoft Windows

[Servicing Stack 10.0.19041.3745](#)

Microsoft Windows

[Servicing Stack 10.0.19041.1704](#)

Microsoft Windows

(2) For Windows 11 Users

Open Windows Update -> Update History -> Uninstall Update, find the corresponding cumulative update

package, and click Uninstall.

Windows Update



No updates available

We'll continue to check daily for newer updates.

[Check for updates](#)

More options



Get the latest updates as soon as they're available

Be among the first to get the latest non-security updates, fixes, and improvements as they roll out. [Learn more](#)

Off ☐



Pause updates

Pause for 1 week 



Update history





Advanced options

Delivery optimization, optional updates, active hours, other update settings



 Windows Update is committed to helping reduce carbon emissions. [Learn more](#)

 [Get help](#)

 [Give feedback](#)

Windows Update > Update history

Driver Updates (13)



Other Updates (1)



Related settings




Uninstall updates



Recovery



[Get help](#)

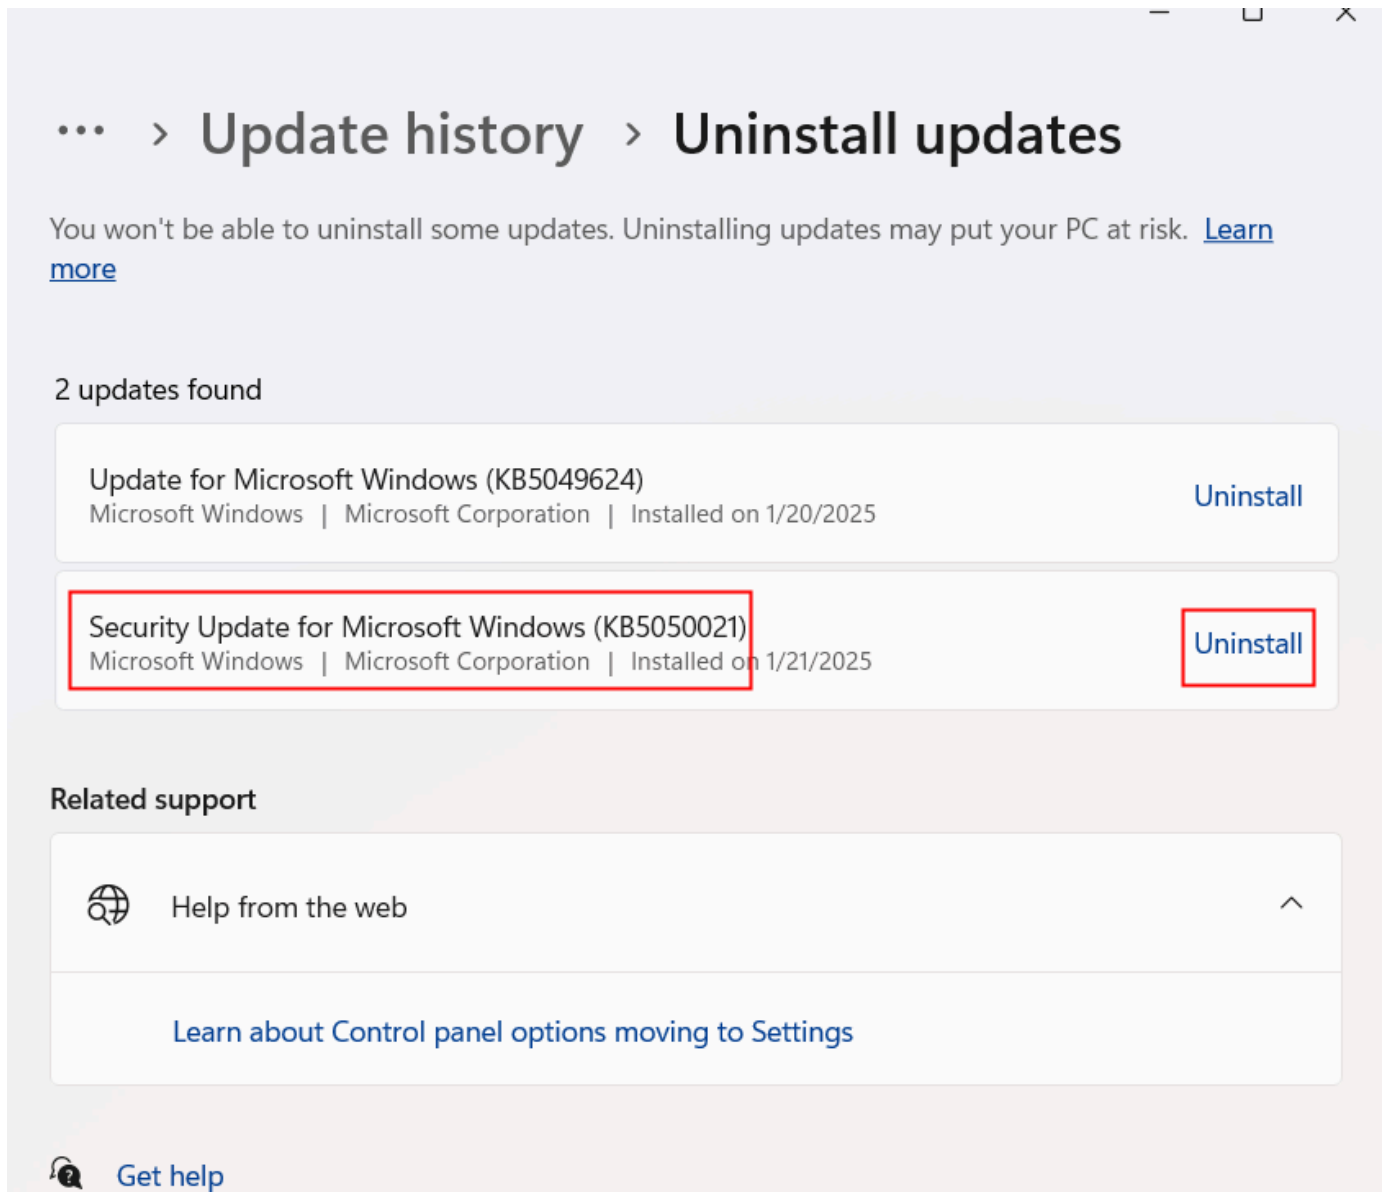

Note 1: To prevent automatic updates from affecting subsequent steps, you can temporarily turn off automatic updates.

Note 2: If your Windows system update policy is managed by an organization such as a business or school, contact your system administrator.

Step 2: Update the firmware version of the Raptor series scanner to 1.3.5 or above

(1) Automatic update (recommend)

If you use a Mac computer or Windows computer has uninstalled the above updates, you can receive a new Raptor firmware upgrade notification after opening Creality Scan and connecting the scanner through **USB3.0**. Please upgrade the firmware to 1.3.5 and above.

(2) Manual update

Download Scanner firmware version ****1.3.5**** from Creality Cloud <https://www.crealitycloud.com/software-firmware/other/type-26> . In the Device-firmware upgrade of the Creality Scan software, upgrade the firmware.

Step 3: Resuming Windows Updates

Download the security update package again from Windows update.

If you previously used Automatic Updates and turned it off temporarily, you can turn Automatic Updates back on.

3. The cause of the problem

In the security update of January 14, 2025, Windows has more stringent requirements on the content of UVC device descriptors, which causes the firmware of the Raptor series scanners to which run normally before, cannot pass the verification of the Windows after update. Therefore, the yellow exclamation marks appear on the Depth and IR cameras of Raptor, causing the enumeration of scanner fails. The Creality Scan software prompts that the device is not recognized.

© 2026 Creality. All rights reserved. | Powered by [Wiki.js](#)