


2

•

Disassemble and remove the following items from the motor plate assembly. Keep the remaining items for the new assembly.

ITEM NO.	DESCRIPTION	QTY.
3	Left Motor Plate with Inserts	1
14	M3 Buttonhead Screw, 12mm long	4

В

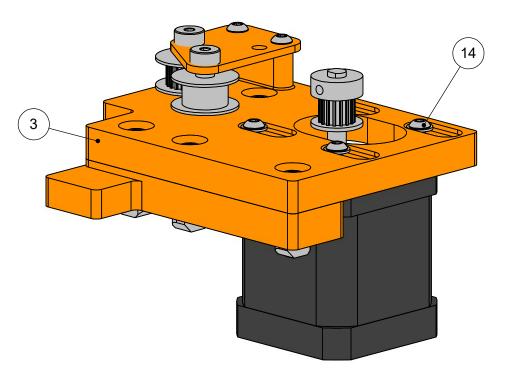


A

Left Assembly Part Harvesting			
CC	(i) BY	Created by: Joshua Vasquez	last edited: 4/23/2020
		SCALE: 1:1	SHEET 3 OF 12

Disassemble and remove the following items from the motor plate assembly. Keep the remaining items for the new assembly.


ITEM NO.	DESCRIPTION	
5	M4 shoulder screw, 12mm-l, 5mm-d	2
6	M3 Buttonhead Screw, 12mm long	4
11	Right Motor Plate with Inserts	1

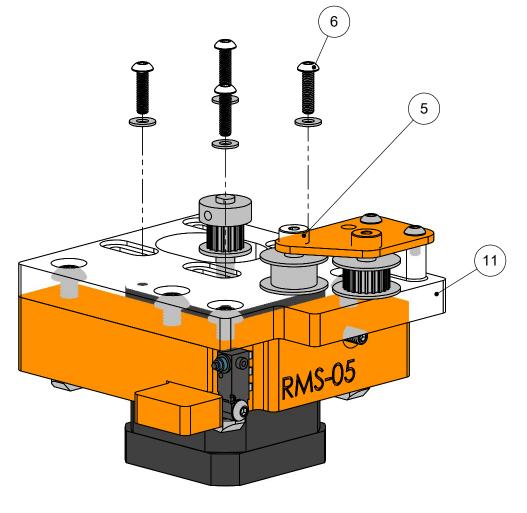


A

В

	Right Assembly Part Harvesting				
66	Created by: last edited:				
(00)	BY	Joshua Vasquez	4/23/2020		
		SCALE: 1:1	SHEET 4 OF 12		

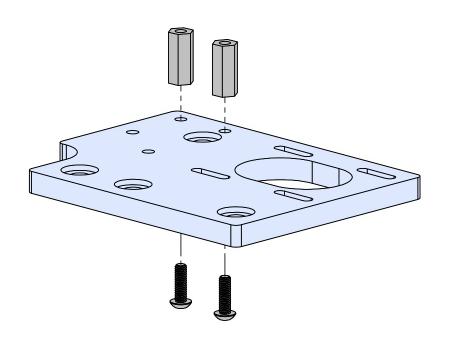


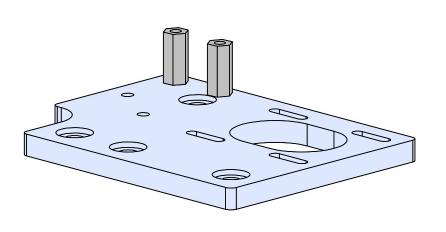

A

ITEM NO.	DESCRIPTION	
1	M3 Standoff, 14mm long	2
2	M3 Buttonhead Screw, 10mm long	2
3	Machined Left Motor Corner Bracket	1

	Left Motor Plate Assembly 1/4			
© 1		Created by: Joshua Vasquez	last edited: 4/23/2020	
		SCALE: 1:1	SHEET 5 OF 12	

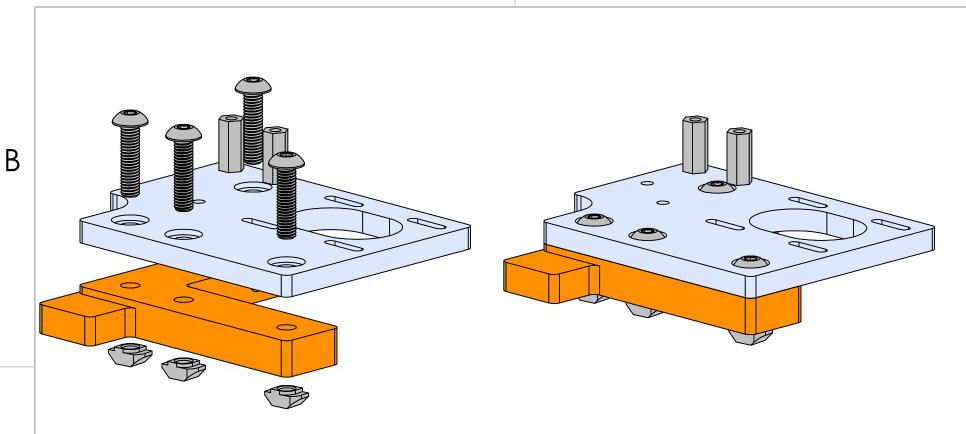


A

ITEM NO.	DESCRIPTION	
4	M5 Buttonhead Screw, 20mm long	4
5	M5 Drop-In T-Nut for 20x20 Extrusion	4
6	Short Motor Corner Plate Spacer with Inserts	1


Left Motor Plate Assembly 2/4			
© ()		Created by: Joshua Vasquez	last edited: 4/23/2020
		SCALE: 1:1	SHEET 6 OF 12

В

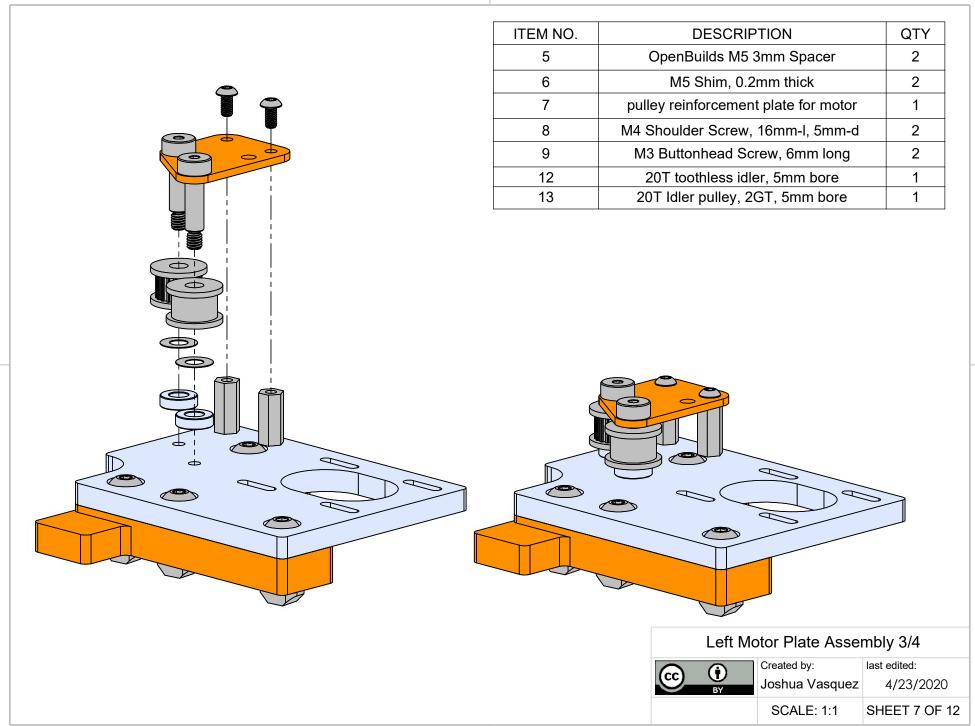

В

1

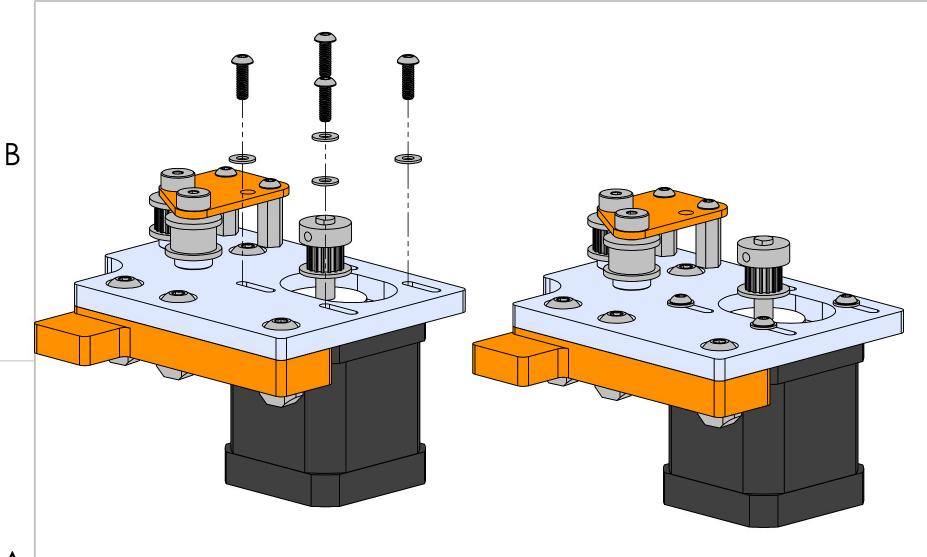



Α

ITEM NO.	DESCRIPTION	
2	M3 Buttonhead Screw, 10mm long	6
12	M3 Washer	4
13	Stepper Motor with Drive Pulley	1
14	20T Idler pulley, 2GT, 5mm bore	1
15	20T Toothless Idler pulley, 2GT, 5mm bore	1

Left Motor Plate Assembly 4/4

(i)	Created by:	last edited:
BY	Joshua Vasquez	4/23/2020
	SCALE: 1:1	SHEET 8 OF 12

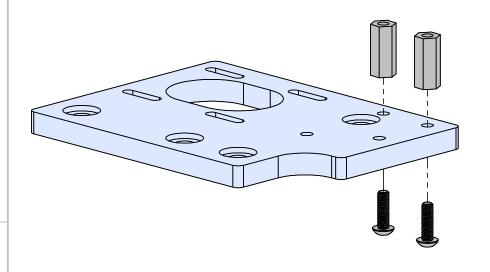

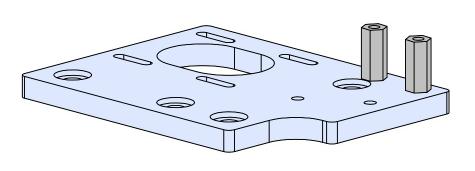


A

ITEM NO.	DESCRIPTION	
1	Machined Right Motor Corner Bracket	1
2	M3 Standoff, 14mm long	2
3	M3 Buttonhead Screw, 10mm long	2


В

(i)	Created by:	last edited:
BY	Joshua Vasquez	4/23/2020
	SCALE: 1:1	SHEET 9 OF 12

ITEM NO.	DESCRIPTION	
3	Tall Motor Corner Plate Spacer Assembly	1
4	M5 Buttonhead Screw, 30mm long	4
5	M5 Drop-In T-Nut for 20x20 Extrusion	4

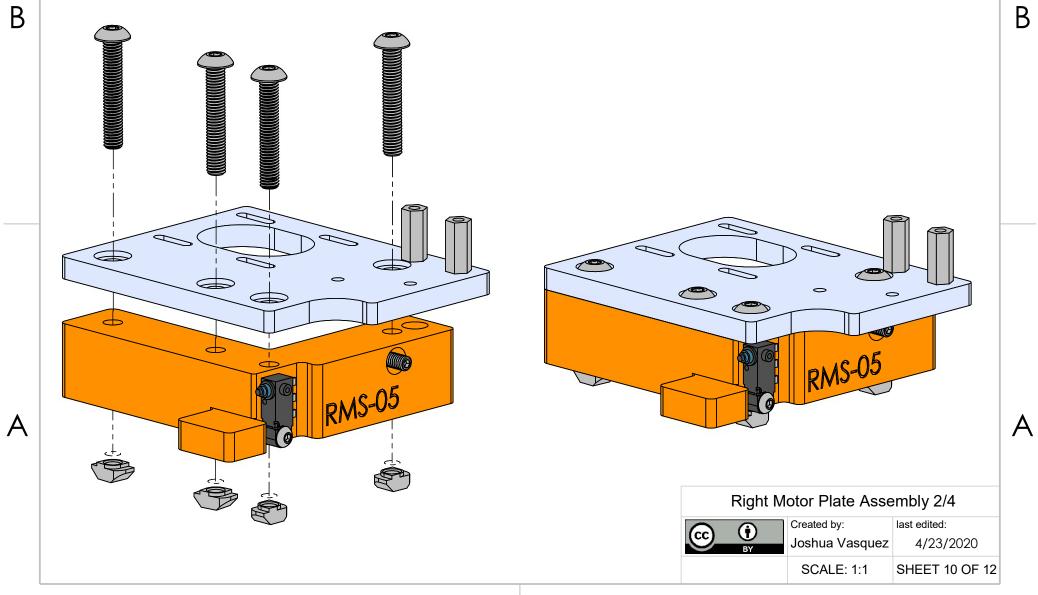


•

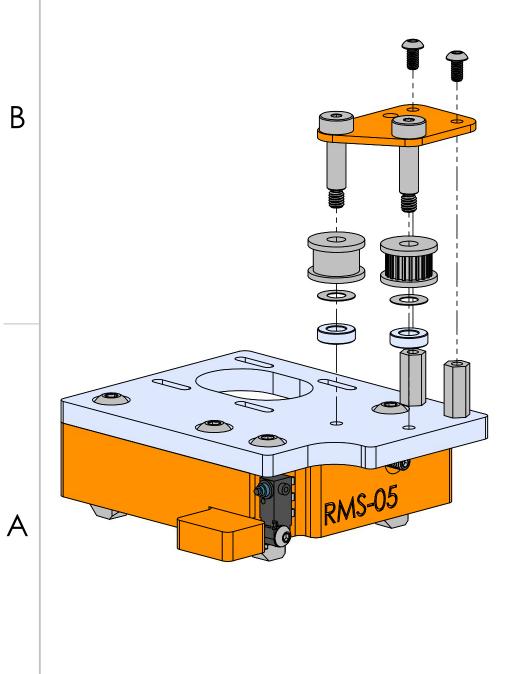

В

ITEM NO.	DESCRIPTION	
3	20T Idler pulley, 2GT, 5mm bore	1
4	20T toothless idler, 5mm bore	1
5	pulley reinforcement plate for motor	1
6	M3 Buttonhead Screw, 6mm long	2
7	M4 Shoulder Screw, 16mm-l, 5mm-d	2
8	M5 Shim, 0.2mm thick	2
9	OpenBuilds M5 3mm Spacer	2

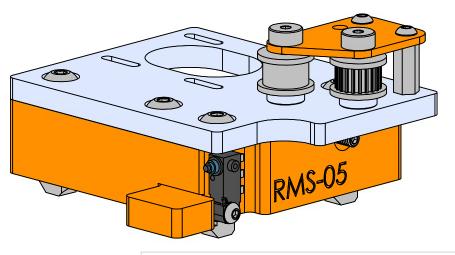



Right M	otor Plate Ass	sembly 3/4

		Created by:	last edited:
CCC BY	BY	Joshua Vasquez	4/23/2020
		SCALE: 1:1	SHEET 11 OF 12

Α

Α

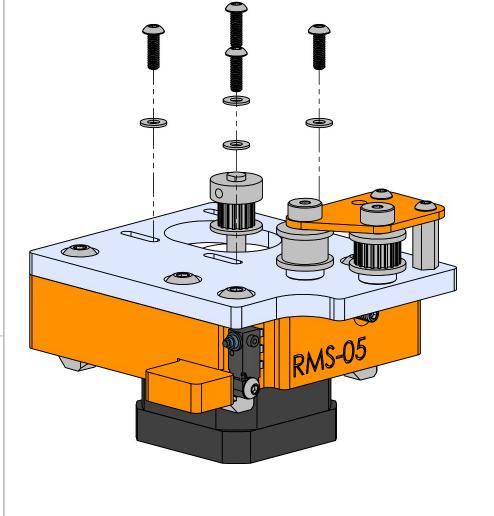

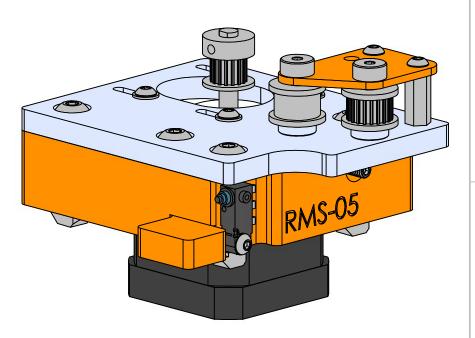

Α

В

ITEM NO.	DESCRIPTION	QTY
11	M3 Buttonhead Screw, 10mm long	6
12	Stepper Motor with Drive Pulley	1
13	M3 Washer	4
14	20T Idler pulley, 2GT, 5mm bore	1
15	20T Toothless Idler pulley, 2GT, 5mm bore	1

Right Motor Plate Assembly 4/4			
(CC)	()	Created by: Joshua Vasquez	last edited: 4/23/2020
		SCALE: 1:1	SHEET 12 OF 12