#### ME: MECHANICAL ENGINEERING

Duration: Three hours

Maximum Marks: 150

#### Read the following instructions carefully

1. This question paper contains **24** printed pages including pages for rough work. Please check all pages and report discrepancy, if any.


- 2. Write your registration number, your name and name of the examination centre at the specified locations on the right half of the ORS.
- 3. Using HB pencil, darken the appropriate bubble under each digit of your registration number and the letters corresponding to your paper code.
- 4. All the questions in this question paper are of objective type.
- 5. Questions must be answered on Objective Response Sheet (ORS) by darkening the appropriate bubble (marked A, B, C, D) using HB pencil against the question number on the left hand side of the ORS. Each question has only one correct answer. In case you wish to change an answer, erase the old answer completely. More than one answer bubbled against a question will be treated as a wrong answer.
- 6. Questions 1 through 20 are 1-mark questions and questions 21 through 85 are 2-mark questions.
- 7. Questions 71 through 73 is one set of common data questions. The question pairs (76, 77), (78, 79), (80, 81), (82, 83) and (84, 85) are questions with linked answers. The answer to the second question of the above pairs will depend on the answer to the first question of the pair. If the first question in the linked pair is wrongly answered or is un-attempted, then the answer to the second question will not be evaluated.
- 8. Unattempted questions will carry zero marks.
- 9. **NEGATIVE MARKING**: For Q.1 to Q.20, 0.25 mark will be deducted for each wrong answer. For Q.21 to Q.75, 0.5 mark will be deducted for each wrong answer. For the pairs of questions with linked answers, there will be negative marks only for wrong answer to the first question, i.e. for Q.76, Q.78, Q.80, Q.82 and Q.84, 0.5 mark will be deducted for each wrong answer. There is no negative marking for Q.77, Q.79, Q.81, Q.83 and Q.85.
- 10. Calculator without data connectivity is allowed in the examination hall.
- 11. Charts, graph sheets and tables are NOT allowed in the examination hall.
- 12. Rough work can be done on the question paper itself. Additional blank pages are given at the end of the question paper for rough work.

## Q.1 - Q.20 carry one mark each.

Q.1. In the Taylor series expansion of  $e^x$  about x=2, the coefficient of  $(x-2)^4$  is

- (A)  $\frac{1}{4!}$  (B)  $\frac{2^4}{4!}$  (C)  $\frac{e^2}{4!}$  (D)  $\frac{e^4}{4!}$
- Q.2. Given that  $\ddot{x} + 3x = 0$ , and x(0) = 1,  $\dot{x}(0) = (0)$ , what is x(1)?
  - (A) -0.99 (B) -0.16 (C) 0.16 (D) 0.99
- Q.3. The value of  $\lim x \to 8\frac{x^{\frac{1}{3}}-2}{(x-8)}$  is
  - (A)  $\frac{1}{16}$  (B)  $\frac{1}{12}$  (C)  $\frac{1}{8}$  (D)  $\frac{1}{4!}$
- Q.4. A coin is tossed 4 times. What is the probability of getting heads exactly 3 times?
  - (A)  $\frac{1}{4}$  (B)  $\frac{3}{8}$  (C)  $\frac{1}{2}$  (D)  $\frac{3}{4}$
- Q.5. The matrix  $\begin{bmatrix} 1 & 2 & 4 \\ 3 & 0 & 6 \\ 1 & 1 & p \end{bmatrix}$  has one eigenvalue equal to 3. The sum of the other two eigenvalues is
  - (A) p (B) p-1 (C) p-2 (D) p-3
- Q.6. The divergence of the vector field  $(x-y)\hat{i} + (y-x)\hat{j} + (x+y+z)\hat{k}$  is
  - (A) 0 (B) 1 (C) 2 (D) 3
- Q.7. The transverse shear stress acting in a beam of rectangular cross-section, subjected to a transverse shear load, is
  - (A) variable with maximum at the bottom of the beam
  - (B) variable with maximum at the top of the beam
  - (C) uniform
  - (D) variable with maximum on the neutral axis
- Q.8. A rod of length L and diameter D is subjected to a tensile load P. Which of the following is sufficient to calculate the resulting change in diameter?
  - (A) Young's modulus
  - (B) Shear modulus
  - (C) Poisson's ratio
  - (D) Both Young's modulus and shear modulus
- Q.9. A straight rod of length L(t), hinged at one end and freely extensible at the other end, rotates through an angle  $\theta(t)$  about the hinge. At time t, L(t) = 1 m,  $\dot{L}(t) = 1$  m/s,  $\theta(t) = \frac{\pi}{4}$ rad and  $\dot{\theta}(t) = 1$  rad/s. The magnitude of the velocity at the other end of the rod is
  - (A) 1 m/s (B)  $\sqrt{2} \text{m/s}$  (C)  $\sqrt{3} \text{m/s}$  (D) 2 m/s

Q.10. A cantilever type gate hinged at Q is shown in the figure. P and R are the centers of gravity of the cantilever part and the counterweight respectively. The mass of the cantilever part is 75 kg. The mass of the counterweight, for static balance, is

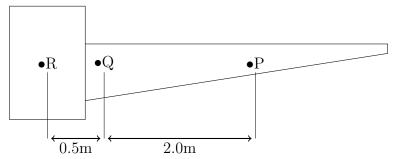

- (A) 75kg (B) 150kg (C) 225kg (D) 300kg
- Q.11. A planar mechanism has 8 links and 10 rotary joints. The number of degrees of freedom of the mechanism, using Greubler's criterion, is
  - (A) 0 (B) 1 (C) 2 (D) 3
- Q.12. An axial residual compressive stress due to a manufacturing process is present on the outer surface of a rotating shaft subjected to bending. Under a given bending load, the fatigue life of the shaft in the presence of residual compressive stress is
  - (A) decreased
  - (B) increased or decreased, depending on the external bending load
  - (C) neither decreased nor increased
  - (D) increased
- Q.13. 2 moles of oxygen are mixed adiabatically with another 2 moles of oxygen in a mixing chamber, so that the final total pressure and temperature of the mixture become same as those of the individual constituents at their intial states. The universal gas constant is given as R. The change in entropy due to mixing, per mole of oxygen, is given by
  - (A)  $-R \ln 2$  (B) 0 (C)  $R \ln 2$  (D)  $R \ln 4$
- Q.14. For flow of liquid over a heated plate, the following fluid properties are known:

viscosity = 0.001 Pa.s; specific heat constant pressure = 1kJ/kg.K; thermal conductivity = 1 W/m.K.

The hydrodynamic boundary layer thickness at a specified location on the plate is 1 mm. The thermal boundary layer thickness at the same location is

(A) 0.001 mm (B) 0.01 mm (C) 1 mm (D) 1000 mm

Q.15. For the continuity equation given by  $\nabla \cdot \bar{V} = 0$  to be valid, where  $\bar{V}$  is the velocity vector, which one of the following is a necessary condition?

- (A) steady flow
- (B) irrotational flow
- (C) inviscid flow
- (D) incompressible flow
- Q.16. Which one of the following is NOT a necessary assumption for the airstandard Otto cycle?
  - (A) All processes are both internally as well as externally reversible.
  - (B) Intake and exhaust processes are constant volume heat rejection processes.
  - (C) The combustion process is a constant volume heat addition process.
  - (D) The working fluid is an ideal gas with constant specific heats.
- Q.17. In an M/M/1 queueing system, the number of arrivals in an interval of length T is a Poisson random variable (i.e. the probability of there being n arrivals in an interval of length T is  $\frac{e^{-\lambda T}(\lambda T)^n}{n!}$ ). The probability density function f(t) of the inter-arrival time is given by
  - (A)  $\lambda^2(e^{-\lambda^2 t})$  (B)  $\frac{e^{-\lambda^2 t}}{\lambda^2}$  (C)  $\lambda e^{-\lambda t}$  (D)  $\frac{e^{-\lambda t}}{\lambda}$
- Q.18. A set of 5 jobs is to be processed on a single machine. The processing time (in days) is given in the table below. The holding cost for each job is Rs. K per day.

Job	Processing time
Р	5
Q	2
R	3
S	2
Т	1


A schedule that minimizes the total inventory cost is

- (A) T-S-Q-R-P (B)
- (B) P-R-S-Q-T
- (C) T-R-S-Q-P
- (D) P-Q-R-S-T
- Q.19. For generating a Coon's surface we require
  - (A) a set of grid points on the surface
  - (B) a set of grid control points
  - (C) four bounding curves defining the surface
  - (D) two bounding curves and a set of grid control points
- Q.20. Internal gear cutting operation can be performed by
  - (A) milling
  - (B) shaping with rack cutter
  - (C) shaping with pinion cutter
  - (D) hobbing

5/14

### Q.21 - Q.75 carry two marks each.

Q.21. Consider the shaded triangular region P shown in the figure. What is  $\iint_{\mathcal{D}} xy dx dy$ ?

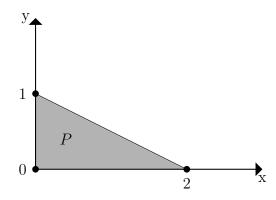

- (A)  $\frac{1}{6}$  (B)  $\frac{2}{9}$  (C)  $\frac{7}{2}$  (D) 1
- Q.22. The directional derivative of the scalar function  $f(x, y, z) = x^2 + 2y^2 + z$  at the point P = (1, 1, 2) in the direction of vector  $\overrightarrow{d} = 3\hat{i} 4\hat{j}$  is
  - (A) -4 (B) -2 (C) -1 (D) 1
- Q.23. For what value of a, if any, will the following system of equations in x, y and z have a solution?

$$2x + 3y = 4$$
$$x + y + z = 4$$
$$x + 2y - z = a$$


- (A) Any real number (B) 0 (C) 1 (D) There is no such value
- Q.24. Which of the following integrals is unbounded?

(A) 
$$\int_0^{\pi/4} \tan x dx$$
 (B)  $\int_0^\infty \frac{1}{x^2 + 1} dx$  (C)  $\int_0^\infty x e^{-x} dx$  (D)  $\int_0^1 \frac{1}{1 - x} dx$ 

- Q.25. The integral  $\oint f(z)dz$  evaluated around the unit circle on the complex plane for  $f(z) = \frac{\cos z}{z}$  is
  - (A)  $2\pi i$  (B)  $4\pi i$  (C)  $-2\pi i$  (D) 0
- Q.26. The length of the curve  $y = \frac{2}{3}x^{\frac{3}{2}}$  from x = 0 to x = 1 is
  - (A) 0.27 (B) 0.67 (C) 1 (D) 1.22
- Q.27. The eigenvectors of the matrix  $\begin{bmatrix} 1 & 2 \\ 0 & 2 \end{bmatrix}$  are written in the form  $\begin{bmatrix} 1 \\ a \end{bmatrix}$  and  $\begin{bmatrix} 1 \\ b \end{bmatrix}$ . What is a + b?
  - (A) 0 (B)  $\frac{1}{2}$  (C) 1 (D) 2
- Q.28. Let  $f = y^x$ . What is  $\frac{\partial^2 f}{\partial x \partial y}$  at x = 2, y = 1?
  - (A) 0 (B)  $\ln 2$  (C) 1 (D)  $\frac{1}{\ln 2}$
- Q.29. It is given that y'' + 2y' + y = 0, y(0) = 0, y(1) = 0. What is y(0.5)?
  - (A) 0 (B) 0.37 (C) 0.62 (D) 1.13

2008

Q.30. The strain energy stored in the beam with flexural rigidity EI and loaded as shown in the figure is

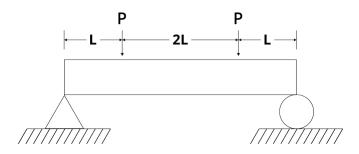

- (A)  $\frac{P^2L^3}{3EI}$  (B)  $\frac{2P^2L^3}{3EI}$  (C)  $\frac{4P^2L^3}{3EI}$  (D)  $\frac{8P^2L^3}{3EI}$
- Q.31. The component loaded with a force F as shown in the figure, the axial stress at the corner point P is

- (A)  $\frac{F(3L-b)}{4b^3}$  (B)  $\frac{F(3L+b)}{4b^3}$  (C)  $\frac{F(3L-4b)}{4b^3}$  (D)  $\frac{F(3L-2b)}{4b^3}$
- Q.32. A solid circular shaft of diameter 100 mm is subjected to an axial stress of 50 MPa. It is further subjected to a torque of 10 kNm. The maximum principal stress experienced on the shaft is closest to
  - (A) 41 MPa
- (B) 82 MPa
- (C) 164 MPa
- (D) 204 MPa
- Q.33. A circular disk of radius R rolls without slipping at a velocity v. magnitude of velocity at point P (see figure) is:
  - (A)  $\sqrt{3}v$
- (B)  $\sqrt{3}v/2$  (C) v/2 (D)  $2v/\sqrt{3}$

- Q.34. Consider a truss PQR loaded at P with a force F as shown in the figure. The tension in the member QR is
  - (A) 0.5 F
- (B) 0.63 F (C) 0.73 F (D) 0.87 F
- Q.35. The natural frequency of the spring mass system shown in the figure is closest to
  - (A) 8 Hz
- (B) 10 Hz
- (C) 12 Hz
- (D) 14 Hz
- Q.36. The rod PQ of length L and with flexural rigidity EI is hinged at both ends. For what minimum force F is it expected to buckle?

  - (A)  $\frac{\pi^2 EI}{L^2}$  (B)  $\frac{\sqrt{2}\pi^2 EI}{L^2}$  (C)  $\frac{\pi^2 EI}{\sqrt{2}L^2}$  (D)  $\frac{\pi^2 EI}{2L^2}$
- Q.37. In a cam design, the rise motion is given by a simple harmonic motion (SHM)  $s = \frac{h}{2}(1 - \cos\frac{\pi\theta}{\beta})$ , where h is the total rise,  $\theta$  is camshaft angle,  $\beta$  is the total angle of the rise interval. The jerk is given by

- (A)  $\frac{h}{2}(1-\cos\frac{\pi\theta}{\beta})$  (B)  $\frac{\pi}{\beta}\frac{h}{2}\sin\frac{\pi\theta}{\beta}$  (C)  $\frac{\pi^2}{\beta^2}\frac{h}{2}\cos\frac{\pi\theta}{\beta}$  (D)  $-\frac{\pi^3}{\beta^3}\frac{h}{2}\sin\frac{\pi\theta}{\beta}$
- Q.38. A uniform rigid rod of mass m=1 kg and length L=1 m is hinged at its centre and laterally supported at one end by a spring of spring constant k = 300 N/m. The natural frequency  $\omega_n$  in rad/s is
  - (A) 10
- (B) 20
- (C) 30
- (D) 40

ME 6/14

Q.39. A compression spring is made of music wire of 2 mm diameter having a shear strength and shear modulus of 800 MPa and 80 GPa respectively. The mean coil diameter is 20 mm, free length is 40 mm and the number of active coils is 10. If the mean coil diameter is reduced to 10 mm, the stiffness of the spring is approximately

- (A) decreased by 8 times (B) decreased by 2 times (C) increased by 2 times (D) increased by 8 times
- Q.40. A journal bearing has a shaft diameter of 40 mm and a length of 40 mm. The shaft is rotating at 20 rad/s and the viscosity of lubricant is 20 mPa.s. The clearance is 0.020 mm. The loss of torque due to the viscosity of the lubricant is approximately.
  - (A) 0.040 Nm (B) 0.252 Nm (C) 0.400 Nm (D) 0.652 Nm
- Q.41. A clutch has outer and inner diameters 100 mm and 40 mm respectively. Assuming a uniform pressure of 2 MPa and coefficient of friction of liner material 0.4, the torque carrying capacity of the clutch is
  - (A) 148 Nm (B) 196 Nm (C) 372 Nm (D) 490 Nm
- Q.42. A spur gear has a module of 3 mm, number of teeth 16, a face width of 36 mm and a pressure angle of 20°. It is transmitting a power of 3 kW at 20 rev/s. Taking a velocity factor of 1.5, and a form factor of 0.3, the stress in the gear tooth is about
  - (A) 32 MPa (B) 46 MPa (C) 58 MPa (D) 70 MPa

Q.43. Match the type of gears with their most appropriate description.

	<i>v</i> 1
	Type of gear
Р	Helical
Q	Spiral Bevel
R	Hypoid
S	Rack and pin-
	ion

	Description
1	Axes non parallel and non intersecting
2	Axes parallel teeth are inclined to the axis
3	Axes parallel teeth are parallel to the axis
4	Axes are perpendicular and intersecting,
	and teeth are inclined to the axis
5	Axes are perpendicular and used for large
	speed reduction
6	Axes parallel and one of the gears has in-
	finite radius

- (A) P-2, Q-4, R-1, S-6
- (B) P-1, Q-4, R-5, S-6
- (C) P-2, Q-6, R-4, S-2

- (D) P-6, Q-3, R-1, S-5
- Q.44. A gas expands in a frictionless piston-cylinder arrangement. The expansion process is very slow, and is resisted by an ambient pressure of 100 kPa. During the expansion process, the pressure of the system (gas) remains constant at 300 kPa. The change in volume of the gas is 0.01 m<sup>3</sup>. The maximum amount of work that could be utilized from the above process is
  - (A) 0 kJ (B) 1 kJ (C) 2 kJ (D) 3 kJ
- Q.45. The logarithmic mean temperature difference (LMTD) of a counterflow heat exchanger is 20°C. The cold fluid enters at 20°C and the hot fluid enters at 100°C. Mass flow rate of the cold fluid is twice that of the hot fluid. Specific heat at constant pressure of the hot fluid is twice that of the cold fluid. The exit temperature of the cold fluid

- (A) is 40°C (B) is 60°C (C) is 80°C (D) cannot be determined
- Q.46. A two dimensional fluid element rotates like a rigid body. At a point within the element, the pressure is 1 unit. Radius of the Mohr's circle, characterizing the state of stress at that point, is
  - (A) 0.5 unit (B) 0 unit (C) 1 unit (D) 2 units
- Q.47. A cyclic device operates between three thermal reservoirs, as shown in the figure. Heat is transferred to/from the cyclic device. It is assumed that heat transfer between each thermal reservoir and the cyclic device takes place across negligible temperature difference. Interactions between the cyclic device and the respective thermal reservoirs that are shown in the figure are all in the form of heat transfer.

The cyclic device can be

- (A) A reversible heat engine
- (B) A reversible heat pump or a reversible refrigerator
- (C) An irreversible heat engine
- (D) An irreversible heat pump or an irreversible refrigerator
- Q.48. A balloon containing an ideal gas is initially kept in an evacuated and insulated room. The balloon ruptures and the gas fills up the entire room. Which one of the following statements is TRUE at the end of above process?
  - (A) The internal energy of the gas decreases from its initial value, but the enthalpy remains constant
  - (B) The internal energy of the gas increases from its initial value, but the enthalpy remains constant
  - (C) Both internal energy and enthalpy of the gas remain constant
  - (D) Both internal energy and enthalpy of the gas increase
- Q.49. A rigid, insulated tank is initially evacuated. The tank is connected with a supply line through which air (assumed to be ideal gas with constant specific heats) passes at 1 MPa, 350°C. A valve connected with the supply line is opened and the tank is charged with air until the final pressure inside the tank reaches 1 MPa. The final temperature inside the tank.
  - (A) is greater than 350°C
  - (B) is less than 350°C
  - (C) is equal to 350°C
  - (D) may be greater than, less than, or equal to 350°C, depending on the volume of the tank.
- Q.50. For the three dimensional object shown in the figure below, five faces are insulated. The sixth face (PQRS), which is not insulated, interacts thermally with the ambient, with a convective heat transfer coefficient of 10 W/m<sup>2</sup>.K. The ambient temperature is 30°C. Heat is uniformly generated inside the object at the rate of 100 W/m<sup>3</sup>. Assuming the face PQRS to be at uniform temperature, its steady state temperature is

(A)  $10^{\circ}$ C (B)  $20^{\circ}$ C (C)  $30^{\circ}$ C (D)  $40^{\circ}$ C

Q.51. Water, having a density of 1000 kg/m³, issues from a nozzle with a velocity of 10 m/s and the jet strikes a bucket mounted on a Pelton wheel. The wheel rotates at 10 rad/s. The mean diameter of the wheel is 1 m. The jet is split into two equal streams by the bucket such that each stream is deflected by 120°, as shown in the figure. Friction in the bucket may be neglected. Magnitude of the torque extended by the water on the wheel, per unit mass flow rate of the incoming jet, is

- (A) 0 (N.m)/(kg/s) (B) 1.25 (N.m)/(kg/s) (C) 2.5 (N.m)/(kg/s) (D) 3.75 (N.m)/(kg/s)
- Q.52. A thermal power plant operates on a regenerative cycle with a single open feedwater heater, as shown in the figure. For the state points shown, the specific enthaplies are:  $h_1 = 2800 \text{ kJ/kg}$  and  $h_2 = 200 \text{ kJ/kg}$ . The bleed to the feedwater heater is 20% of the boiler steam generation rate. The specific enthalpy at state 3 is
  - (A) 720 kJ/kg (B) 2280 kJ/kg (C) 1500 kJ/kg (D) 3000 kJ/kg
- Q.53. Moist air at a pressure of 100 kPa is compressed to 500 kPa and then cooled to 35°C in an aftercooler. The air at the entry to the aftercooler is unsaturated and becomes just saturated at the exit of the aftercooler. The saturation pressure of water at 35°C is 5.628 kPa. The partial pressure of water vapour (in kPa) in the moist air entering the compressor is closest to
  - (A) 0.57 (B) 1.13 (C) 2.26 (D) 4.52
- Q.54. A hollow enclosure is formed between two infinitely long concentric cylinders of radii 1 m and 2 m, respectively. Radiative heat exchange takes place between the inner surface of the larger cylinder (surface-2) and the outer surface of the smaller cylinder (surface-1). The radiating surfaces are diffuse and the medium in the enclosure is non-participating. The fraction of the thermal radiation leaving the larger surface and striking itself is
  - (A) 0.25 (B) 0.5 (C) 0.75 (D) 1
- Q.55. Air (at atmospheric pressure) at a dry bulb temperature of 40°C and wet bulb temperature of 20°C is humidified in an air washer operating with continuous water recirculation. The wet bulb depression (i.e. the difference between the dry and wet bulb temperatures) at the exit is 25% of that at the inlet. The dry bulb temperature at the exit of the air washer is closest to
  - (A)  $10^{\circ}$ C (B)  $20^{\circ}$ C (C)  $25^{\circ}$ C (D)  $30^{\circ}$ C
- Q.56. Steady two-dimensional heat conduction takes place in the body shown in the figure below. The normal temperature gradients over surfaces P and Q can be considered to be uniform. The temperature gradient  $\frac{\partial T}{\partial x}$  at surface Q is equal to 10 K/m. Surfaces P and Q are maintained at constant temperatures as shown in the figure, while the remaining part of the boundary is insulated. The body has a constant thermal conductivity of 0.1 W/m.K. The values of  $\frac{\partial T}{\partial x}$  and  $\frac{\partial T}{\partial y}$  at surface P are
  - (A)  $\frac{\partial T}{\partial x} = 20 \text{ K/m}, \frac{\partial T}{\partial y} = 0 \text{ K/m}$  (B)  $\frac{\partial T}{\partial x} = 0 \text{ K/m}, \frac{\partial T}{\partial y} = 10 \text{ K/m}$  (C)  $\frac{\partial T}{\partial x} = 10 \text{ K/m}, \frac{\partial T}{\partial y} = 10 \text{ K/m}$  (D)  $\frac{\partial T}{\partial x} = 0 \text{ K/m}, \frac{\partial T}{\partial y} = 20 \text{ K/m}$

Q.57. In a steady state steady flow process taking place in a device with a single inlet and a single outlet, the work done per unit mass flow rate is given by  $w = -\int_{inlet}^{outlet} v dp$ , where v is the specific volume and p is the pressure. The expression for w given above

- (A) is valid only if the process is both reversible and adiabatic
- (B) is valid only if the process is both reversible and isothermal
- (C) is valid for any reversible process
- (D) is incorrect; it must be  $w = \int_{inlet}^{outlet} p dv$
- Q.58. For the standard transportation linear programme with m sources and n destinations and total supply equaling total demand, an optimal solution (lowest cost) with the smallest number of non-zero  $x_{ij}$  values (amounts from source i to destination j) is desired. The best upper bound for this number is
  - (A) mn (B) 2(m+n) (C) m+n (D) m+n-1
- Q.59. A moving average system is used for forcasting weekly demand.  $F_1(t)$  and  $F_2(t)$  are sequences of forecasts with parameters  $m_1$  and  $m_2$ , respectively, where  $m_1$  and  $m_2$  ( $m_1 > m_2$ ) denote the numbers of weeks over which the moving averages are taken. The actual demand shows a step increase from  $d_1$  to  $d_2$  at a certain time. Subsequently,
  - (A) neither  $F_1(t)$  nor  $F_2(t)$  will catch up with the value  $d_2$
  - (B) both sequences  $F_1(t)$  and  $F_2(t)$  will reach  $d_2$  in the same period
  - (C)  $F_1(t)$  will attain the value  $d_2$  before  $F_2(t)$
  - (D)  $F_2(t)$  will attain the value  $d_2$  before  $F_1(t)$
- Q.60. For the network below, the objective is to find the length of the shortest path from node P to node G. Let  $d_{ij}$  be the length of directed arc from node i to node j.

Let  $s_j$  be the length of the shortest path from P to node j. Which of the following equations can be used to find  $s_G$ ?

- (A)  $s_G = \min\{s_Q, s_R\}$
- (B)  $s_G = \min\{s_Q d_{QG}, s_R d_{RG}\}$
- (C)  $s_G = Min\{s_Q + d_{QG}, s_R + d_{RG}\}$
- (D)  $s_G = \operatorname{Min}\{d_{QG}, d_{RG}\}$
- Q.61. The product structure of an assembly P is shown in the figure Estimated demand for end product P is as follows:

Week	1	2	3	4	5	6
Demand	1000	1000	1000	1000	1200	1200

Ignore lead times for assembly and sub-assembly. Production capacity (per week) for component R is the bottleneck operation. Starting with zero inventory, the smallest capacity that will ensure a feasible production plan up to week 6 is

(A) 1000 (B) 1200 (C) 2200 (D) 2400

ME 10/14

Q.62. One tooth of a gear having 4 module and 32 teeth is shown in the figure. Assume that the gear tooth and the corresponding tooth space make equal intercepts on the pitch circumference. The dimension 'a' and 'b', respectively, are closest to

- (A) 6.08 mm, 4 mm (B) 6.48 mm, 4.2 mm (C) 6.28 mm, 4.3 mm (D) 6.28 mm, 4.1 mm
- Q.63. While cooling, a cubical casting of side 40 mm undergoes 3%, 4%, and 5% volume shrinkage during the liquid state, phase transition and solid state, respectively. The volume of metal compensated from the riser is
  - (A) 2% (B) 7% (C) 8% (D) 9%
- Q.64. In a single point turning tool, the side rake angle and the orthogonal rake angle are equal.  $\phi$  is the principal cutting edge angle and its range is  $0^{\circ} \leq \phi \leq 90^{\circ}$ . The chip flows in the orthogonal plane. The value of  $\phi$  is closest to
  - (A)  $0^{\circ}$  (B)  $45^{\circ}$  (C)  $60^{\circ}$  (D)  $90^{\circ}$
- Q.65. A researcher conducts electrochemical machining (ECM) on a binary alloy (density  $6000 \text{ kg/m}^3$ ) of iron (atomic weight 56, valency 2) and metal P (atomic weight 24, valency 4). Faraday's constant = 96500 coulomb/mole. Volumetric material removal rate of the alloy is  $50 \text{ mm}^3/\text{s}$  at a current of 2000 A. The percentage of the metal P in the alloy is closest to
  - (A) 40 (B) 25 (C) 15 (D) 79
- Q.66. In a single pass rolling operation, a 20 mm thick plate with plate width of 100 mm, is reduced to 18 mm. The roller radius is 250 mm and rotational speed is 10 rpm. The average flow stress for the plate material is 300 MPa. The power required for the rolling operation in kW is closest to
  - (A) 15.2 (B) 18.2 (C) 30.4 (D) 45.6
- Q.67. In arc welding of a butt joint, the welding speed is to be selected such that the highest cooling rate is achieved. Melting efficiency and heat transfer efficiency are 0.5 and 0.7, respectively. The area of the weld cross section is 5 mm<sup>2</sup> and the unit energy required to melt the metal is 10 J/mm<sup>3</sup>. If the welding power is 2 kW, the welding speed in mm/s is closest to
  - (A) 4 (B) 14 (C) 24 (D) 34
- Q.68. In the deep drawing of cups, blanks show a tendency to wrinkle up around the periphery (flange). The most likely cause and remedy of the phenomenon are, respectively,
  - (A) Buckling due to circumferential compression; Increase blank holder pressure
  - (B) High blank holder pressure and high friction; Reduce blank holder pressure and apply lubricant
  - (C) High temperature causing increase in circumferential length; Apply coolant to blank
  - (D) Buckling due to circumferential compression; decrease blank holder pressure

ME 11/14

Q.69. The figure shows an incomplete schematic of a conventional lathe to be used for cutting threads with different pitches. The speed gear box  $U_V$  is shown and the feed gear box  $U_X$  is to be placed. P, Q, R and S denote locations and have no other significance. Changes in  $U_V$  should NOT affect the pitch of the thread being cut and changes in  $U_X$  should NOT affect the cutting speed. The correct connections and the correct placement of  $U_X$  are given by

- (A) Q and E are conneted,  $U_X$  is placed between P and Q.
- (B) S and E are conneted,  $U_X$  is placed between R and S.
- (C) Q and E are conneted,  $U_X$  is placed between Q and E.
- (D) S and E are connected,  $U_X$  is placed between S and E.
- Q.70. A displacement sensor (a dial indicator) measures the lateral displacement of a mandrel mounted on the taper hole inside a drill spindle. The mandrel axis is an extension of the drill spindle taper hole axis and the protruding portion of the mandrel surface is perfectly cylindrical. Measurements are taken with the sensor placed at two positions P and Q as shown in the figure. The readings are recorded as  $R_X = \text{maximum deflection minus minimum deflection}$ , corresponding to sensor position at X, over one rotation.
  - If  $R_P = R_Q > 0$ , which one of the following would be consistent with the observation?
    - (A) The drill spindle rotational axis is coincident with the drill spindle taper hole axis
    - (B) The drill spindle rotational axis intersects the drill spindle taper hole axis at point P
    - (C) The drill spindle rotational axis is parallel to the drill spindle taper hole axis
    - (D) The drill spindle rotational axis intersects the drill spindle taper hole axis at point Q

ME 12/14

# Common Data Questions Common Data for Questions 71, 72 and 73:

In the figure shown, the system is a pure substance kept in a piston-cylinder arrangement. The system is initially a two-phase mixture containing 1 kg of liquid and 0.03 kg of vapour at a pressure of 100 kPa. Initially, the pison rests on a set of stops, as shown in the figure. A pressure of 200 kPa is required to exactly balance the weight of the piston and the outside atmospheric pressure. Heat transfer takes place into the system until its volume increases by 50%. Heat transfer to the system occurs in such a manner that the piston, when allowed to move, does so in a very slow (quasi-static / quasi-equilibrium) process. The thermal reservoir from which heat is transferred to the system has a temperature of 400°C. Average temperature of the system boundary can be taken as 175°C. The heat transfer to the system is 1 kJ, during which its entropy increases by 10 J/K.

Specific volumes of liquid  $(v_f)$  and vapour  $(v_g)$  phases, as well as values of saturation temperatures, are given in the table below.

Pressure (kPa)	Saturation temperature, $T_{sat}$ (°C)	$v_f(\mathrm{m}^3/\mathrm{kg})$	$v_g(\mathrm{m}^3/\mathrm{kg})$
100	100	0.001	0.1
200	200	0.0015	0.002

- Q.71. At the end of the process, which one of the following situations will be true?
  - (A) superheated vapour will be left in the system
  - (B) no vapour will be left in the system
  - (C) a liquid + vapour mixture will be left in the system
  - (D) the mixture will exist at a dry saturated vapour state
- Q.72. The work done by the sywstem during the process is
  - (A) 0.1 kJ (B) 0.2 kJ (C) 0.3 kJ (D) 0.4 kJ
- Q.73. The net entropy generation (considering the system and the thermal reservoir together) during the process is closest to

(A) 7.5 J/K (B) 7.7 J/K (C) 8.5 J/K (D) 10 J/K

ME 13/14

# Common Data for Questions 74 and 75

Consider the Linear Programme (LP)

$$\begin{aligned} & \text{Max } 4x + 6y \\ & \text{subject to } 3x + 2y \leq 6 \\ & 2x + 3y \leq 6 \\ & x, y \geq 0 \end{aligned}$$

Q.74. After introducing slack variables s and t, the initial basic feasible solution is represented by the tableu below (basic variables are s=6 and t=6, and the objective function value is 0).

	-4	-6	0	0	0
s	3	2	1	0	6
t	2	3	0	1	6
	X	у	s	t	RHS

- $(A) \quad (B) \quad (C) \quad (D)$
- Q.75. (A) (B) (C) (D)
- Q.76. (A) (B) (C) (D)
- Q.77. (A) (B) (C) (D)

ME 14/14