## **Minebea**

Outline

PM15S-020 18°

87.7 20±0.2 23

0.5 0.8 12MAX 1MAX

<u>|1</u>±0.5

Ø1.5-0.01


 ${\rm *Please\ contact\ our\ sales\ for\ inventory\ and\ lot\ information.}\ Specification\ may\ be\ changed\ without\ notice.}$ 


## **■** Specifications

Number of Steps per Rotation	Drive Method	Drive Circuit	Drive Voltage	Current/Phase	Coil Resistance/Phase	Drive IC
20 (18°/Step)	2-2 Phase	Bipolar Const. Volt.	5 [V]		30 [Ω]	L293D
			12 [V]	·	100 [Ω]	L293D

Magnet Material	Insulation Resistance	Dielectric Strength	Class of Insulation	Operating Temperature	Storage Temperature	Operating Humidity
Nd-Fe-B bonded magnet (MS70)	100M [Ω] MIN	AC 500 [V] 1 [min]	CLASS E	-10 [°C] ~ 50 [°C]	-30 [°C] ~ 80 [°C]	20 [%] RH ~ 90 [%] RH

## **■** Torque/Speed Characteristics

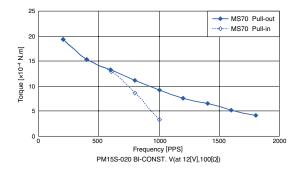

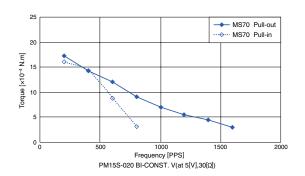

These torque values are reference only. Heat radiation conditions and temperature rise effect by duty are different on each equipment, therefore please select motors after considering the actual equipment.

## **■** Applications

- OA Equipment: Printers/Scanners
- Optical Instruments: Digital cameras/Video cameras

**PM**