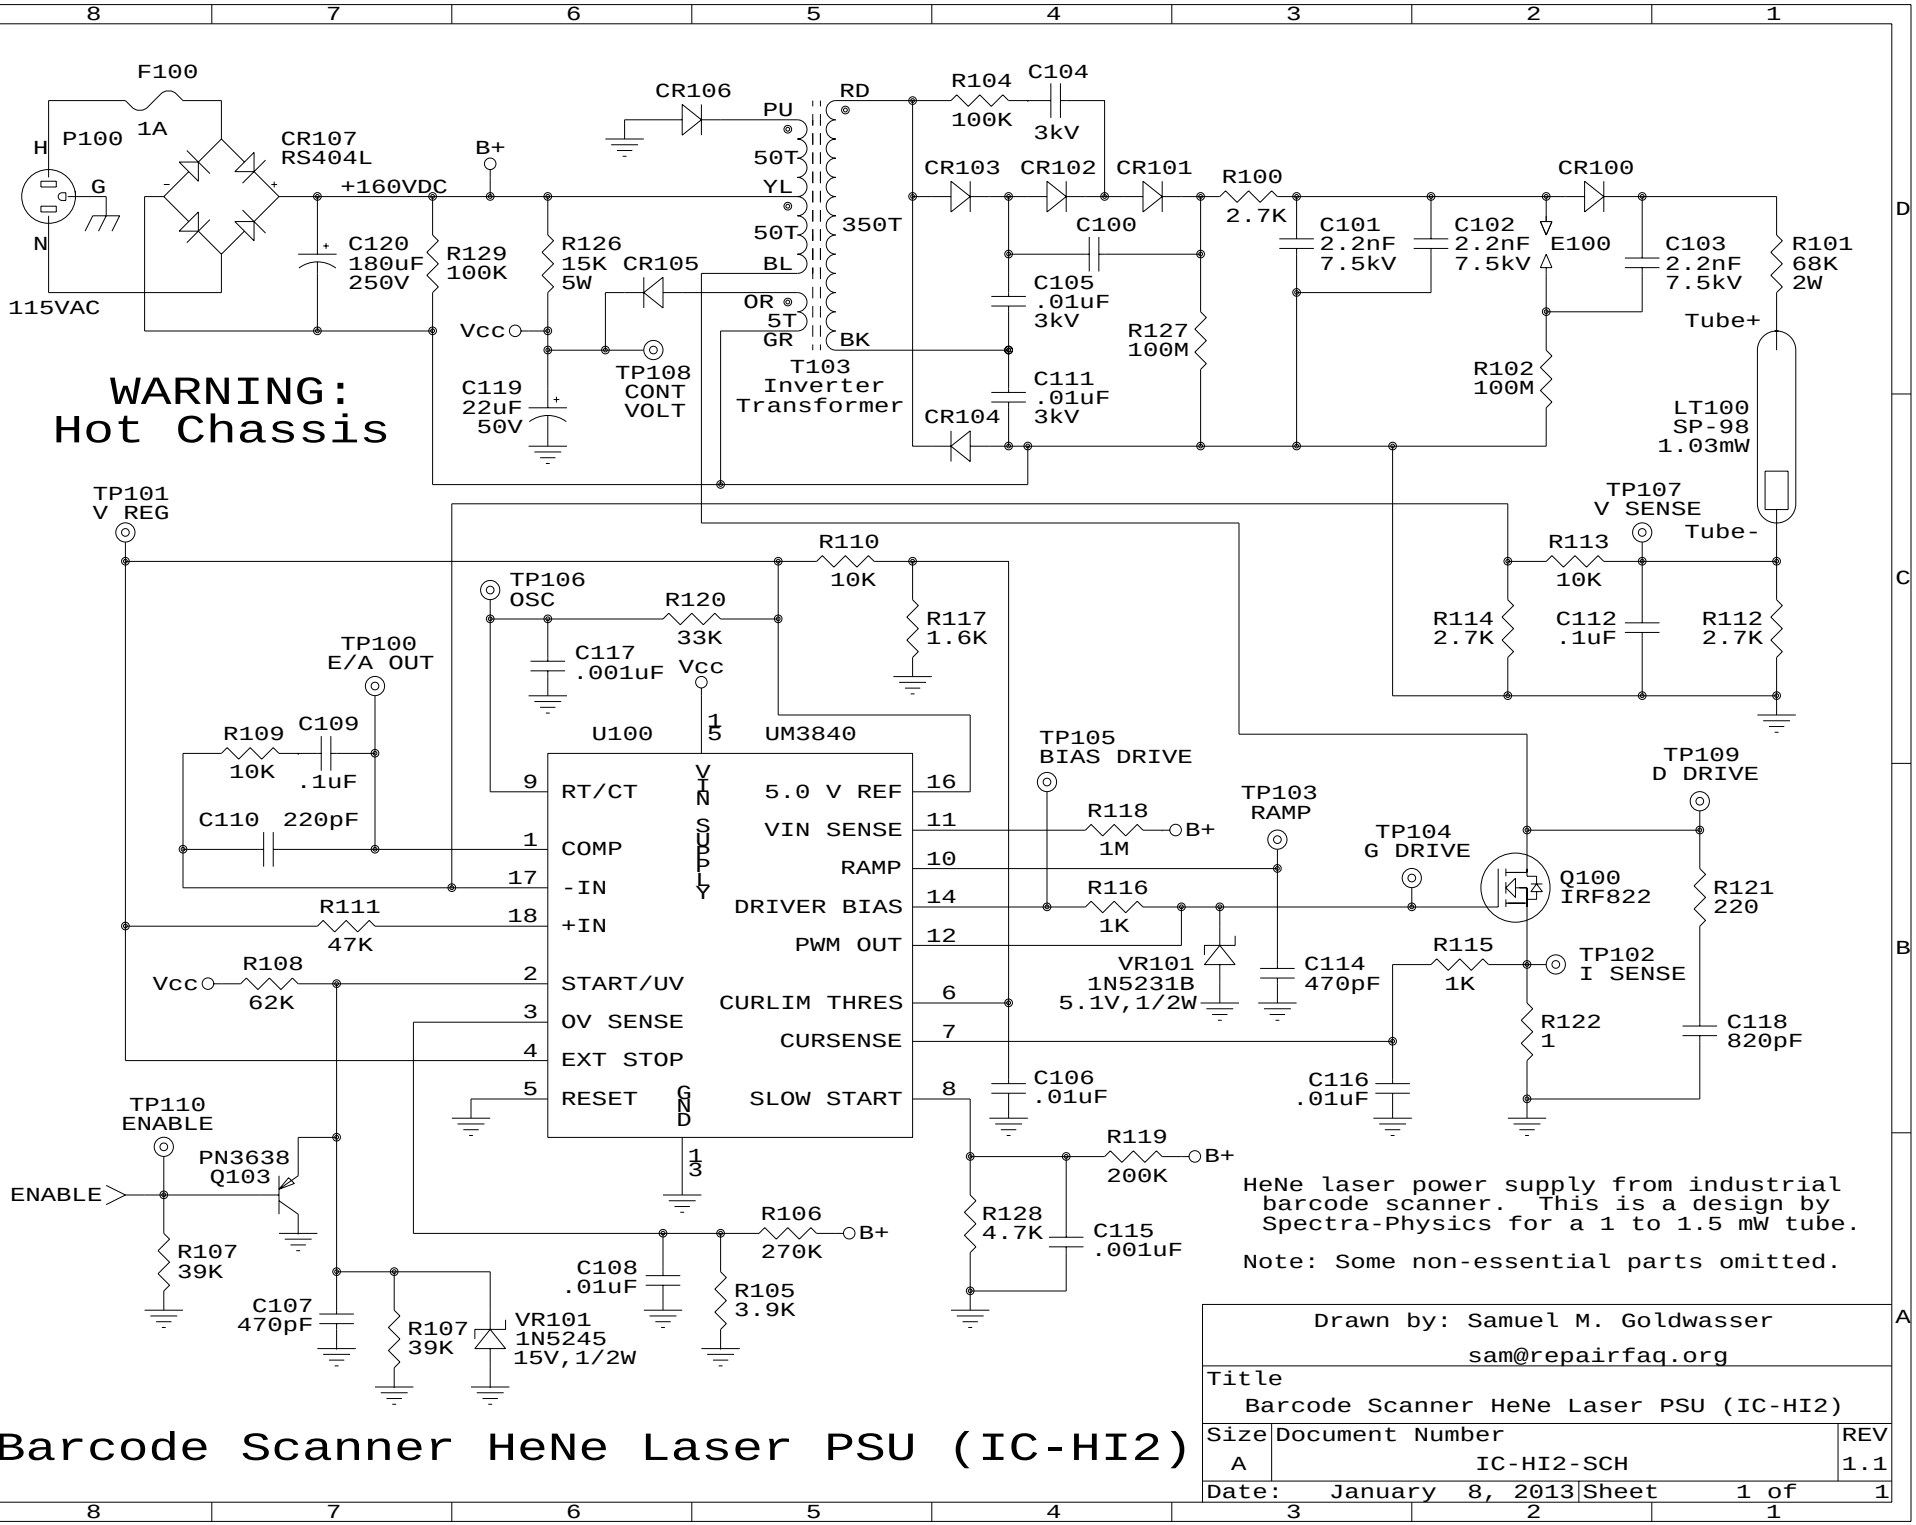
F100
1A
P100
H
G
N
115VAC
CR107
RS404L
+160VDC
B+
C120
180uF
250V
R129
100K
R126
15K
5W
CR105
Vcc
C119
22uF
50V
TP108
CONT
VOLT
CR106
PU
50T
YL
50T
BL
OR
5T
GR
RD
BK
350T
T103
Inverter
Transformer
R104
100K
C104
3kV
CR103
CR102
CR101
C100
C105
.01uF
3kV
C111
.01uF
3kV
CR104
R100
2.7K
C101
2.2nF
7.5kV
C102
2.2nF
7.5kV
CR100
E100
C103
2.2nF
7.5kV
R101
68K
2W
Tube+
R127
100M
R102
100M
LT100
SP-98
1.03mW
Tube-
TP107
V SENSE
R113
10K
R114
2.7K
C112
.1uF
R112
2.7K
WARNING:
Hot Chassis
TP101
V REG
R110
10K
TP106
OSC
R120
33K
R117
1.6K
C117
.001uF
Vcc
TP100
E/A OUT
R109
10K
C109
.1uF
C110
220pF
U100
UM3840
9
RT/CT
1
COMP
17
-IN
18
+IN
2
START/UV
3
OV SENSE
4
EXT STOP
5
RESET
15
VIN
SUPPLY
16
5.0 V REF
11
VIN SENSE
10
RAMP
14
DRIVER BIAS
12
PWM OUT
6
CURLIM THRES
7
CURSENSE
8
SLOW START
13
GND
R111
47K
R108
62K
TP105
BIAS DRIVE
R118
1M
B+
R116
1K
VR101
1N5231B
5.1V,1/2W
TP103
RAMP
C114
470pF
TP104
G DRIVE
Q100
IRF822
TP109
D DRIVE
R121
220
R115
1K
TP102
I SENSE
R122
1
C118
820pF
C116
.01uF
C106
.01uF
R119
200K
B+
R128
4.7K
C115
.001uF
TP110
ENABLE
PN3638
Q103
ENABLE
R107
39K
R106
270K
B+
C108
.01uF
R105
3.9K
C107
470pF
R107
39K
VR101
1N5245
15V,1/2W
HeNe laser power supply from industrial barcode scanner. This is a design by Spectra-Physics for a 1 to 1.5 mW tube.
Note: Some non-essential parts omitted.
Drawn by: Samuel M. Goldwasser
sam@repairfaq.org
Title
Barcode Scanner HeNe Laser PSU (IC-HI2)
Size
A
Document Number
IC-HI2-SCH
REV
1.1
Date: January 8, 2013
Sheet 1 of 1
Barcode Scanner HeNe Laser PSU (IC-HI2)