

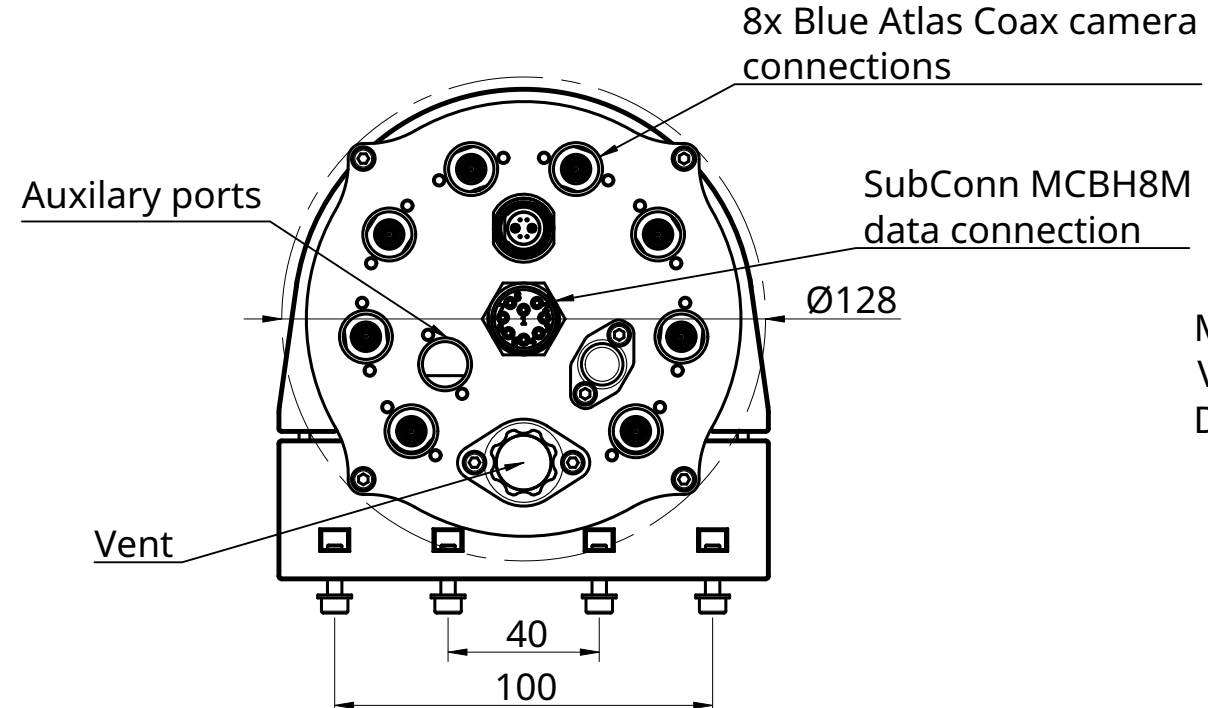
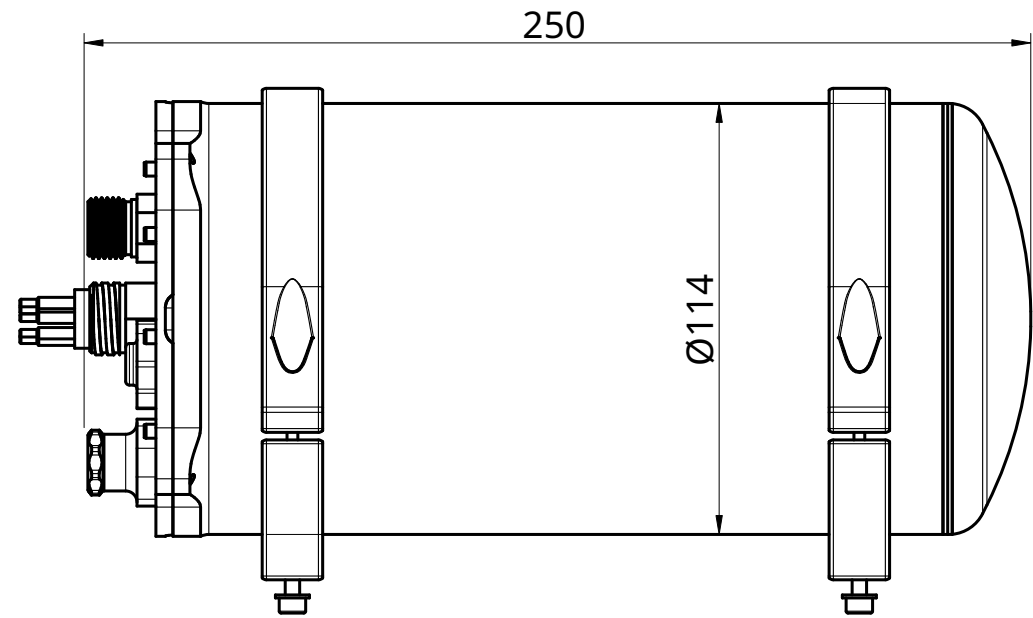


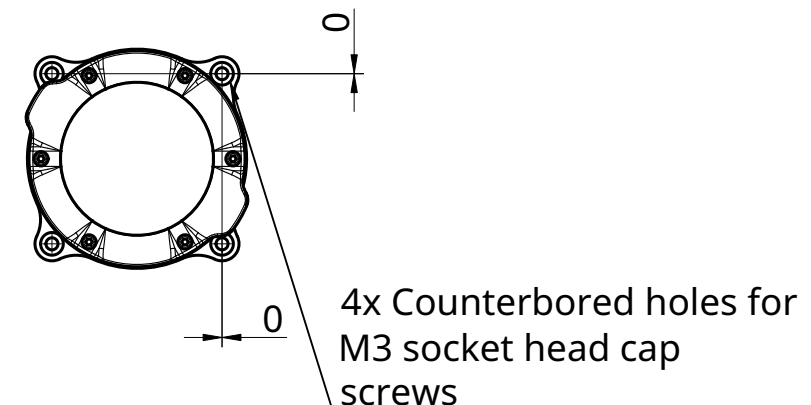

Mass: 1.6 kg
Volume: 2300 mL
Depth rating: 100 m


Central bottle unit

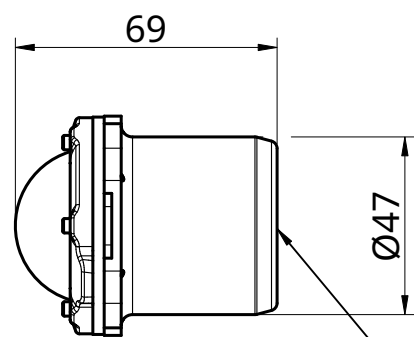


Mass: 0.17 kg
Volume: 120 mL
Depth rating: 100 m

NOTE: Length and Diameter of camera unit may be subject to change

Camera unit

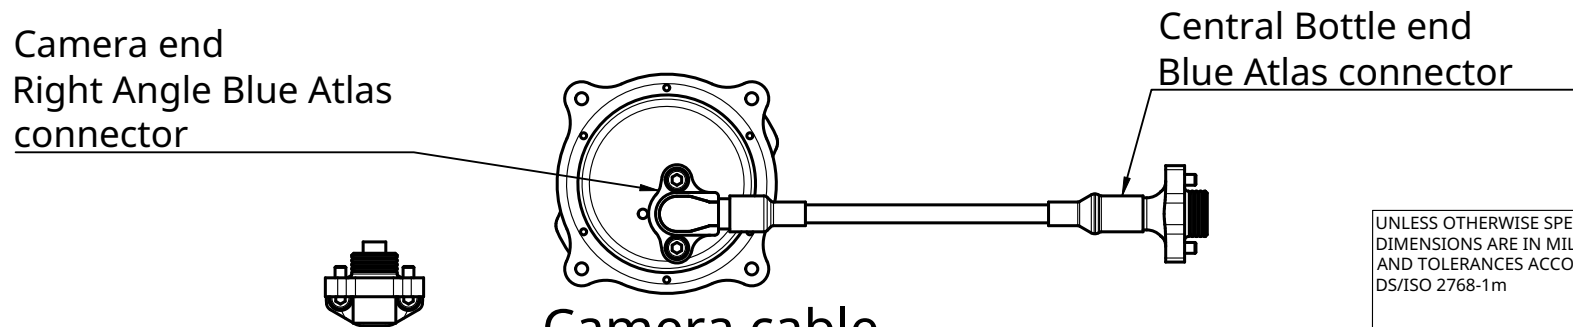

Cable diameter: 5 mm
Min. bend radius: 15 mm

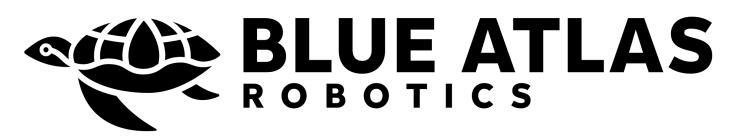

UNLESS OTHERWISE SPECIFIED, DIMENSIONS ARE IN MILLIMETERS AND TOLERANCES ACCORDING TO DS/ISO 2768-1m	NAME		DATE	TITLE Vision System Datasheet		
	DRAWN	KEVIN EVARSDEN GRAU	2022-10-20			
	BREAK ALL SHARP EDGES AND REMOVE BURRS					
	MATERIAL		FINISH	SIZE A3	DWG NO.	REV.
	N/A			SCALE 1:2	MASS	SHEET 1 of 9

6 5 4 3 2 1

D

D

C


C

B

B


A

A


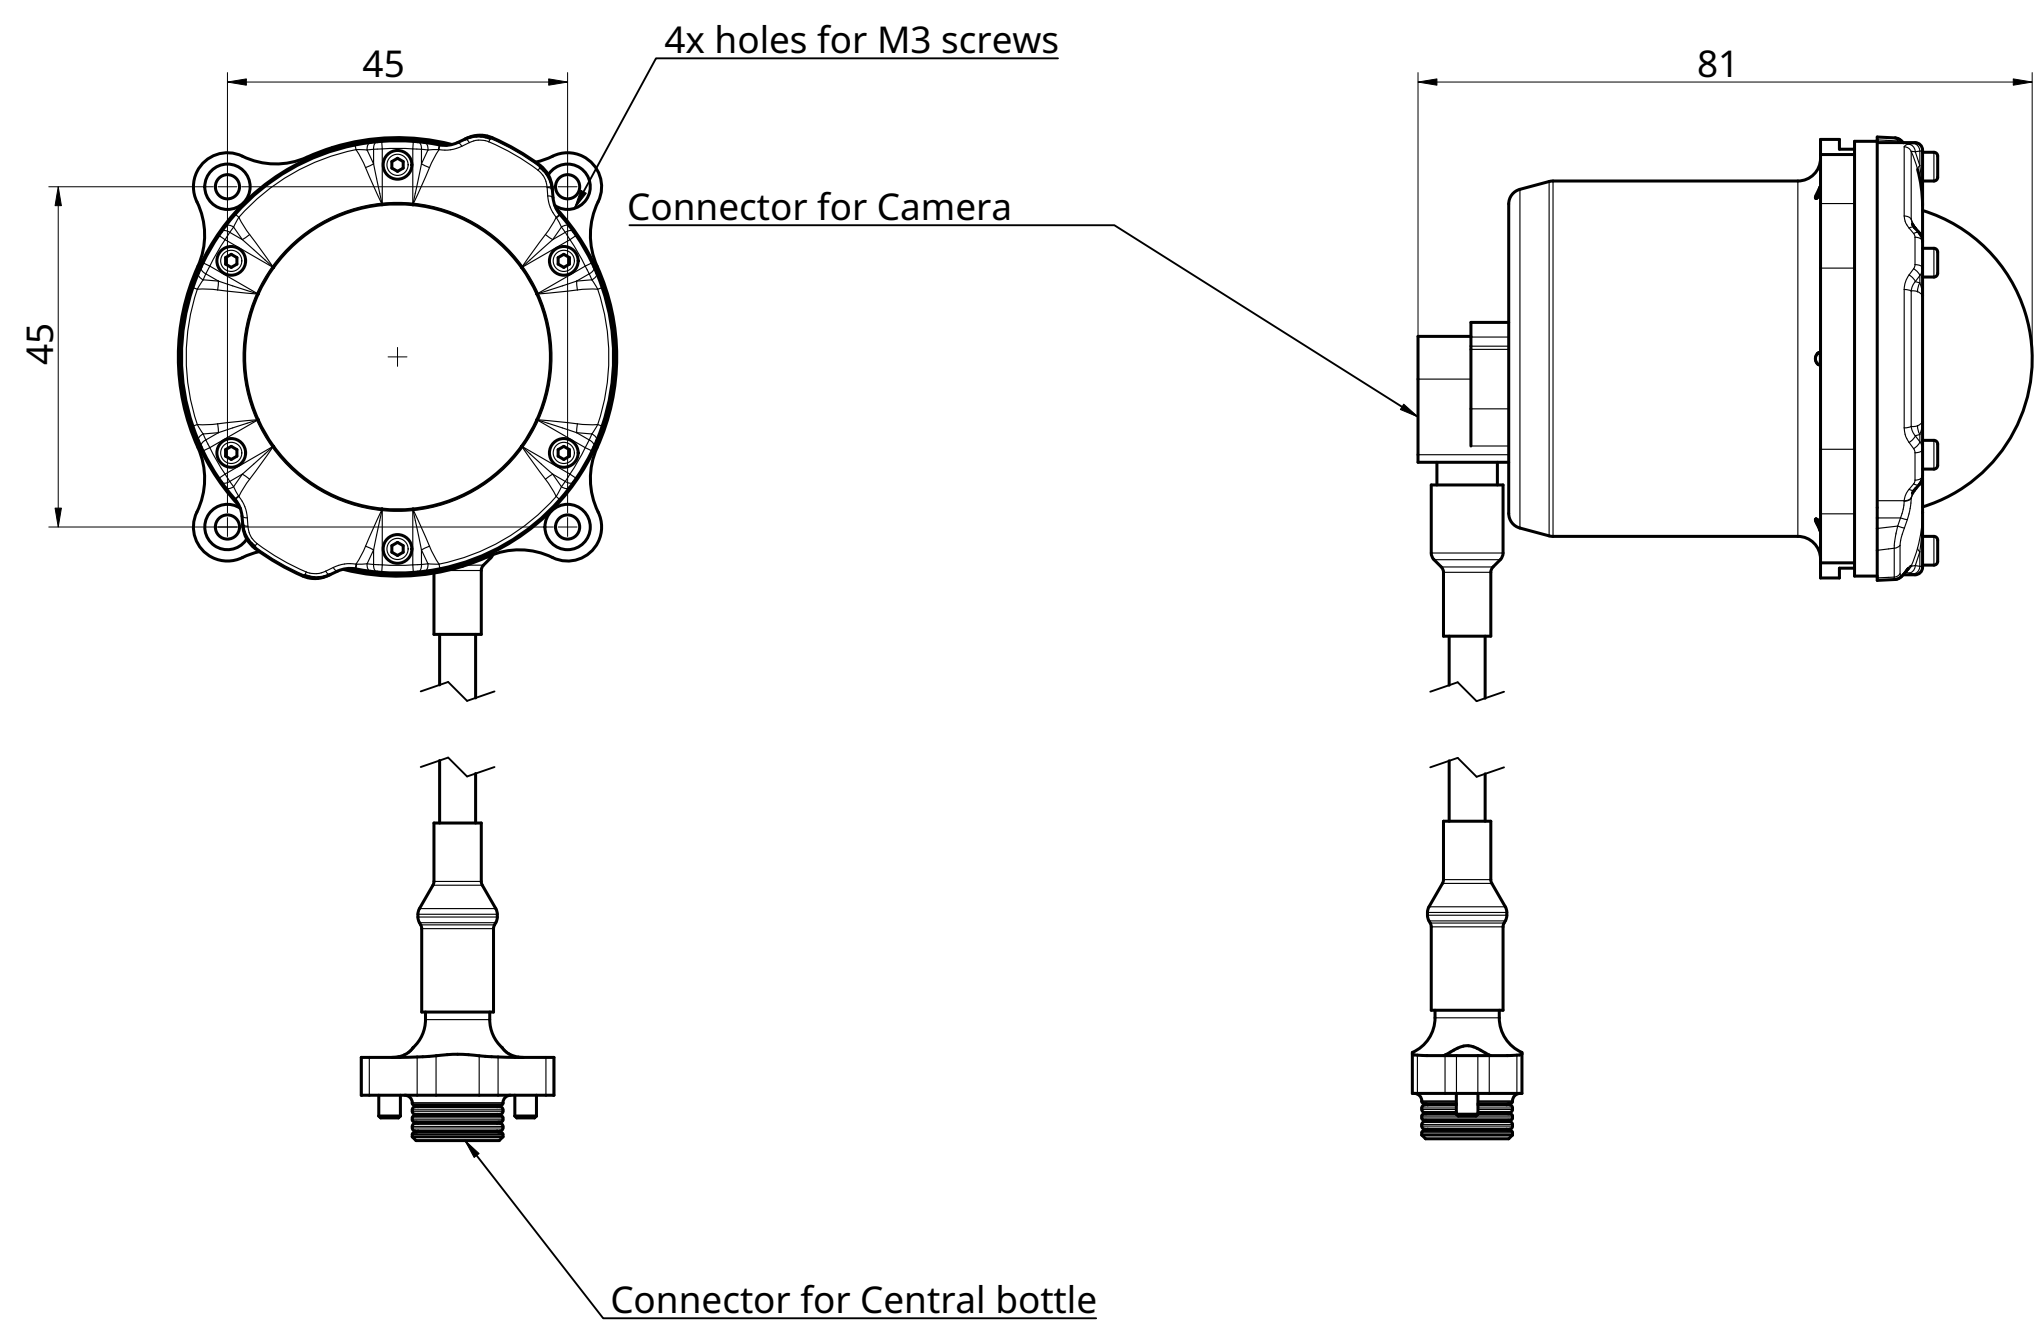


**BLUE ATLAS**
ROBOTICS


TITLE		Camera Unit	
SIZE	A3	DWG NO.	REV.
SCALE	1:1	MASS	SHEET 2 of 9

UNLESS OTHERWISE SPECIFIED, DIMENSIONS ARE IN MILLIMETERS AND TOLERANCES ACCORDING TO DS/ISO 2768-1m		NAME	DATE
	DRAWN	KEVIN EVARSEN GRAU	2022-10-20
BREAK ALL SHARP EDGES AND REMOVE BURRS			
	MATERIAL	FINISH	

6 5 4 3 2 1

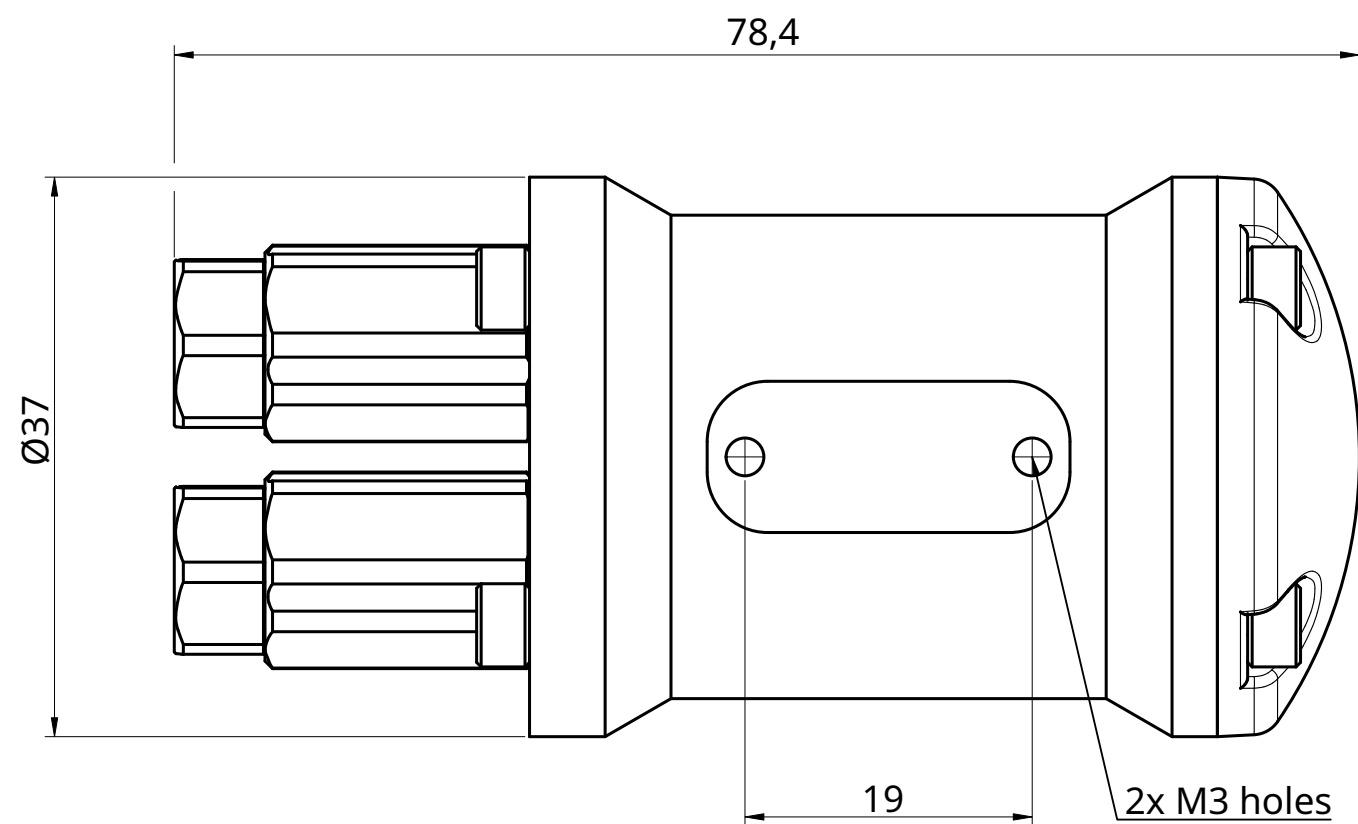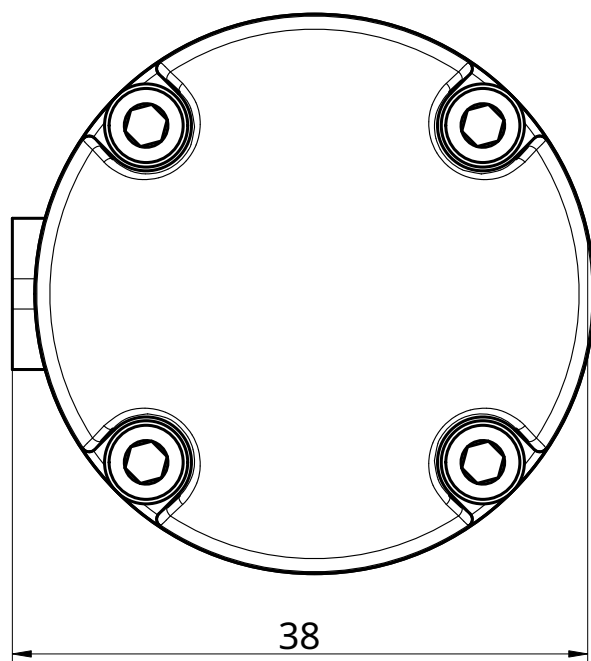

3 Light chains each with 4 lights and 1 m cable
between lights

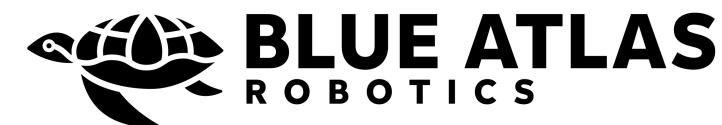

UNLESS OTHERWISE SPECIFIED, DIMENSIONS ARE IN MILLIMETERS AND TOLERANCES ACCORDING TO DS/ISO 2768-1m		NAME	DATE	TITLE Light		
	DRAWN	KEVIN EVARSEN GRAU	2022-10-20			
BREAK ALL SHARP EDGES AND REMOVE BURRS				SIZE A3	DWG NO.	REV.
	MATERIAL		FINISH		SCALE 2:1	MASS
					SHEET 3 of 9	

6

5

4

3

2

1

D

D

C



C

B

B


A





A

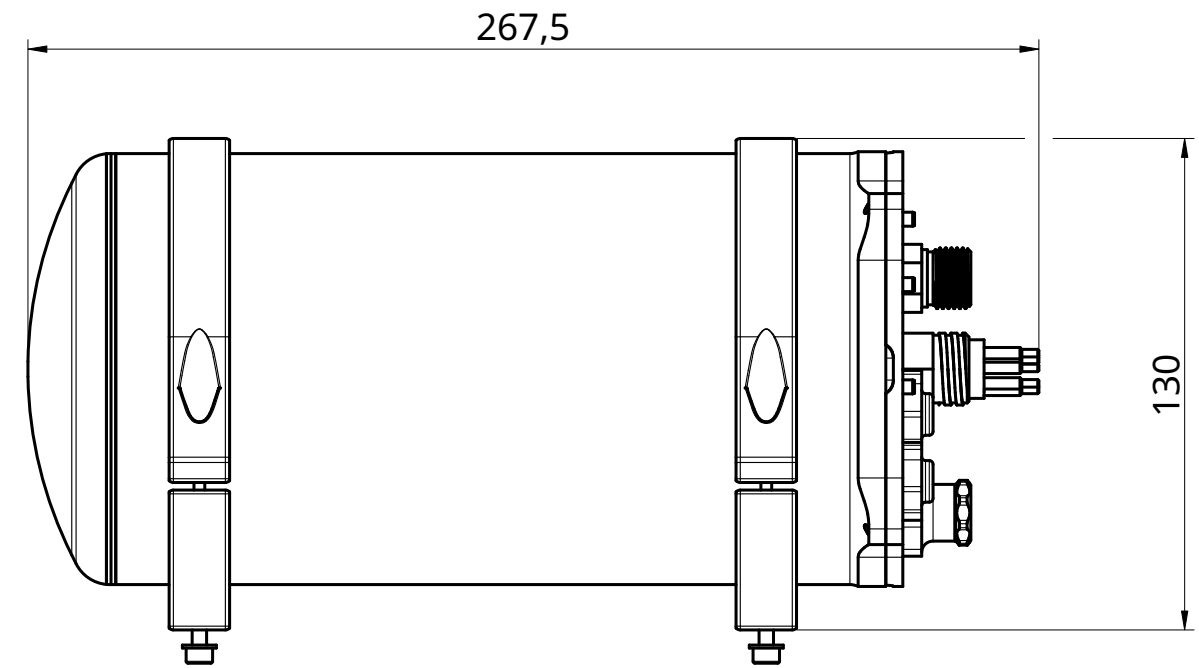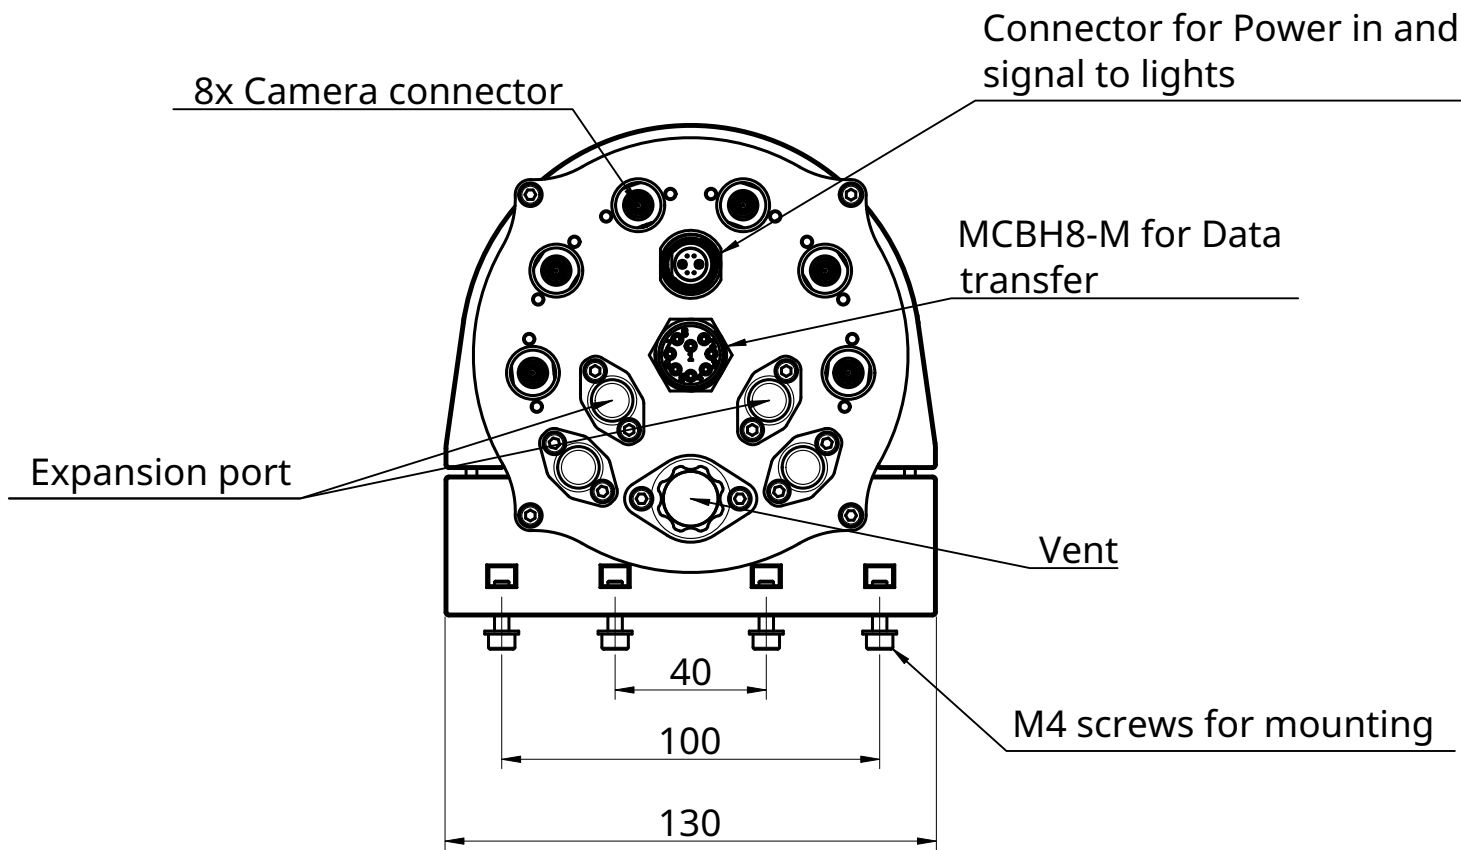

4 Out of the 8 M4 mounting screws are required for a secure mounting



UNLESS OTHERWISE SPECIFIED, DIMENSIONS ARE IN MILLIMETERS AND TOLERANCES ACCORDING TO DS/ISO 2768-1m		NAME	DATE	TITLE Central Bottle		
	DRAWN	KEVIN EVARSEN GRAU	2022-10-20			
BREAK ALL SHARP EDGES AND REMOVE BURRS				SIZE	DWG NO.	REV.
	MATERIAL		FINISH		A3	
					SCALE	1:2
					MASS	
				SHEET	4 of 9	

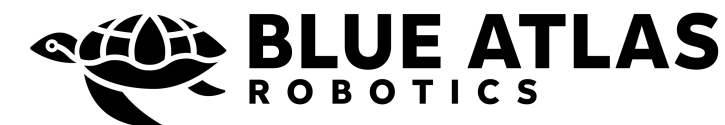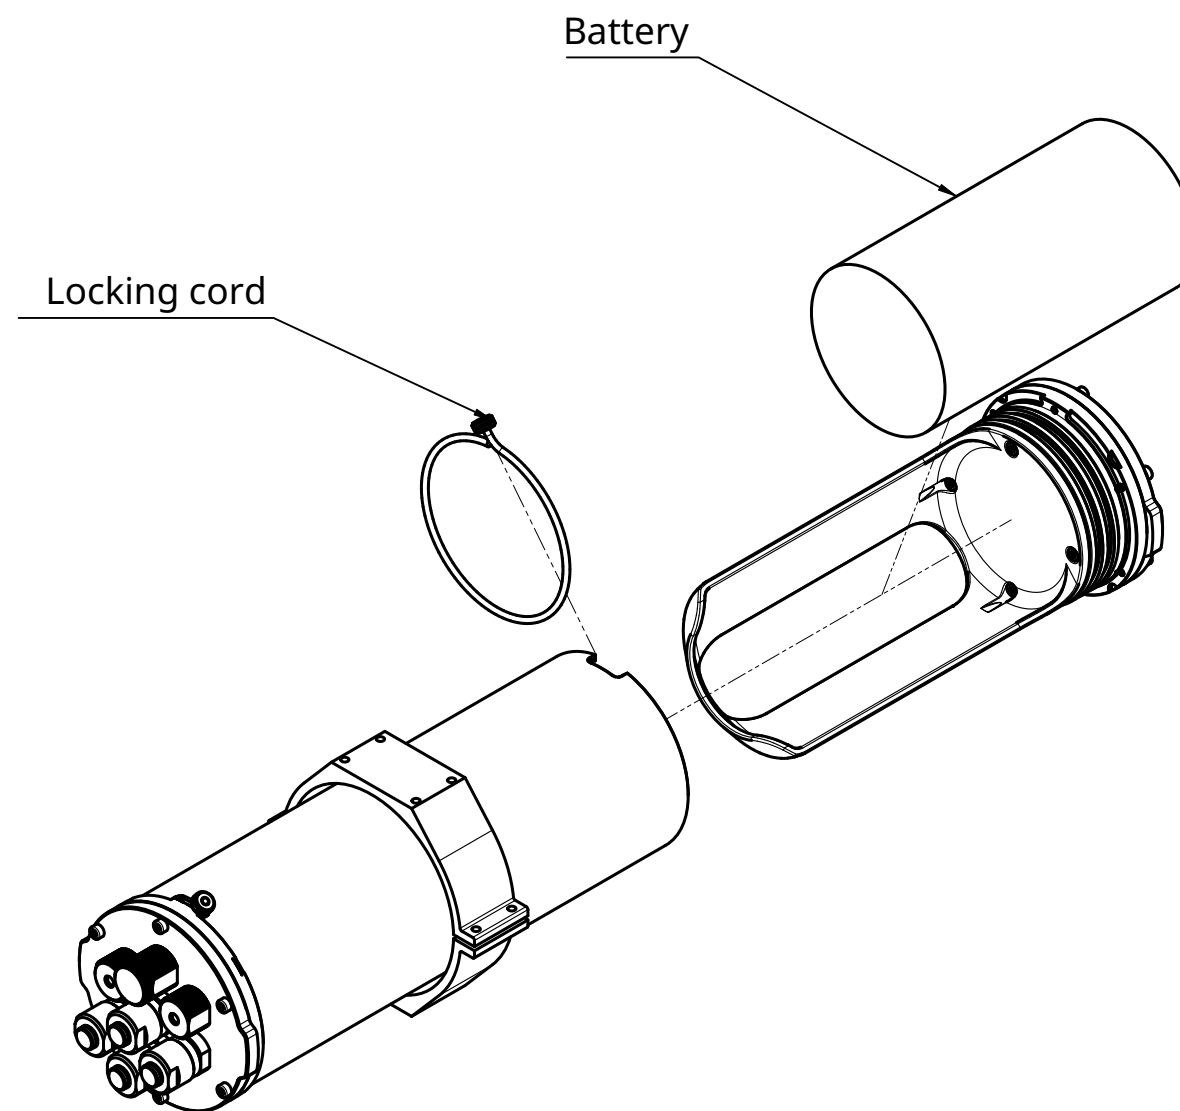
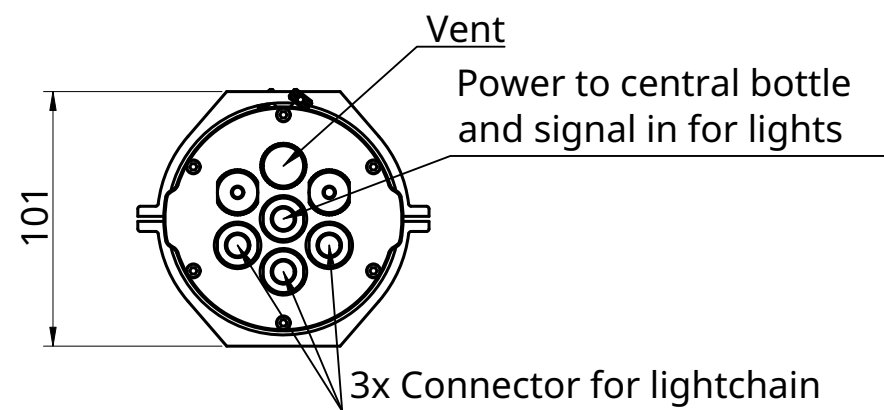
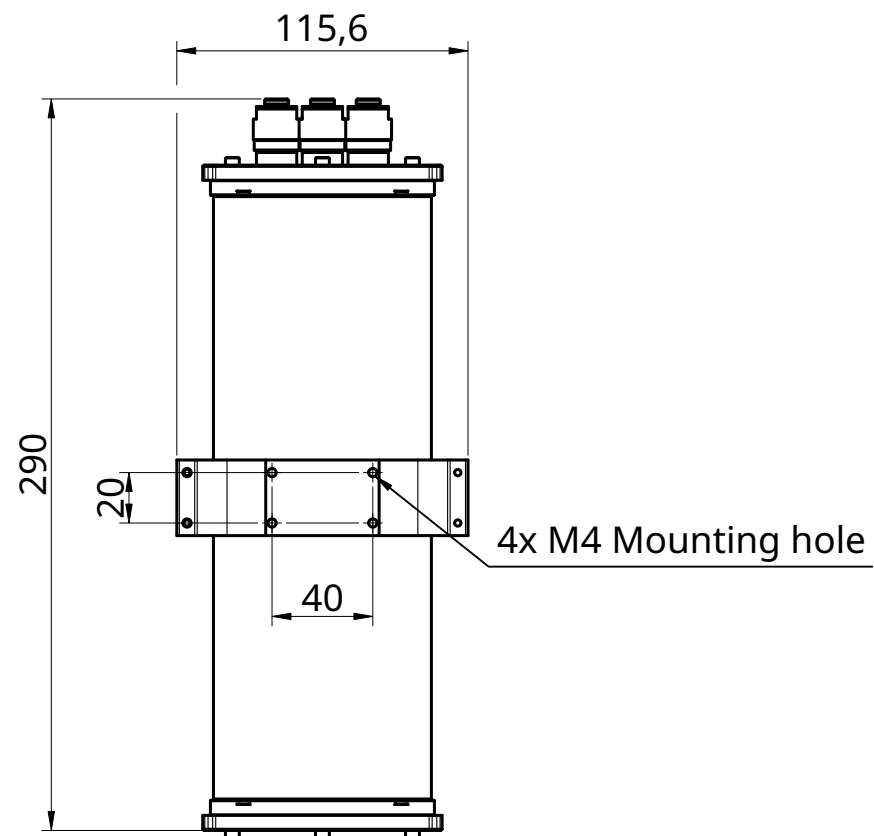


UNLESS OTHERWISE SPECIFIED, DIMENSIONS ARE IN MILLIMETERS AND TOLERANCES ACCORDING TO DS/ISO 2768-1m	NAME		DATE	TITLE Battery bottle		
	DRAWN	KEVIN EVARSEN GRAU	2022-10-20			
BREAK ALL SHARP EDGES AND REMOVE BURRS				SIZE A3	DWG NO.	REV.
	MATERIAL		FINISH	SCALE 1:3	MASS	SHEET 5 of 9

Included items			
Item	Step	Part name	Actions
1	1	CobaltDummyPlug	Unscrew
1	2	Cobalt BH 6 HybridPin	Screw in
1	3	Subconn Tether connector	Screw in
6	4	BAR Connectors	Screw in
10	5	BARDummyPlug	Unscrew

Assembly instructions Main Bottle and cables
To connect the CentralBottle with the Cameras and BatteryBottle.
Follow this guide.

- 1) Unscrew the 6x BAR BlindePlugs as shown in the left figur.
- 2) Unscrew the CobaltDummyPlug.
- 3) Screw in the Power & PWM signal cable to the Cobolt connector.
- 4) Screw in all 6x Bar Camera Connector to each connector.

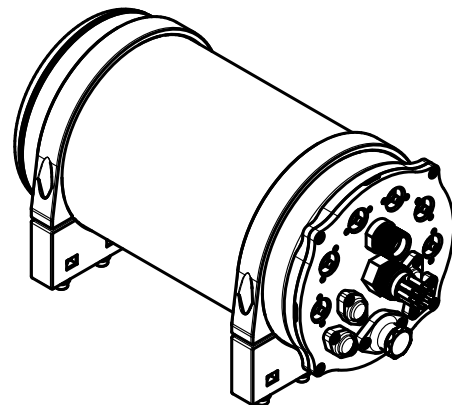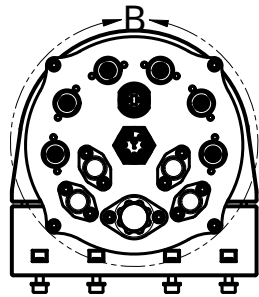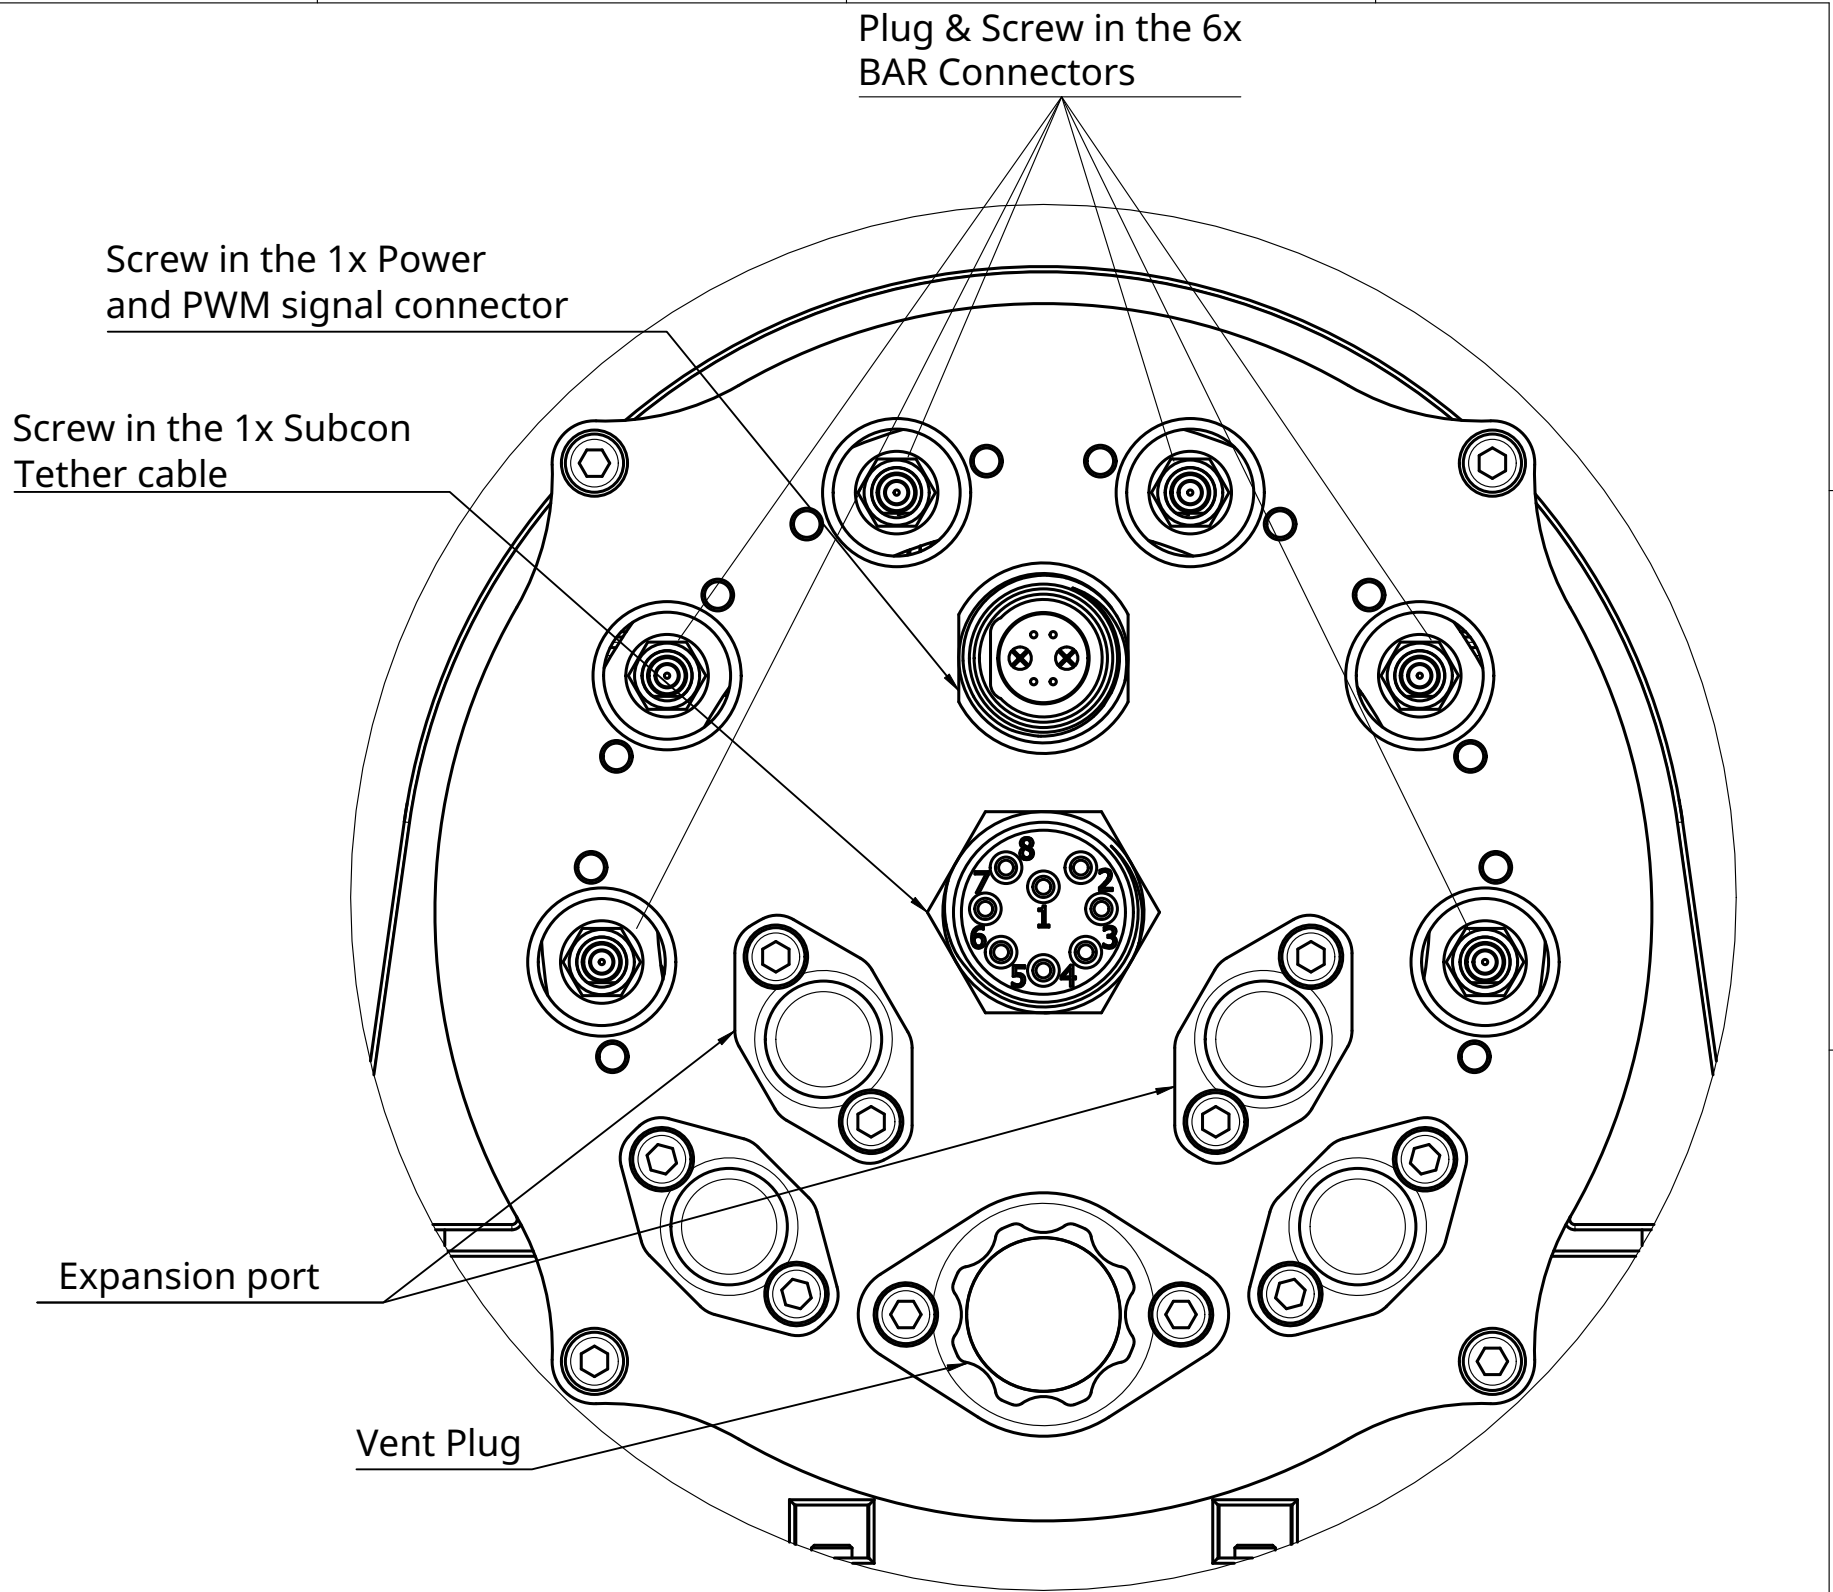

6	UNLESS OTHERWISE SPECIFIED, DIMENSIONS ARE IN MILLIMETERS AND TOLERANCES ACCORDING TO DS/ISO 2768-1m		
	BREAK ALL SHARP EDGES AND REMOVE BURRS		

DRAWN	NAME		DATE
	KEVIN EVARSEN GRAU		2022-10-20
MATERIAL		FINISH	
N/A			

TITLE			
Assembly instrutions Cable Assembly Central Bottle			
SIZE		DWG NO.	REV.
A3			
SCALE	1:4	MASS	SHEET 7 of 9

6

5

4

3

2

1

Assembly instruction

1	6x M2.5 screws
2	1x Dome and retaining ring
3	1x Flange and O-rings
4	1x Lens and jam nut
5	2x Silica Gel
6	2x lid for Silica Gel
7	
8	

Camera Focusing Instruction

Follow this guide.

- 1) Unscrew all 6x M2.5 Screws.
- 2) Remove the Dome and retaining ring together with the screws.
- 5) Put a lens cover over the exposed lens.
- 6) Using a tool to pull out the Flange and O-rings
- 7) Take out both of the Silica gel containiors and set them to dry. (60-80 degress)
- 8) At this point the focus can be adjusted by losening the lens jam nut and rotating the lens. The focus can then be locked by tightening the jam nut.

4x M3 Mounting hole

2x Silica Gel

2x lid for Silica Gel

1x Lens and jam nut

1x Flange and O-rings

1x Dome and retaining ring

6x M2.5 screws

UNLESS OTHERWISE SPECIFIED,
DIMENSIONS ARE IN MILLIMETERS
AND TOLERANCES ACCORDING TO
DS/ISO 2768-1m

BREAK ALL SHARP EDGES AND
REMOVE BURRS

DRAWN

NAME

DATE

MATERIAL

FINISH

N/A

TITLE

Camera Focusing Instruction

SIZE

A3

DWG NO.

REV.

SCALE

1:1

MASS

SHEET

9 of 9

6

5

4

3

2

1