"Smart" Radar Explosion Proof 2 Wire Measurement Sensors"



730 The Kingsway Peterborough , Ont. K9J6W6 Canada Tel: (705) 740 – 2010 Web: www.abmsensor.com Fax: (705) 740 – 2563 E-mail: info@abmsensor.com

FEATURES

2 Wire Operation
Self Adjusting Tracking Radar
Output 4-20 mA / 20- 4 mA
For communications with calibration,
diagnostics & data logging software
Communication with "HART 7"
Measuring Period @ 20 mA = 1 Echo / 36 msec.

APPLICATIONS

Water / Wastewater Chemicals with vapors

MECHANICAL

Conduit Entry: 1/2" NPT

Enclosure: Aluminum /S.S.- 94V0 Ingress Protection: TYPE 4/4X,

NEMA 6 (IP68)

ENVIRONMENTAL

Approvals :FM & CSA for Can. & U\$ Explosion Proof

Class I, Div.1, Groups B, C, D: Dust-Ignition Proof Enclosure for Class II/III Div. 1,Groups E, F, G

CAN: <u>View Certification</u>
US: View Certification

Approvals : FCC Part 15 - Low

Power Communication Device

View Certification

Temperature : - 40 to 140°F (- 40 to 60°C)

Installation Category : Class II

<u>Catalogue #</u> - On the Web return to Home Page & refer to Catalogue Number Structure for ordering information. In Product Documentation refer to page 5.

TECHNICAL SPECIFICATIONS

Radar Range Code	RANGE In Liquids	RESOLUTION	MOUNTING
017	* - 17 ft. * - 5 m	0.08" 2.0 mm	2.0",1 1/2" NPT **
033	* - 33 ft. - 10 m	0.15" 3.9 mm	2.0",1 1/2" NPT **
050	* - 50 ft. * - 15 m	0.22" 5.7 mm	2.0",1 1/2" NPT **
100	* - 100 ft. * - 30 m	0.44" 11 mm	2.0",1 1/2" NPT
140	* - 140 ft. * - 42 m	0.62" 15.7 mm	2.0",1 1/2" NPT
240	* - 240 ft. * - 73 m	1.06" 26 mm	2.0",1 1/2" NPT **

Note - * Minimum Range starts at the lower tip of the antenna for high dielectric material (water). For low dielectric materials allow longer Minimum Range.

Note -**Only 2" and 3"NPT Mtg. Connection Available on High Temperature Radar.

OPTIONAL

Antenna Extension: 6" or 8" Lengths

- Use only with Teflon Antenna!


- Refer to catalogue number Page for ordering info.

High Temperature Unit:

- 2" / 1 1/2" NPT Process Connection

- Teflon De-coupler threads on with 2" NPT Process Connection.





PROCESS

Material Dielectric: Er >2

Pressure: 5 bar Max. 15-75 psi

Temperature: - Std. Sensor

PP Rod: - 40 to 140°F (- 40 to 60°C)

High Temp. Optional Sensor

PTFE Rod: - 40 to 350°F (- 40 to 177°C)
Teflon Temperature De-coupler Required

OPERATIONAL

Operation : Pulse Radar

Accuracy: +/- 0.1% of max. range in lab using

4-20mA current output

+/-0.25% of max. range (typically in field)

Frequency: 6.3 GHz

Loss of Echo Hold: 1 min., 22mA or 2mA output

Transmitter Power: 50 uW average

Calibration: via optional communications port.

(required)

Diagnostics: (Echo Profile) via communications port Antenna: Dielectric rod PP or Optional PTFE

ELECTRICAL SPECIFICATIONS

Power DC 16 to 30 VDC,

ABM200 R load max. = (Vs - 14) / 25 mA

Output 4-20 mA Output 6.1 uA resolution

Optional Communication with "HART 7"


2 Wire Radar Sensors **User Instruction Manual**



730 The Kingsway Peterborough, Ont. K9J6W6 Canada Tel: (705) 740 - 2010 Web: www.abmsensor.com F-mail: info@ahmsensor.com

Fax: (705) 740 - 2563

Fig. #1 - "2 Wire Sensor" Wiring Connection

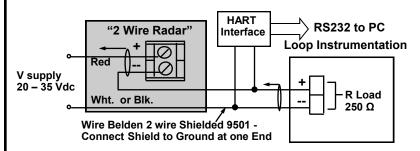


FCC INFORMATION TO RADAR USERS

NOTE: This equipment has been tested and found to comply with the limits for a Class A digital device, pursuant to Part 15 of the FCC Rules. These limits are designed to provided reasonable protection against harmful interference when the equipment is operated in a commercial environment. This equipment generates, uses, and can radiate radio frequency energy and, if not installed and used in accordance with the instruction manual, may cause harmful interference to radio communications. Operation of this equipment in a residential area is likely to cause harmful interference in which case the user will be required to correct the interference at his own expense.

WARNING- Changes or Modifications not expressly approved by ABM Sensor Technology Inc. could void the user's authority to operate the equipment.


Typical Installation

1)Radar unit must be installed into metal fitting with the antenna pointing downward.

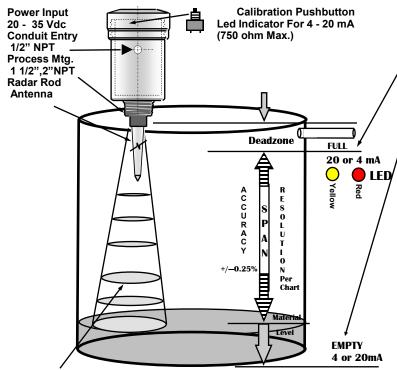

Operation - electromagnetic pulse is transmitted from the ABM sensor . The pulse travels to the surface being monitored and is reflected off this surface back to the sensor. The time of flight is divided by 2 and converted to an output signal directly proportional to the material level .

Top View of Sensor (Access Cover Removed)

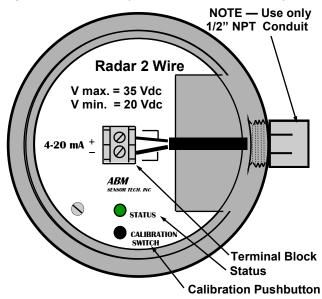

Wiring Information

- Ground shield at one end only.
 All terminal block wiring must be rated for 250V.
- Terminal is for use only with equipment which has no live parts which are accessible.
- Terminal is for use with equipment which maintains basic insulation
- from hazardous voltage under normal and single fault conditions. Connection used at the remote end of external circuit .
- **Recommended Wiring** - 2 Wire shielded 24 AWG, 300 V

Calibration — 4 -20 or 20 - 4 mA Output

FULL — Calibrate 20 mA or 4mA (Set Near Target)

- Calibration mode LED color is blinking Green. (for Radar Low Dielectric Materials has to be off)
- 2. Push button and hold until LED turns Yellow (20 mA) or push button and hold until LED turns Red (4 mA)
- 3. Release button at Yellow or Red and observe LED flashes to acknowledge the calibration.
- EMPTY— Calibrate 4 mA or 20 mA (Set Far Target)
- 1. Calibration mode LED color is blinking Green (for Radar Low Dielectric Materials has to be off)
- 2. Push button and hold until LED turns Red (4 mA) or push button and hold until LED turns Yellow (20 mA)
- 3. Release button at Yellow or Red and observe LED flashes to acknowledge the calibration.


For Radar to turn the Low Dielectric Materials operation mode ON and OFF (this mode is recommended for materials with dielectric constant lower than 4 and also to eliminate multiple reflections in tank.)

- 1) To turn the Low Dielectric Materials ON. Push button and hold until LED goes OFF after the sequence of Yellow ,Red and turns Off. The Low Dielectric Material operation is On when the LED'S Green light gives two short blinks.
- 2) To turn the Low Dielectric Materials OFF. Push button and hold until LED goes OFF after the sequence of Yellow, Red and Turns OFF. The Low Dielectric Material operation is OFF when LED is blinking Green.
- 3) Or use "Hart 7" communication software (Fig. #1).

2 Wire Explosion Proof Radar Level **Measurement Sensors Outline Dimensional Dtl.**

730 The Kingsway , Peterberough , Ont. K9J6W6 Canada Tel. (705) 740 - 2010 Fax.(705) 740 - 2563


Web: www.abmsensor.com E-mail: info@abmsensor.com

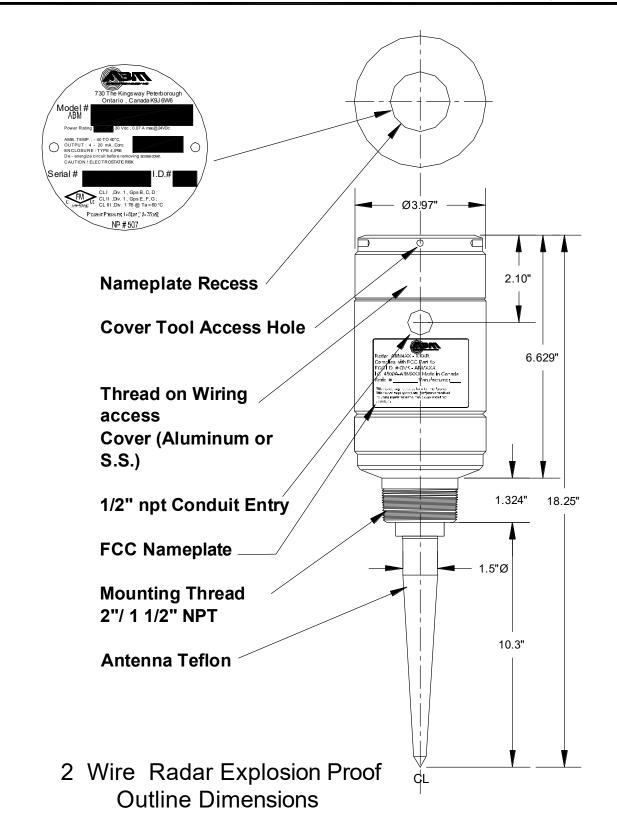

Radar Standard and Exp. Proof Sensors c/w Horn Dimensional Dtl. 730 The Kingsway Peterborough, Ont. K9J6W6 Canada



Tel: (705) 740 – 2010 Fax: (705) 740 – 2563 Web: www.abmsensor.com E-mail: info@abmsensor.com

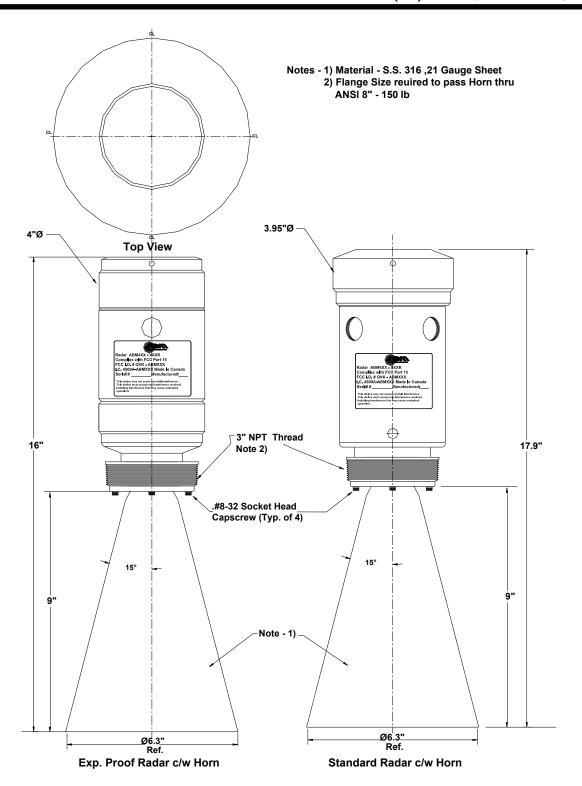

2,3 & 4 Wire Radar Level Sensor with Horn Outline Detail