


# **Lab13-03: Troubleshooting DHCP**

## **Member list:**

1	นาย ชวิน กสิกิจพงศ์พันธ์ 5710500186
2	นาย ภารจ สิงหพันธ์ 5710503495

## **Topology**

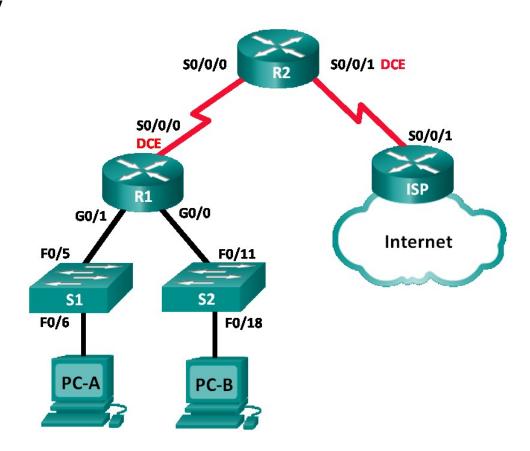

### **Addressing Table**

Device	Interface	IP Address	Subnet Mask	Default Gateway
R1	G0/0	192.168.0.1	255.255.255.128	N/A
	G0/1	192.168.1.1	255.255.255.0	N/A
	S0/0/0 (DCE)	192.168.0.253	255.255.255.252	N/A
R2	S0/0/0	192.168.0.254	255.255.255.252	N/A
	S0/0/1 (DCE)	209.165.200.226	255.255.255.252	N/A
ISP	S0/0/1	209.165.200.225	255.255.255.252	N/A
S1	VLAN 1	192.168.1.2	255.255.255.0	192.168.1.1
S2	VLAN 1	192.168.0.2	255.255.255.128	192.168.0.1
PC-A	NIC	DHCP	DHCP	DHCP
РС-В	NIC	DHCP	DHCP	DHCP

### **Objectives**

Part 1: Build the Network and Configure Basic Device Settings

Part 2: Troubleshoot DHCPv4 Issues

### Background / Scenario

The Dynamic Host Configuration Protocol (DHCP) is a network protocol that lets the network administrators manage and automate the assignment of IP addresses. Without DHCP, the administrator must manually assign and configure IP addresses, preferred DNS servers, and the default gateway. As the network grows in size, this becomes an administrative problem when devices are moved from one internal network to another.

In this scenario, the company has grown in size, and the network administrators can no longer assign IP addresses to devices manually. The R2 router has been configured as a DHCP server to assign IP addresses to the host devices on router R1 LANs. Several errors in the configuration have resulted in connectivity issues. You are asked to troubleshoot and correct the configuration errors and document your work.

Ensure that the network supports the following:

- 1) The router R2 should function as the DHCP server for the 192.168.0.0/25 and 192.168.1.0/24 networks connected to R1.
- 2) All PCs connected to S1 and S2 should receive an IP address in the correct network via DHCP.

**Note**: The routers used with CCNA hands-on labs are Cisco 1941 Integrated Services Routers (ISRs) with Cisco IOS Release 15.2(4)M3 (universalk9 image). The switches used are Cisco Catalyst 2960s with Cisco IOS Release 15.0(2) (lanbasek9 image). Other routers, switches and Cisco IOS versions can be used. Depending on the model and Cisco IOS version, the commands available and output produced might vary from what is shown in the labs. Refer to the Router Interface Summary Table at the end of this lab for the correct interface identifiers.

**Note**: Make sure that the routers and switches have been erased and have no startup configurations. If you are unsure, contact your instructor.

#### **Required Resources**

3 Routers (Cisco 1941 with Cisco IOS Release 15.2(4)M3 universal image or comparable)

- 2 Switches (Cisco 2960 with Cisco IOS Release 15.0(2) lanbasek9 image or comparable)
- 2 PCs (Windows 7, Vista, or XP with terminal emulation program, such as Tera Term)
- Console cables to configure the Cisco IOS devices via the console ports
- Ethernet and serial cables as shown in the topology

## Part 1: Build the Network and Configure Basic Device Settings

In Part 1, you will set up the network topology and configure the routers and switches with basic settings, such as passwords and IP addresses. You will also configure the IP settings for the PCs in the topology.

- Step 1: Cable the network as shown in the topology.
- Step 2: Initialize and reload the routers and switches.
- Step 3: Configure basic settings for each router.
  - a. Disable DNS lookup.
  - b. Configure device name as shown in the topology.
  - c. Assign **class** as the privileged EXEC password.
  - d. Assign **cisco** as the console and vty passwords.
  - e. Configure logging synchronous to prevent console messages from interrupting command entry.
  - f. Configure the IP addresses for all the router interfaces.
  - g. Set clock rate to 128000 for all DCE router interfaces.
  - h. Configure RIP for R1.

```
R1(config)# router rip
R1(config-router)# version 2
R1(config-router)# network 192.168.0.0
R1(config-router)# network 192.168.1.0
R1(config-router)# no auto-summary
R1(config-router)# exit
```

Configure RIP and a static default route on R2.

```
R2(config)# router rip
R2(config-router)# version 2
R2(config-router)# network 192.168.0.0
R2(config-router)# default-information originate
R2(config-router)# no auto-summary
R2(config-router)# exit
R2(config)# ip route 0.0.0.0 0.0.0.0 209.165.200.225
```

j. Configure a summary static route on ISP to the networks on R1 and R2 routers.

```
ISP(config)# ip route 192.168.0.0 255.255.254.0 209.165.200.226
```

#### Step 4: Verify network connectivity between the routers.

If any pings between the routers fail, correct the errors before proceeding to the next step. Use **show ip route** and **show ip interface brief** to locate possible issues.

### Step 5: Configure basic settings for each switch.

- a. Disable DNS lookup.
- b. Configure device name as shown in the topology.
- c. Configure the IP address for the VLAN 1 interface and the default gateway for each switch.
- d. Assign **class** as the privileged EXEC mode password.
- e. Assign **cisco** as the console and vty passwords.
- f. Configure logging synchronous for the console line.

#### Step 6: Verify the hosts are configured for DHCP.

#### Step 7: Load the initial DHCP configuration for R1 and R2.

#### Router R1

```
interface GigabitEthernet0/1
ip helper-address 192.168.0.253
```

#### Router R2

```
ip dhcp excluded-address 192.168.11.1 192.168.11.9
ip dhcp excluded-address 192.168.0.1 192.168.0.9
ip dhcp pool R1G1
  network 192.168.1.0 255.255.255.0
  default-router 192.168.1.1
ip dhcp pool R1G0
  network 192.168.0.0 255.255.255.128
  default-router 192.168.11.1
```

#### Part 2: Troubleshoot DHCPv4 Issues

After configuring routers R1 and R2 with DHCPv4 settings, several errors in the DHCP configurations were introduced and resulted in connectivity issues. R2 is configured as a DHCP server. For both pools of DHCP addresses, the first nine addresses are reserved for the routers and switches. R1 relays the DHCP information to all the R1 LANs. Currently, PC-A and PC-B have no access to the network. Use the **show** and **debug** commands to determine and correct the network connectivity issues.

#### Step 1: Record IP settings for PC-A and PC-B.

- a. For PC-A and PC-B, at the command prompt, enter ipconfig /all to display the IP and MAC addresses.
- b. Record the IP and MAC addresses in the table below. The MAC address can be used to determine which PC is involved in the debug message.

	IP Address/Subnet Mask	MAC Address
PC-A	192.168.1.10 255.255.255.0	8c:89:a5:fa:fe:b9
РС-В	192.168.0.10 255.255.255.0	8c:89:a5:fa:fd:44

#### Step 2: Troubleshoot DHCP issues for the 192.168.1.0/24 network on router R1.

Router R1 is a DHCP relay agent for all the R1 LANs. In this step, only the DHCP process for the 192.168.1.0/24 network will be examined. The first nine addresses are reserved for other network devices, such as routers, switches, and servers.

a. Use a DHCP **debug** command to observe the DHCP process on R2 router.

R2# debug ip dhcp server events

b. On R1, display the running configuration for the G0/1 interface.

```
R1# show run interface g0/1
interface GigabitEthernet0/1
ip address 192.168.1.1 255.255.255.0
ip helper-address 192.168.0.253
duplex auto
speed auto
```

If there are any DHCP relay issues, record any commands that are necessary to correct the configurations errors.

```
___ip helper-address 192.168.0.253_____ipdhcp excluded-address 192.168.0.1 192.168.0.9_____network 192.168.0.0 255.255.255.0____
```

c. In a command prompt on PC-A, type **ipconfig** *I* **renew** to receive an address from the DHCP server. Record the configured IP address, subnet mask, and default gateway for PC-A.

```
_192.168.0.10_____
```

d. Observe the debug messages on R2 router for the DHCP renewal process for PC-A. The DHCP server attempted to assign 192.168.1.1/24 to PC-A. This address is already in use for G0/1 interface on R1. The same issue occurs with IP address 192.168.1.2/24 because this address has been assigned to S1 in the initial configuration. Therefore, an IP address of 192.168.1.3/24 has been assigned to PC-A. The DHCP assignment conflict indicates there may be an issue with the excluded-address statement on the DHCP server configuration on R2.

```
*Mar 5 06:32:16.939: DHCPD: Sending notification of DISCOVER:
*Mar 5 06:32:16.939:
                       DHCPD: htype 1 chaddr 0050.56be.768c
                       DHCPD: circuit id 00000000
*Mar 5 06:32:16.939:
*Mar 5 06:32:16.939: DHCPD: Seeing if there is an internally specified pool class:
*Mar 5 06:32:16.939:
                      DHCPD: htype 1 chaddr 0050.56be.768c
*Mar 5 06:32:16.939:
                       DHCPD: circuit id 00000000
*Mar 5 06:32:16.943: DHCPD: Allocated binding 2944C764
*Mar 5 06:32:16.943: DHCPD: Adding binding to radix tree (192.168.1.1)
*Mar 5 06:32:16.943: DHCPD: Adding binding to hash tree
*Mar 5 06:32:16.943: DHCPD: assigned IP address 192.168.1.1 to client
0100.5056.be76.8c.
*Mar 5 06:32:16.951: %DHCPD-4-PING_CONFLICT: DHCP address conflict: server pinged
192.168.1.1.
```

```
*Mar 5 06:32:16.951: DHCPD: returned 192.168.1.1 to address pool R1G1.
   *Mar 5 06:32:16.951: DHCPD: Sending notification of DISCOVER:
   *Mar 5 06:32:16.951: DHCPD: htype 1 chaddr 0050.56be.768c
   *Mar 5 06:32:16.951: DHCPD: circuit id 00000000
   *Mar 5 06:32:1
   R2#6.951: DHCPD: Seeing if there is an internally specified pool class:
   *Mar 5 06:32:16.951: DHCPD: htype 1 chaddr 0050.56be.768c
                          DHCPD: circuit id 00000000
   *Mar 5 06:32:16.951:
   *Mar 5 06:32:16.951: DHCPD: Allocated binding 31DC93C8
   *Mar 5 06:32:16.951: DHCPD: Adding binding to radix tree (192.168.1.2)
   *Mar 5 06:32:16.951: DHCPD: Adding binding to hash tree
   *Mar 5 06:32:16.951: DHCPD: assigned IP address 192.168.1.2 to client
   0100.5056.be76.8c.
   *Mar 5 06:32:18.383: %DHCPD-4-PING_CONFLICT: DHCP address conflict: server pinged
   192,168,1,2,
   *Mar 5 06:32:18.383: DHCPD: returned 192.168.1.2 to address pool R1G1.
   *Mar 5 06:32:18.383: DHCPD: Sending notification of DISCOVER:
   *Mar 5 06:32:18.383: DHCPD: htype 1 chaddr 0050.56be.6c89
   *Mar 5 06:32:18.383:
                           DHCPD: circuit id 00000000
   *Mar 5 06:32:18.383: DHCPD: Seeing if there is an internally specified pool class:
   *Mar 5 06:32:18.383: DHCPD: htype 1 chaddr 0050.56be.6c89
   *Mar 5 06:32:18.383: DHCPD: circuit id 00000000
   *Mar 5 06:32:18.383: DHCPD: Allocated binding 2A40E074
   *Mar 5 06:32:18.383: DHCPD: Adding binding to radix tree (192.168.1.3)
   *Mar 5 06:32:18.383: DHCPD: Adding binding to hash tree
   *Mar 5 06:32:18.383: DHCPD: assigned IP address 192.168.1.3 to client
   0100.5056.be76.8c.
   <output omitted>
e. Display the DHCP server configuration on R2. The first nine addresses for 192.168.1.0/24 network are
   not excluded from the DHCP pool.
   R2# show run | section dhcp
   ip dhcp excluded-address 192.168.11.1 192.168.11.9
   ip dhcp excluded-address 192.168.0.1 192.168.0.9
   ip dhcp pool R1G1
    network 192.168.1.0 255.255.255.0
    default-router 192.168.1.1
   ip dhcp pool R1G0
    network 192.168.0.0 255.255.255.128
    default-router 192.168.1.1
   Record the commands to resolve the issue on R2.
     R2 (config)# no ip dhcp excluded-address 192.168.11.1 192.168.11.9
     R2 (config)# ip dhcp excluded-address 192.168.1.1 192.168.1.9
  At the command prompt on PC-A, type ipconfig /release to return the 192.168.1.3 address back to the
   DHCP pool. The process can be observed in the debug message on R2.
   *Mar 5 06:49:59.563: DHCPD: Sending notification of TERMINATION:
   *Mar 5 06:49:59.563: DHCPD: address 192.168.1.3 mask 255.255.255.0
   *Mar 5 06:49:59.563: DHCPD: reason flags: RELEASE
   *Mar 5 06:49:59.563: DHCPD: htype 1 chaddr 0050.56be.768c
```

```
*Mar 5 06:49:59.563: DHCPD: lease time remaining (secs) = 85340
      *Mar 5 06:49:59.563: DHCPD: returned 192.168.1.3 to address pool R1G1.
   g. At the command prompt on PC-A, type ipconfig /renew to be assigned a new IP address from the DHCP
      server. Record the assigned IP address and default gateway information.
         IP address/subnet mask: 192.168.1.10/24 Default gateway: 192.168.1.1
      The process can be observed in the debug message on R2.
      *Mar 5 06:50:11.863: DHCPD: Sending notification of DISCOVER:
      *Mar 5 06:50:11.863: DHCPD: htype 1 chaddr 0050.56be.768c
      *Mar 5 06:50:11.863: DHCPD: circuit id 00000000
      *Mar 5 06:50:11.863: DHCPD: Seeing if there is an internally specified pool class:
      *Mar 5 06:50:11.863: DHCPD: htype 1 chaddr 0050.56be.768c
      *Mar 5 06:50:11.863: DHCPD: circuit id 00000000
      *Mar 5 06:50:11.863: DHCPD: requested address 192.168.1.3 has already been assigned.
      *Mar 5 06:50:11.863: DHCPD: Allocated binding 3003018C
      *Mar 5 06:50:11.863: DHCPD: Adding binding to radix tree (192.168.1.10)
      *Mar 5 06:50:11.863: DHCPD: Adding binding to hash tree
      *Mar 5 06:50:11.863: DHCPD: assigned IP address 192.168.1.10 to client
      0100.5056.be76.8c.
      <output omitted>
   h. Verify network connectivity.
      Can PC-A ping the assigned default gateway? _____Yes____
      Can PC-A ping the R2 router? Yes
      Can PC-A ping the ISP router? ___Yes____
Step 3: Troubleshoot DHCP issues for 192.168.0.0/25 network on R1.
   Router R1 is a DHCP relay agent for all the R1 LANs. In this step, only the DHCP process for the
   192.168.0.0/25 network is examined. The first nine addresses are reserved for other network devices.
   a. Use a DHCP debug command to observe the DHCP process on R2.
      R2# debug ip dhcp server events
   b. Display the running configuration for the G0/0 interface on R1 to identify possible DHCP issues.
      R1# show run interface q0/0
      interface GigabitEthernet0/0
        ip address 192.168.0.1 255.255.255.128
       duplex auto
       speed auto
      Record the issues and any commands that are necessary to correct the configurations errors.
        ip helper-address 192.168.0.253
      ____ipdhcp excluded-address 192.168.0.1 192.168.0.9_____
      network 192.168.0.0 255.255.255.0
   c. From the command prompt on PC-B, type ipconfig /renew to receive an address from the DHCP server.
      Record the configured IP address, subnet mask, and default gateway for PC-B.
       192.168.0.10
```

d.	<ul> <li>d. Observe the debug messages on R2 router for the renewal process for PC-A. The DHCP server assign 192.168.0.10/25 to PC-B.</li> </ul>				
	*Mar 5 07:15:09.663: DHCPD: Sending notification of DISCOVER:				
	*Mar 5 07:15:09.663: DHCPD: htype 1 chaddr 0050.56be.f6db				
	*Mar 5 07:15:09.663: DHCPD: circuit id 00000000				
	*Mar 5 07:15:09.663: DHCPD: Seeing if there is an internally specified pool class:				
	*Mar 5 07:15:09.663: DHCPD: htype 1 chaddr 0050.56be.f6db				
	*Mar 5 07:15:09.663: DHCPD: circuit id 00000000				
	*Mar 5 07:15:09.707: DHCPD: Sending notification of ASSIGNMENT:				
	*Mar 5 07:15:09.707: DHCPD: address 192.168.0.10 mask 255.255.255.128				
	*Mar 5 07:15:09.707: DHCPD: htype 1 chaddr 0050.56be.f6db				
	*Mar 5 07:15:09.707: DHCPD: lease time remaining (secs) = 86400				
e.	. Verify network connectivity.				
	Can PC-B ping the DHCP assigned default gateway?Yes				
	Can PC-B ping its default gateway (192.168.0.1)?No				
	Can PC-B ping the R2 router?Yes				
	Can PC-B ping the ISP router?Yes				
f.	If any issues failed in Step e, record the problems and any commands to resolve the issues.				
	R2(config)# ip dhcp pool R1G0				
	R2(dhcp-config)# default-router 192.168.0				
g	. Release and renew the IP configurations on PC-B. Repeat Step e to verify network connectivity.				
h.	. Discontinue the debug process by using the <b>undebug all</b> command.				
	R2# undebug all				
	All possible debugging has been turned off				
Refle	ection				
V	Vhat are the benefits of using DHCP?				
	ั้ เพื่อให้การแจกจ่ายipเป็นไปได้อย่างอัตโนมัติไม่ตังมาคอย configทีละเครื่องว่าให้เครื่องเหล่านั้นได้รับipใดไป				
_	 ยิ่งหากมีจำนวน Device ที่เยอะและแตกต่างกันมากแล้ว การconfig DHCP จะมีประโยชน์มากกว่าการconfigแบบ Static				
_					