

FI Finland – Cable Condition Analysis Report




Overview:

- Total analyzed outlets: 32
- Data coverage: until 21.10.2025
- Objective: Identify potential cable-temperature anomalies

Result:

- ✓ No critical trends in most outlets.
- ✓ One outlet (**gkybxi – Outlet 3**) shows a **steady temperature increase** worth checking.

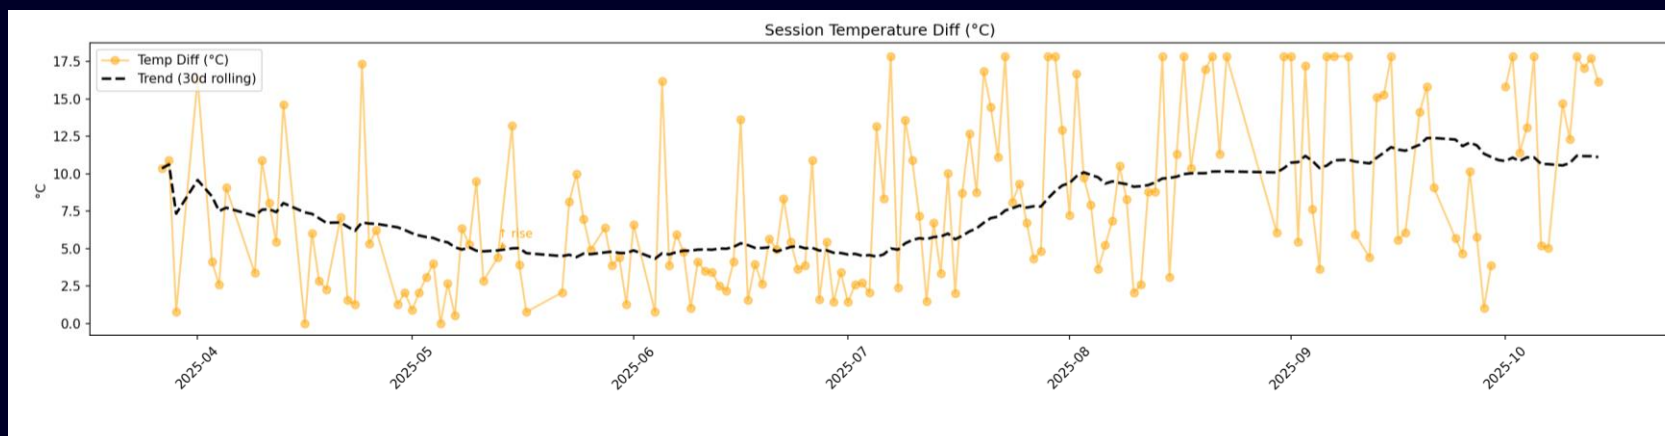

❖ Gradual temperature rise pattern ($\Delta T > 5\text{ °C}$)

FI Finland – Field Feedback (gkybxi / DC3)

- DC3 plug showed **burnt** and **melted contacts** with **visible gaps** and **pin deformation**.
- **Cable Holder (gland) broken**, so the cable leaned down, adding mechanical stress to the connector.
- After **cleaning** the pins, the charger worked for about **2 minutes**, then **stopped** due to **temperature difference**.
- Repeated tests started the session, but **no power was delivered**, suggesting internal contact damage or safety cutoff.



Recommended Next Steps:

- Inspect the physical connector of Outlet 3 (gkybxl)
- **Clean** contacts and check for mechanical stress or oxidation.
- Continue monitoring temperature and event data in the next 2–4 weeks to confirm if the trend stabilizes

