## **FMA SERIES**

## MicroForce Sensors, Compensated/Amplified

## **DESCRIPTION**

The FMA Series are piezoresistive-based force sensors offering a digital output for reading force over the specified full scale force span and temperature range. They are fully calibrated and temperature compensated for sensor offset, sensitivity, temperature effects, and nonlinearity using an on-board Application Specific Integrated Circuit (ASIC). Direct mechanical coupling allows for easy interface with the sensor, coupling with tubing, membrane or a plunger, providing repeatable performance and a reliable mechanical interface to the application. All products are designed and manufactured according to ISO 9001 standards. These products offer a more stable output which is directly proportional to the force applied to the mechanically-coupled sphere.

The FMA Series is available with pocket tape and reel packaging.

#### **VALUE TO CUSTOMERS**

The FMA Series are designed to meet the customer's need for a compensated, amplified force sensor which provides digital outputs, a variety of force sensing ranges, a small, cost-effective format, and enhanced durability and accuracy. The flexible design provides multiple standard configurations over a wide operating temperature range.

#### DIFFERENTIATION

- Multiple force ranges allow the customer to choose the force range to maximize sensitivity and improve system resolution/performance
- Smaller package allows for space constrained applications
- Robust design provides enhanced durability in applications where overforce may exist
- Enhanced accuracy includes all errors due to force non-linearity, force hysteresis, and non-repeatability
- Reduced Total Error Band enhances system performance
- Digital output enhances performance through reduced conversion requirements and the convenience of direct interface to microprocessors
- Diagnostic functions allow the user to determine if the sensor is working correctly by detecting if electrical paths are broken or shorted inside the sensor
- Selectable supply voltages provide customers with design flexibility


## **POTENTIAL APPLICATIONS**

#### **MEDICAL**

- Infusion pumps
- Ambulatory pumps
- Enteral feeding pumps
- Kidney dialysis machines

#### **INDUSTRIAL**

- Load and compression sensing
- Touch panels
- Switch replacement
- Robotic equipment
- Weight measurement
- Force/grip measuring equipment

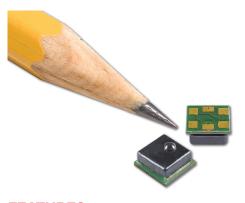

## **FEATURES**

- Small form factor: 5 mm x 5 mm
   [0.20 in x 0.20 in]
- Accuracy: ±2 %FSS typical
- SPI- or I<sup>2</sup>C-compatible digital output
- Fully calibrated and temperature compensated over a temperature range of 5°C to 50°C [41°F to 122°F]
- Available in a wide variety of standard and configurable force ranges
- Overforce: 3X force range
- Supply voltage: 3.3 Vdc typ. or 5.0 Vdc typ.
- Low power consumption: 14 mW
- Enhanced part-to-part repeatability
- Enhanced reliability
- Stable, stainless steel sphere interface
- Internal diagnostic functions available
- REACH and RoHS compliant

The FMA Series joins the FSA Series, FSG Series, FSS Series, FSS-SMT Series, TBF Series, and 1865 Series Force Sensors. To view the entire product portfolio, click here.



TABLE 1. ABSOLUTE MAXIMUM SPECIFICATIONS				
CHARACTERISTIC	MINIMUM	TYPICAL	MAXIMUM	UNIT
Supply voltage	-0.3	_	6.0	Vdc
Voltage on any pin	-0.3	_	Vsupply + 0.3	V
Digital clock frequency: SPI I <sup>2</sup> C	50 100	_	800 400	kHz
ESD susceptibility (human body model)	8	_	_	kV
Storage temperature range	-40 [-40]	_	85 [185]	°C °[F]
Overforce limit	_	_	3X force range <sup>1</sup>	_

 $<sup>^{1}</sup>$ Repeated exposure to the overforce may cause permanent damage to the sensor.

TABLE 2. OPERATING SPECIFICATIONS				
CHARACTERISTIC	MINIMUM	TYPICAL	MAXIMUM	UNIT
Supply voltage (Vsupply) <sup>1, 2, 3</sup> : 3.3 Vdc 5.0 Vdc	3.0 4.75	3.3 5.0	3.6 5.25	Vdc
Supply current: 3.3 Vdc 5.0 Vdc	_ _	2.8 3.9	3.9 4.6	mA
Powerinput	_	20	_	mW
Operating temperature range <sup>4</sup>	-40 [-40]	_	85 [185]	°C °[F]
Compensated temperature range <sup>5</sup>	5 [41]	_	50[122]	°C °[F]
Storage temperature range	-40 [-40]	_	85 [185]	°C °[F]
Startup time (power up to data ready)	_	_	3	ms
Response time	_	0.42	0.84	ms
SPI/I <sup>2</sup> C voltage level: low high	_ 80	_ _ _	20	$V_{\text{supply}}$
Pull up on SDA/MISO, SCL/SCLK, SS	1	_	_	kOhm
Accuracy <sup>6</sup>	_	±2	_	%FSS <sup>7</sup> BFSL
Total Error Band <sup>8</sup>	_	_	±8	%FSS
Output resolution	12	-	-	bits
Long term stability	_	±1.6	_	%FSS

<sup>&</sup>lt;sup>1</sup>Sensors are either 3.3 Vdc or 5.0 Vdc based on the catalog listing selected.

<sup>&</sup>lt;sup>2</sup>Ratiometricity of the sensor (the ability of the device output to scale to the supply voltage) is achieved within the specified operating voltage.

<sup>&</sup>lt;sup>3</sup>The sensor is not reverse polarity protected. Incorrect application of supply voltage or ground to the wrong pin may cause electrical failure.

<sup>&</sup>lt;sup>4</sup>Operating temperature range: The temperature range over which the sensor will produce an output proportional to force.

<sup>&</sup>lt;sup>5</sup>Compensated temperature range: The temperature range over which the sensor will produce an output proportional to force within the specified performance limits.

<sup>&</sup>lt;sup>6</sup>**Accuracy:** The maximum deviation in output from a Best Fit Straight Line (BFSL) fitted to the output measured over the force range with single load-unload cycle at 25°C. Includes all errors due to force non linearity, force hysteresis, and non repeatability.

 $<sup>^7</sup>$ Full Scale Span (FSS): The algebraic difference between the output voltage at full scale force and the output at zero force.

<sup>&</sup>lt;sup>8</sup>Total Error Band (TEB): Combined error from calibration, accuracy and temperature effects over the compensated temperature range at 5.0 V from 20 %FSS to 80 %FSS.


TABLE 3. ENVIRONMENTAL SPECIFICATIONS		
CHARACTERISTIC	PARAMETER	
Humidity	0% to 95% RH, non-condensing	
Vibration	MIL-STD-202, Method 214, Condition 1F (20.71 Gms)	
Shock	MIL-STD-202, Method 213, Condition A (50 G)	
Life <sup>1</sup>	1 million full scale force cycles minimum	

 $<sup>^{1}</sup>$ Life may vary depending on specific application in which the sensor is utilized.

TABLE 4. MATERIALS	
COMPONENT	MATERIAL <sup>1</sup>
Covers	liquid crystal polymer
Sphere contact element	stainless steel 440C
Substrate	FR4
Adhesives	epoxy, silicone
Electronic components	silicon, glass, solder


 $<sup>^{1}\</sup>mbox{Contact}$  Honeywell customer service for detailed material information.

## **FIGURE 1. TRANSFER FUNCTION LIMITS**

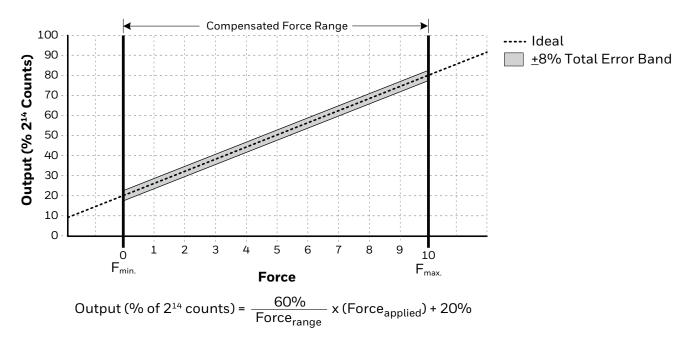

#### FIGURE 2. NOMENCLATURE AND ORDER GUIDE

For example, **FMAMSDXX025WCSC3** defines an FMA Series Force Sensor, compensated/amplified, mechanically coupled, sphere contact element, sensor short and open diagnostics, 25 N force range, force unit in N, compression force type, SPI digital output, 20% to 80% transfer function, 3.3 Vdc supply voltage<sup>1</sup>

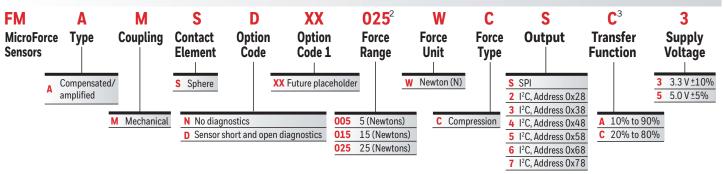

 $<sup>^{</sup>m 1}$  Custom configurations are available upon request. Please contact Honeywell Sales.

Note: Breakout boards, designed for use with the Honeywell SEB002 Sensor Evaluation Kit, are available with the FMA Series sensor already mounted. Please contact your Honeywell representative for details.

TABLE 5. FMA SERIES AVAILABILITY <sup>1</sup>			
CATALOG LISTING	FORCE RANGE	OUTPUT	DESCRIPTION
FMAMSDXX005WCSC3	5 N	SPI	FMA Series Force Sensor, compensated/amplified, mechanically coupled, sphere contact element, sensor short and open diagnostics, 5 N force range, compression force type, SPI digital output, 20% to 80% transfer function, 3.3 V $\pm 10\%$ supply voltage
FMAMSDXX005WC2C3		I <sup>2</sup> C, address 0x28	FMA Series Force Sensor, compensated/amplified, mechanically coupled, sphere contact element, sensor short and open diagnostics, 5 N force range, compression force type, I²C digital output, address 0x28, 20% to 80% transfer function, 3.3 V $\pm 10\%$ supply voltage
FMAMSDXX015WCSC3	15 N	SPI	FMA Series Force Sensor, compensated/amplified, mechanically coupled, sphere contact element, sensor short and open diagnostics, 15 N force range, compression force type, SPI digital output, 20% to 80% transfer function, 3.3V ±10% supply voltage
FMAMSDXX015WC2C3		I <sup>2</sup> C, address 0x28	FMA Series Force Sensor, compensated/amplified, mechanically coupled, sphere contact element, sensor short and open diagnostics, $15\text{N}$ force range, compression force type, $I^2\text{C}$ digital output, address 0x28, 20% to80% transfer function, 3.3 V ±10% supply voltage
FMAMSDXX025WCSC3	25 N	SPI	FMA Series Force Sensor, compensated/amplified, mechanically coupled, sphere contact element, sensor short and open diagnostics, 25 N forcerange, compression force type, SPI digital output, 20% to 80% transfer function, 3.3 V $\pm 10\%$ supply voltage
FMAMSDXX025WC2C3		I <sup>2</sup> C, address 0x28	FMA Series Force Sensor, compensated/amplified, mechanically coupled, sphere contact element, sensor short and open diagnostics, 25 N force range, compression force type, $I^2C$ digital output, address 0x28, 20% to 80% transfer function, 3.3 V ±10% supply voltage

<sup>&</sup>lt;sup>1</sup>These catalog listings are production released and are readily available. Other configurations per Figure 2 are possible; however, minimum order quantity thresholds and NRE may apply. Please consult the factory.

<sup>&</sup>lt;sup>2</sup> Three characters specify the desired force level; allowable characters are the numbers 0 through 9. See Table 5 for currently configurable force ranges.

<sup>&</sup>lt;sup>3</sup> For other available transfer functions, contact Honeywell Customer Service.

## FIGURE 3. SENSOR MOUNTING DIMENSIONS (FOR REFERENCE ONLY: MM/[IN].)


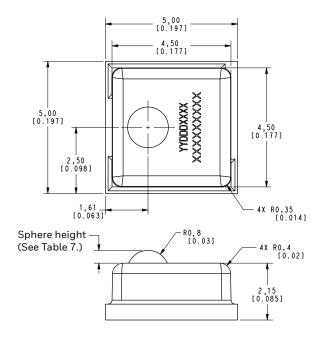



TABLE 6. PINOUT			
FUNCTION			
I <sup>2</sup> C	SPI		
VS	VS		
NC	SS		
GND	GND		
SCL	SCLK		
SDA	MISO		
NC	NC		
	FUNC  I <sup>2</sup> C  VS  NC  GND  SCL  SDA		

TABLE 7. SPHERE FORCE VS HEIGHT			
FORCE (N)	SPHERE HEIGHT (MM)		
5	0,293 ±0,075		
15	0,393 ±0,075		
25	0,483 ±0,075		

## **Solder Pad Layout** (viewed from top)

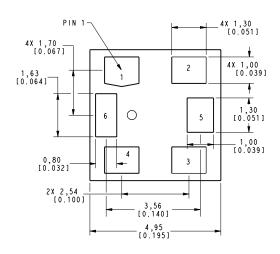



## **Recommended Land Pattern**

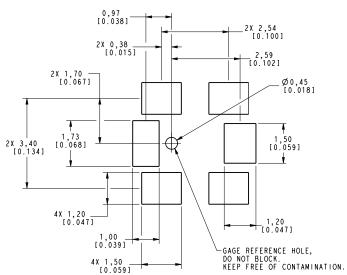


5

## FIGURE 4. REEL MOUNTING DIMENSIONS (FOR REFERENCE ONLY: MM/[IN], ALL DIMENSIONS COMPLY WITH EIA-481-1.)

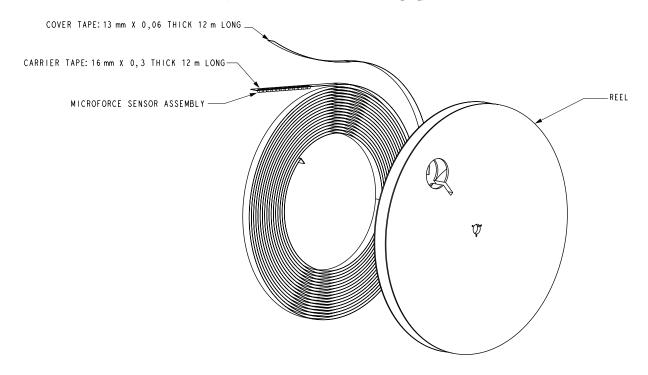

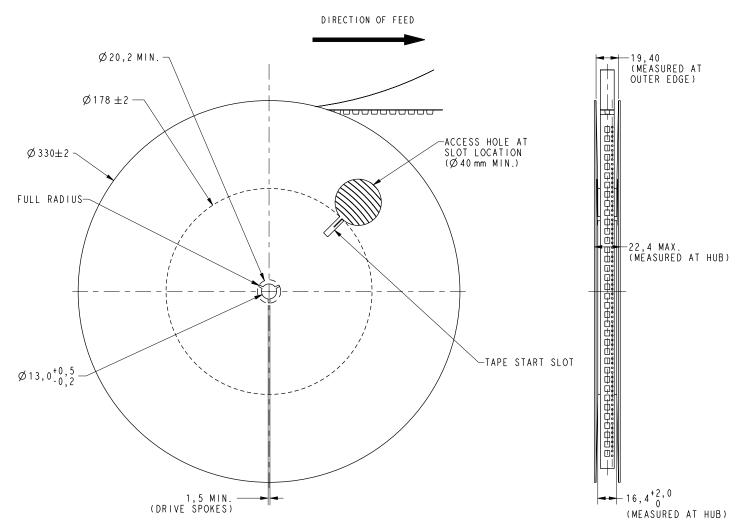

## FIGURE 5. TAPE MOUNTING DIMENSIONS (FOR REFERENCE ONLY: MM/[IN], ALL DIMENSIONS COMPLY WITH EIA-481-1.)

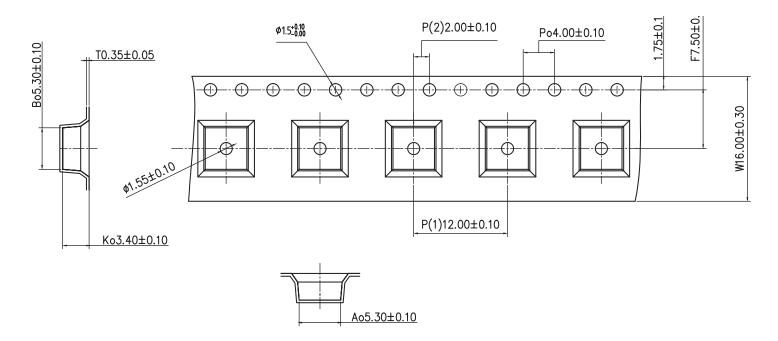

Note: FMA Series products are shipped in tape and reel packaging with a Minimum Order Quantity (MOQ) of 160 pieces. The maximum tape and reel quantity is 960 pieces per reel.



7

#### **ADDITIONAL MATERIALS**

The following associated literature is available at sensing.honeywell.com:

- Product range guide
- Technical notes:
  - MicroForce Sensor Coupling
  - Overforce Design Considerations
  - Force Sensor Diagnostics
  - Digital Output Force Sensors I<sup>2</sup>C Communications
  - Digital Output Force Sensors SPI Communications
- Other technical notes
- Application notes
- Sell Sheets
- CAD Models

#### WARRANTY/REMEDY

Honeywell warrants goods of its manufacture as being free of defective materials and faulty workmanship during the applicable warranty period. Honeywell's standard product warranty applies unless agreed to otherwise by Honeywell in writing; please refer to your order acknowledgment or consult your local sales office for specific warranty details. If warranted goods are returned to Honeywell during the period of coverage, Honeywell will repair or replace, at its option, without charge those items that Honeywell, in its sole discretion, finds defective.

The foregoing is buyer's sole remedy and is in lieu of all other warranties, expressed or implied, including those of merchantability and fitness for a particular purpose. In no event shall Honeywell be liable for consequential, special, or indirect damages.

## **△ WARNING**PERSONAL INJURY

DO NOT USE these products as safety or emergency stop devices or in any other application where failure of the product could result in personal injury.

Failure to comply with these instructions could result in death or serious injury.

# **⚠ WARNING**MISUSE OF DOCUMENTATION

- The information presented in this product sheet is for reference only. Do not use this document as a product installation guide.
- Complete installation, operation, and maintenance information is provided in the instructions supplied with each product.

Failure to comply with these instructions could result in death or serious injury.

While Honeywell may provide application assistance personally, through our literature and the Honeywell web site, it is buyer's sole responsibility to determine the suitability of the product in the application.

Specifications may change without notice. The information we supply is believed to be accurate and reliable as of this writing. However, Honeywell assumes no responsibility for its use.

## FOR MORE INFORMATION

Honeywell Advanced Sensing
Technologies services its customers
through a worldwide network of sales
offices and distributors. For application
assistance, current specifications, pricing
or the nearest Authorized Distributor, visit
our website or call:

Asia Pacific +65 6355-2828 Europe +44 1698 481481 USA/Canada +1-302-613-4491

Honeywell

Advanced Sensing Technologies

830 East Arapaho Road Richardson, TX 75081 sps.honeywell.com/ast

