

The Lid Says Vanilla. Does the Tub Agree?

Inside a VeriPak inspection system that reads the lid and the sidewall of every ice cream tub at 65 per minute, rejects the mismatches, and logs the rest.



The lid-match inspection system before shipment: split-belt conveyor, inspection shroud, and controls enclosure on one frame.

Case basis: Ice cream production, North Carolina. Customer anonymized pending approval. • Published September 2026.

Executive Summary

A round ice cream tub tells you what it is twice: once on the lid, once on the sidewall. On a lidding line running two dozen flavors, those two statements can disagree. A stack of French vanilla lids loaded onto a cookies-and-cream run produces a package that looks finished, weighs right, seals fine, and is mislabeled. Nothing upstream catches it, and the consequences land downstream: allergen exposure, retailer chargebacks, and the kind of recall that starts with a consumer photo.

This paper walks through an inspection system AQS engineered, built, and commissioned for an ice cream plant in the Southeast that packs 48-ounce tubs for a national brand. The system sits directly after the liddler. It gaps each tub, spins it 180 degrees on a split belt, reads the lid with a vision sensor and the sidewall UPC with a code reader, checks both against the active product in the Product Configuration Library, and pushes any tub that fails out of the flow. Every tub, every read, and every reject is logged, with checkweigh data captured by SKU alongside.

- Inspects 100% of tubs at 65 per minute with no fixed orientation required at infeed
- Reads lid text and sidewall UPC on every tub and requires both to match the running SKU

- Replaces a six-reader ring array with two readers and one camera by rotating the product instead
- Ships pre-loaded with 24 SKUs and room for 40, changed from a single dropdown on the HMI
- Type 316 stainless, IP69K washdown, 56 by 47 inch footprint, one Meltric plug and one air drop

The short version: the tub proves it is what the lid says it is, or it leaves the line, and the plant has the record either way.

A Mislabeled Is a Recall Waiting for a Reason

Most inspection equipment on a packaging line answers a physical question. Is there metal in it? Does it weigh enough? Is the seal intact? A lid-to-body mismatch passes every one of those tests. The package is complete and correct in every way except identity.

Identity matters more in ice cream than almost anywhere else. Flavors share a filler, a lidder, and a case packer, and they change over often. Lids arrive in stacks and get loaded by hand. Bodies are printed and staged separately. The two streams meet at the lidder and nothing verifies they agree. One flavor contains egg, another contains tree nuts, and a third contains neither, and the allergen statement is on the body while the flavor name a consumer reads first is on the lid. When they disagree, the plant owns an undeclared-allergen risk it cannot see.

The plant in this case wanted every tub verified before it reached the case packer, without adding operators and without asking the line to slow down. They had one more constraint that shaped the whole design: they did not want a wall of hardware to do it.

Fewer Readers, One Rotating Tub

The first proposal on the table, from the sensor vendor, was a ring of six fixed code readers around the conveyor so that a barcode at any orientation would land in someone's field of view. It would have worked. It would also have meant six readers, six mounts, six cables, and six things to clean, align, and keep in calibration.



Section view of the inspection zone: split belt rotates the tub while the vision sensor reads the lid and the code reader scans the sidewall.

AQS took the opposite approach: move the product, not the sensors. If the tub rotates a controlled 180 degrees while it travels through the inspection zone, one code reader sees the entire sidewall and one camera sees the entire lid. The mechanism that makes that happen is a split belt: two independent 3-inch flat-top belts running side by side, each on its own hub motor and drive. Run them at different speeds and a round tub riding on both of them rolls as it travels. The speed ratio sets how far it turns in

the length of the zone. The calculation is not exotic; with the tub's circumference, the zone length, and the line rate, the belt differential falls out directly, and the drives are set to match.

The inspection zone came out at roughly 18 inches of travel, with two Keyence SR-2000W code readers covering the sidewall and a Keyence IV4 vision sensor covering the lid. The sensor sizing was verified against the vendor's own installation model at 1.4 pixels per cell on the barcode, comfortably above the 1.1 minimum, at the 14.7-inch standoff the mechanical layout allowed.


Parameter	Specification
Line rate	65 tubs per minute
Product	48 oz (1.5 qt) round ice cream tubs, presented lid down, no rotational orientation
Inspection	Lid text via Keyence IV4 vision sensor; sidewall UPC via two Keyence SR-2000W code readers
Verification	Lid read and 11-character UPC must both match the active SKU
SKU library	24 SKUs loaded at commissioning; capacity for 40
Conveyance	Split belt, two 3 in Intralox S1100 flat-top belts, 86 and 147 ft/min, OneMotion hub motors on Allen-Bradley PowerFlex drives
Gapping	Pneumatic infeed stop for consistent product spacing
Reject	RapidFire pneumatic pusher to customer reject table; audible alarm and upstream pause output on consecutive rejects
Controls	Allen-Bradley CompactLogix 5069 PLC, FactoryTalk Optix touchscreen HMI, IO-Link I/O
Data	Per-tub inspection log; checkweigh data captured by SKU; CSV export and FTP transfer to plant server
Access	Two credentialed levels: Operator and Maintenance
Construction	Type 316 stainless frame and shroud; NGI hygienic feet and bearings; IP69K washdown
Utilities	480 V, 15 A on a single Meltric plug; clean dry plant air at one drop
Footprint	56 in long by 47 in wide; 35.6 in belt height, adjustable ± 3 in

How an Inspection Cycle Works

- **Enter.** Tubs arrive from the ladder lid-down, at line pace, in whatever rotation they happen to be. The system does not ask the upstream line to orient anything.
- **Gap.** A photo eye sees the incoming tub and a pneumatic stop holds it for a fraction of a second, opening a consistent gap to the tub ahead. The read windows are timed off this gap, so spacing is what makes the rest of the cycle repeatable.
- **Spin.** The tub crosses onto the split belt. With one belt running 1.7 times faster than the other, it rolls a half turn through the inspection zone.
- **Read.** The vision sensor reads the lid text and color. The code readers pick up the sidewall UPC as it rotates past. Both results go to the PLC.
- **Decide.** The PLC compares both reads to the active SKU in the Product Configuration Library. A tub passes only when the lid and the barcode both match. A no-read on either counts as a fail; the system errs toward rejecting a good tub rather than passing a bad one.

- **Reject or release.** A failing tub is pushed onto the reject table for an operator to inspect. The conservative default kicks the following tub as well on a lid failure, since two mismatched lids in a row usually share a cause. Passing tubs continue to the case packer.
- **Log.** Every cycle is recorded with SKU, time, and result. Where the plant's checkweigher is connected, the weight rides along in the same record.

Changing flavors is a dropdown and an Apply button. Each SKU profile holds the lid text, the sidewall identifier, and the checkweigh setpoints, and recipes can be browsed on the HMI while the current one is still running.

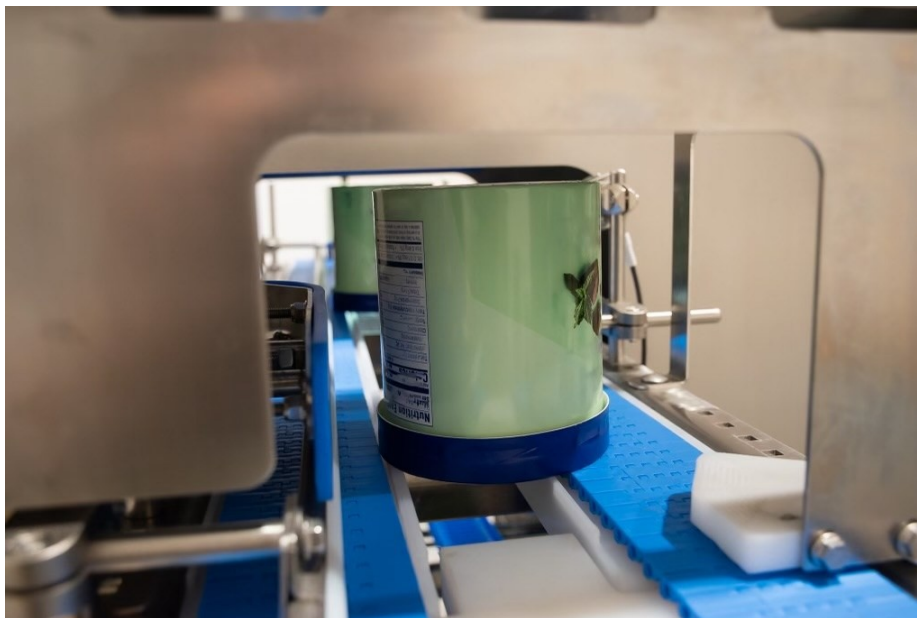

Inside the inspection tunnel: a tub rides the two independent belts past the sidewall code reader.

Verification Is the Product

The system's value is not that it moves ice cream. Plenty of conveyors do that. Its value is that it turns an assumption ("the lids loaded on this run are the right lids") into a verified fact for every tub, and it keeps the receipt.

That is the pattern VeriPak is built around. The inspection devices do what they do well: a vision sensor reads text, a code reader reads codes. VeriPak supplies the part they cannot do on their own, which is knowing which product is supposed to be running, deciding what a pass looks like, acting on the result with a reject, and writing all of it into a production record. The plant did not buy two readers and a camera. It bought the answer to a question, delivered 65 times a minute, with a log.

The record matters as much as the reject. When a retailer or a brand owner asks whether a lot was mislabeled, the plant does not reconstruct a shift from memory. It exports the run.

Engineered for the Wash

Ice cream plants sanitize hard and often. The frame and shroud are Type 316 stainless, formed from 10 and 12 gauge sheet, with hygienic leveling feet and sealed bearings. The whole system is rated IP69K, with the touchscreen the one component that gets a cover before the hoses come out. Power arrives on a single Meltric plug, so the machine disconnects for cleaning without an electrician, and the only air connection is one half-inch drop.

Commissioning turned up one lesson worth passing on. Within weeks of startup, one flavor began rejecting at a rate that made no sense. The cause was a polarizing filter on the vision sensor that had

clouded under chlorinated washdown. Removing it fixed the reads. Sanitation chemistry is part of the operating environment, and optics that are fine in a lab or a dry plant are not automatically fine in a dairy. The system now runs without the filter, and it is on the checklist for every washdown vision application AQS builds.

Built Around the Line You Already Run

The system installed as a drop-in section between the lidder and the case packer: 56 inches of conveyor length, one power plug, one air drop, and a network cable. The upstream lidder did not change. The downstream case packer did not change. The plant's existing checkweigher was tied in rather than replaced, so its readings land in the same log as the inspection results.



Installed between the lidder and the case packer. Reject table at left, downstream conveyor at right.

The reject table, the anchor points, and the network drop were the customer's scope. Everything the plant had to provide fit on one page of the punch list.

What the Plant Got

- Every 48-ounce tub verified for lid-to-body match before it enters a case
- Mismatched tubs off the line automatically, with an alarm and an upstream pause if they start coming in bunches
- Flavor changeover from a single HMI dropdown, with 24 SKUs ready on day one
- A per-tub inspection and weight log that exports to CSV and transfers to the plant server
- Operator and Maintenance access levels so setpoints and recipes stay under controlled hands
- A washdown-rated machine that unplugs for sanitation

The system was commissioned in late summer 2024 and is in daily production.

Thinking About Your Line?

If your plant runs multiple SKUs through shared lidding, capping, or labeling, the question this system answers applies to you: can you prove the outside of the package matches the inside, for every unit, with a record you can hand to an auditor? The pattern transfers. Present the product consistently, read what identifies it, verify against the running configuration, reject the exceptions, and log everything.

AQS engineers and builds sanitary automation for food and beverage processors: conveyance, inspection, palletizing, and the VeriPak Production Quality Platform that ties it together, designed in Nampa, Idaho and supported for life. Tell us about your product, your SKUs, and your line, and we'll tell you what's possible.

Automated Quality Solutions • automatedqs.com • sales@automatedqs.com • 208-297-4420