

200573



**DC Adjustable Buck Boost Converter Module**

## Parameters:

Input Voltage: DC 6-30V

Output Voltage: DC 0.5-30V adjustable

Output Current: 4A (max), adjustable, recommended to use within 3A.

• NOTE: If the output current or power is more than 2.5A or 35W, you'd better enhance the heat dissipation.

Output Power: 60W (max), recommended to use within 50W.

• NOTE: Please reduce the power when the difference between input and output voltage is large.

Operating Temperature: -20~+70?

• NOTE: Pay attention to the temperature of the power tube when using this module, please strengthen heat dissipation if it exceeds 70?.

Conversion efficiency: Up to 96%

Installation: Nylon post \*8, 3mm screw \*8

Wiring: Terminals or solder terminals; VIN means input; VOUT means output.

Dimension: L69.8mm(2.75in), W43.5mm(1.71in), H26.8mm(1.06in)

## Protections:

Short circuit protection: Yes (currently constant current value)

Over temperature protection: Yes (automatically turn off the output if over-temperature)

Tips: There is an additional fan opening on the bottom of the module shell, which can be used to add a fan.

Input reverse polarity protection: Yes

Output anti-backflow: Yes

## Front View of the Module:

## LCD Voltage Current Dual Display

Input Anti-reverse Connection

Enter & Backlight Switch

USB Indicator


Setting & Mode

Input -

Input +

Output -

Output +

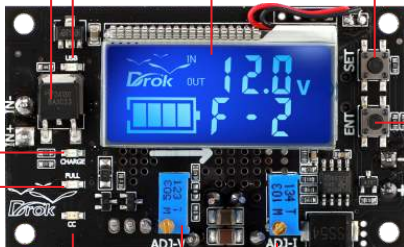

Constant Current Indicator

Current Regulation (Increasing Current by Screwing Clockwise)

Full Charged Indicator

Charging Indicator

Voltage Regulation ( Increasing Voltage by Screwing Clockwise )

## Back View of the Module:

Single Chip Microcomputer


USB Output

Output -

Output +

Input -

Input +

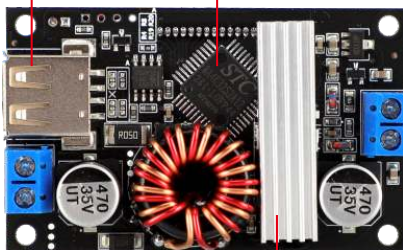

Power Supply Chip (Cooling Fin Pasted Here)

## Voltage Calibration:

If you find that the measuring values are not accurate, please do as follow:

- In the condition of power off, hold press the " SET " button and power on to enter the voltage calibration mode, at this time the LCD screen starts to flash.
- Then release the " SET " button, press the " SET " button to increase voltage value while press the "ENT" button to reduce, till the input voltage value is correct. e.g. If input voltage is 12.65V, adjust the voltage value to 12.65V.
- It will automatically be saved after 2 seconds, then power off the module to finish calibrating.

## Display Description & Setting:


### "SET" button for 4 display modes:

- F-0 mode: Display output voltage
- F-1 mode: Display input voltage
- F-2 mode: Alternately display input and output voltage
- USB mode: Display USB output voltage and turn on or turn off USB output

### Instructions:

Press the "SET" button, the 4 display modes would be displayed cyclically, and the corresponding indicator would be on or off, press the " ENT " button to save and exit. Turn on/off the LCD backlight by singly pressing the "ENT" button.


F-0 means showing output voltage

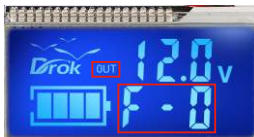

F-1 means showing input voltage



F-2 means showing input and output voltage alternately

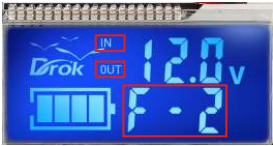

USB means showing USB output voltage and turn on or turn off USB output



**Recommend Product  
on Amazon:**



**Buck boost converter**

**Visit DROK Store  
on Amazon:**

