

User Manual

For

Solidwork Windchill User Manual

Submitted to:



Bajaj Electricals Limited

Rustomjee Aspire, 7th Floor,
Bhanu Shankar Yagnik Marg,
Sion East,
Mumbai
Maharashtra – 400022, India

Submitted by:



Softcell Technologies Global Pvt. Ltd.

401, Mayfair Tower-1,
Wakdewadi, Shivajinagar,
Pune
Maharashtra – 411005, India.

Document History

Version	Date	Owner	Description
00	06-03-2024	Softcell Technologies Global Pvt. Ltd.	Solidwork Windchill User Manual

Document Author

Mr. Sumit Garade	sagarade@softcell.com
------------------	--

Approved & Reviewed By

Mr. Ravichandran M A	ravichandran@softcell.com
Mr. Suresh Vasu	sureshv@softcell.com
Ms. Bhagyashree Kulkarni	bkulkarni@softcell.com

Index


1. Solidworks-RegisterCADApplicationwithWindchill	1
2. Solidworks-CreatestandaloneCADlocalandcheck-intoWindchillfromCADApplication	4
3. Windchill-SearchforCADassemblies/models	7
4. Windchill-PartCreationusingmultipleattributesdefinition	8
5. Windchill-AssociatePartwithCADdrawing/models	11
6. ModifytheCADdata(Check-out&Check-in)	15

1. Solidworks-RegisterCADApplicationwith Windchill


- You'll find the Windchill Workgroup Manager on your system, launch it by double clicking the icon




- GotoTools→ApplicationManagement

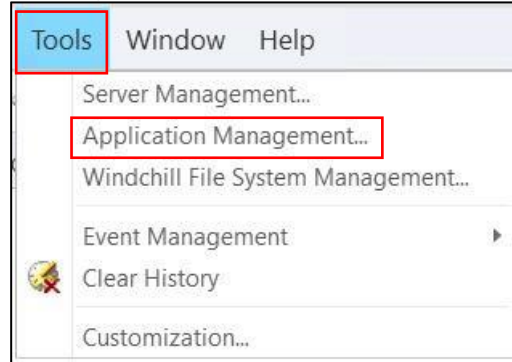


- GotoApplications→RegisterNewApplication

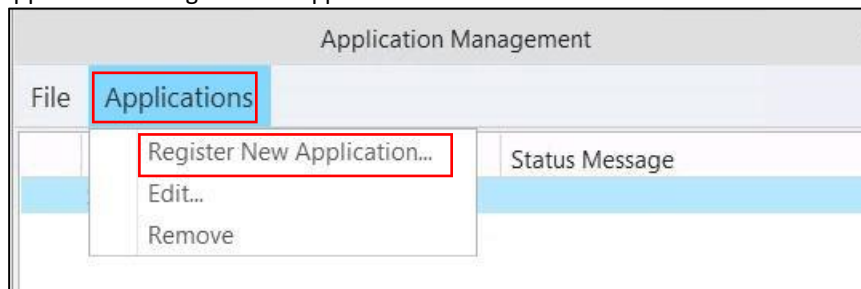

- You'll get the available version of Solidworks→Click on it→Click Close

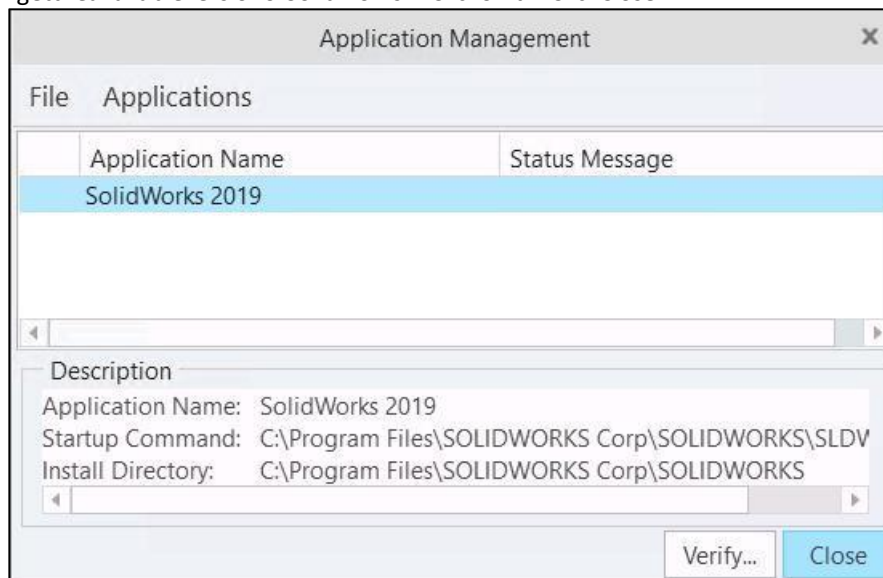

- GotoTools→Sertvertab→RegisterNewServer

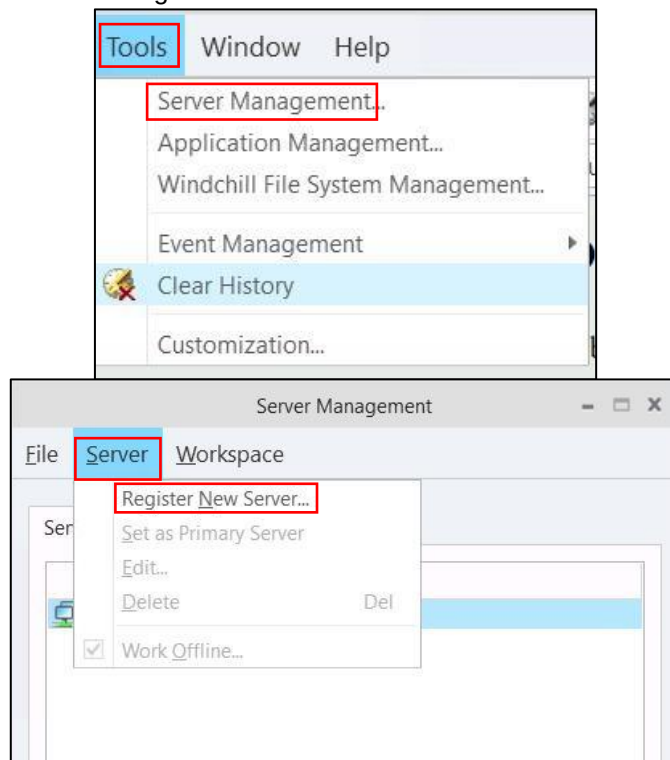


- Give appropriate server name (like in our case Windchill) →In location enter or paste the WindchillURL<https://windchillplm.bajaelectricals.com/Windchill/>→clickonCheckbutton.




- Onsuccessfulconnection,itwillaskforWindchillcredentials.PuttheWindchillUsernameand Password.




- It'll show the list of the Context Workspace in which you're a participant. Select appropriate Workspace. Here we have Department wise context libraries for Consumer Product and Illumination Products.

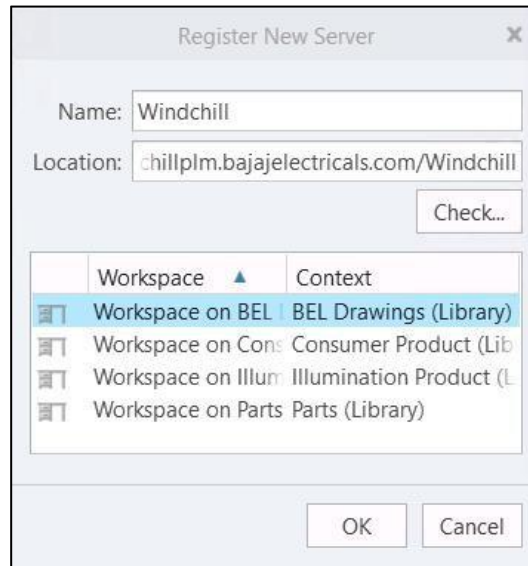

- Verify that the Windchill Commons space and Workspace are available in WGM

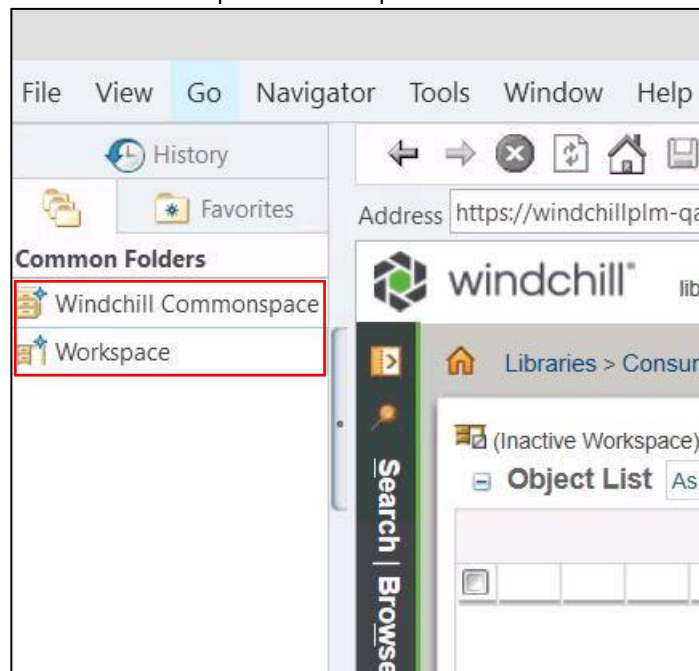


- Exit from Windchill Workgroup Manager (WGM) and launch SolidWorks. It should launch the WGM as well.
- Check for the Windchill tab in SolidWorks as shown below.

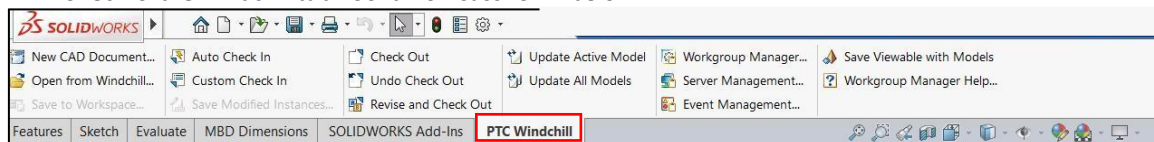


2. Solidworks-Createstandalone CADlocalandcheck- inintoWindchillfromCADApplication


● CreateaPartinSolidworks

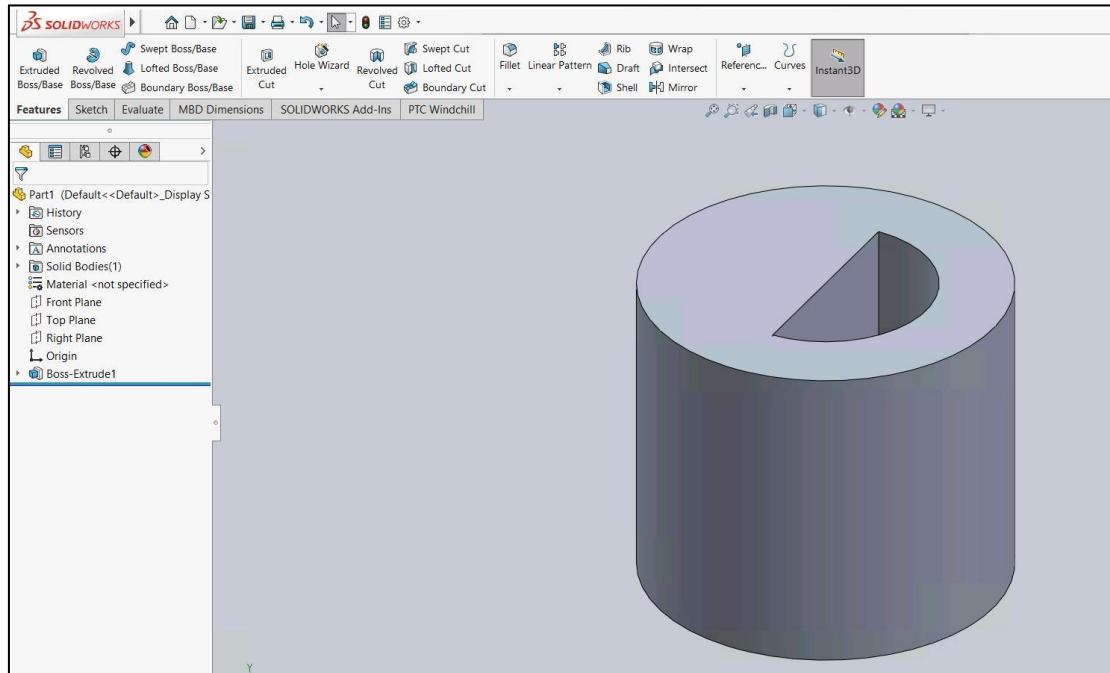


● GotoPTCWindchilltab→SelecttheoptionSaveViewablewithModelsifitisnotselectedand click on Custom Check In

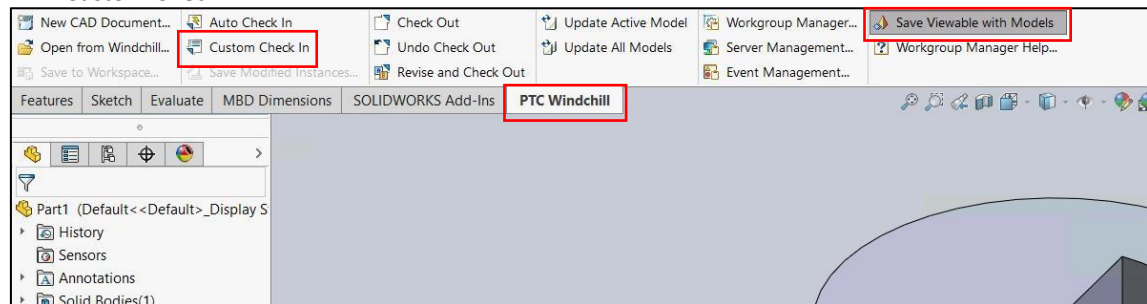

● You'llbeaskedtosavethepartintheWorkspace.Giveappropriate(uniquename)andSave

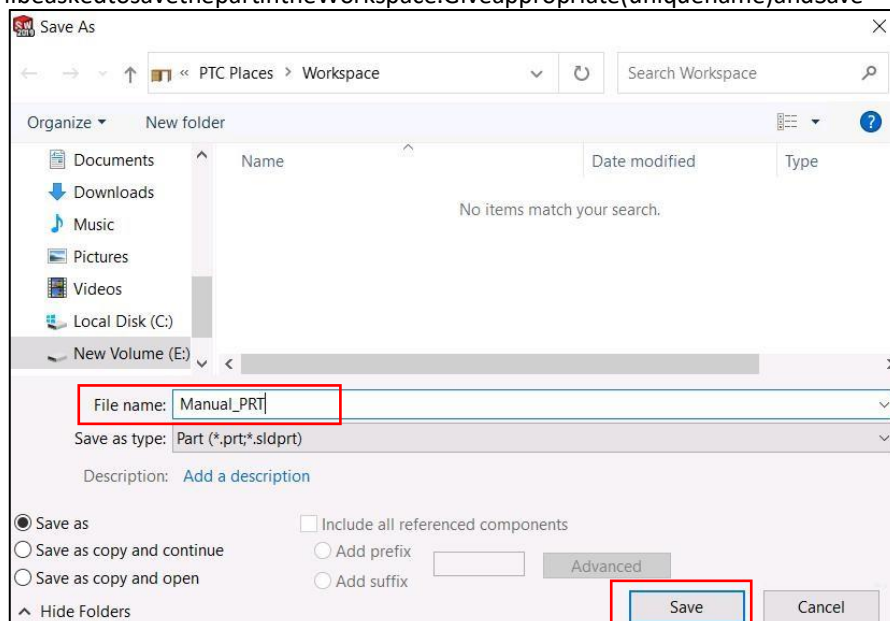

- You'll be redirected to Check In window. Check the box as shown in below image and click Next.

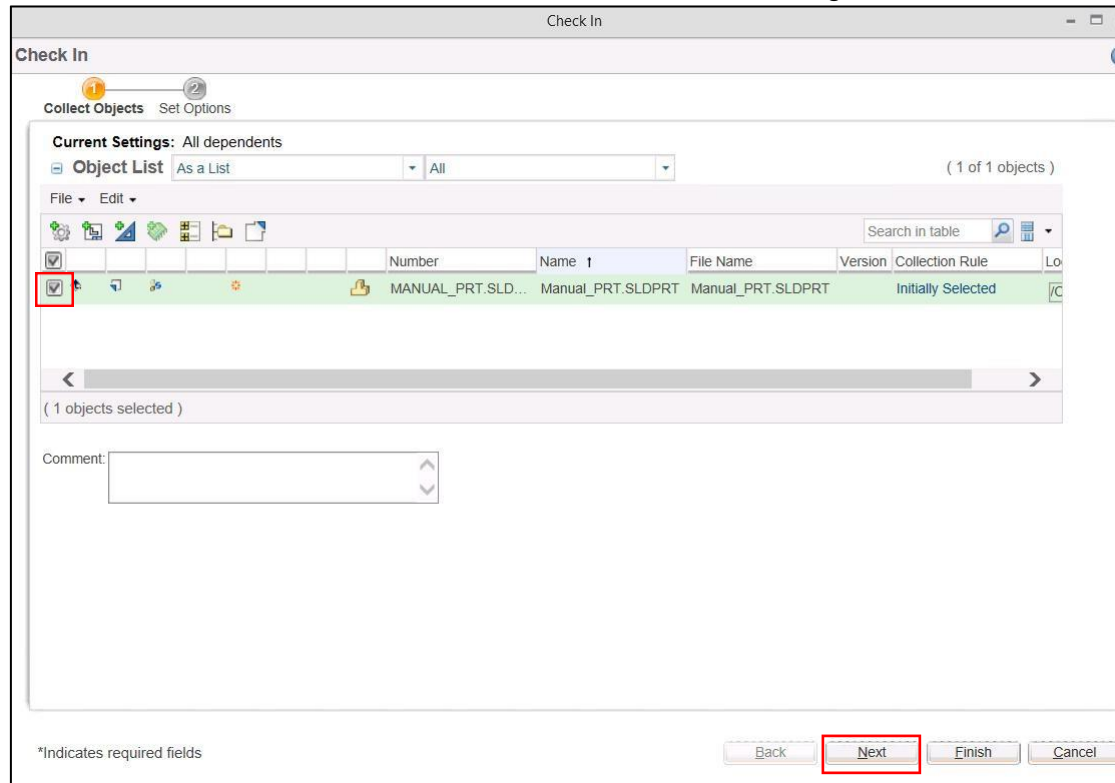

Check In

Collect Objects Set Options

Current Settings: All dependents

Object List As a List All (1 of 1 objects)

File Edit

Number	Name	File Name	Version	Collection Rule	Location
1	MANUAL_PRT.SLD...	Manual_PRT.SLDPRT	Manual_PRT.SLDPRT	Initially Selected	/C/


(1 objects selected)

Comment:

*Indicates required fields

Back Next Finish Cancel

- Check the boxes
 - Remove from Workspace
 - Auto resolve incomplete objects (Update with object on server, then ignore should be selected).

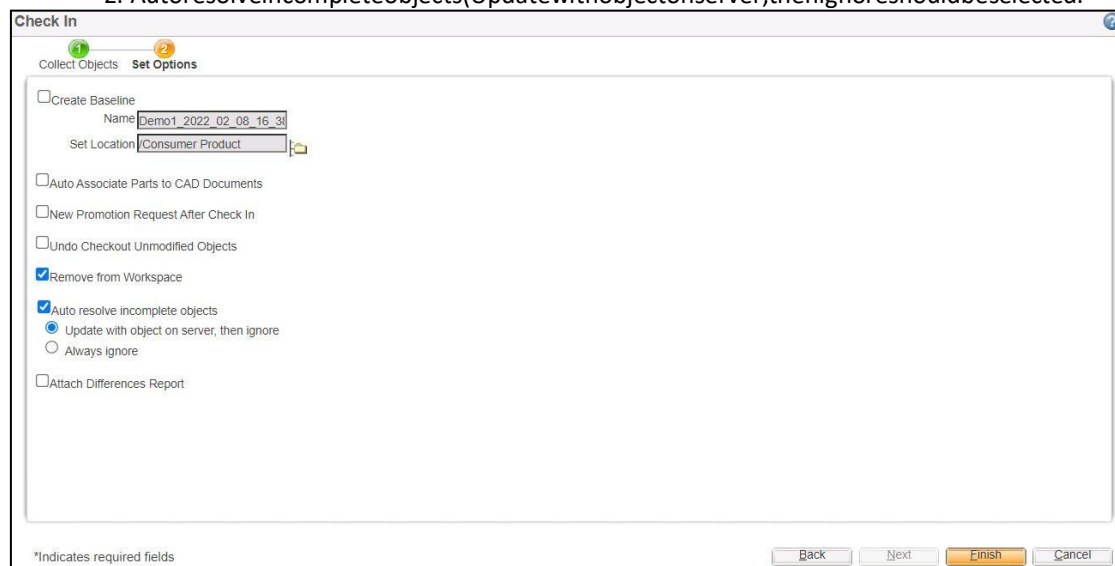

Check In

Collect Objects Set Options

Create Baseline

Name Demo1_2022_02_08_16_38

Set Location Consumer Product

Auto Associate Parts to CAD Documents

New Promotion Request After Check In

Undo Checkout Unmodified Objects

Remove from Workspace

Auto resolve incomplete objects

Update with object on server, then ignore

Always Ignore

Attach Differences Report

*Indicates required fields

Back Next Finish Cancel

- On successful Check In, you'll be asked for the confirmation to Close and Update. Click on OK

Conflicts

1 Conflicts Set All ▾

Object	Description	Action
 Manual_PRT.SLDPRT	 The document is open in the authoring application. Would you like to close it?	Close and Update ▾

Selected Conflict Description


The document is open in the authoring application. Would you like to close it?

OK
Cancel

3. Windchill-Search forCADassemblies/models

- HittheURL<https://windchillplm.bajaelectricals.com/Windchill/>fromanyWebBrowser.It'llopt for Windchill credentials. Sign in with appropriate credentials.

- OnHome,wecanseetheseearchbaronTop-RightCorner

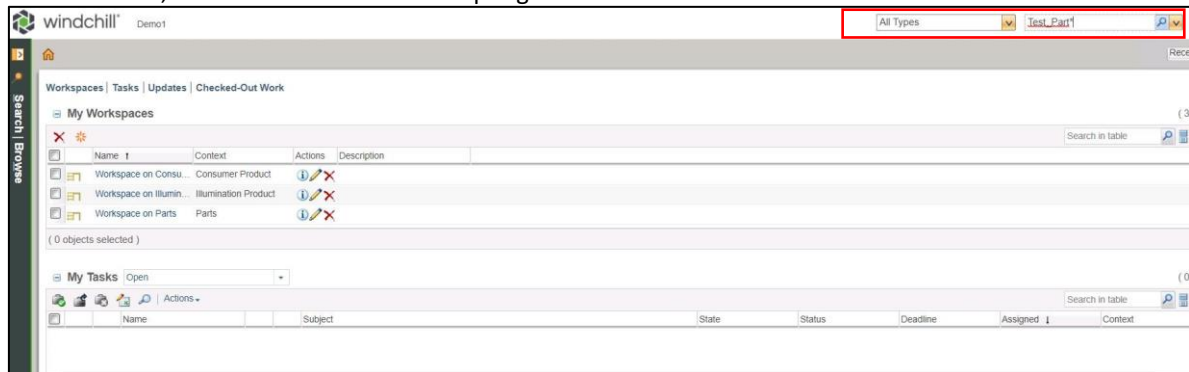


- RightsideofthesearchmenuisObjectTypefilter.MakesureitisselectedforAllTypes andPut the name of the CAD you wants to search.
- Supposeyoudon'tremember thewholenametheCADcanbesearchedbythreewaysputting Wildcard character in the name
- Let'sassumewewanttosearchTest_Part_0001,

- ◆ Weremembersthe**Test**onlyfromthename→Itcanbesearchedbyputting**Test***

- ◆ Weremembersthe**Part**onlyfromthename→Itcanbesearchedbyputting***Part***


- ◆ Weremembersthe**0001**onlyfromthename→Itcanbesearchedbyputting***0001**

- Putthesearchcriteria asyouwantandhitenter. ResultswillappearedintheSearch tabof Navigator. Notice the criteria line and search results

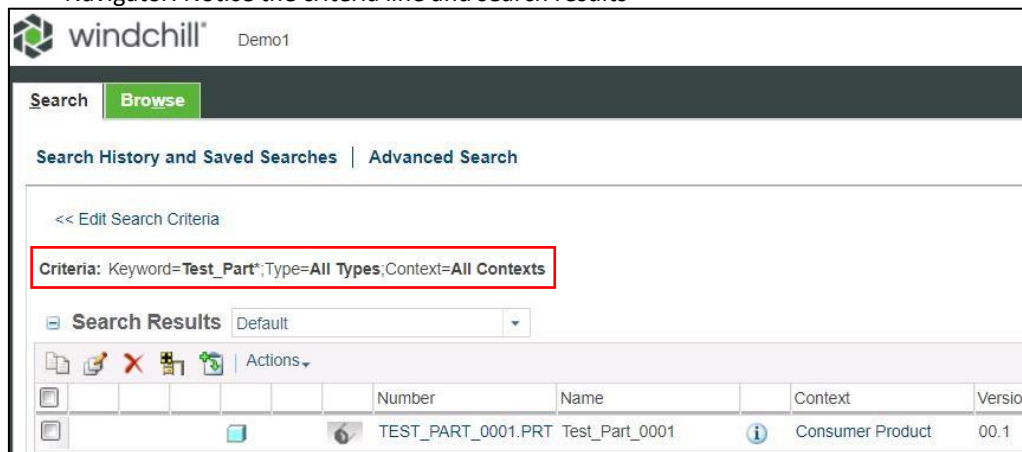



4. Windchill-PartCreationusingmultipleattributesdefinition

- To create a Part, go to Parts library → Expand → Folders from Browse tab of navigator.

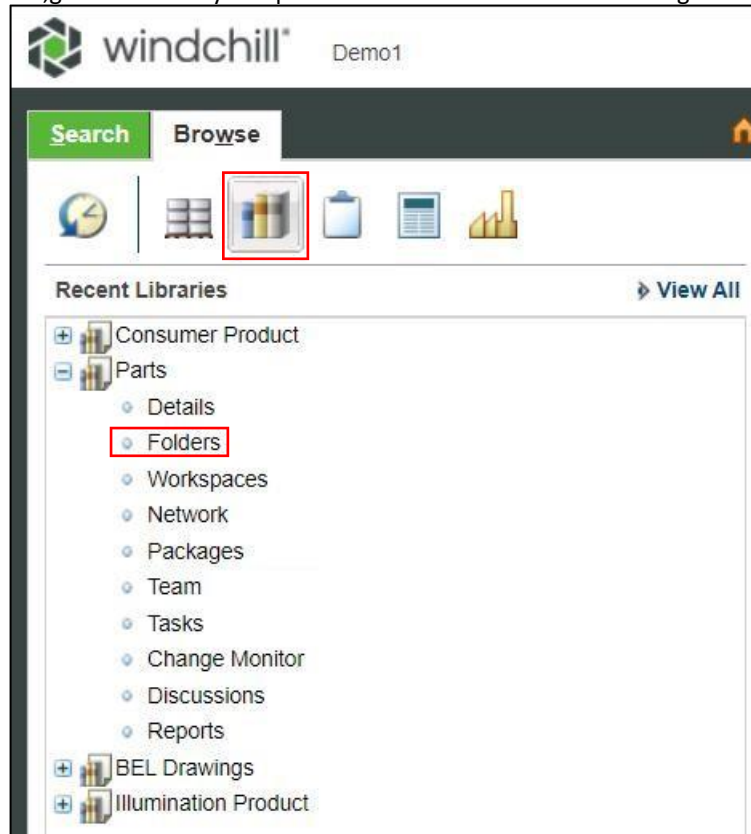


- To create a new part, click on the gear-like icon as shown in the below image. It will open the new part creation window.

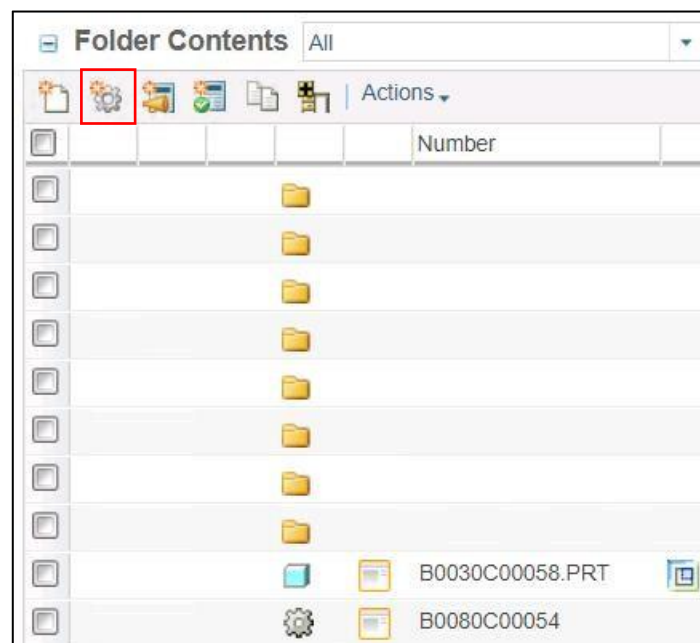

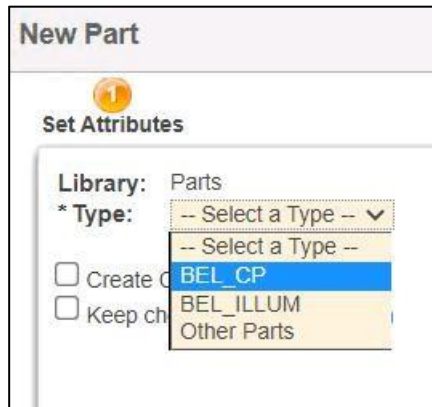

- For Example, we'll go with BEL_CP Part. Define all the attributes as shown in below images → Finish

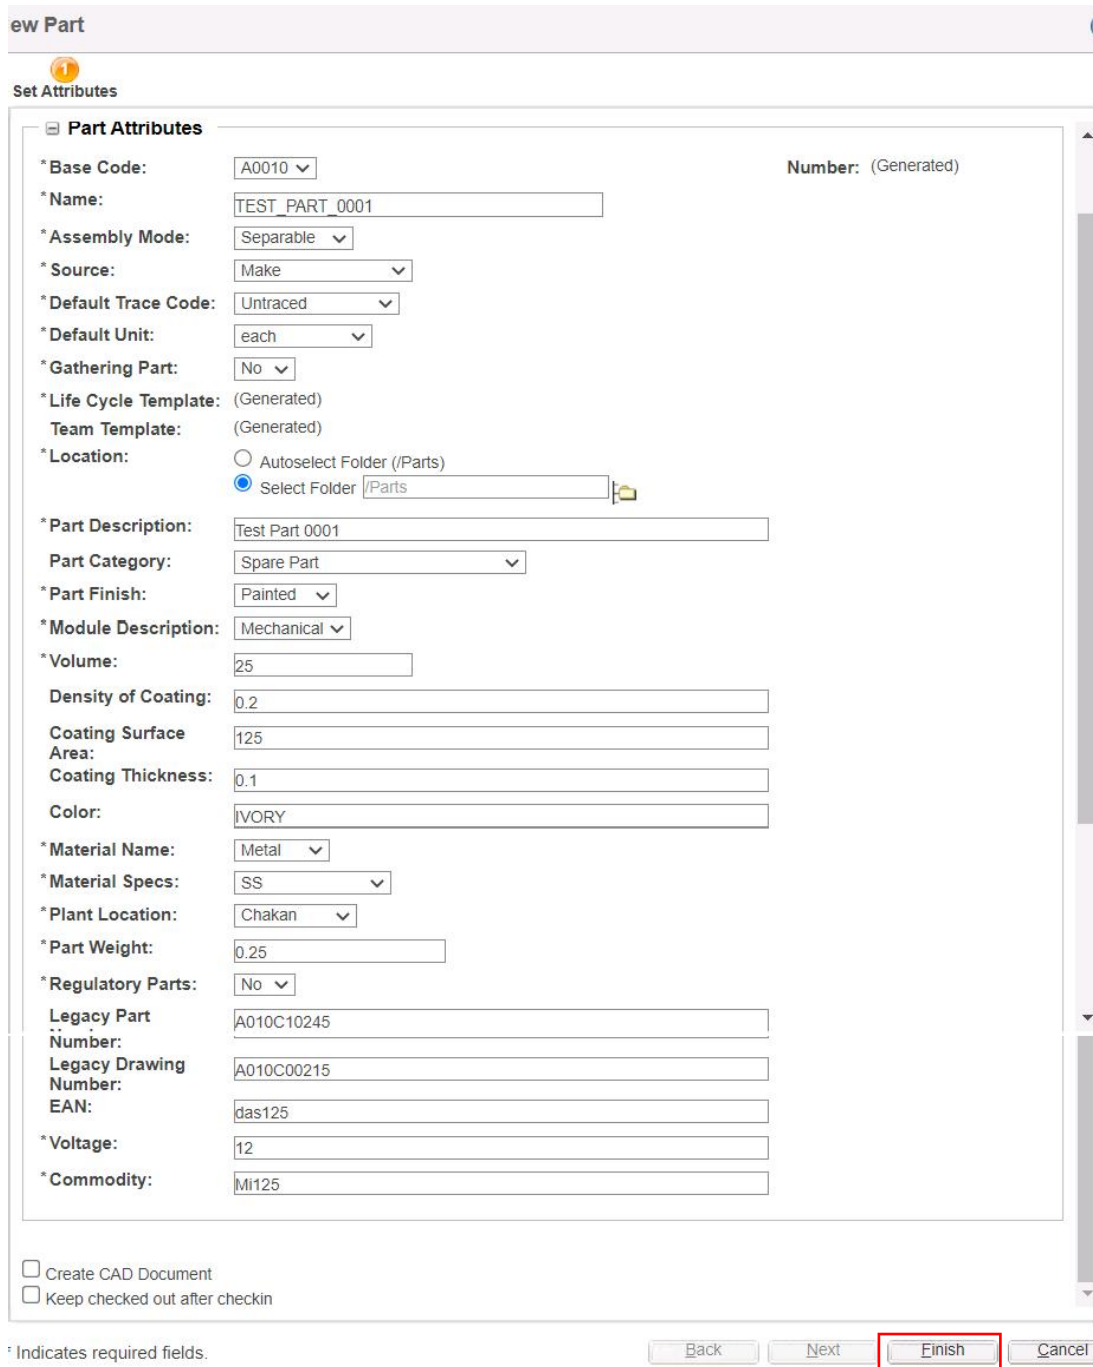

ew Part

Set Attributes

Part Attributes

* Base Code: A0010 Number: (Generated)

* Name: TEST_PART_0001

* Assembly Mode: Separable

* Source: Make

* Default Trace Code: Untraced

* Default Unit: each

* Gathering Part: No

* Life Cycle Template: (Generated)

* Team Template: (Generated)

* Location: ☐ Autoselect Folder (/Parts) ☒ Select Folder (/Parts)

* Part Description: Test Part 0001

* Part Category: Spare Part

* Part Finish: Painted

* Module Description: Mechanical

* Volume: 25

* Density of Coating: 0.2

* Coating Surface Area: 125

* Coating Thickness: 0.1

* Color: IVORY

* Material Name: Metal

* Material Specs: SS

* Plant Location: Chakan

* Part Weight: 0.25

* Regulatory Parts: No

Legacy Part Number: A010C10245

Legacy Drawing Number: A010C00215

EAN: das125

* Voltage: 12

* Commodity: Mi125

☐ Create CAD Document

☐ Keep checked out after checkin

* Indicates required fields.

Back Next **Finish** Cancel


- On successful part creation, Notification can be seen on the top of the Windchill window




- To create BEL_ILLUM part, repeat the same procedure starting from topic 4.

5. Windchill-AssociatePartwithCADdrawing/models


- ToPartwithCAD,addtheWTPartandCADinacommonworkspaceasbelow.
- FromConsumerProductlibrary,selecttheCADbycheckingtheboxandclick AddtoWorkspace option as shown below.

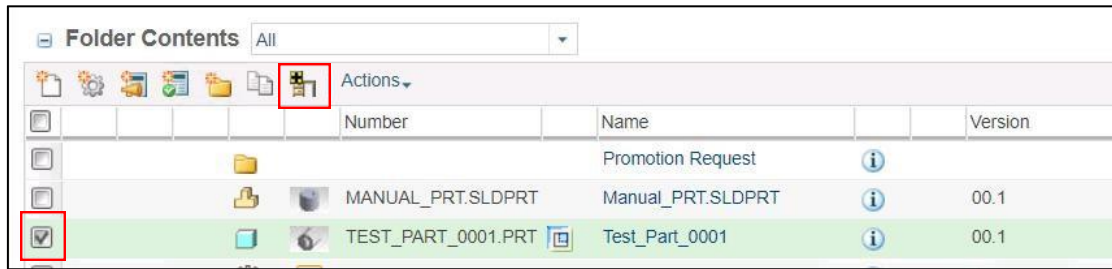


- Addtoworkspacewindowwillbeopened.VerifytheworkspaceandclickOK

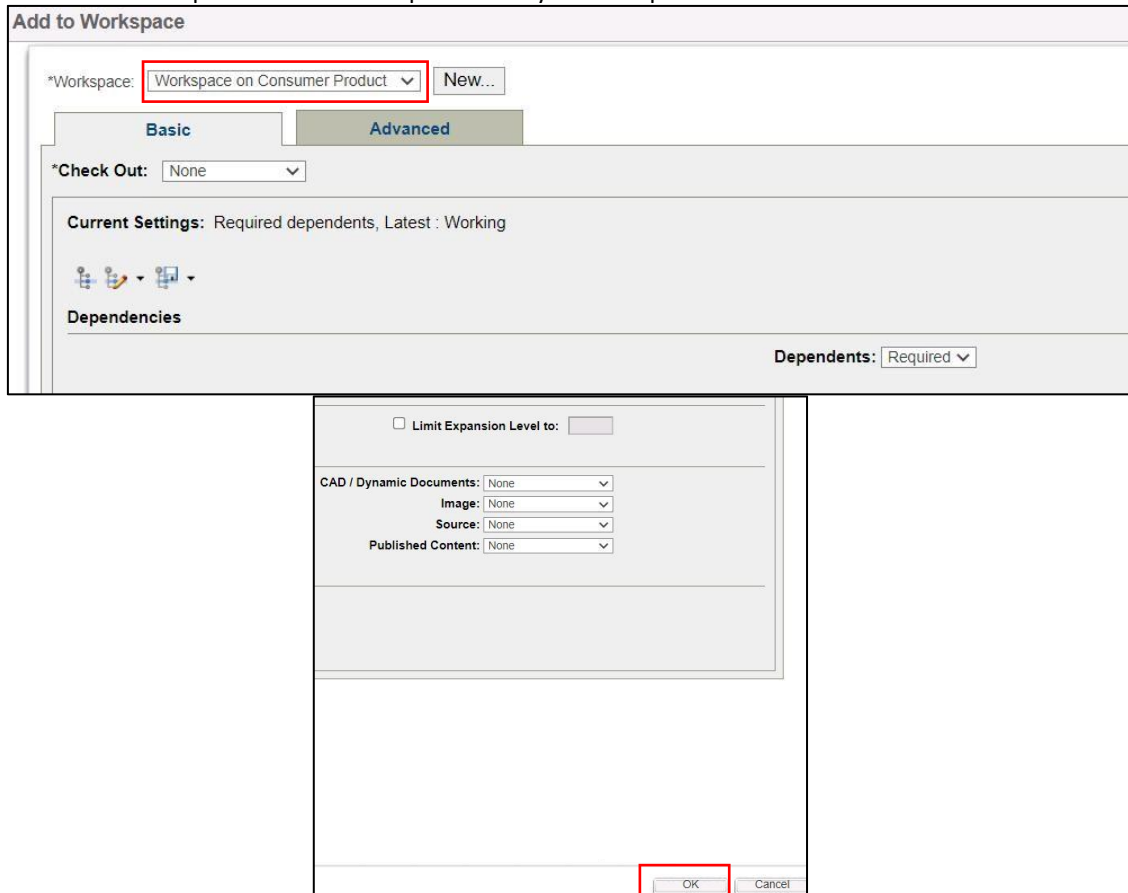


- GotoPartslibraryandselecttheWTPart,whichwewantassociatewithCAD,bycheckingthe box and click Add to Workspace option.

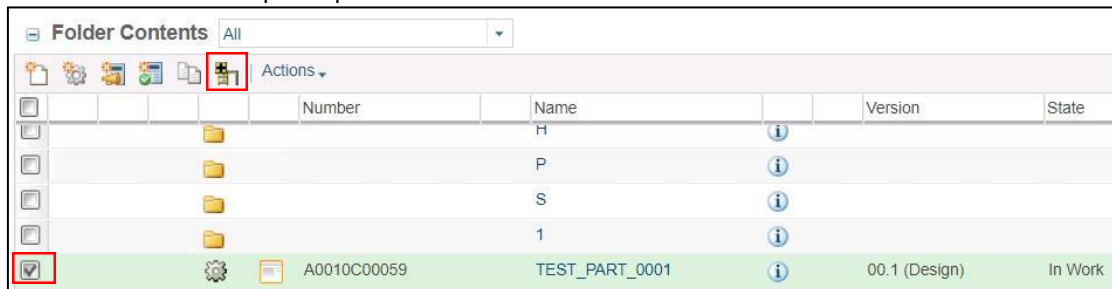


- InAddtoWorkspacewindow,changetheworkspacefromParttoConsumerProductandclickOK.

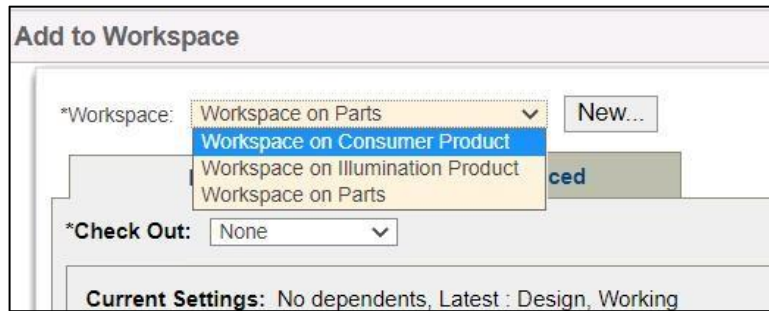


- Inworkspace, theisaooptioncalled SearchinTable.PutyourcriteriatosearchyourCAD& WTPart. You'll find your objects in the results.

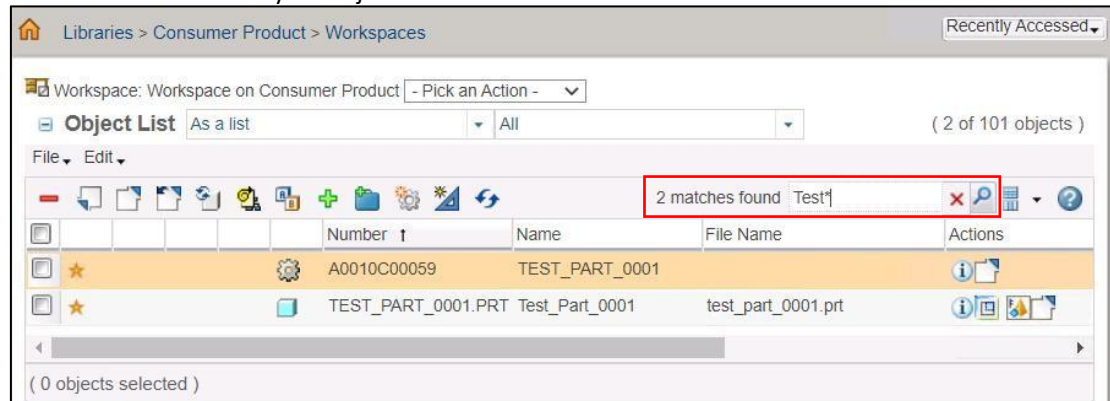


- Selectbothobjectsbycheckingtheboxagainsteach.AndclickonEditdrop-downfromabove.

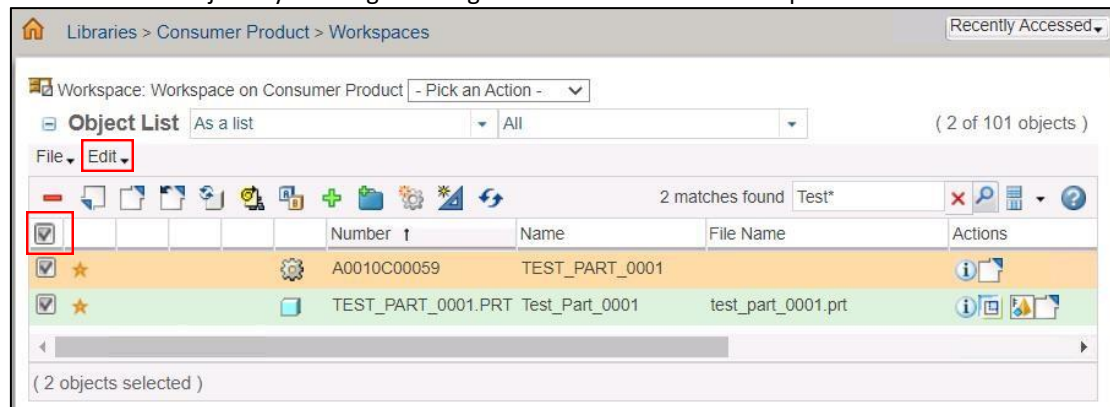


- SelectEditAssociationoptionfromthedrop-down.

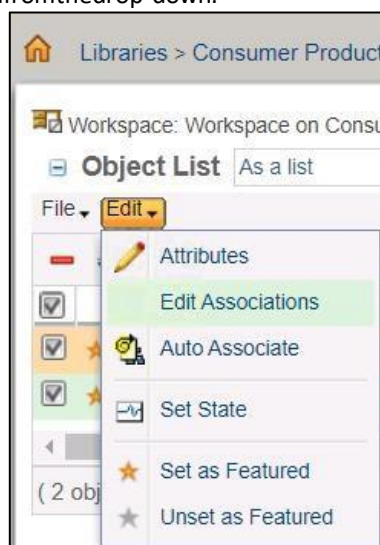


- EditAssociationswindowwillopen.FromAssociationtypedrop-downselectContributingImage and click OK.

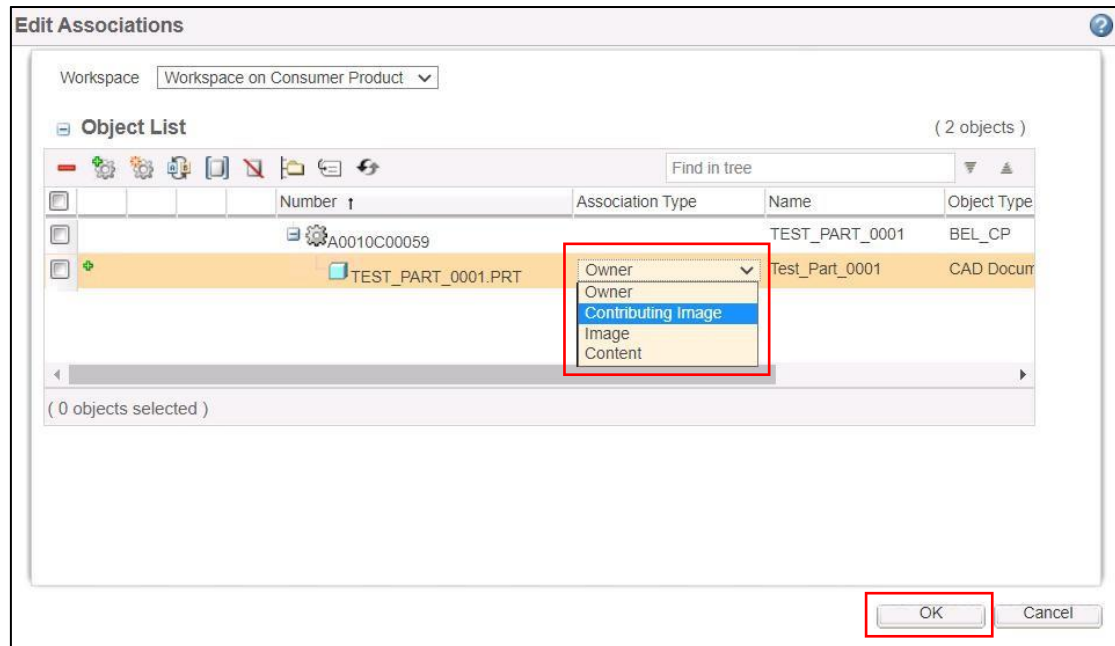


- WTPartwillbechecked-outbythisprocess.Sochek-initagain,bystepsshowninfollowing image.

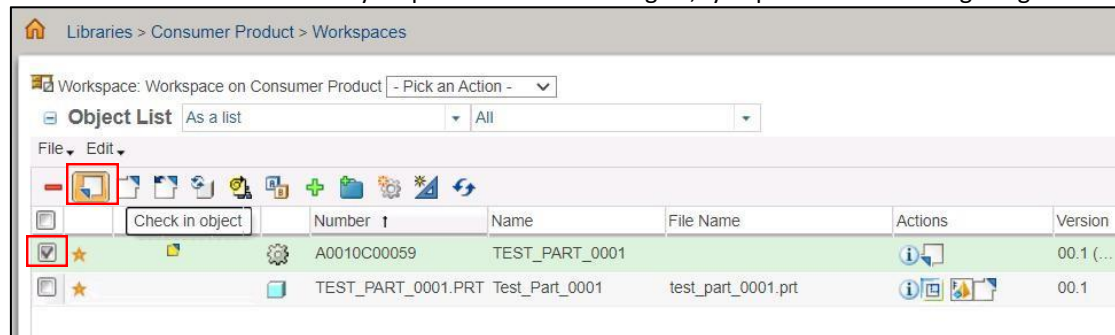

- OncetheWTPartchecked-in,selectbothobjectandremovefromWorkspace.

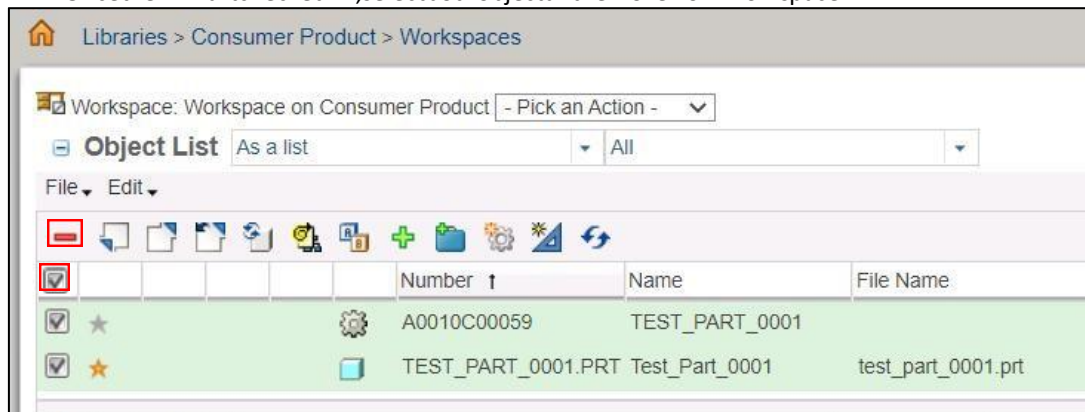

- To verify the association, go to the details page of the Part or CAD from their respective library and go to the Related Objects tab.

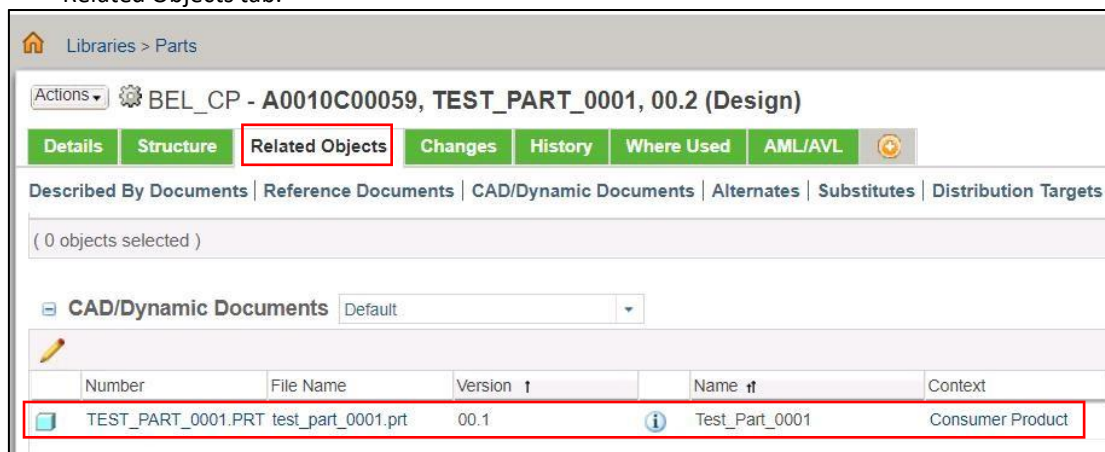


The screenshot shows the 'Libraries > Parts' section of the Solidworks-Windchill interface. The main title is 'BEL_CP - A0010C00059, TEST_PART_0001, 00.2 (Design)'. Below the title are several tabs: 'Details', 'Structure', 'Related Objects' (highlighted with a red box), 'Changes', 'History', 'Where Used', 'AML/AVL', and a plus icon. Below the tabs are links for 'Described By Documents', 'Reference Documents', 'CAD/Dynamic Documents', 'Alternates', 'Substitutes', and 'Distribution Targets'. A message '(0 objects selected)' is displayed. Below this is a section for 'CAD/Dynamic Documents' with a 'Default' dropdown menu. A table below shows the details of the selected document:


Number	File Name	Version ↑	Name ↑	Context
TEST_PART_0001.PRT	test_part_0001.prt	00.1	Test_Part_0001	Consumer Product

6. Modify the CAD data (Check-out & Check-in)


- To modify the CAD data or any object checked into Windchill, first it should be checked out.
- To check out the CAD data, search it in Windchill as mentioned in Index no. 3 on page no. 5.
- On detailstab of the CAD object go to **Actions** → **Check Out**

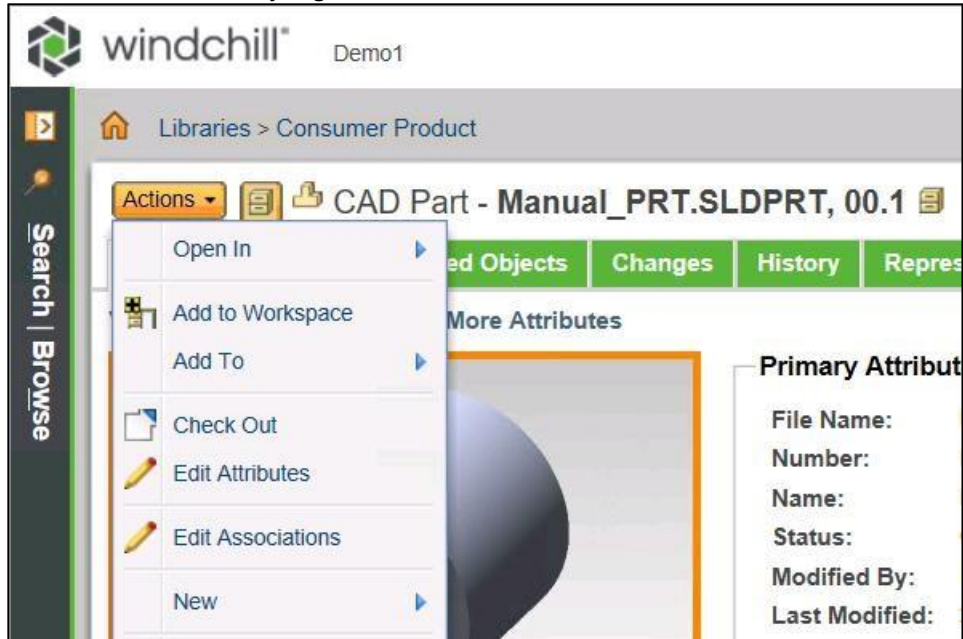


- You'll be landed to Check Out and Add to Workspace page. Select appropriate workspace and click on **OK** from right bottom corner of the page. (in our case the Workspace on Consumer Product)

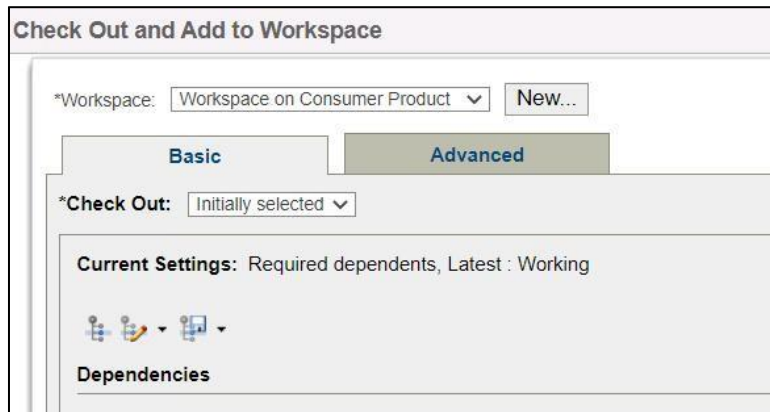

- You'll see the checked out copy as below.

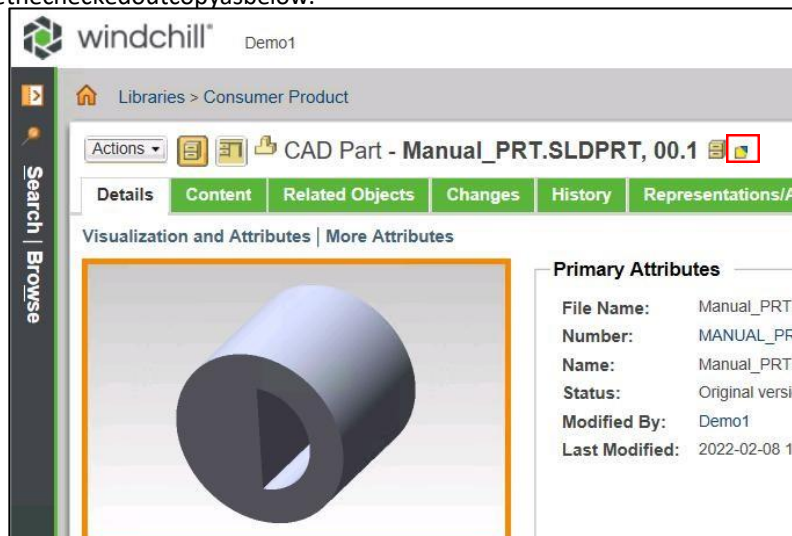

- GotoWWGMandnavigatetoWorkspacefromCommonFolderson LHS.
- You'llfindtherecentlychecked-out parthere.Inactionscolumn thereisOpen inSolidworksicon. Click on it to open the CAD model in Solidworks.

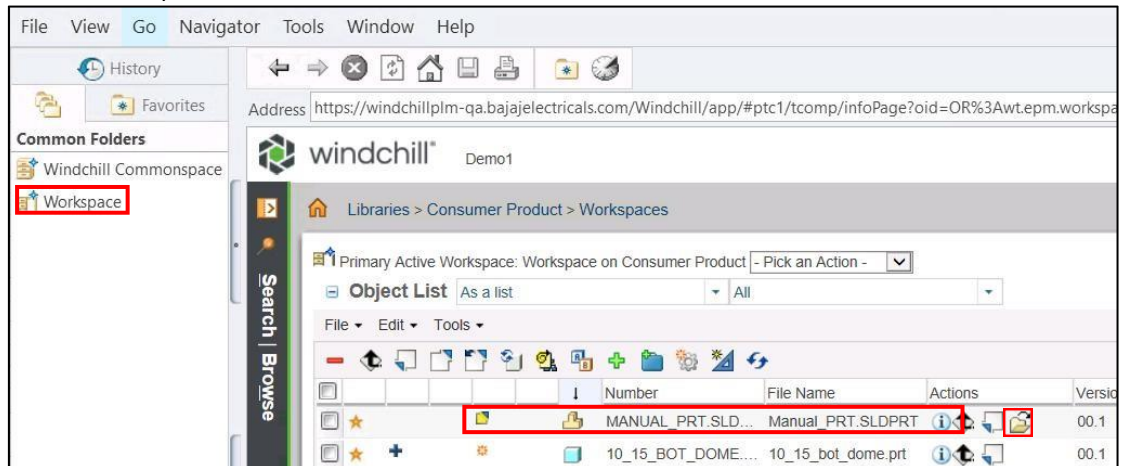

- Dotherequiredmodifications.

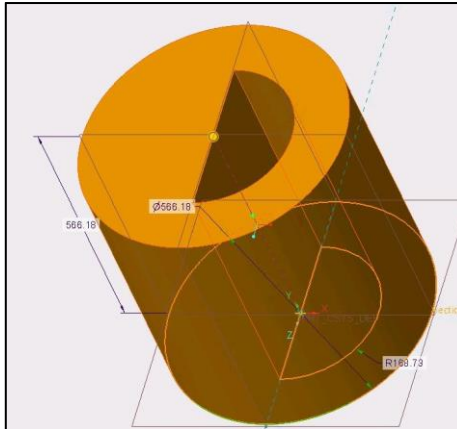


Image is for example only,
considerthisasSolidworks
window

- Aftermodification,tocheck-in the dataagain,repeatactionsmentioned inIndexno.2from second bullet.
- GotoWindchillcommonsapcefromWWGM ornavigatetotheCADdatafromwebbrowser to verify the modifications.

