


A16-R101 BASE ADAPTER

PETG / PA12 trial; planar plate. Bottom datum A at assembly Z58. OD134 +/-0.15 after coupon compensation.

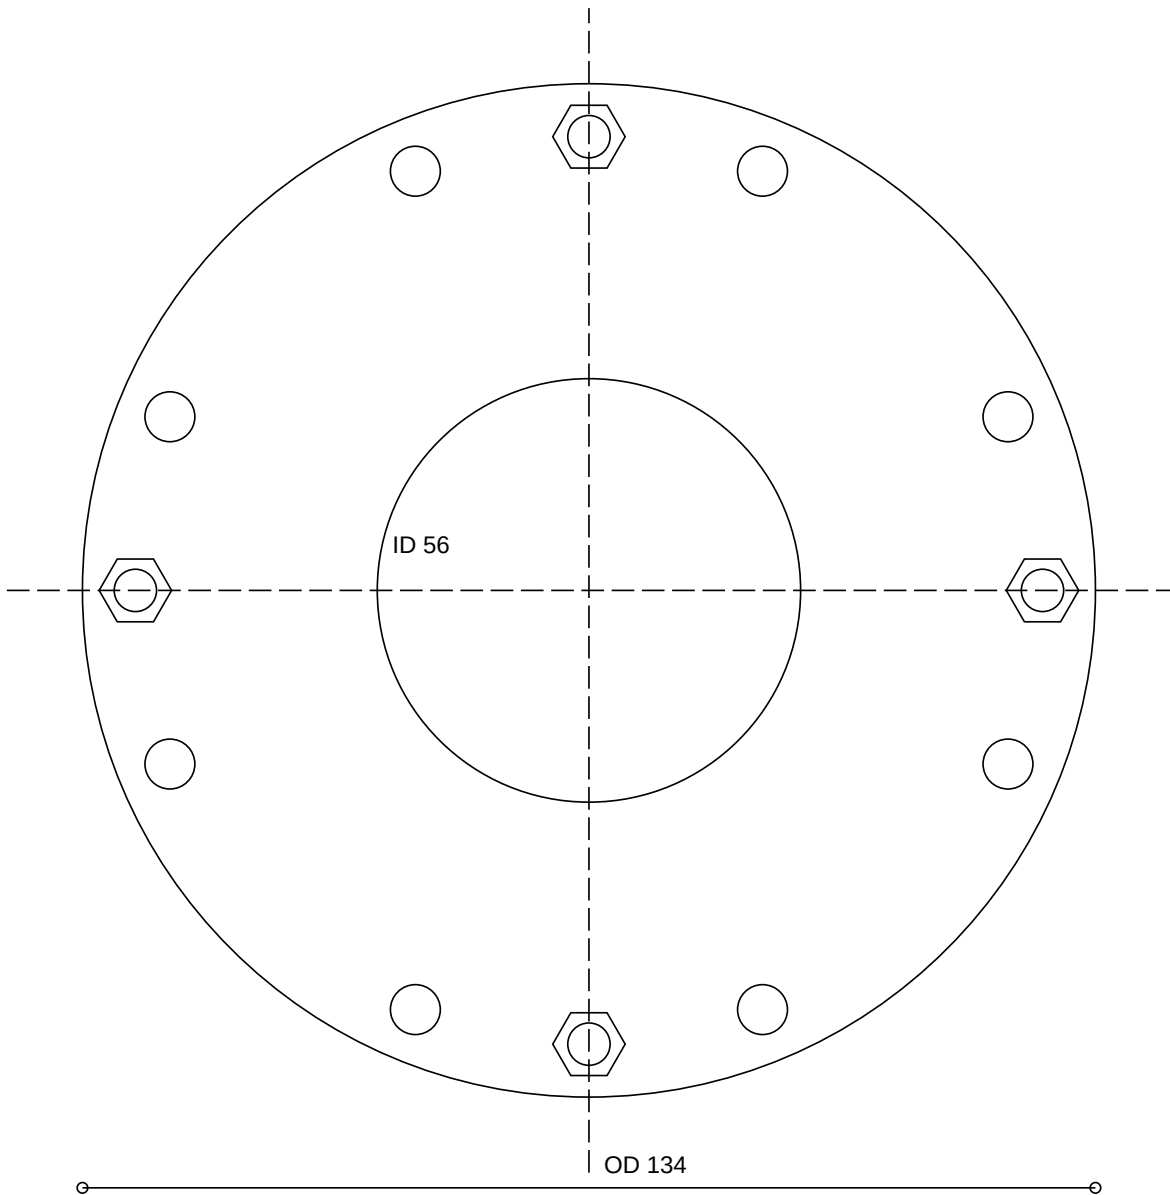

Hole coordinates in local XY; datum B at centre

01	X	55.433	Y	22.961
02	X	22.961	Y	55.433
03	X	-22.961	Y	55.433
04	X	-55.433	Y	22.961
05	X	-55.433	Y	-22.961
06	X	-22.961	Y	-55.433
07	X	22.961	Y	-55.433
08	X	55.433	Y	-22.961

8x D6.6 THRU / PCD120 /22.5 +45*k deg

4x D5.6 THRU at (+/-60,0), (0,+/-60)

4x AF8.3 hex nut pockets,5 deep FROM TOP

M5 nut4.7 high;0.3 recess; pocket bottomZ61




8

Bore D56 +0.2/0; general printed linear tolerance +/-0.2.

Break sharp edges0.3; clear brim from datum A. No finishing on B06.

A16-R103 J1 OUTPUT PEDESTAL

PETG / PA12 trial; conventional coaxial turned/milled form. Bottom datum A at J1 rotorZ0.

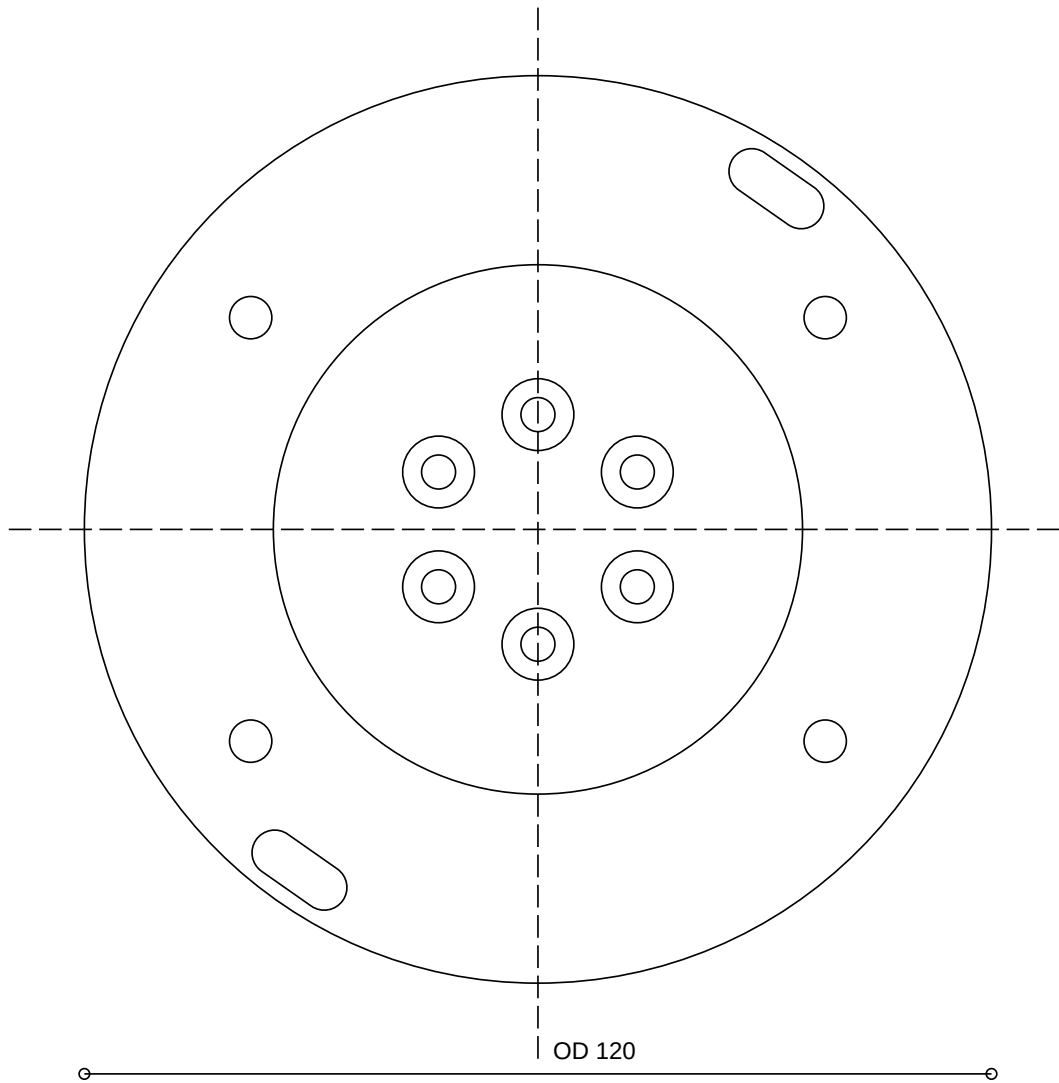

Hole coordinates in local XY; datum B at centre


01	X	-13.146	Y	-7.590
02	X	-13.146	Y	7.590
03	X	0.000	Y	-15.180
04	X	-0.000	Y	15.180
05	X	13.146	Y	-7.590
06	X	13.146	Y	7.590

6x D4.5 THRU / source output PCD30.36

6x counterbore D9.5 x10 FROM TOP

4x D5.6 through upper plate at X+/-38,Y+/-28

2x6x14 slots /endR3 /R55 /55 and235deg; THRU upper10 only

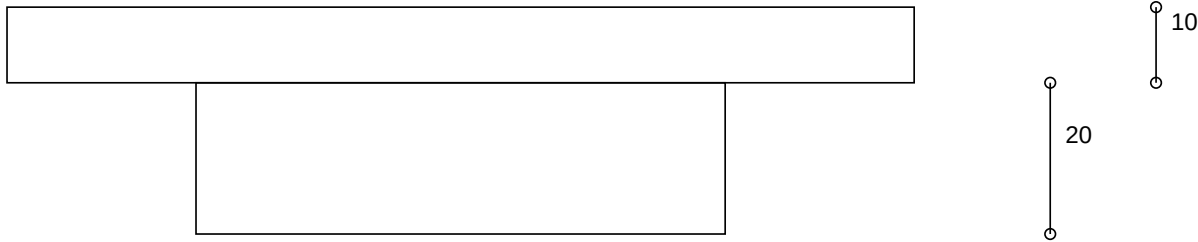


M4x25 +0.8 washer:20 grip /4.2 insertion /source blind depth6

Overall130; D70 +/-0.15 stem /D120 plate. Print upper plate DOWN; motor face UP.

A16-S103-upper-proximal-socket


mm | supported, unpowered, unloaded fit issue | STEP defines complete nominal geometry

XY all edges, hidden included

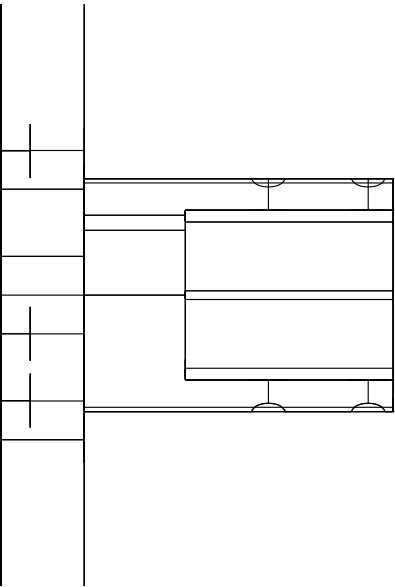


47.150 overall / drawing scale1.100
Vertical70.000; CAD axes XY

XZ all edges, hidden included

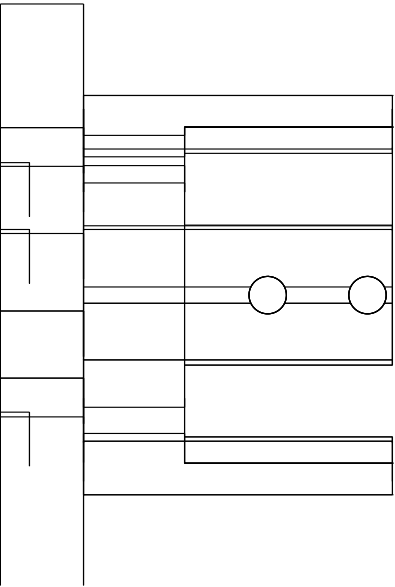

47.150 overall / drawing scale1.100
Vertical70.000; CAD axes XZ

YZ all edges, hidden included

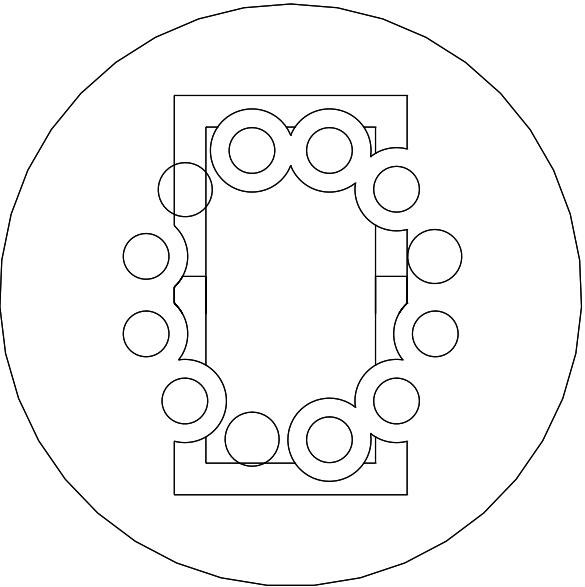

70.000 overall / drawing scale1.100
Vertical70.000; CAD axes YZ

Native J3 output faceX27.85; OD70 x10.
SocketX50..75.1; nominal20.4x40.4 internal.
Stock tube startsX50; clamp centresX60/72, Z0.
2xD4.5 parallelY; M4x35 with OD8/ID4.5/L16 crush sleeves.

Printed default linear +/-0.2 after coupons; drilled holes +/-0.1 as trial targets; no metal GD&T release.


No inferred tapped plastic threads. Purchased motors/tubes/steel sleeves/fasteners are not printed.

Projection scale varies per view. Original CAD frame retained. Check supports, nut access, manual fit and actual motor plugs.

A16-S106-fore-proximal-socket

mm | supported, unpowered, unloaded fit issue | STEP defines complete nominal geometry

XY all edges, hidden included

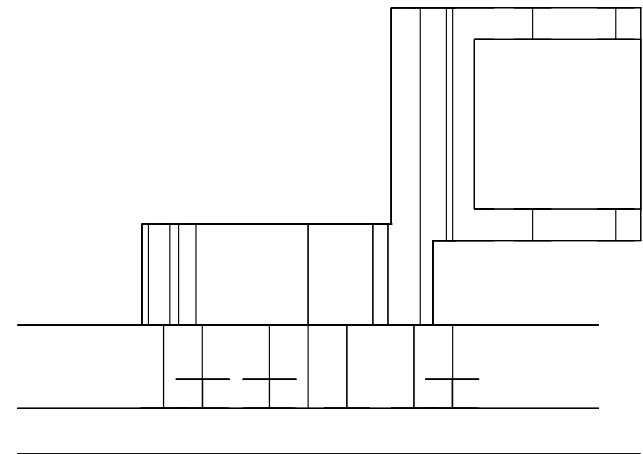

75.000 overall / drawing scale1.100
Vertical48.150; CAD axes XY


Native J4 output faceY27.85; OD70x10.
Tube socketX20..40.1,20.4x40.4, centreY62.
ClampsX27/37,Z0,D4.5 parallelY.
Native9xD5.5 and3xD6.5x3.6 pin reliefs.

Printed default linear +/-0.2 after coupons; drilled holes +/-0.1 as trial targets; no metal GD&T release.

No inferred tapped plastic threads. Purchased motors/tubes/steel sleeves/fasteners are not printed.


Projection scale varies per view. Original CAD frame retained. Check supports, nut access, manual fit and actual motor plugs.

XZ all edges, hidden included

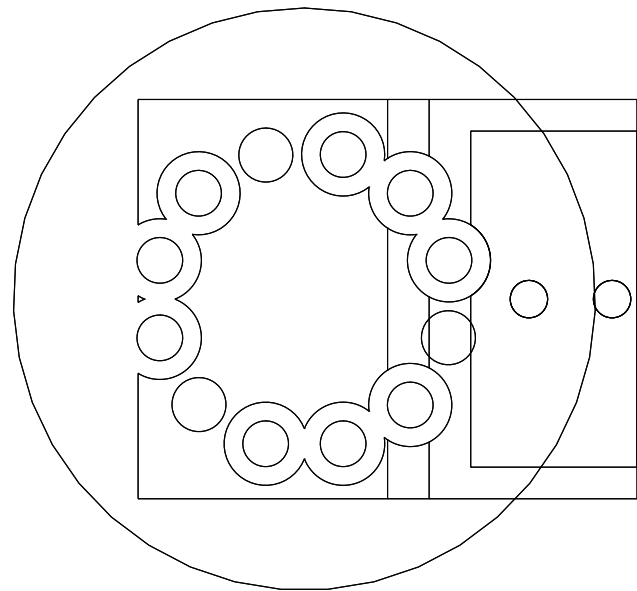

75.000 overall / drawing scale1.100
Vertical70.000; CAD axes XZ

YZ all edges, hidden included

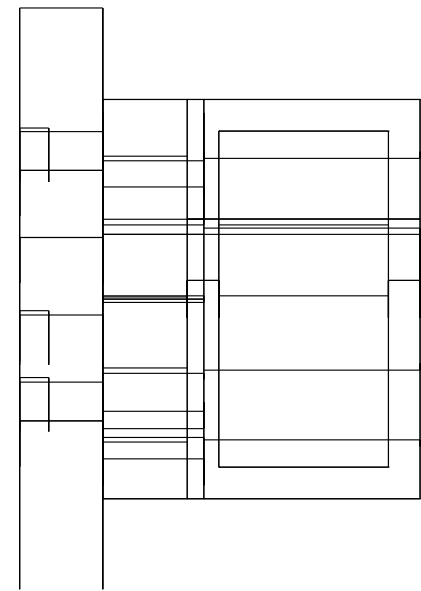


48.150 overall / drawing scale1.100
Vertical70.000; CAD axes YZ

A16-S110-wrist-yaw-roll-L

mm | supported, unpowered, unloaded fit issue | STEP defines complete nominal geometry

XY all edges, hidden included

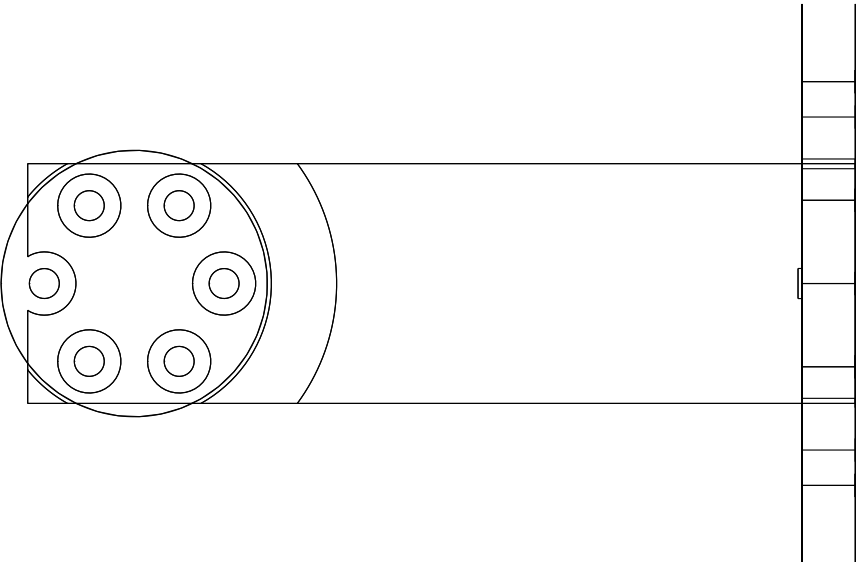


128.300 overall / drawing scale0.881
Vertical84.000; CAD axes XY

XZ all edges, hidden included



128.300 overall / drawing scale0.881
Vertical90.300; CAD axes XZ

YZ all edges, hidden included

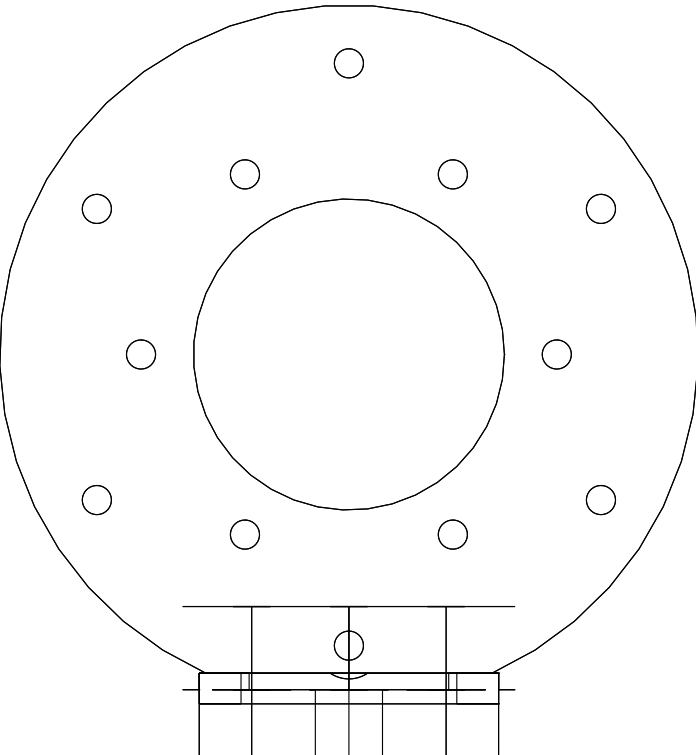

84.000 overall / drawing scale1.100
Vertical90.300; CAD axes YZ

Native J6 output planeZ-30.3;OD40,10 nominal screw grip.
J7 fixed faceX100.3,8thick; centreX75.
J7 annulusOD84 ID37.4;6nativeD3.5 /PCD50.
Cage6xD3.5 PCD70,30+60*k; D8x0.6 washer-edge relief.
OutputD9.5 counterboresZ-40.3..-48.4; strapZ-48.3..-38.3.

Printed default linear +/-0.2 after coupons; drilled holes +/-0.1 as trial targets; no metal GD&T release.

No inferred tapped plastic threads. Purchased motors/tubes/steel sleeves/fasteners are not printed.

Projection scale varies per view. Original CAD frame retained. Check supports, nut access, manual fit and actual motor plugs.

A13-J7-102-bearing-retainer

mm | supported, unpowered, unloaded fit issue | STEP defines complete nominal geometry

XY all edges, hidden included




2.500 overall / drawing scale1.100
Vertical80.444; CAD axes XY

XZ all edges, hidden included



2.500 overall / drawing scale1.100
Vertical84.000; CAD axes XZ

YZ all edges, hidden included

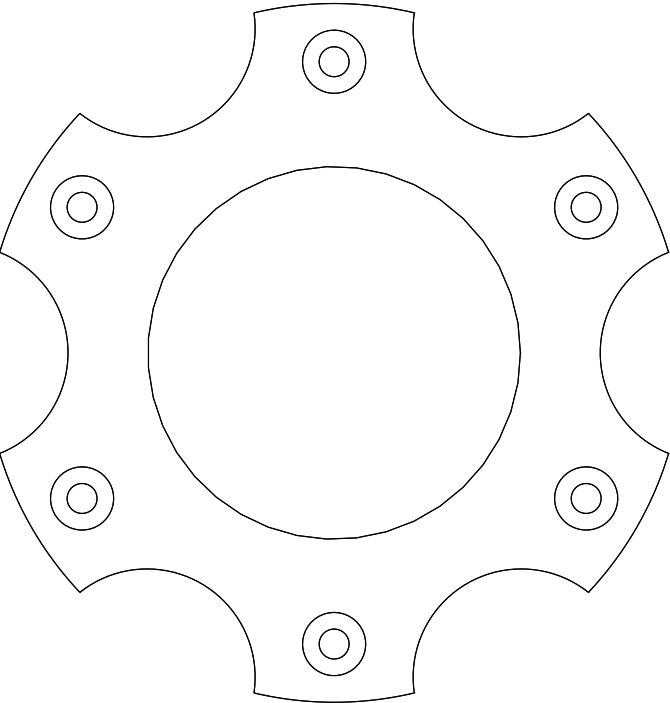

80.444 overall / drawing scale1.100
Vertical84.000; CAD axes YZ

Retained original A13 cartridge/interface STEP, unmodified; source dimensions and bearing stack in linked fit documents.
J7 local mounting/shaft datums retained. Supplier motor pilot, bearing seats and captive nuts need physical gauges.

Printed default linear +/-0.2 after coupons; drilled holes +/-0.1 as trial targets; no metal GD&T release.

No inferred tapped plastic threads. Purchased motors/tubes/steel sleeves/fasteners are not printed.

Projection scale varies per view. Original CAD frame retained. Check supports, nut access, manual fit and actual motor plugs.


A13-J7-103-output-journal

mm | supported, unpowered, unloaded fit issue | STEP defines complete nominal geometry


XY all edges, hidden included

XZ all edges, hidden included


YZ all edges, hidden included

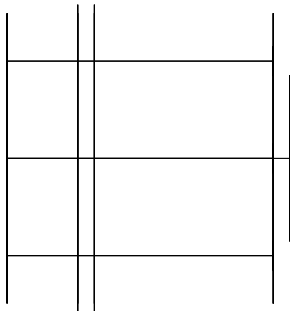

34.000 overall / drawing scale1.100
Vertical37.000; CAD axes XY

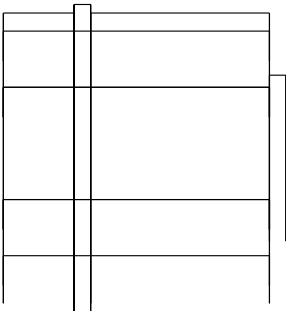

34.000 overall / drawing scale1.100
Vertical37.000; CAD axes XZ

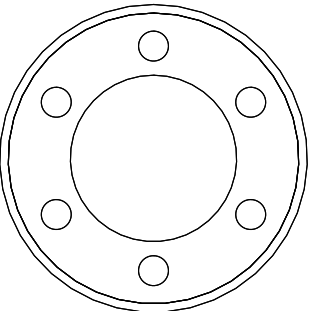

37.000 overall / drawing scale1.100
Vertical37.000; CAD axes YZ

Retained original A13 cartridge/interface STEP, unmodified; source dimensions and bearing stack in linked fit documents.
J7 local mounting/shaft datums retained. Supplier motor pilot, bearing seats and captive nuts need physical gauges.

Printed default linear +/-0.2 after coupons; drilled holes +/-0.1 as trial targets; no metal GD&T release.

No inferred tapped plastic threads. Purchased motors/tubes/steel sleeves/fasteners are not printed.

Projection scale varies per view. Original CAD frame retained. Check supports, nut access, manual fit and actual motor plugs.

A13-J7-104-inner-spacer

mm | supported, unpowered, unloaded fit issue | STEP defines complete nominal geometry

XY all edges, hidden included

XZ all edges, hidden included


YZ all edges, hidden included



3.500 overall / drawing scale1.100
Vertical37.000; CAD axes XY



3.500 overall / drawing scale1.100
Vertical37.000; CAD axes XZ

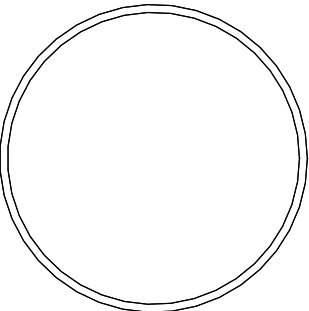

37.000 overall / drawing scale1.100
Vertical37.000; CAD axes YZ

Retained original A13 cartridge/interface STEP, unmodified; source dimensions and bearing stack in linked fit documents.
J7 local mounting/shaft datums retained. Supplier motor pilot, bearing seats and captive nuts need physical gauges.

Printed default linear +/-0.2 after coupons; drilled holes +/-0.1 as trial targets; no metal GD&T release.


No inferred tapped plastic threads. Purchased motors/tubes/steel sleeves/fasteners are not printed.

Projection scale varies per view. Original CAD frame retained. Check supports, nut access, manual fit and actual motor plugs.

A13-IF-107-piloted-flange


mm | supported, unpowered, unloaded fit issue | STEP defines complete nominal geometry

XY all edges, hidden included




10.000 overall / drawing scale1.100
Vertical60.000; CAD axes XY

XZ all edges, hidden included



10.000 overall / drawing scale1.100
Vertical60.000; CAD axes XZ

YZ all edges, hidden included

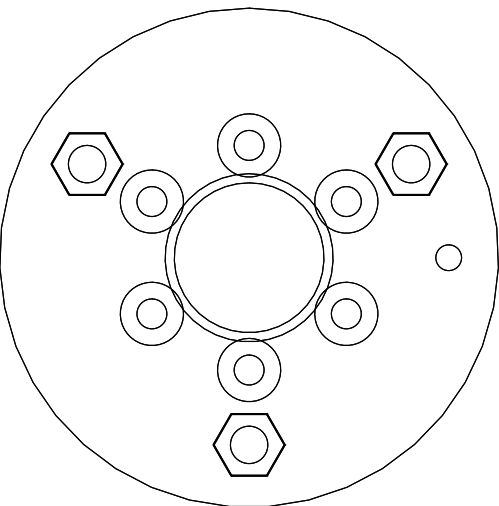

60.000 overall / drawing scale1.100
Vertical60.000; CAD axes YZ

Retained original A13 cartridge/interface STEP, unmodified; source dimensions and bearing stack in linked fit documents.
J7 local mounting/shaft datums retained. Supplier motor pilot, bearing seats and captive nuts need physical gauges.

Printed default linear +/-0.2 after coupons; drilled holes +/-0.1 as trial targets; no metal GD&T release.


No inferred tapped plastic threads. Purchased motors/tubes/steel sleeves/fasteners are not printed.

Projection scale varies per view. Original CAD frame retained. Check supports, nut access, manual fit and actual motor plugs.

A13-IF-301-recessed-carrier


mm | supported, unpowered, unloaded fit issue | STEP defines complete nominal geometry

XY all edges, hidden included

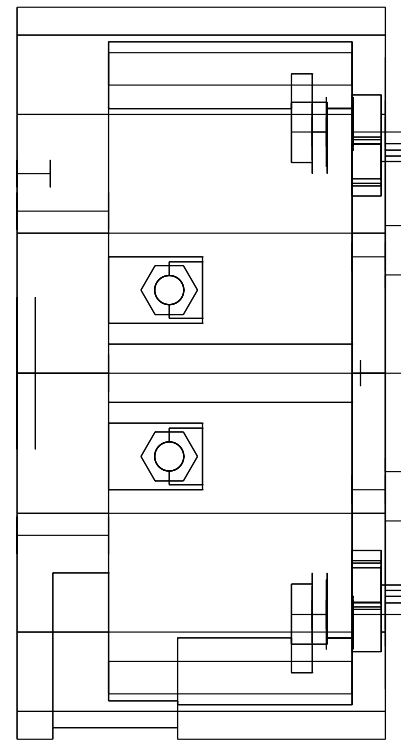


46.300 overall / drawing scale1.100
Vertical88.000; CAD axes XY

XZ all edges, hidden included

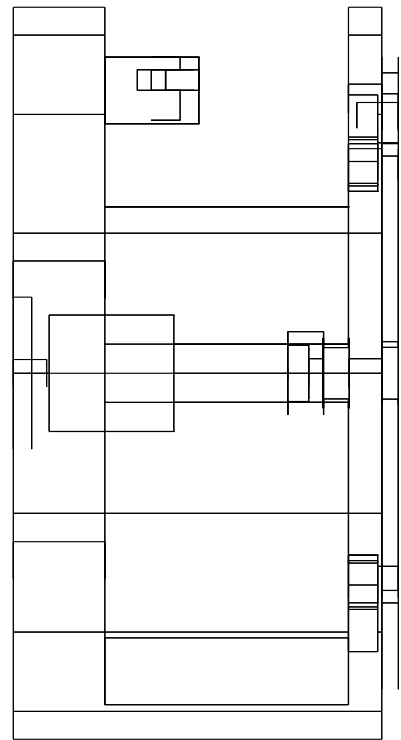

46.300 overall / drawing scale1.100
Vertical88.000; CAD axes XZ

YZ all edges, hidden included

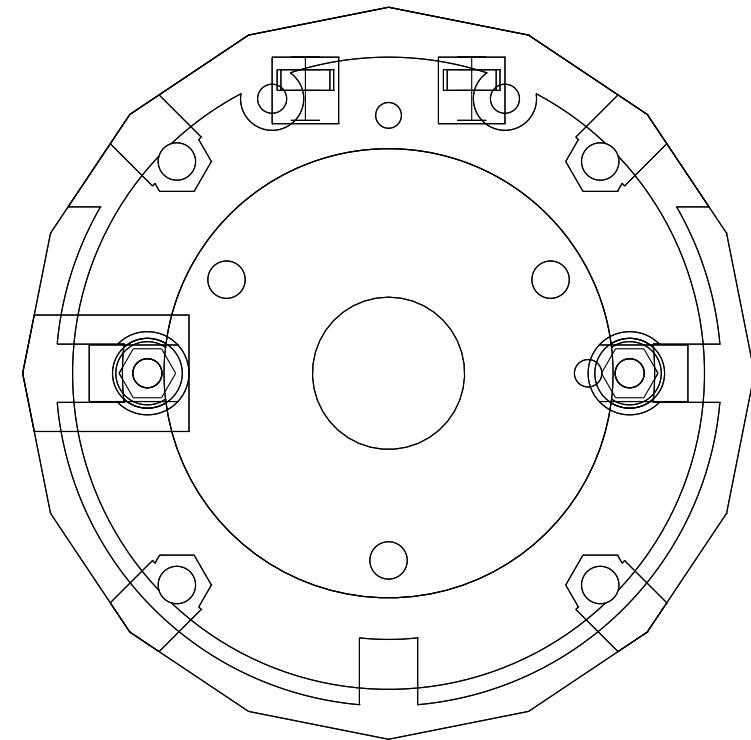

88.000 overall / drawing scale1.100
Vertical88.000; CAD axes YZ

Retained original A13 cartridge/interface STEP, unmodified; source dimensions and bearing stack in linked fit documents.
J7 local mounting/shaft datums retained. Supplier motor pilot, bearing seats and captive nuts need physical gauges.

Printed default linear +/-0.2 after coupons; drilled holes +/-0.1 as trial targets; no metal GD&T release.


No inferred tapped plastic threads. Purchased motors/tubes/steel sleeves/fasteners are not printed.

Projection scale varies per view. Original CAD frame retained. Check supports, nut access, manual fit and actual motor plugs.

A13-IF-302-dorsal-cover


mm | supported, unpowered, unloaded fit issue | STEP defines complete nominal geometry

XY all edges, hidden included

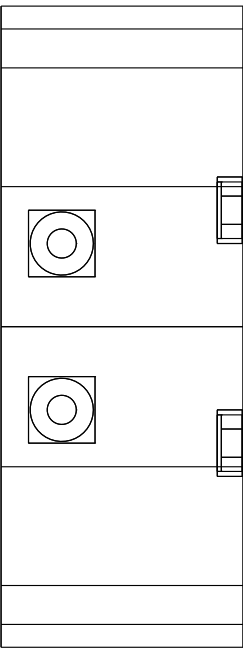


29.100 overall / drawing scale1.100
Vertical77.076; CAD axes XY

XZ all edges, hidden included

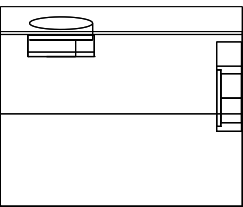

29.100 overall / drawing scale1.100
Vertical24.000; CAD axes XZ

YZ all edges, hidden included

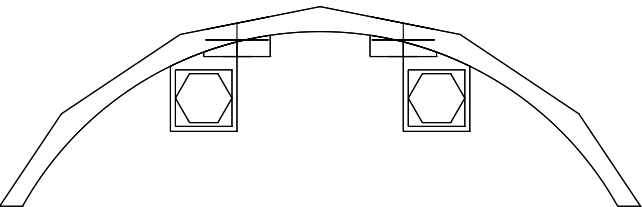

77.076 overall / drawing scale1.100
Vertical24.000; CAD axes YZ

Retained original A13 cartridge/interface STEP, unmodified; source dimensions and bearing stack in linked fit documents.
J7 local mounting/shaft datums retained. Supplier motor pilot, bearing seats and captive nuts need physical gauges.

Printed default linear +/-0.2 after coupons; drilled holes +/-0.1 as trial targets; no metal GD&T release.

No inferred tapped plastic threads. Purchased motors/tubes/steel sleeves/fasteners are not printed.

Projection scale varies per view. Original CAD frame retained. Check supports, nut access, manual fit and actual motor plugs.

A13-IF-303-face-insert

mm | supported, unpowered, unloaded fit issue | STEP defines complete nominal geometry

XY all edges, hidden included




3.000 overall / drawing scale1.100
Vertical66.000; CAD axes XY

XZ all edges, hidden included



3.000 overall / drawing scale1.100
Vertical52.000; CAD axes XZ

YZ all edges, hidden included

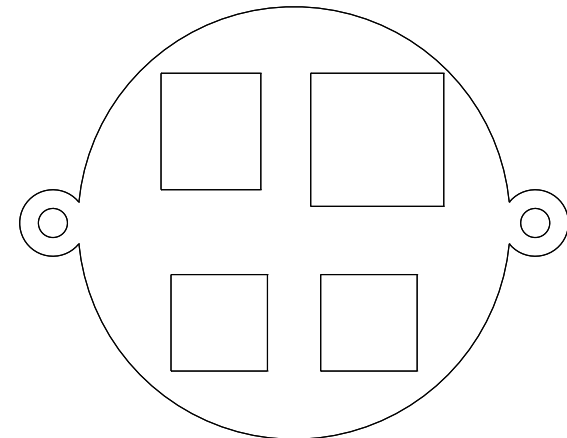

66.000 overall / drawing scale1.100
Vertical52.000; CAD axes YZ

Retained original A13 cartridge/interface STEP, unmodified; source dimensions and bearing stack in linked fit documents.
J7 local mounting/shaft datums retained. Supplier motor pilot, bearing seats and captive nuts need physical gauges.

Printed default linear +/-0.2 after coupons; drilled holes +/-0.1 as trial targets; no metal GD&T release.


No inferred tapped plastic threads. Purchased motors/tubes/steel sleeves/fasteners are not printed.

Projection scale varies per view. Original CAD frame retained. Check supports, nut access, manual fit and actual motor plugs.

A16-C03-root-front-holder


A16 root-cover addon | mm | supported, unpowered, unloaded FIT ONLY

XY all edges; hidden included

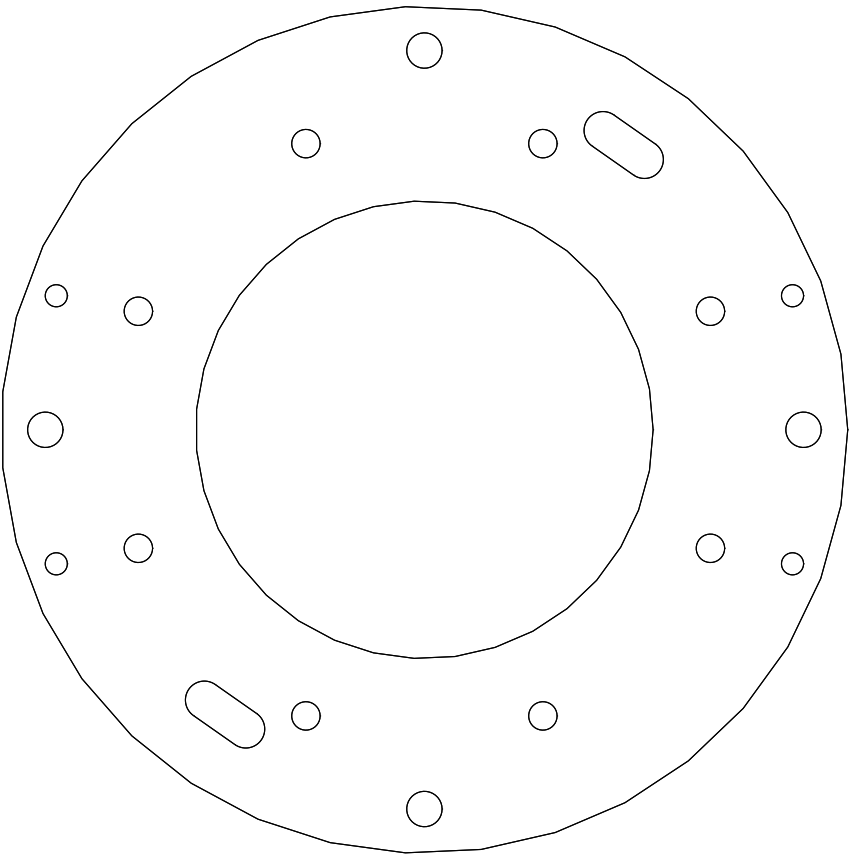


Overall 134.000 x134.000; scale0.836

XZ all edges; hidden included



Overall 134.000 x6.000; scale0.836

YZ all edges; hidden included



Overall 134.000 x6.000; scale0.836

4xD3.5 atR62;20/160/200/340deg. X=+/-58.2609,Y=+/-21.2052; source CAD is authoritative.

R102 plateZ-2.5..3.5; tabsZ4..7,3thick; washer fills0.5 gap. Two tabs per half, straight8-wide strips.

4xM3x16 +8xDIN125 OD7/ID3.2/H0.5 washers +4xM3 nuts AF5.5/H2.4. No plastic tapped threads.

Old R102 and two C02 root skins are replaced; do not stack/install duplicate source parts.

Cowl bottomJ1Z-89.8 /worldZ75.2; B06 neck topZ74. Nominal vertical service seam1.2mm.

Nominal trial linear +/-0.2 after coupons. Motor/base mounts and wire slots retain current source dimensions.


New screw grip9.5+head washer0.5; nutZ-4.9..-2.5, screw tipZ-8.5. Retention/load/thermal not qualified.

STEP and STL supplied for fit. Inspect internal supports, washer seats, actual tools and manual removal.

A16-C03-root-cowl-a


A16 root-cover addon | mm | supported, unpowered, unloaded FIT ONLY

XY all edges; hidden included

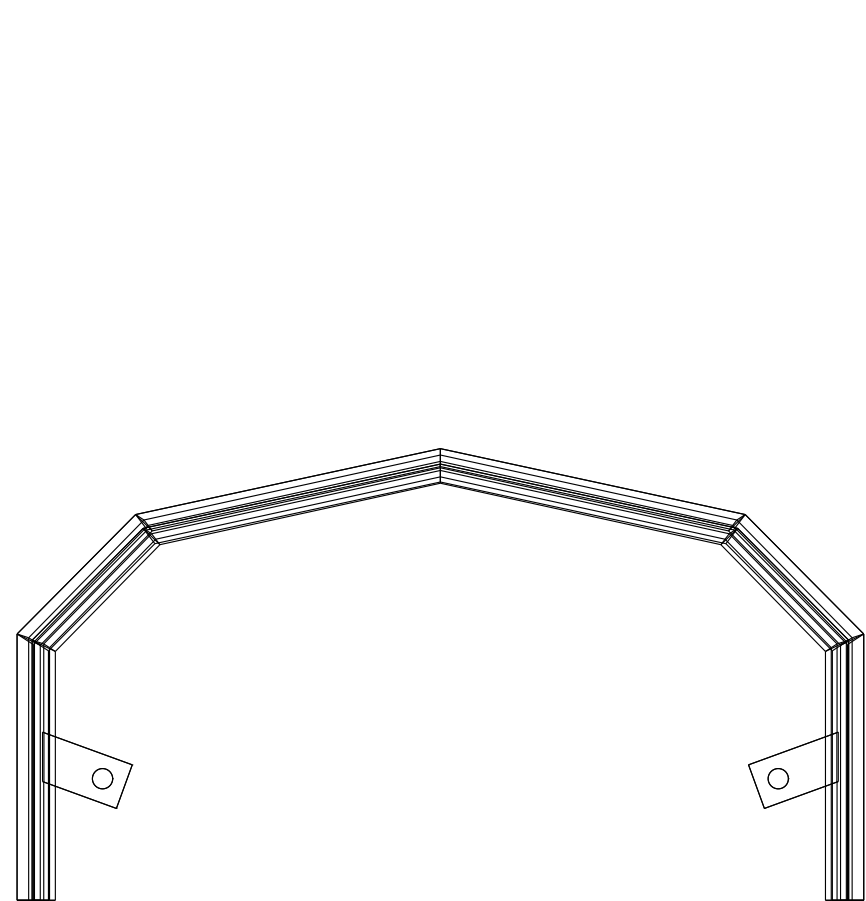


Overall 146.000 x77.850; scale0.767

XZ all edges; hidden included

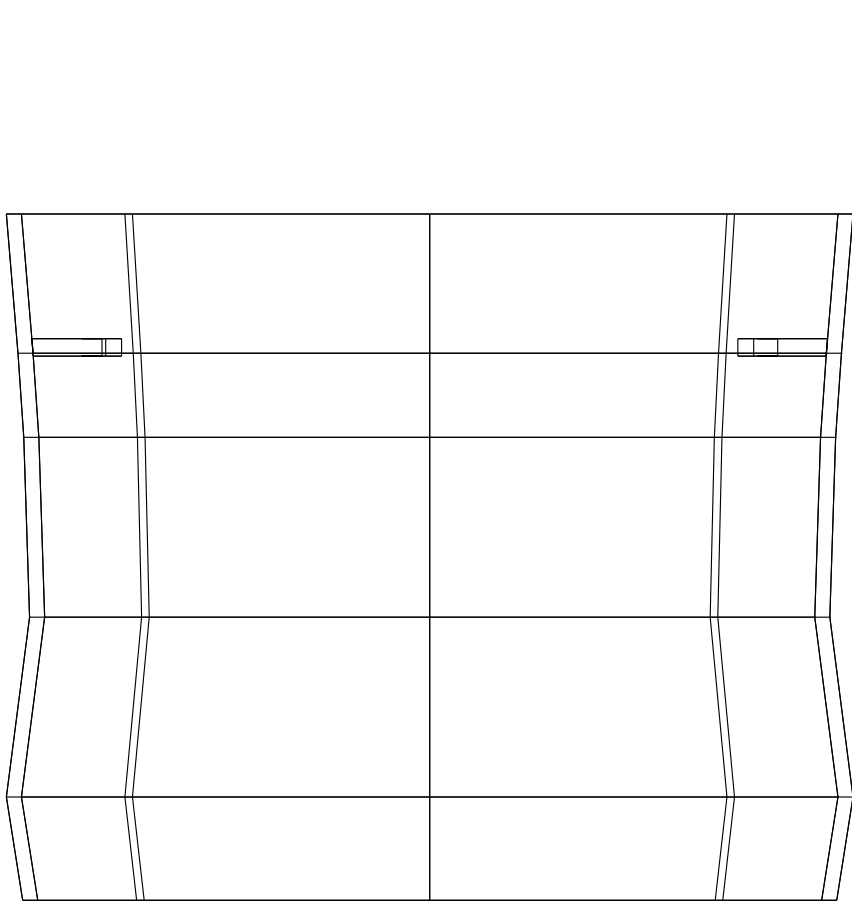

Overall 146.000 x118.300; scale0.767

YZ all edges; hidden included

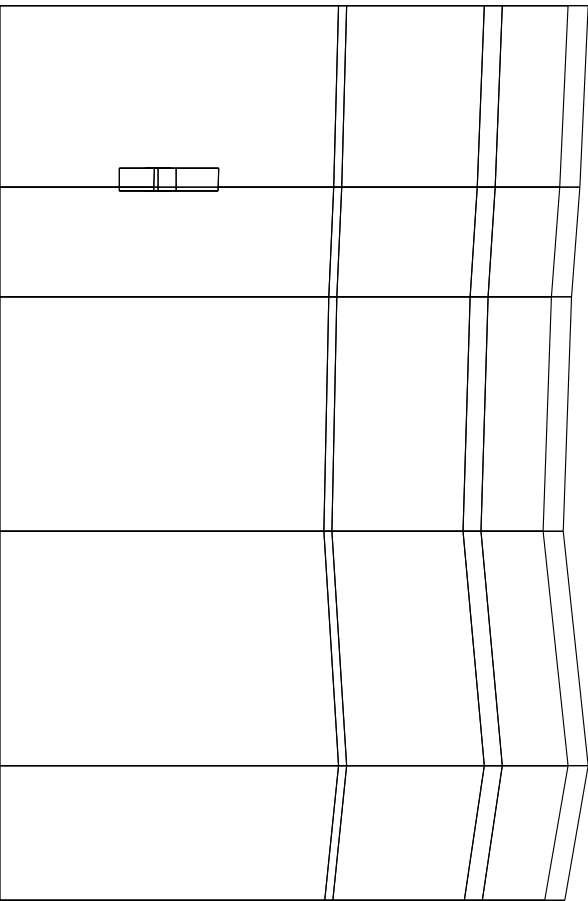

Overall 77.850 x118.300; scale1.000

4xD3.5 atR62;20/160/200/340deg. X=+/-58.2609,Y=+/-21.2052; source CAD is authoritative.

R102 plateZ-2.5..3.5; tabsZ4..7,3thick; washer fills0.5 gap. Two tabs per half, straight8-wide strips.

4xM3x16 +8xDIN125 OD7/ID3.2/H0.5 washers +4xM3 nuts AF5.5/H2.4. No plastic tapped threads.

Old R102 and two C02 root skins are replaced; do not stack/install duplicate source parts.

Cowl bottomJ1Z-89.8 /worldZ75.2; B06 neck topZ74. Nominal vertical service seam1.2mm.

Nominal trial linear +/-0.2 after coupns. Motor/base mounts and wire slots retain current source dimensions.


New screw grip9.5+head washer0.5; nutZ-4.9..-2.5, screw tipZ-8.5. Retention/load/thermal not qualified.

STEP and STL supplied for fit. Inspect internal supports, washer seats, actual tools and manual removal.

A16-C03-root-cowl-b


A16 root-cover addon | mm | supported, unpowered, unloaded FIT ONLY

XY all edges; hidden included

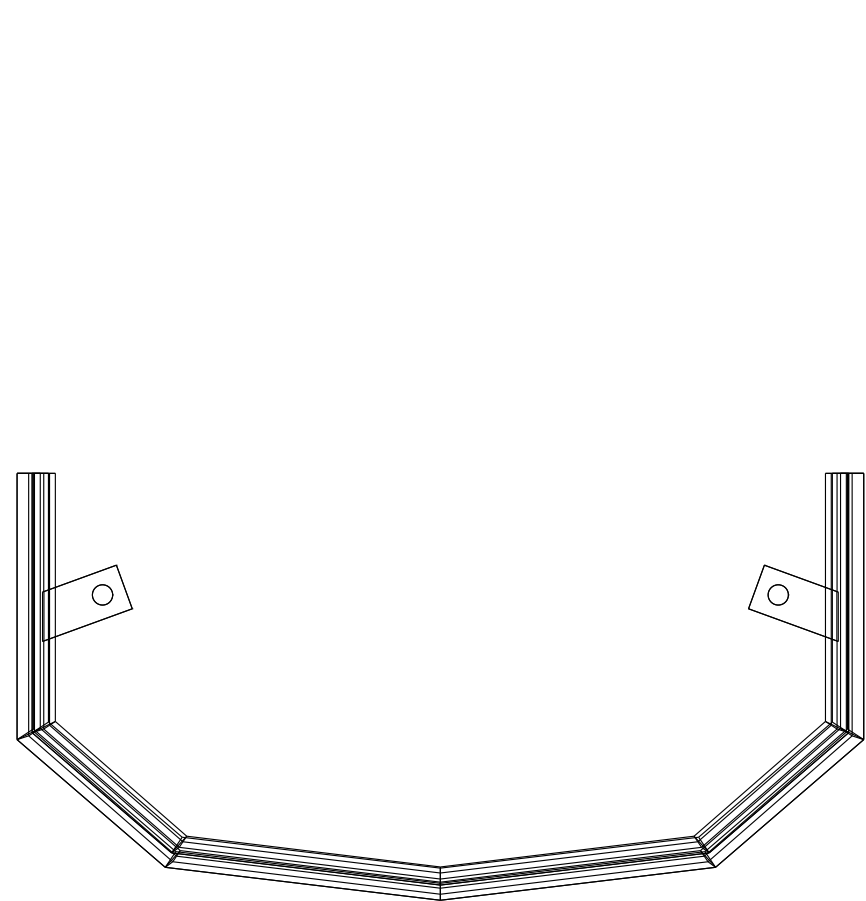


Overall 146.000 x73.590; scale0.767

XZ all edges; hidden included

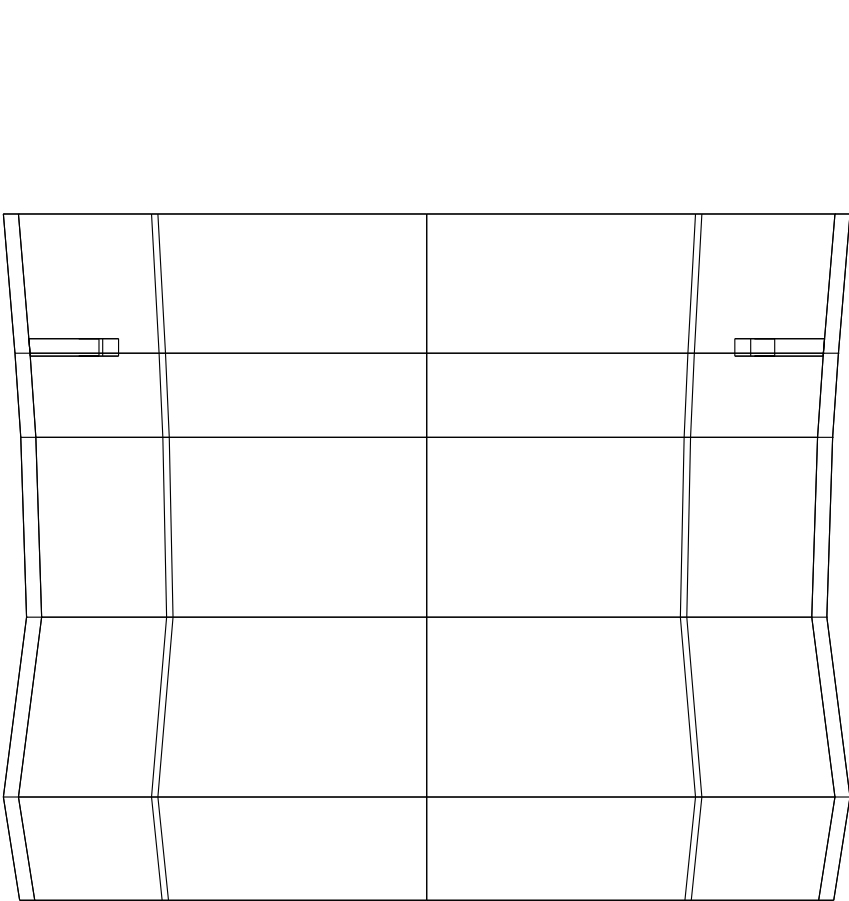

Overall 146.000 x118.300; scale0.767

YZ all edges; hidden included

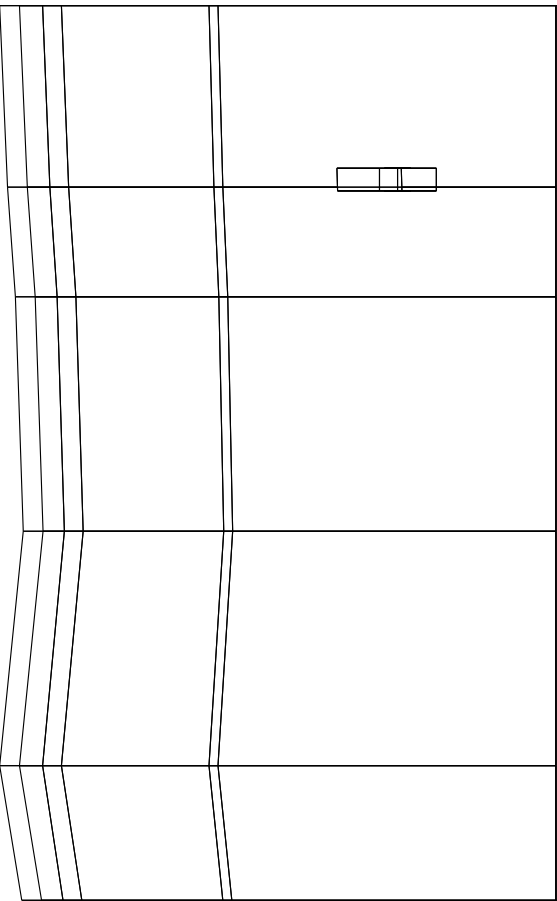

Overall 73.590 x118.300; scale1.000

4xD3.5 atR62;20/160/200/340deg. X=+/-58.2609,Y=+/-21.2052; source CAD is authoritative.

R102 plateZ-2.5..3.5; tabsZ4..7,3thick; washer fills0.5 gap. Two tabs per half, straight8-wide strips.

4xM3x16 +8xDIN125 OD7/ID3.2/H0.5 washers +4xM3 nuts AF5.5/H2.4. No plastic tapped threads.

Old R102 and two C02 root skins are replaced; do not stack/install duplicate source parts.

Cowl bottomJ1Z-89.8 /worldZ75.2; B06 neck topZ74. Nominal vertical service seam1.2mm.

Nominal trial linear +/-0.2 after coupns. Motor/base mounts and wire slots retain current source dimensions.


New screw grip9.5+head washer0.5; nutZ-4.9..-2.5, screw tipZ-8.5. Retention/load/thermal not qualified.

STEP and STL supplied for fit. Inspect internal supports, washer seats, actual tools and manual removal.

A16-C04-J2-mount-plate


mm | NOMINAL FIT ONLY | supported, unpowered, unloaded | original CAD axes

XY all edges, hidden included

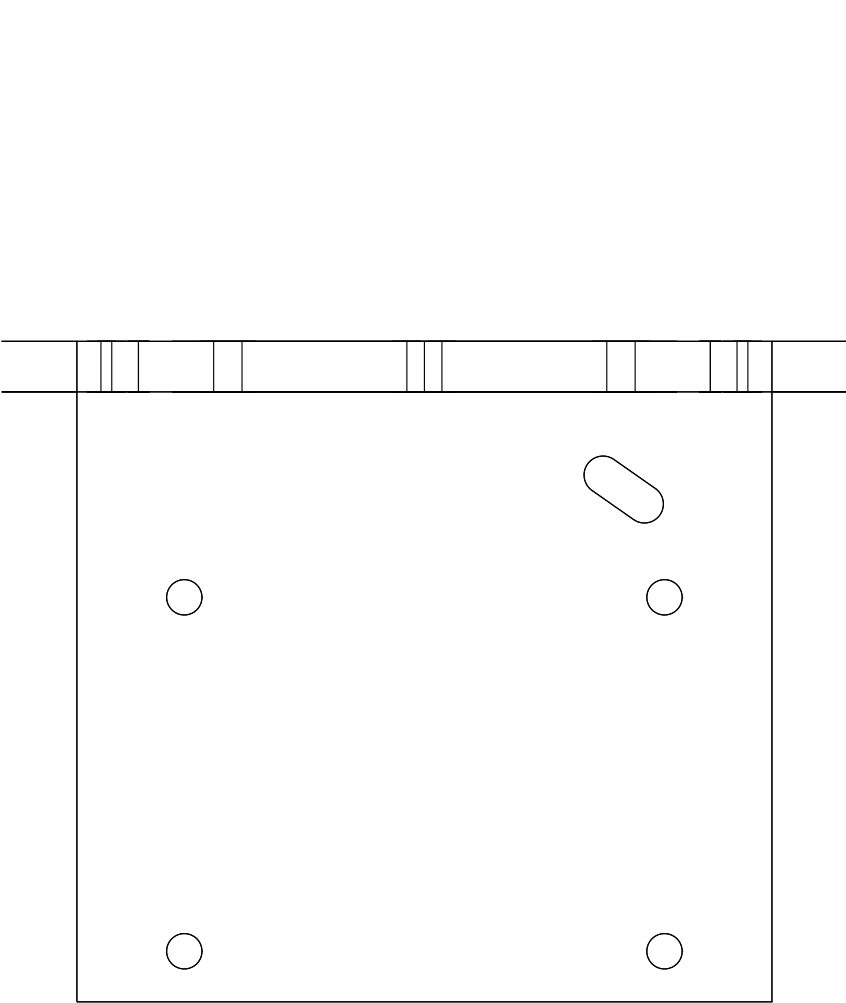


Overall134.000 x104.500; scale0.836

XZ all edges, hidden included

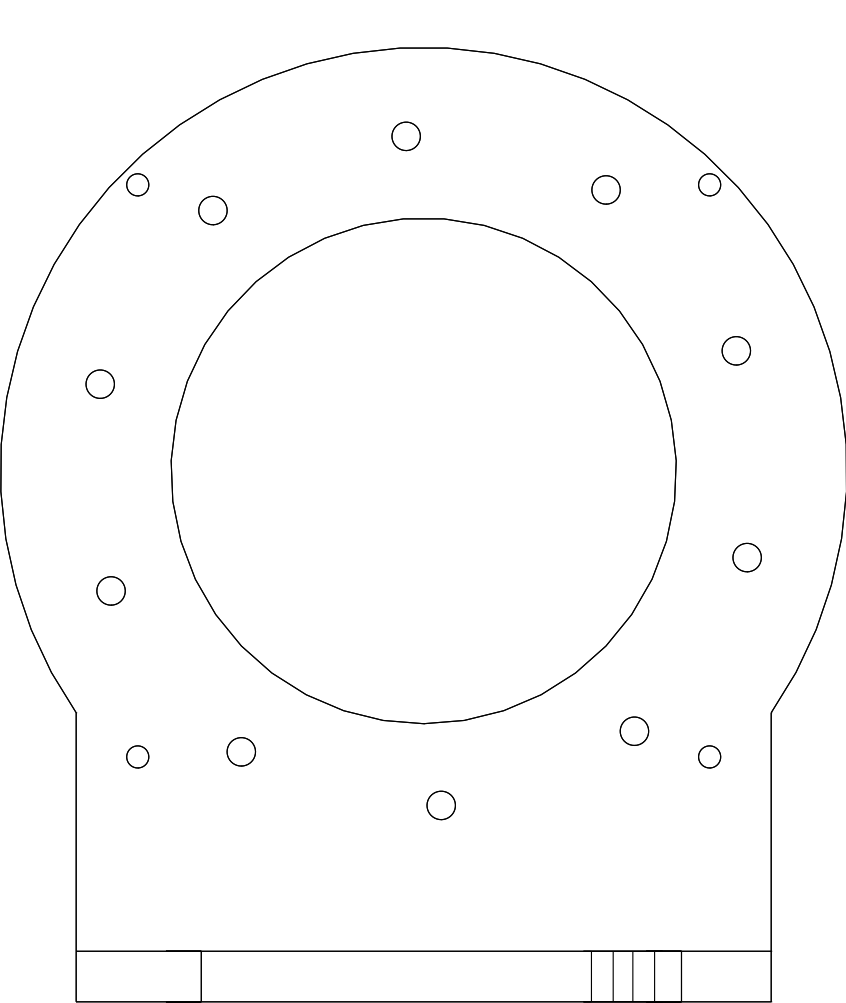

Overall134.000 x151.000; scale0.836

YZ all edges, hidden included



Overall104.500 x151.000; scale0.874

STEP defines complete nominal geometry; native holes retained. mount-table.csv lists added centres/axes.

RS04:4xD3.5 atR64,45/135/225/315deg; plate8, spacer0.5, ear3, head washer0.5.

RS04:4xM3x16 per joint,2 per cover half;8xOD7/ID3.2/H0.5 washers and4xAF5.5/H2.4 nuts.

Replacement parts only: never stack old bracket or old cowl. Base and motor native datums unchanged.

Trial printed linear +/-0.2 after coupon calibration; inspect washer seating and de-support internal ears.


Source dimensions, thread engagement and hardware envelopes do not certify plastic retention or metal GD&T.

Three named static poses and empty straight hex-key space only; motion, actual tools and load not released.

A16-C04-J2-cowl-a


mm | NOMINAL FIT ONLY | supported, unpowered, unloaded | original CAD axes

XY all edges, hidden included

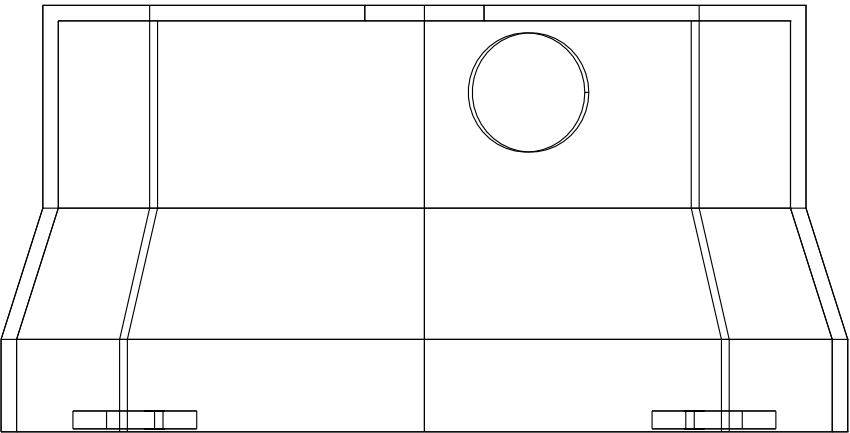


Overall142.000 x71.500; scale0.789

XZ all edges, hidden included

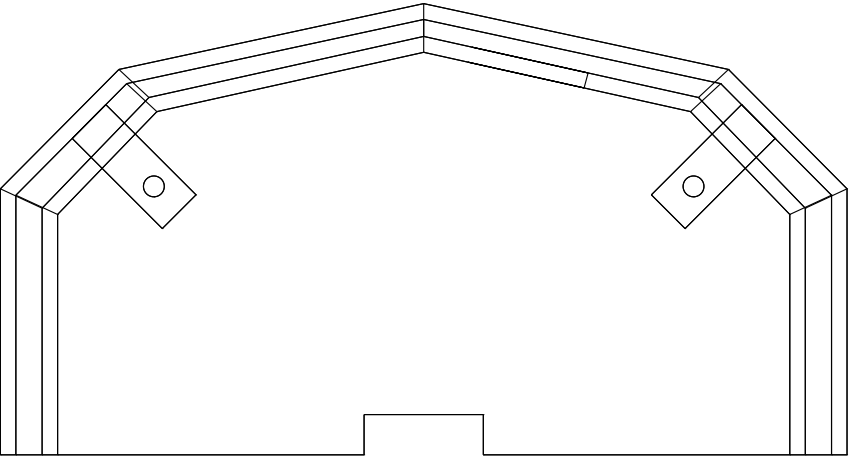

Overall142.000 x75.650; scale0.789

YZ all edges, hidden included

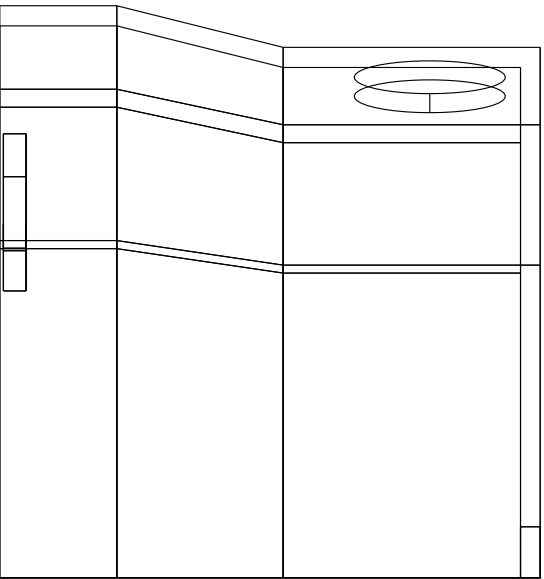

Overall71.500 x75.650; scale1.000

STEP defines complete nominal geometry; native holes retained. mount-table.csv lists added centres/axes.

RS04:4xD3.5 atR64,45/135/225/315deg; plate8, spacer0.5, ear3, head washer0.5.

RS04:4xM3x16 per joint,2 per cover half;8xOD7/ID3.2/H0.5 washers and4xAF5.5/H2.4 nuts.

Replacement parts only: never stack old bracket or old cowl. Base and motor native datums unchanged.

Trial printed linear +/-0.2 after coupon calibration; inspect washer seating and de-support internal ears.


Source dimensions, thread engagement and hardware envelopes do not certify plastic retention or metal GD&T.

Three named static poses and empty straight hex-key space only; motion, actual tools and load not released.

A16-C04-J2-cowl-b


mm | NOMINAL FIT ONLY | supported, unpowered, unloaded | original CAD axes

XY all edges, hidden included

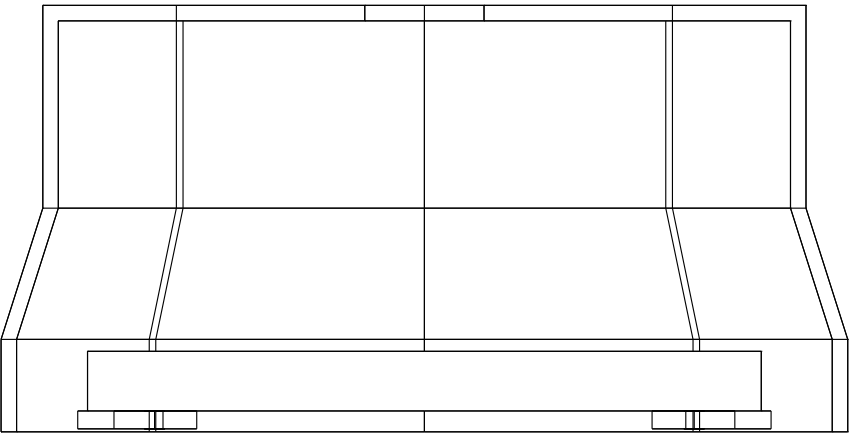


Overall142.000 x71.500; scale0.789

XZ all edges, hidden included

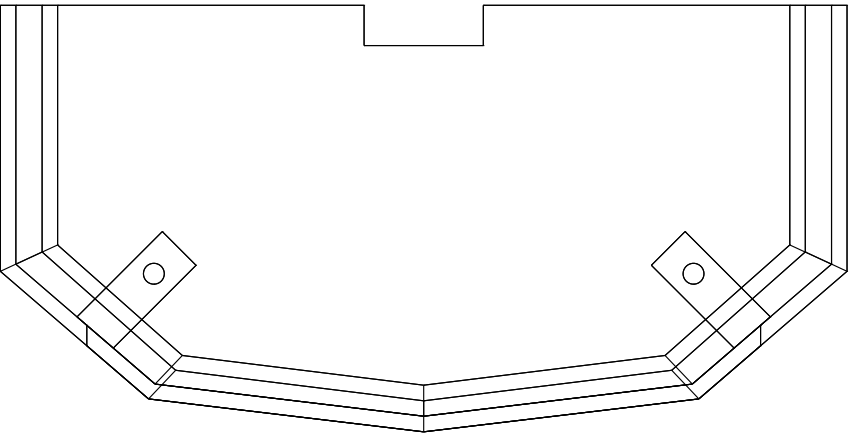

Overall142.000 x71.510; scale0.789

YZ all edges, hidden included

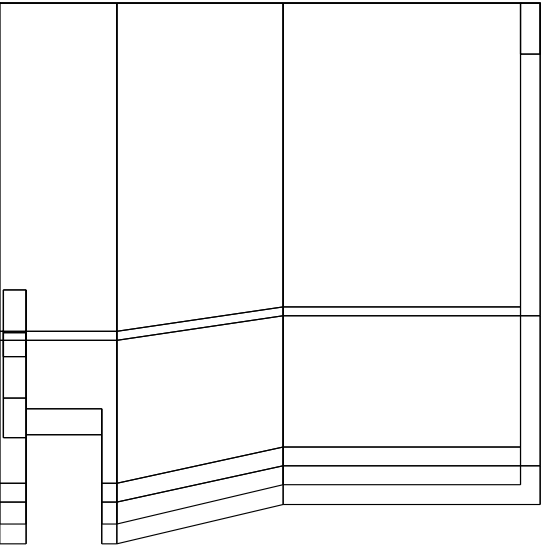

Overall71.500 x71.510; scale1.000

STEP defines complete nominal geometry; native holes retained. mount-table.csv lists added centres/axes.

RS04:4xD3.5 atR64,45/135/225/315deg; plate8, spacer0.5, ear3, head washer0.5.

RS04:4xM3x16 per joint,2 per cover half;8xOD7/ID3.2/H0.5 washers and4xAF5.5/H2.4 nuts.

Replacement parts only: never stack old bracket or old cowl. Base and motor native datums unchanged.

Trial printed linear +/-0.2 after coupon calibration; inspect washer seating and de-support internal ears.


Source dimensions, thread engagement and hardware envelopes do not certify plastic retention or metal GD&T.

Three named static poses and empty straight hex-key space only; motion, actual tools and load not released.

A16-C04-J3-mount-plate


mm | NOMINAL FIT ONLY | supported, unpowered, unloaded | original CAD axes

XY all edges, hidden included




Overall70.350 x150.000; scale0.880

XZ all edges, hidden included

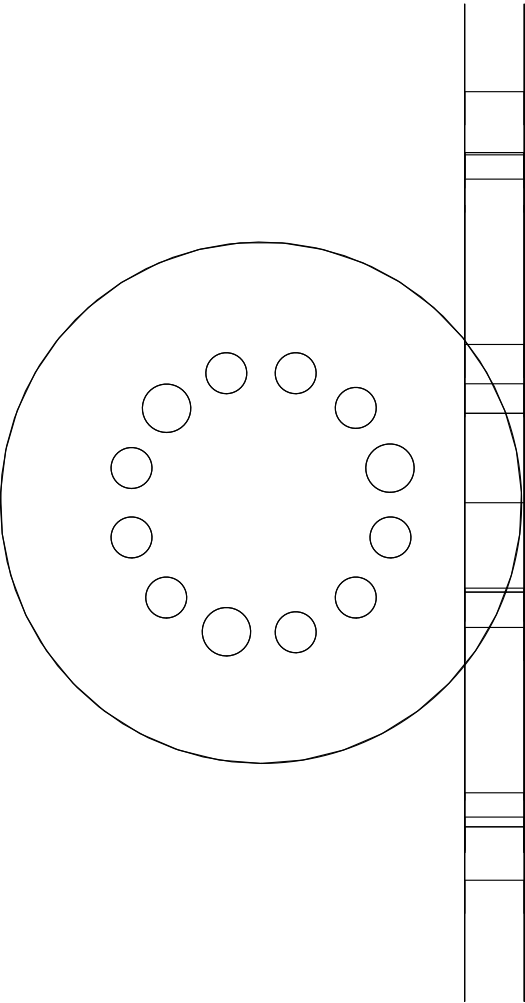

Overall70.350 x134.000; scale0.985

YZ all edges, hidden included

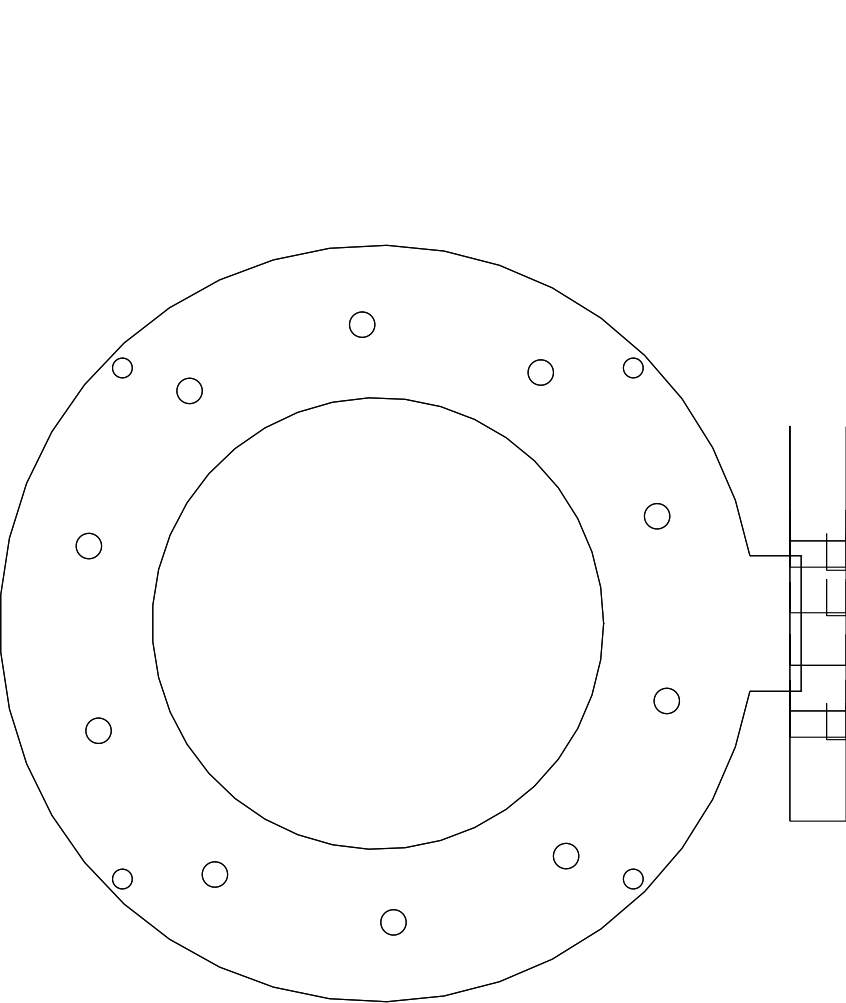

Overall150.000 x134.000; scale0.747

STEP defines complete nominal geometry; native holes retained. mount-table.csv lists added centres/axes.

RS04:4xD3.5 atR64,45/135/225/315deg; plate8, spacer0.5, ear3, head washer0.5.

RS04:4xM3x16 per joint,2 per cover half;8xOD7/ID3.2/H0.5 washers and4xAF5.5/H2.4 nuts.

Replacement parts only: never stack old bracket or old cowl. Base and motor native datums unchanged.

Trial printed linear +/-0.2 after coupon calibration; inspect washer seating and de-support internal ears.


Source dimensions, thread engagement and hardware envelopes do not certify plastic retention or metal GD&T.

Three named static poses and empty straight hex-key space only; motion, actual tools and load not released.

A16-C04-J3-cowl-a


mm | NOMINAL FIT ONLY | supported, unpowered, unloaded | original CAD axes

XY all edges, hidden included

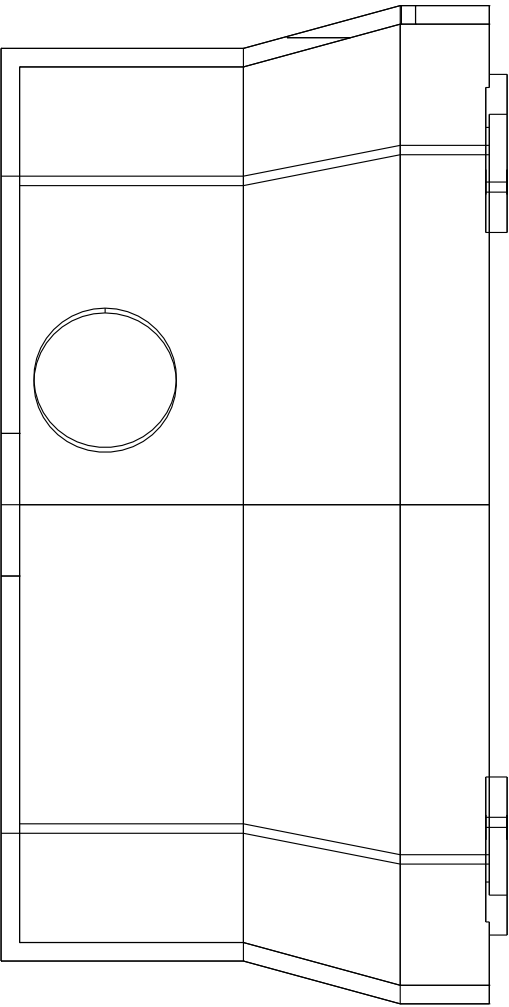


Overall71.000 x140.000; scale0.943

XZ all edges, hidden included

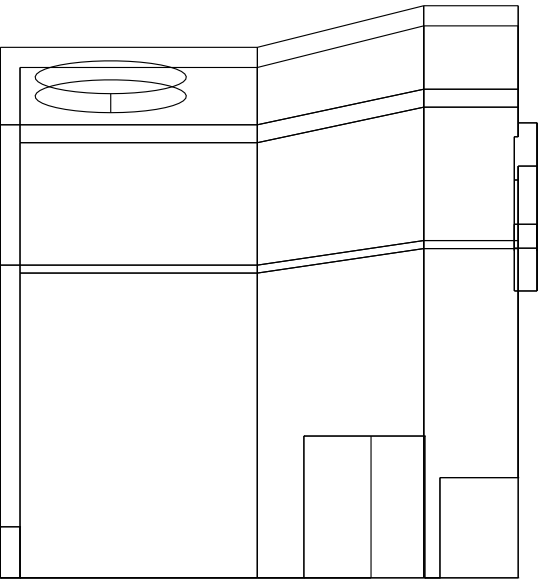

Overall71.000 x75.650; scale1.000

YZ all edges, hidden included

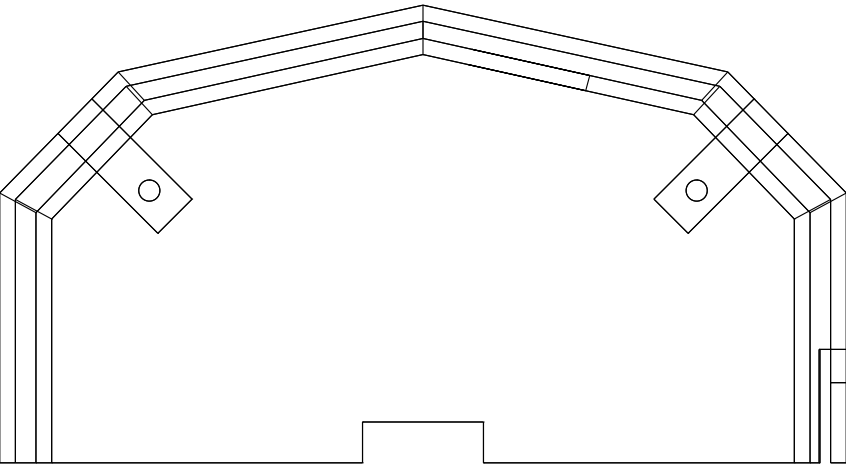

Overall140.000 x75.650; scale0.800

STEP defines complete nominal geometry; native holes retained. mount-table.csv lists added centres/axes.

RS04:4xD3.5 atR64,45/135/225/315deg; plate8, spacer0.5, ear3, head washer0.5.

RS04:4xM3x16 per joint,2 per cover half;8xOD7/ID3.2/H0.5 washers and4xAF5.5/H2.4 nuts.

Replacement parts only: never stack old bracket or old cowl. Base and motor native datums unchanged.

Trial printed linear +/-0.2 after coupon calibration; inspect washer seating and de-support internal ears.


Source dimensions, thread engagement and hardware envelopes do not certify plastic retention or metal GD&T.

Three named static poses and empty straight hex-key space only; motion, actual tools and load not released.

A16-C04-J3-cowl-b


mm | NOMINAL FIT ONLY | supported, unpowered, unloaded | original CAD axes

XY all edges, hidden included

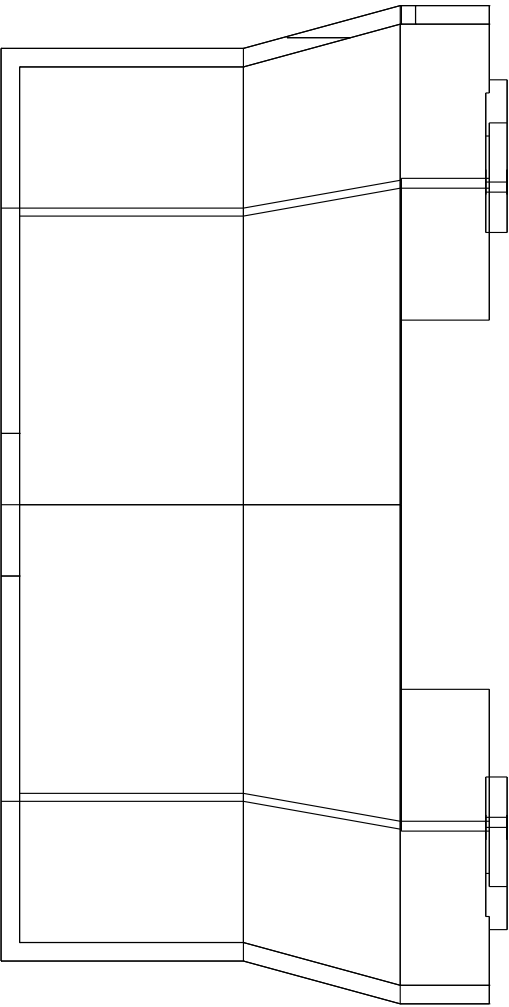


Overall71.000 x140.000; scale0.943

XZ all edges, hidden included

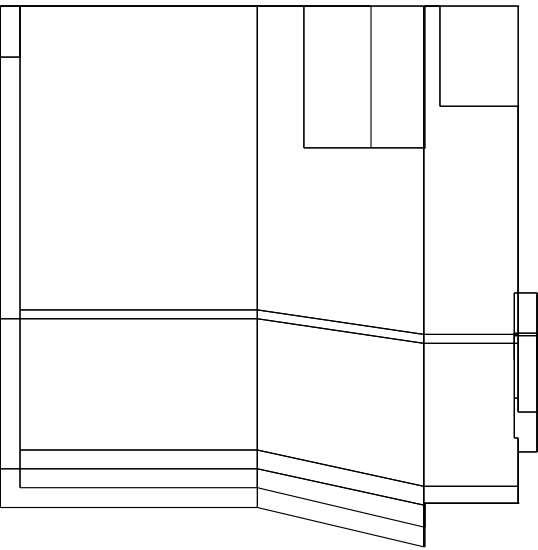

Overall71.000 x71.510; scale1.000

YZ all edges, hidden included

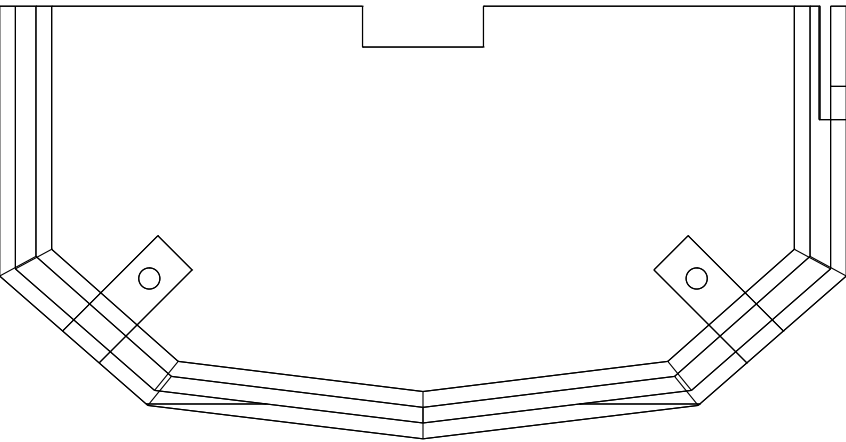

Overall140.000 x71.510; scale0.800

STEP defines complete nominal geometry; native holes retained. mount-table.csv lists added centres/axes.

RS04:4xD3.5 atR64,45/135/225/315deg; plate8, spacer0.5, ear3, head washer0.5.

RS04:4xM3x16 per joint,2 per cover half;8xOD7/ID3.2/H0.5 washers and4xAF5.5/H2.4 nuts.

Replacement parts only: never stack old bracket or old cowl. Base and motor native datums unchanged.

Trial printed linear +/-0.2 after coupon calibration; inspect washer seating and de-support internal ears.


Source dimensions, thread engagement and hardware envelopes do not certify plastic retention or metal GD&T.

Three named static poses and empty straight hex-key space only; motion, actual tools and load not released.

A16-C04-J4-mount-plate


mm | NOMINAL FIT ONLY | supported, unpowered, unloaded | original CAD axes

XY all edges, hidden included




Overall162.000 x49.350; scale0.691

XZ all edges, hidden included

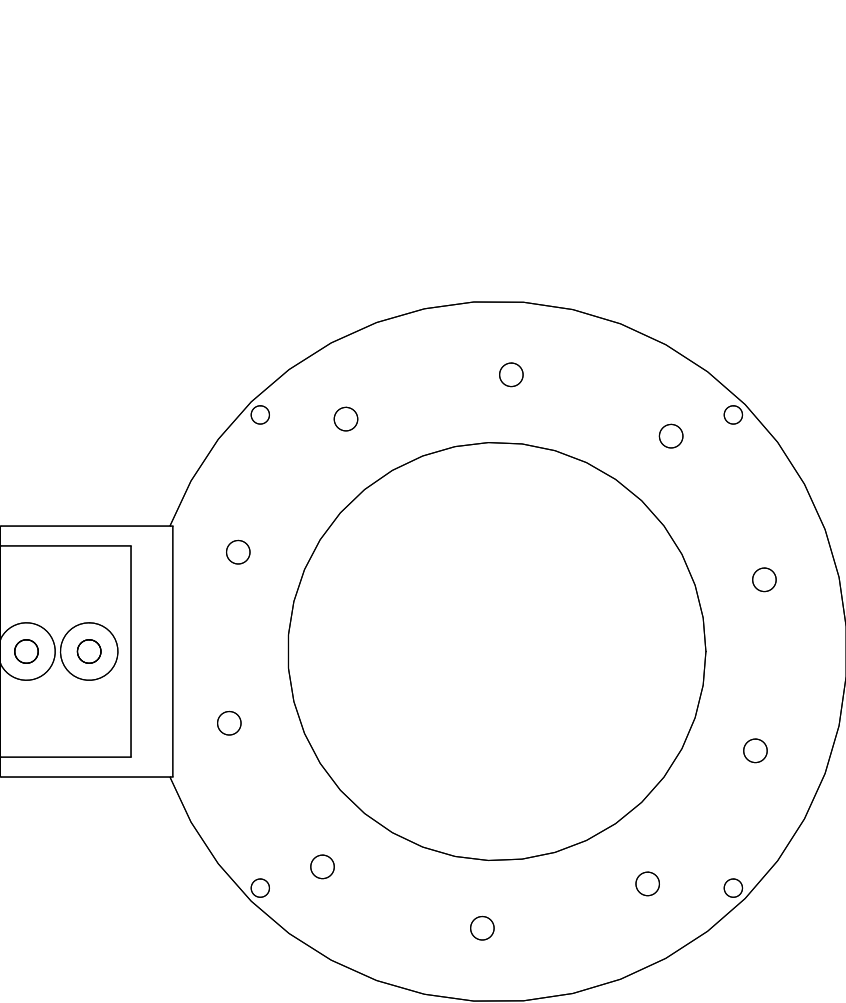

Overall162.000 x134.000; scale0.691

YZ all edges, hidden included

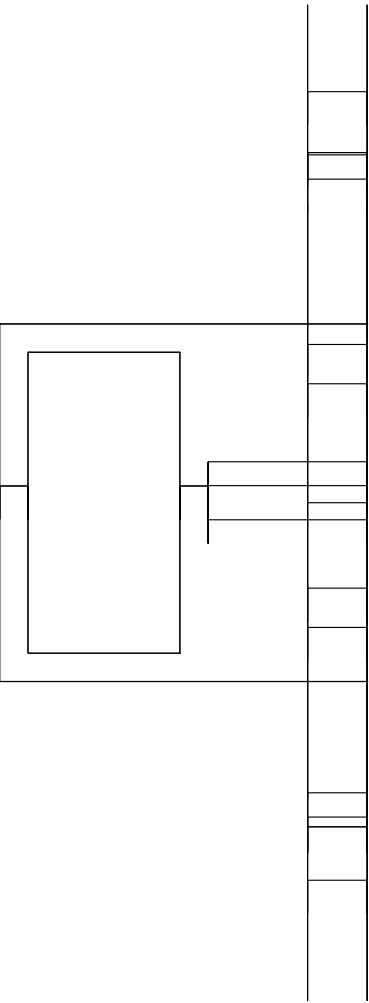

Overall49.350 x134.000; scale0.985

STEP defines complete nominal geometry; native holes retained. mount-table.csv lists added centres/axes.

RS04:4xD3.5 atR64,45/135/225/315deg; plate8, spacer0.5, ear3, head washer0.5.

RS04:4xM3x16 per joint,2 per cover half;8xOD7/ID3.2/H0.5 washers and4xAF5.5/H2.4 nuts.

Replacement parts only: never stack old bracket or old cowl. Base and motor native datums unchanged.

Trial printed linear +/-0.2 after coupon calibration; inspect washer seating and de-support internal ears.


Source dimensions, thread engagement and hardware envelopes do not certify plastic retention or metal GD&T.

Three named static poses and empty straight hex-key space only; motion, actual tools and load not released.

A16-C04-J4-cowl-a


mm | NOMINAL FIT ONLY | supported, unpowered, unloaded | original CAD axes

XY all edges, hidden included

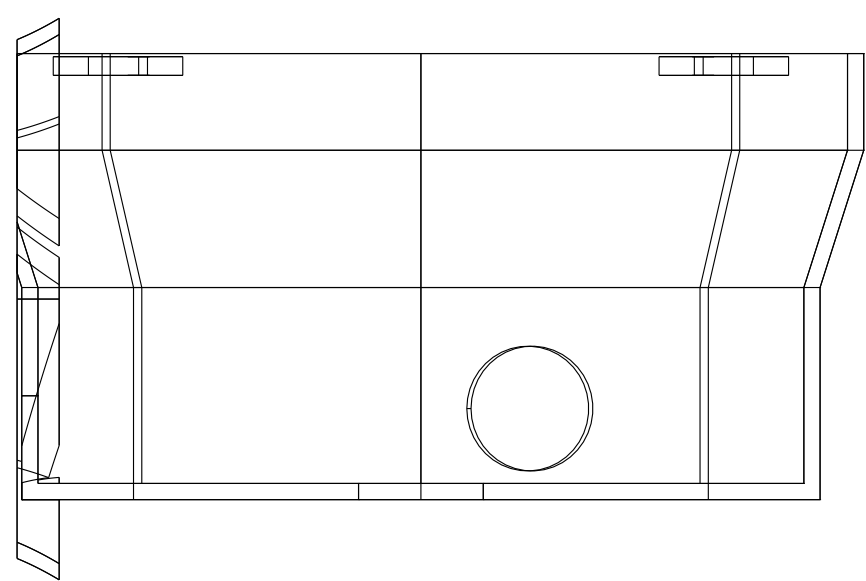


Overall135.750 x90.000; scale0.825

XZ all edges, hidden included

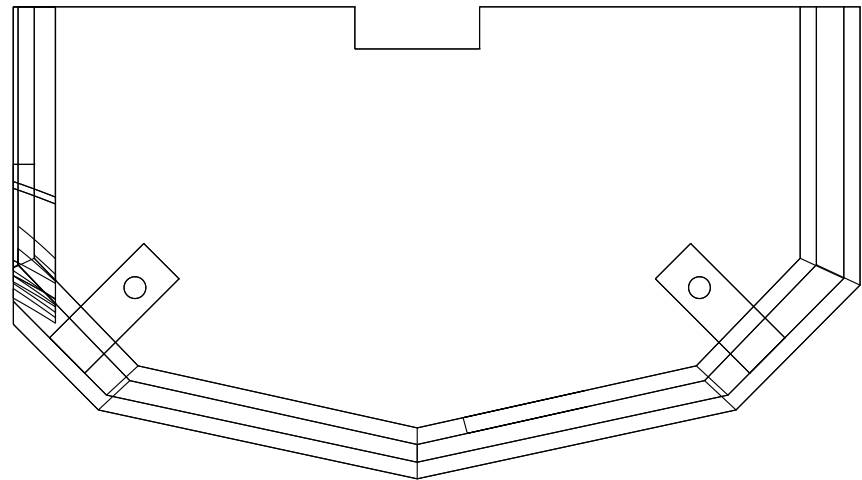

Overall135.750 x75.650; scale0.825

YZ all edges, hidden included

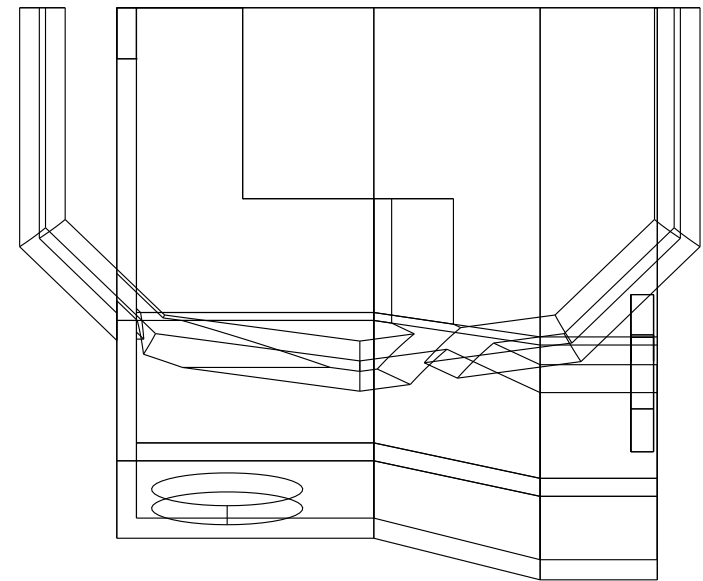

Overall90.000 x75.650; scale1.000

STEP defines complete nominal geometry; native holes retained. mount-table.csv lists added centres/axes.

RS04:4xD3.5 atR64,45/135/225/315deg; plate8, spacer0.5, ear3, head washer0.5.

RS04:4xM3x16 per joint,2 per cover half;8xOD7/ID3.2/H0.5 washers and4xAF5.5/H2.4 nuts.

Replacement parts only: never stack old bracket or old cowl. Base and motor native datums unchanged.

Trial printed linear +/-0.2 after coupon calibration; inspect washer seating and de-support internal ears.


Source dimensions, thread engagement and hardware envelopes do not certify plastic retention or metal GD&T.

Three named static poses and empty straight hex-key space only; motion, actual tools and load not released.

A16-C04-J4-cowl-b


mm | NOMINAL FIT ONLY | supported, unpowered, unloaded | original CAD axes

XY all edges, hidden included

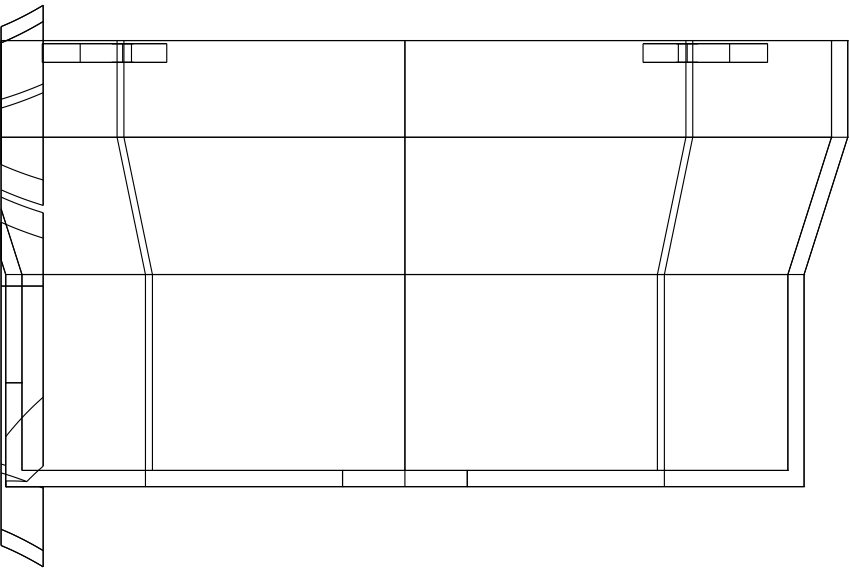


Overall135.750 x90.000; scale0.825

XZ all edges, hidden included

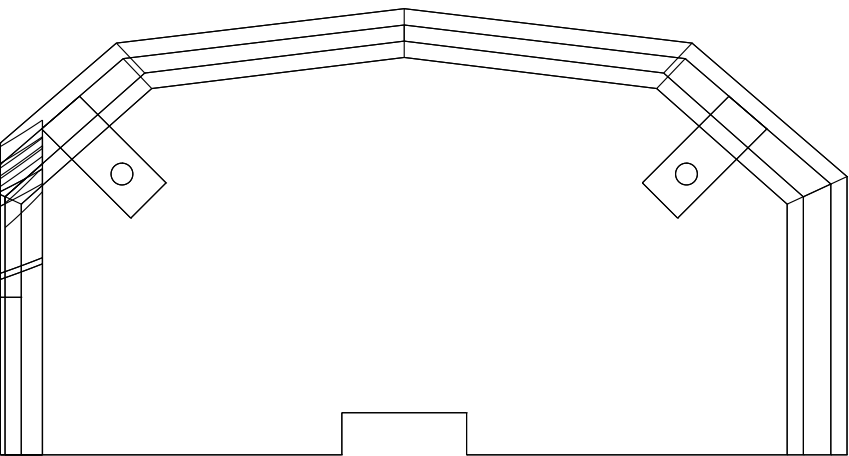

Overall135.750 x71.510; scale0.825

YZ all edges, hidden included

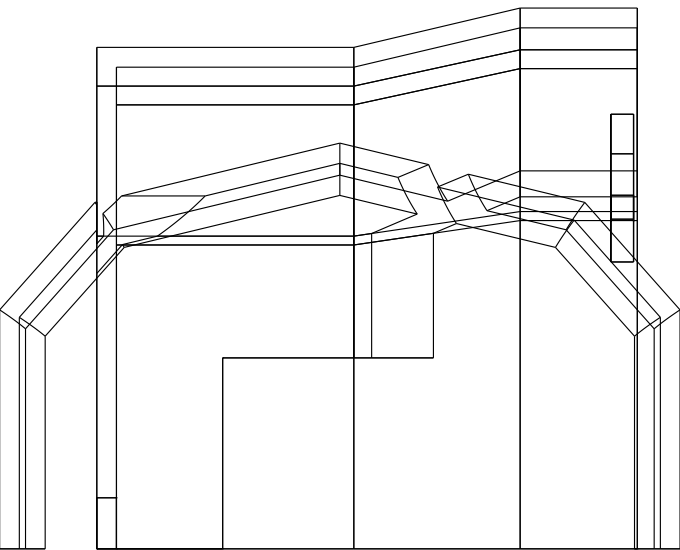

Overall90.000 x71.510; scale1.000

STEP defines complete nominal geometry; native holes retained. mount-table.csv lists added centres/axes.

RS04:4xD3.5 atR64,45/135/225/315deg; plate8, spacer0.5, ear3, head washer0.5.

RS04:4xM3x16 per joint,2 per cover half;8xOD7/ID3.2/H0.5 washers and4xAF5.5/H2.4 nuts.

Replacement parts only: never stack old bracket or old cowl. Base and motor native datums unchanged.

Trial printed linear +/-0.2 after coupon calibration; inspect washer seating and de-support internal ears.


Source dimensions, thread engagement and hardware envelopes do not certify plastic retention or metal GD&T.

Three named static poses and empty straight hex-key space only; motion, actual tools and load not released.

A16-C05-J5-cowl-a


mm | NOMINAL FIT ONLY | supported, unpowered, unloaded | original CAD axes

XY all edges, hidden included

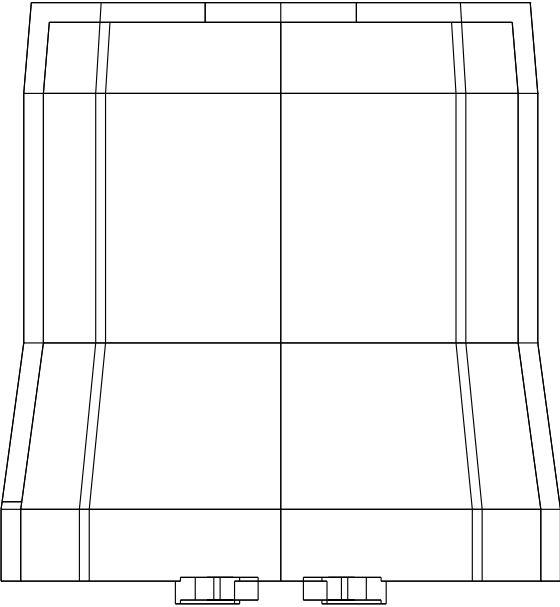


Overall74.000 x79.500; scale1.000

XZ all edges, hidden included

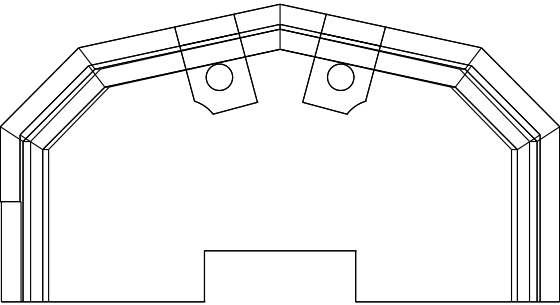

Overall74.000 x39.350; scale1.000

YZ all edges, hidden included

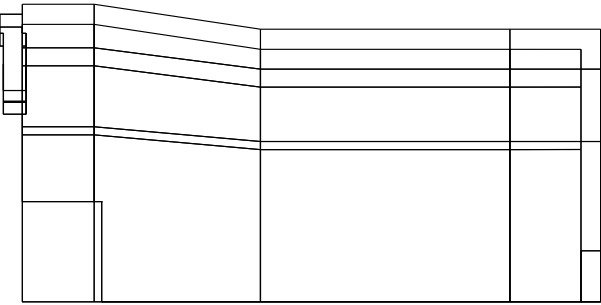

Overall79.500 x39.350; scale1.000

STEP defines complete nominal geometry; native holes retained. mount-table.csv lists added centres/axes.

Heat-set pilotsD4.0; genuine ruthexRX-M3x5.7 /RX-M3Sx4.0,maximumOD4.6. Calibrate first.

See mount-table.csv: exact fixing centre/axis andmanifest for screw length, insert length and grip.

Replacement parts only: never stack old bracket or old cowl. Base and motor native datums unchanged.

Trial printed linear +/-0.2 after coupon calibration; inspect washer seating and de-support internal ears.


Source dimensions, thread engagement and hardware envelopes do not certify plastic retention or metal GD&T.

Three named static poses and empty straight hex-key space only; motion, actual tools and load not released.

A16-C05-J5-cowl-b


mm | NOMINAL FIT ONLY | supported, unpowered, unloaded | original CAD axes

XY all edges, hidden included

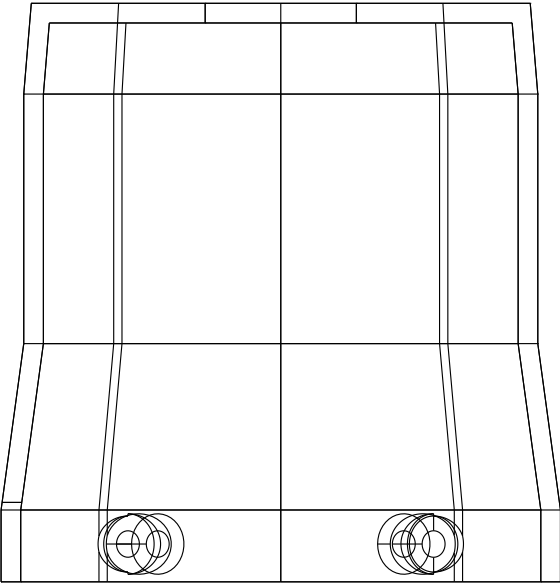


Overall74.000 x76.500; scale1.000

XZ all edges, hidden included

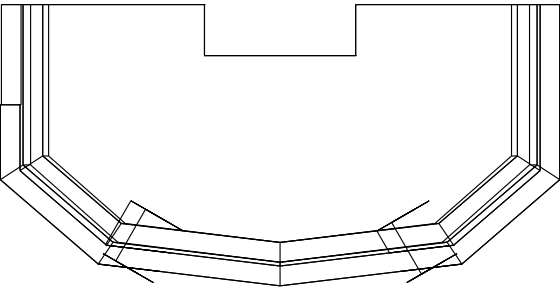

Overall74.000 x37.190; scale1.000

YZ all edges, hidden included

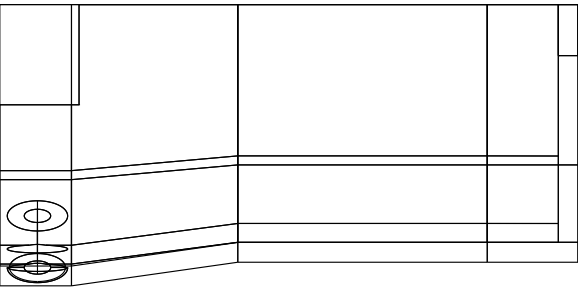

Overall76.500 x37.190; scale1.000

STEP defines complete nominal geometry; native holes retained. mount-table.csv lists added centres/axes.

Heat-set pilotsD4.0; genuine ruthexRX-M3x5.7 /RX-M3Sx4.0,maximumOD4.6. Calibrate first.

See mount-table.csv: exact fixing centre/axis andmanifest for screw length, insert length and grip.

Replacement parts only: never stack old bracket or old cowl. Base and motor native datums unchanged.

Trial printed linear +/-0.2 after coupon calibration; inspect washer seating and de-support internal ears.


Source dimensions, thread engagement and hardware envelopes do not certify plastic retention or metal GD&T.

Three named static poses and empty straight hex-key space only; motion, actual tools and load not released.

A16-C05-J6-mount-plate


mm | NOMINAL FIT ONLY | supported, unpowered, unloaded | original CAD axes

XY all edges, hidden included

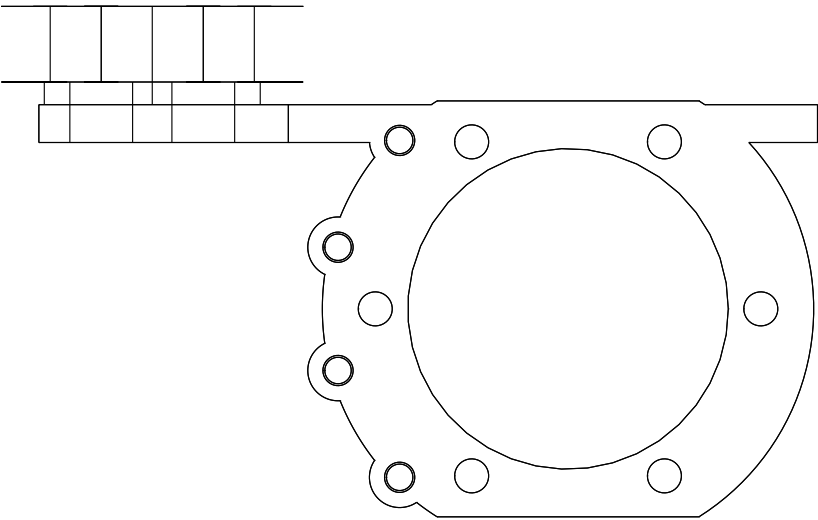


Overall108.000 x67.500; scale1.000

XZ all edges, hidden included

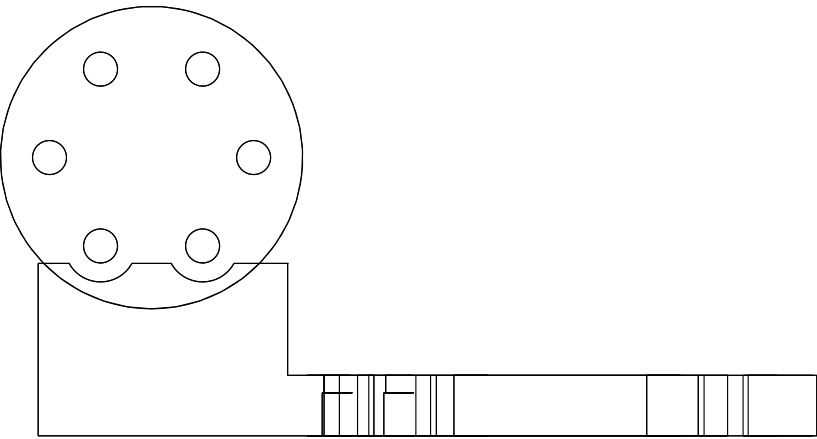

Overall108.000 x56.800; scale1.000

YZ all edges, hidden included

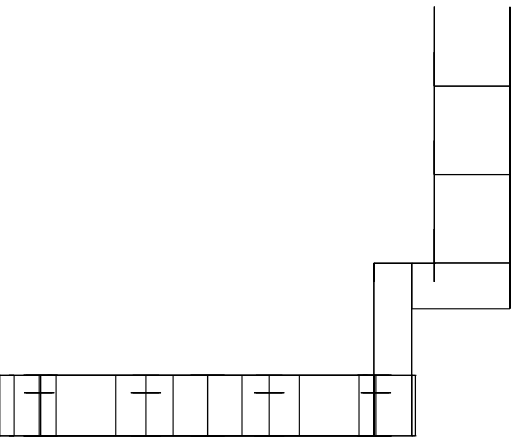

Overall67.500 x56.800; scale1.000

STEP defines complete nominal geometry; native holes retained. mount-table.csv lists added centres/axes.

Heat-set pilotsD4.0; genuine ruthexRX-M3x5.7 /RX-M3Sx4.0,maximumOD4.6. Calibrate first.

See mount-table.csv: exact fixing centre/axis andmanifest for screw length, insert length and grip.

Replacement parts only: never stack old bracket or old cowl. Base and motor native datums unchanged.

Trial printed linear +/-0.2 after coupon calibration; inspect washer seating and de-support internal ears.


Source dimensions, thread engagement and hardware envelopes do not certify plastic retention or metal GD&T.

Three named static poses and empty straight hex-key space only; motion, actual tools and load not released.

A16-C05-J6-cowl-a


mm | NOMINAL FIT ONLY | supported, unpowered, unloaded | original CAD axes

XY all edges, hidden included

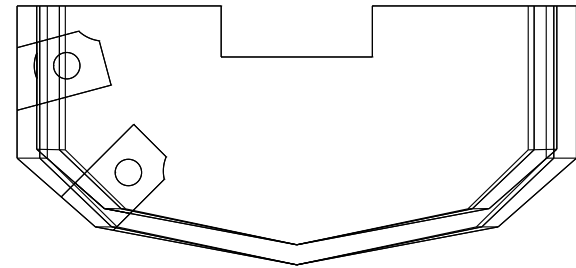


Overall74.000 x34.235; scale1.000

XZ all edges, hidden included

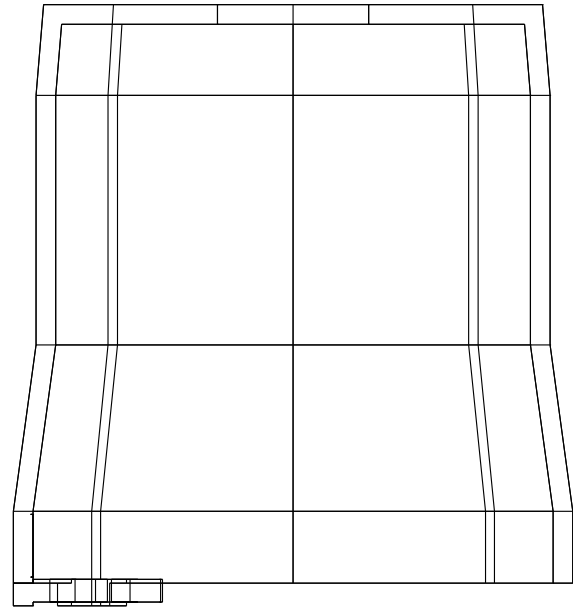

Overall74.000 x79.500; scale1.000

YZ all edges, hidden included

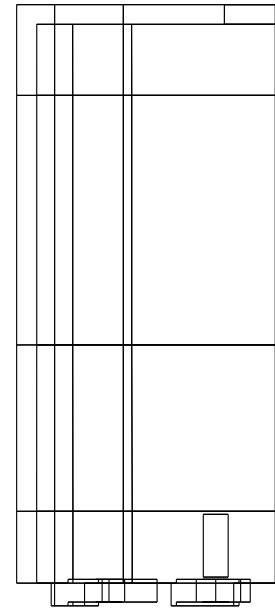

Overall34.235 x79.500; scale1.000

STEP defines complete nominal geometry; native holes retained. mount-table.csv lists added centres/axes.

Heat-set pilotsD4.0; genuine ruthexRX-M3x5.7 /RX-M3Sx4.0,maximumOD4.6. Calibrate first.

See mount-table.csv: exact fixing centre/axis andmanifest for screw length, insert length and grip.

Replacement parts only: never stack old bracket or old cowl. Base and motor native datums unchanged.

Trial printed linear +/-0.2 after coupon calibration; inspect washer seating and de-support internal ears.


Source dimensions, thread engagement and hardware envelopes do not certify plastic retention or metal GD&T.

Three named static poses and empty straight hex-key space only; motion, actual tools and load not released.

A16-C05-J6-cowl-b


mm | NOMINAL FIT ONLY | supported, unpowered, unloaded | original CAD axes

XY all edges, hidden included

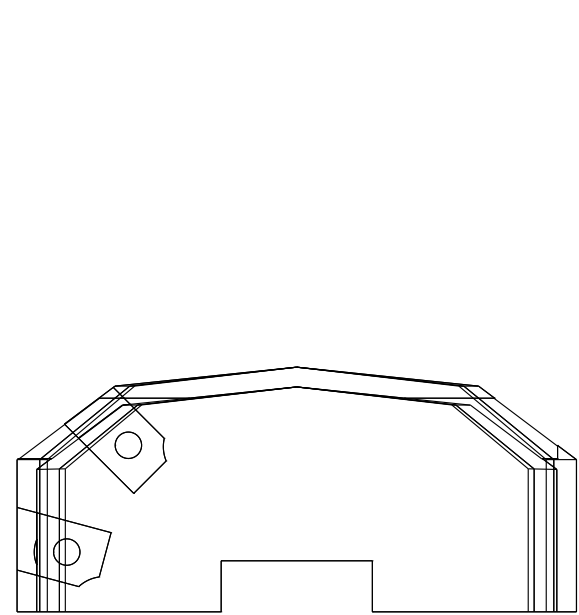


Overall74.000 x32.354; scale1.000

XZ all edges, hidden included

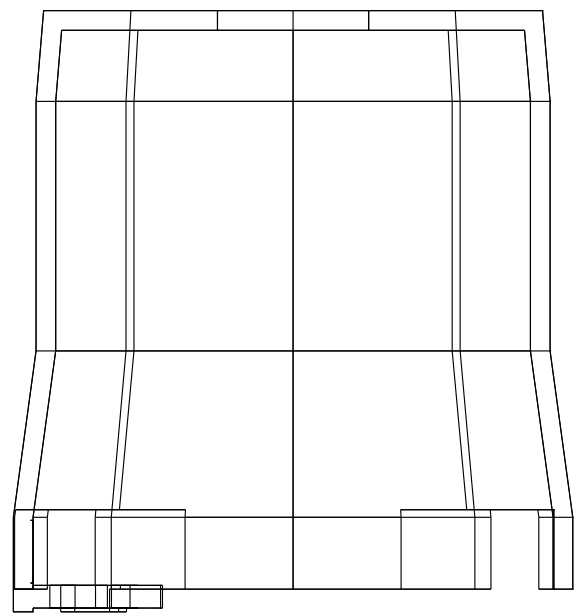

Overall74.000 x79.500; scale1.000

YZ all edges, hidden included

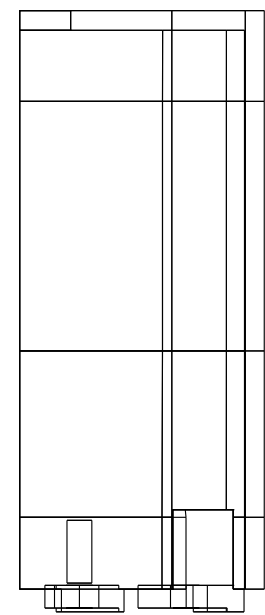

Overall32.354 x79.500; scale1.000

STEP defines complete nominal geometry; native holes retained. mount-table.csv lists added centres/axes.

Heat-set pilotsD4.0; genuine ruthexRX-M3x5.7 /RX-M3Sx4.0,maximumOD4.6. Calibrate first.

See mount-table.csv: exact fixing centre/axis andmanifest for screw length, insert length and grip.

Replacement parts only: never stack old bracket or old cowl. Base and motor native datums unchanged.

Trial printed linear +/-0.2 after coupon calibration; inspect washer seating and de-support internal ears.


Source dimensions, thread engagement and hardware envelopes do not certify plastic retention or metal GD&T.

Three named static poses and empty straight hex-key space only; motion, actual tools and load not released.

A16-C05-J7-bearing-housing


mm | NOMINAL FIT ONLY | supported, unpowered, unloaded | original CAD axes

XY all edges, hidden included

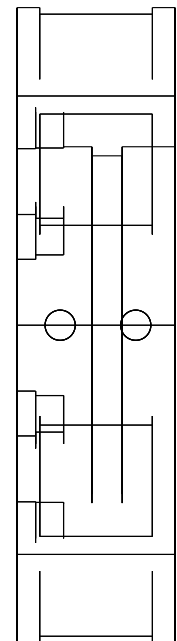


Overall20.900 x84.000; scale1.000

XZ all edges, hidden included

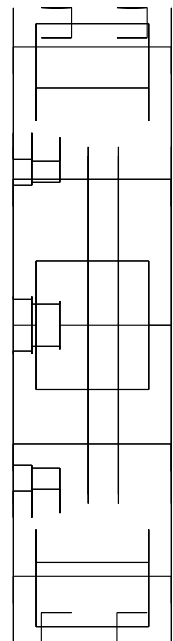

Overall20.900 x84.000; scale1.000

YZ all edges, hidden included

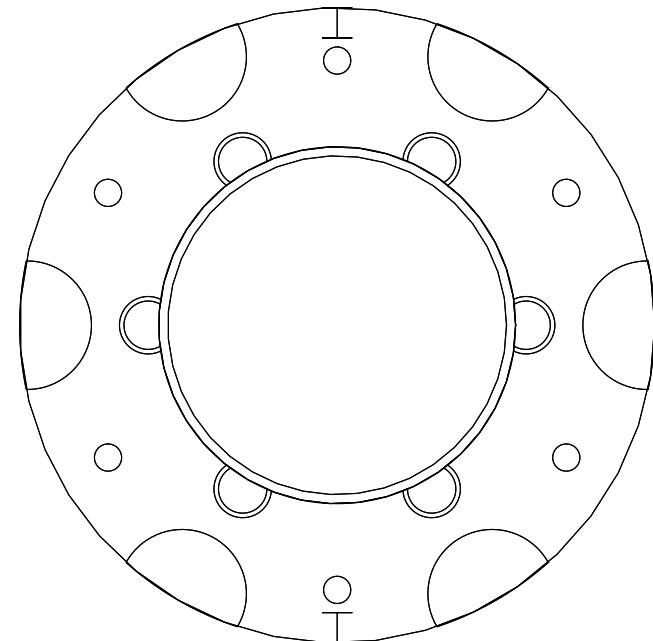

Overall84.000 x84.000; scale1.000

STEP defines complete nominal geometry; native holes retained. mount-table.csv lists added centres/axes.

Heat-set pilotsD4.0; genuine ruthexRX-M3x5.7 /RX-M3Sx4.0,maximumOD4.6. Calibrate first.

See mount-table.csv: exact fixing centre/axis andmanifest for screw length, insert length and grip.

Replacement parts only: never stack old bracket or old cowl. Base and motor native datums unchanged.

Trial printed linear +/-0.2 after coupon calibration; inspect washer seating and de-support internal ears.


Source dimensions, thread engagement and hardware envelopes do not certify plastic retention or metal GD&T.

Three named static poses and empty straight hex-key space only; motion, actual tools and load not released.

A16-C05-J7-cowl-a


mm | NOMINAL FIT ONLY | supported, unpowered, unloaded | original CAD axes

XY all edges, hidden included

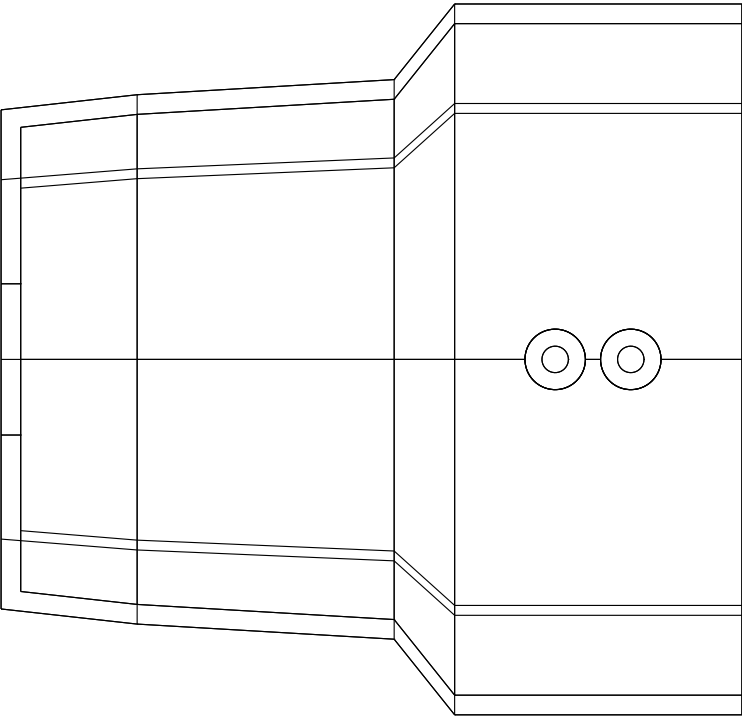


Overall98.000 x94.000; scale1.000

XZ all edges, hidden included

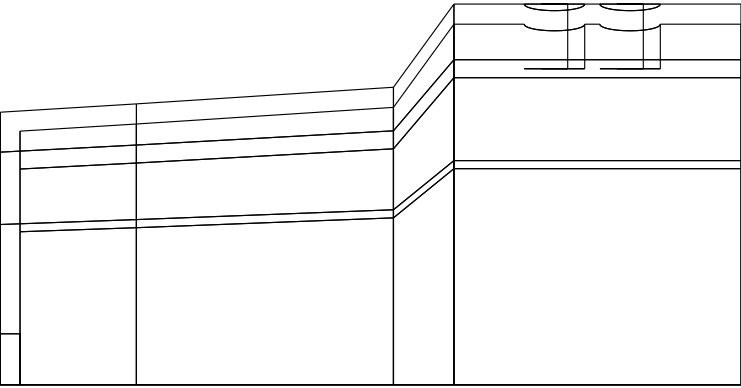

Overall98.000 x50.350; scale1.000

YZ all edges, hidden included

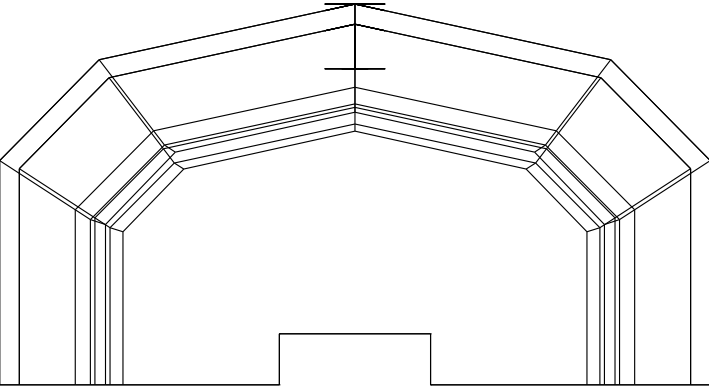

Overall94.000 x50.350; scale1.000

STEP defines complete nominal geometry; native holes retained. mount-table.csv lists added centres/axes.

Heat-set pilotsD4.0; genuine ruthexRX-M3x5.7 /RX-M3Sx4.0,maximumOD4.6. Calibrate first.

See mount-table.csv: exact fixing centre/axis andmanifest for screw length, insert length and grip.

Replacement parts only: never stack old bracket or old cowl. Base and motor native datums unchanged.

Trial printed linear +/-0.2 after coupon calibration; inspect washer seating and de-support internal ears.


Source dimensions, thread engagement and hardware envelopes do not certify plastic retention or metal GD&T.

Three named static poses and empty straight hex-key space only; motion, actual tools and load not released.

A16-C05-J7-cowl-b


mm | NOMINAL FIT ONLY | supported, unpowered, unloaded | original CAD axes

XY all edges, hidden included

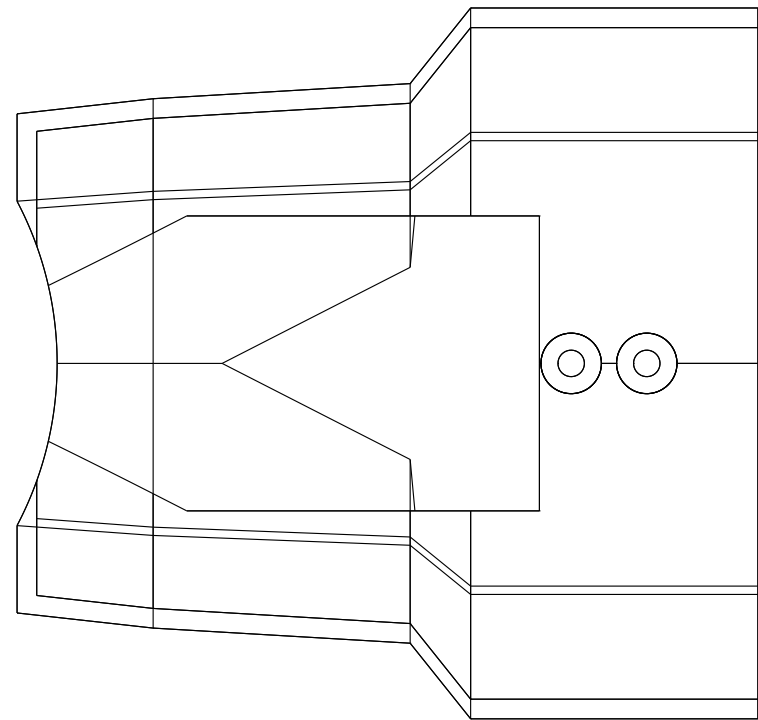


Overall98.000 x94.000; scale1.000

XZ all edges, hidden included

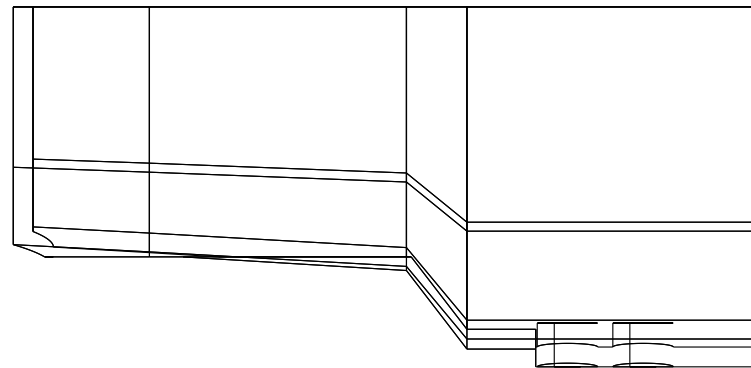

Overall98.000 x47.590; scale1.000

YZ all edges, hidden included

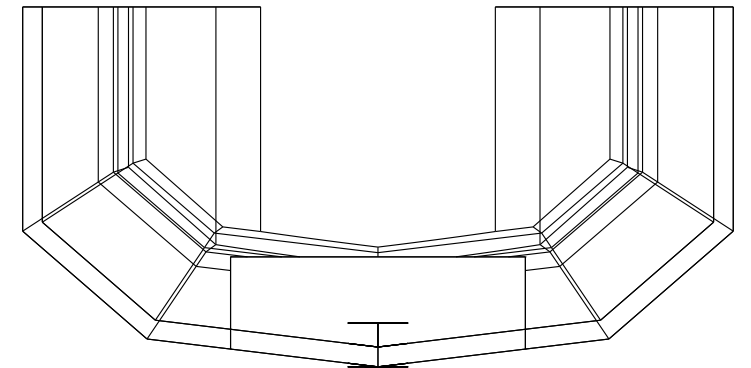

Overall94.000 x47.590; scale1.000

STEP defines complete nominal geometry; native holes retained. mount-table.csv lists added centres/axes.

Heat-set pilotsD4.0; genuine ruthexRX-M3x5.7 /RX-M3Sx4.0,maximumOD4.6. Calibrate first.

See mount-table.csv: exact fixing centre/axis andmanifest for screw length, insert length and grip.

Replacement parts only: never stack old bracket or old cowl. Base and motor native datums unchanged.

Trial printed linear +/-0.2 after coupon calibration; inspect washer seating and de-support internal ears.


Source dimensions, thread engagement and hardware envelopes do not certify plastic retention or metal GD&T.

Three named static poses and empty straight hex-key space only; motion, actual tools and load not released.

A16-C06-upper-saddle-115-dorsal

mm | NOMINAL FIT ONLY | supported, unpowered, unloaded | original CAD axes

XY all edges, hidden included




Overall8.000 x38.000; scale1.000

XZ all edges, hidden included



Overall8.000 x26.848; scale1.000

YZ all edges, hidden included

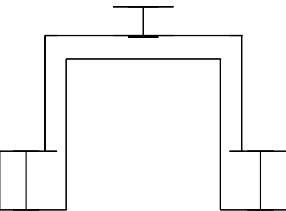

Overall38.000 x26.848; scale1.000

STEP defines complete nominal geometry; native holes retained. mount-table.csv lists added centres/axes.

Heat-set pilotsD4.0; genuine ruthexRX-M3x5.7 /RX-M3Sx4.0,maximumOD4.6. Calibrate first.

See mount-table.csv: exact fixing centre/axis andmanifest for screw length, insert length and grip.

Replacement parts only: never stack old bracket or old cowl. Base and motor native datums unchanged.

Trial printed linear +/-0.2 after coupon calibration; inspect washer seating and de-support internal ears.

Source dimensions, thread engagement and hardware envelopes do not certify plastic retention or metal GD&T.

Three named static poses and empty straight hex-key space only; motion, actual tools and load not released.

A16-C06-upper-saddle-115-ventral

mm | NOMINAL FIT ONLY | supported, unpowered, unloaded | original CAD axes

XY all edges, hidden included




Overall8.000 x38.000; scale1.000

XZ all edges, hidden included



Overall8.000 x25.152; scale1.000

YZ all edges, hidden included

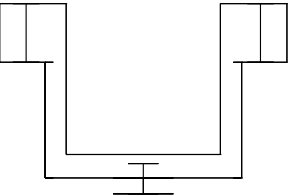

Overall38.000 x25.152; scale1.000

STEP defines complete nominal geometry; native holes retained. mount-table.csv lists added centres/axes.

Heat-set pilotsD4.0; genuine ruthexRX-M3x5.7 /RX-M3Sx4.0,maximumOD4.6. Calibrate first.

See mount-table.csv: exact fixing centre/axis andmanifest for screw length, insert length and grip.

Replacement parts only: never stack old bracket or old cowl. Base and motor native datums unchanged.

Trial printed linear +/-0.2 after coupon calibration; inspect washer seating and de-support internal ears.

Source dimensions, thread engagement and hardware envelopes do not certify plastic retention or metal GD&T.

Three named static poses and empty straight hex-key space only; motion, actual tools and load not released.

A16-C06-upper-saddle-200-dorsal

mm | NOMINAL FIT ONLY | supported, unpowered, unloaded | original CAD axes


XY all edges, hidden included

XZ all edges, hidden included


YZ all edges, hidden included



Overall8.000 x38.000; scale1.000



Overall8.000 x26.311; scale1.000

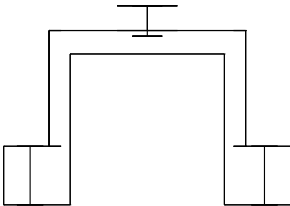

Overall38.000 x26.311; scale1.000

STEP defines complete nominal geometry; native holes retained. mount-table.csv lists added centres/axes.

Heat-set pilotsD4.0; genuine ruthexRX-M3x5.7 /RX-M3Sx4.0,maximumOD4.6. Calibrate first.

See mount-table.csv: exact fixing centre/axis andmanifest for screw length, insert length and grip.

Replacement parts only: never stack old bracket or old cowl. Base and motor native datums unchanged.

Trial printed linear +/-0.2 after coupon calibration; inspect washer seating and de-support internal ears.


Source dimensions, thread engagement and hardware envelopes do not certify plastic retention or metal GD&T.

Three named static poses and empty straight hex-key space only; motion, actual tools and load not released.

A16-C06-upper-saddle-200-ventral


mm | NOMINAL FIT ONLY | supported, unpowered, unloaded | original CAD axes

XY all edges, hidden included




Overall8.000 x38.000; scale1.000

XZ all edges, hidden included



Overall8.000 x24.644; scale1.000

YZ all edges, hidden included

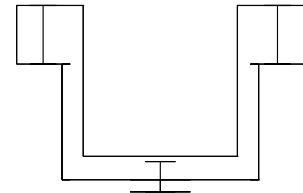

Overall38.000 x24.644; scale1.000

STEP defines complete nominal geometry; native holes retained. mount-table.csv lists added centres/axes.

Heat-set pilotsD4.0; genuine ruthexRX-M3x5.7 /RX-M3Sx4.0,maximumOD4.6. Calibrate first.

See mount-table.csv: exact fixing centre/axis andmanifest for screw length, insert length and grip.

Replacement parts only: never stack old bracket or old cowl. Base and motor native datums unchanged.

Trial printed linear +/-0.2 after coupon calibration; inspect washer seating and de-support internal ears.


Source dimensions, thread engagement and hardware envelopes do not certify plastic retention or metal GD&T.

Three named static poses and empty straight hex-key space only; motion, actual tools and load not released.

A16-C06-upper-dorsal


mm | NOMINAL FIT ONLY | supported, unpowered, unloaded | original CAD axes

XY all edges, hidden included

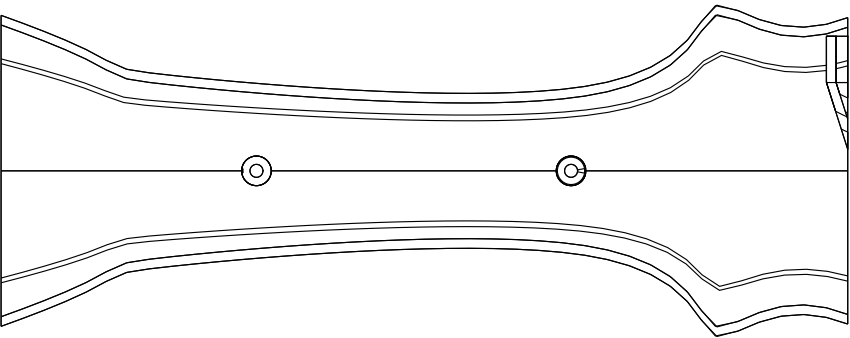


Overall228.750 x89.660; scale0.490

XZ all edges, hidden included

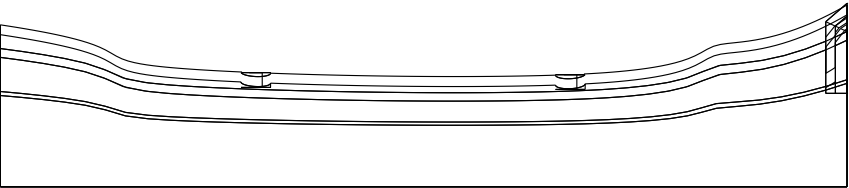

Overall228.750 x49.549; scale0.490

YZ all edges, hidden included

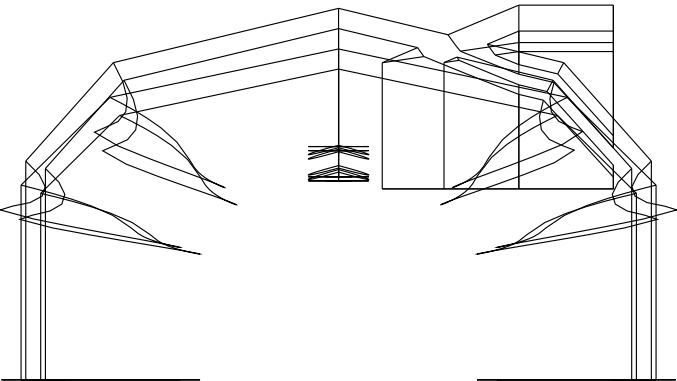

Overall89.660 x49.549; scale1.000

STEP defines complete nominal geometry; native holes retained. mount-table.csv lists added centres/axes.

Heat-set pilotsD4.0; genuine ruthexRX-M3x5.7 /RX-M3Sx4.0,maximumOD4.6. Calibrate first.

See mount-table.csv: exact fixing centre/axis andmanifest for screw length, insert length and grip.

Replacement parts only: never stack old bracket or old cowl. Base and motor native datums unchanged.

Trial printed linear +/-0.2 after coupon calibration; inspect washer seating and de-support internal ears.


Source dimensions, thread engagement and hardware envelopes do not certify plastic retention or metal GD&T.

Three named static poses and empty straight hex-key space only; motion, actual tools and load not released.

A16-C06-upper-ventral


mm | NOMINAL FIT ONLY | supported, unpowered, unloaded | original CAD axes

XY all edges, hidden included

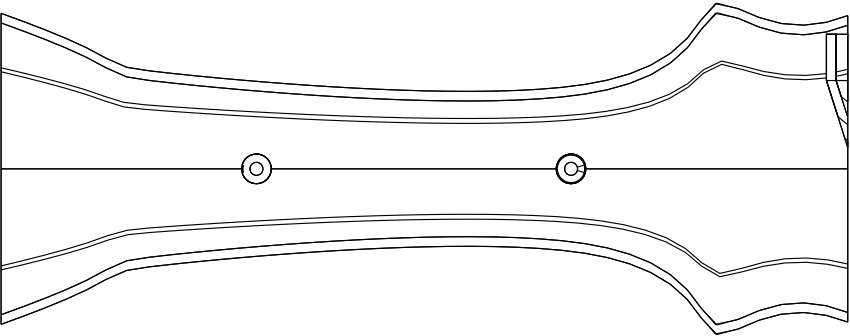


Overall228.750 x89.660; scale0.490

XZ all edges, hidden included

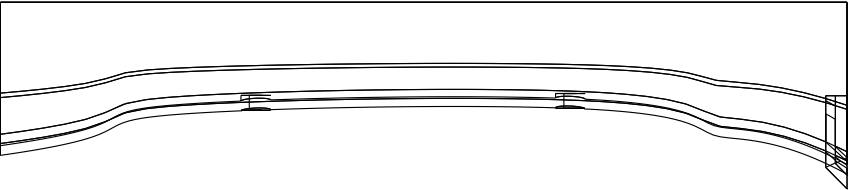

Overall228.750 x50.388; scale0.490

YZ all edges, hidden included

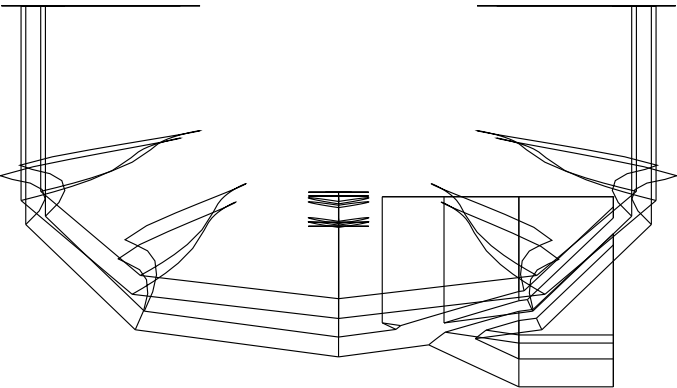

Overall89.660 x50.388; scale1.000

STEP defines complete nominal geometry; native holes retained. mount-table.csv lists added centres/axes.

Heat-set pilotsD4.0; genuine ruthexRX-M3x5.7 /RX-M3Sx4.0,maximumOD4.6. Calibrate first.

See mount-table.csv: exact fixing centre/axis andmanifest for screw length, insert length and grip.

Replacement parts only: never stack old bracket or old cowl. Base and motor native datums unchanged.

Trial printed linear +/-0.2 after coupon calibration; inspect washer seating and de-support internal ears.

Source dimensions, thread engagement and hardware envelopes do not certify plastic retention or metal GD&T.

Three named static poses and empty straight hex-key space only; motion, actual tools and load not released.


A16-C06-fore-spine-and-J5-ring

mm | NOMINAL FIT ONLY | supported, unpowered, unloaded | original CAD axes


XY all edges, hidden included

XZ all edges, hidden included


YZ all edges, hidden included

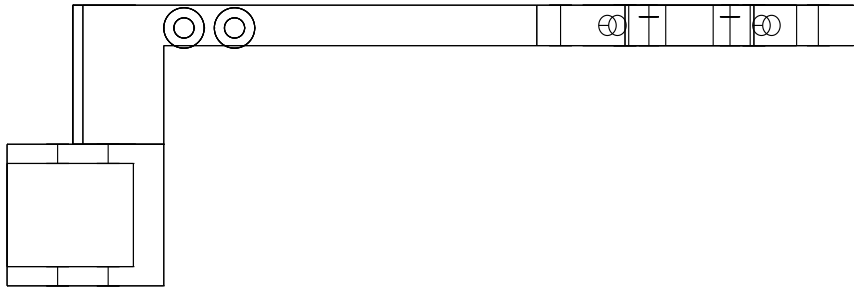

Overall167.500 x55.500; scale0.669

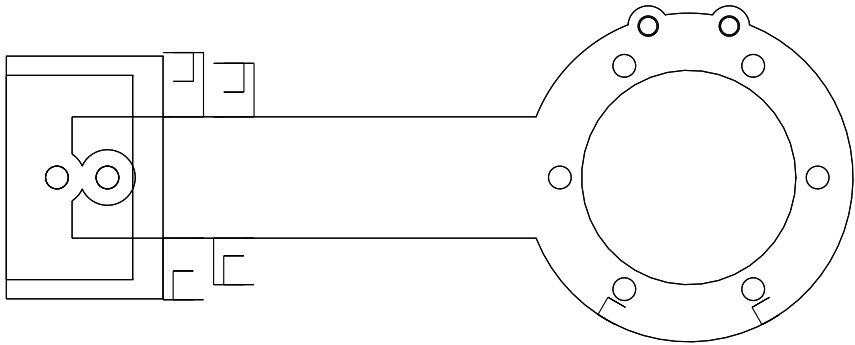

Overall167.500 x66.444; scale0.669

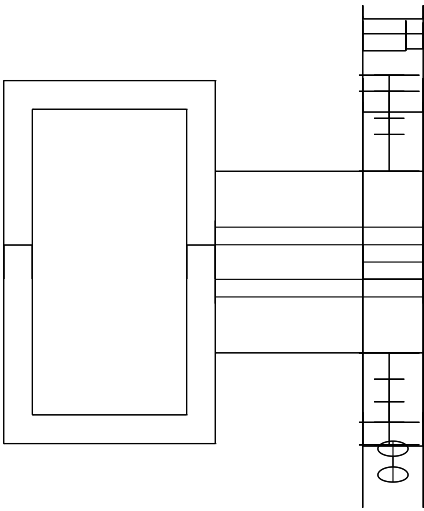

Overall55.500 x66.444; scale1.000

STEP defines complete nominal geometry; native holes retained. mount-table.csv lists added centres/axes.

Heat-set pilotsD4.0; genuine ruthexRX-M3x5.7 /RX-M3Sx4.0,maximumOD4.6. Calibrate first.

See mount-table.csv: exact fixing centre/axis andmanifest for screw length, insert length and grip.

Replacement parts only: never stack old bracket or old cowl. Base and motor native datums unchanged.

Trial printed linear +/-0.2 after coupon calibration; inspect washer seating and de-support internal ears.


Source dimensions, thread engagement and hardware envelopes do not certify plastic retention or metal GD&T.

Three named static poses and empty straight hex-key space only; motion, actual tools and load not released.

A16-C06-fore-dorsal


mm | NOMINAL FIT ONLY | supported, unpowered, unloaded | original CAD axes

XY all edges, hidden included

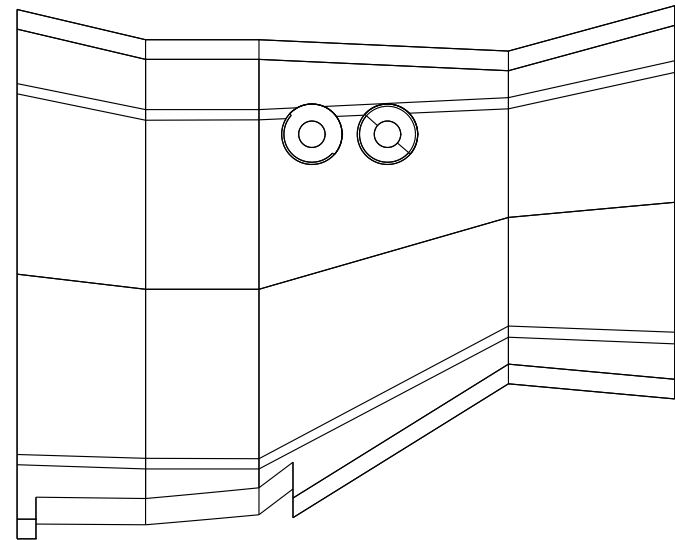


Overall87.000 x70.500; scale1.000

XZ all edges, hidden included

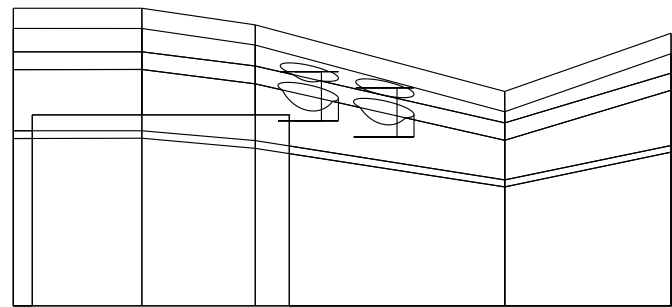

Overall87.000 x39.350; scale1.000

YZ all edges, hidden included

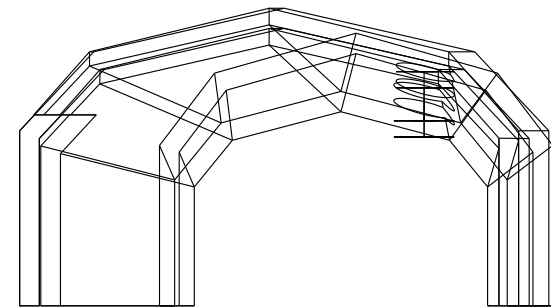

Overall70.500 x39.350; scale1.000

STEP defines complete nominal geometry; native holes retained. mount-table.csv lists added centres/axes.

Heat-set pilotsD4.0; genuine ruthexRX-M3x5.7 /RX-M3Sx4.0,maximumOD4.6. Calibrate first.

See mount-table.csv: exact fixing centre/axis andmanifest for screw length, insert length and grip.

Replacement parts only: never stack old bracket or old cowl. Base and motor native datums unchanged.

Trial printed linear +/-0.2 after coupon calibration; inspect washer seating and de-support internal ears.


Source dimensions, thread engagement and hardware envelopes do not certify plastic retention or metal GD&T.

Three named static poses and empty straight hex-key space only; motion, actual tools and load not released.

A16-C06-fore-ventral


mm | NOMINAL FIT ONLY | supported, unpowered, unloaded | original CAD axes

XY all edges, hidden included

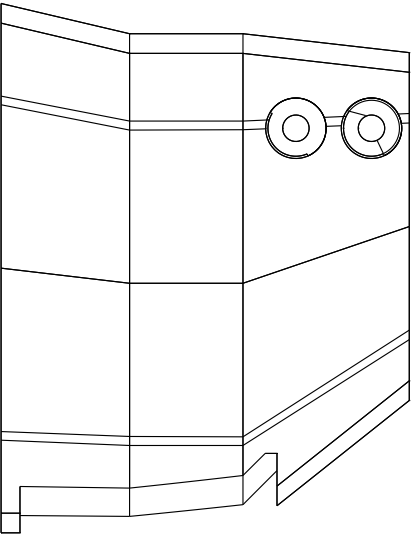


Overall54.000 x70.000; scale1.000

XZ all edges, hidden included

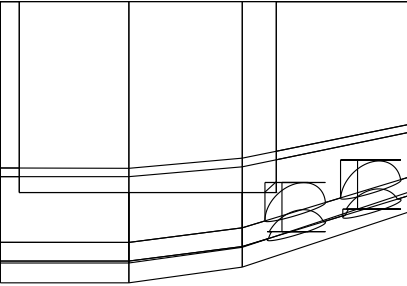

Overall54.000 x37.190; scale1.000

YZ all edges, hidden included

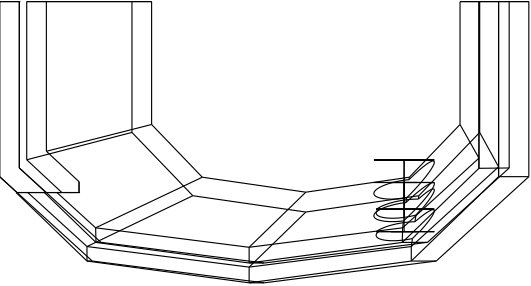

Overall70.000 x37.190; scale1.000

STEP defines complete nominal geometry; native holes retained. mount-table.csv lists added centres/axes.

Heat-set pilotsD4.0; genuine ruthexRX-M3x5.7 /RX-M3Sx4.0,maximumOD4.6. Calibrate first.

See mount-table.csv: exact fixing centre/axis andmanifest for screw length, insert length and grip.

Replacement parts only: never stack old bracket or old cowl. Base and motor native datums unchanged.

Trial printed linear +/-0.2 after coupon calibration; inspect washer seating and de-support internal ears.

Source dimensions, thread engagement and hardware envelopes do not certify plastic retention or metal GD&T.

Three named static poses and empty straight hex-key space only; motion, actual tools and load not released.