



AUROMIX / ODRADEK | B06-TEST-01 | B06-T01-TEST-ADAPTER

INDEPENDENT BASE TEST FIXTURE - METAL ONLY - APPARATUS QUALIFICATION PENDING


TOP XY / fitted view, NTS

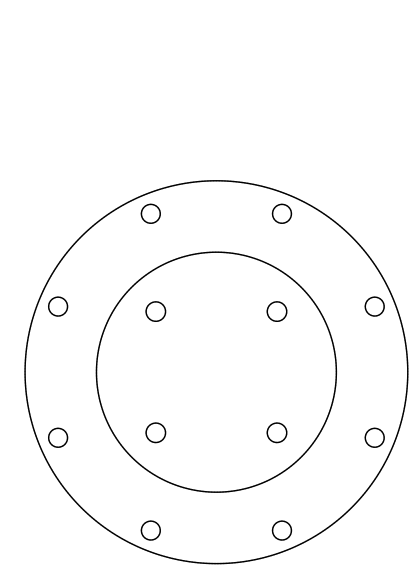

FRONT XZ / fitted view, NTS

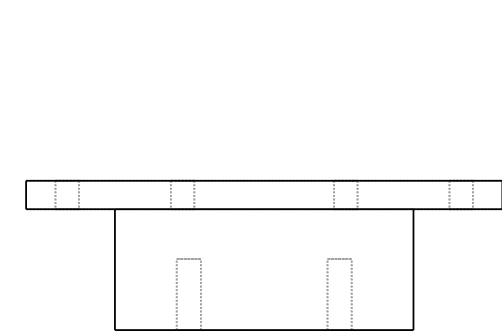

SIDE YZ / fitted view, NTS

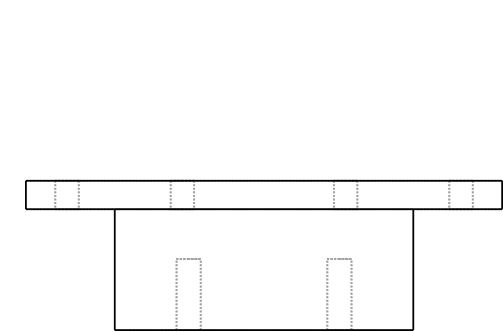

Material: S355; envelope 134.000 x 134.000 x 42.000 mm

Global X [-67.000,67.000] Y [8.000,142.000] Z [58.000,100.000]

Assembly datum: base upper plane Z58; axis XY(0,75). Machining coordinates below use this common datum.

Turn/mill from solid blank; no weld

OD134, lower datum A Z58, disk8; boss OD84 to Z100

Datum A and top boss seat flatness0.10; parallelism0.10; deburr0.5

Review tolerances: OD134 +/-0.10; disk/boss heights +/-0.10; XY hole centres +/-0.10

Do not print or substitute polymer; test apparatus requires its own inspection

FEATURES / entry X,Y,Z mm / axis direction / bore and depth / required machining

- 01 55.433,97.961,58.000 ; axis 0,0,1 ; D6.600 depth8.000 ; D6.6 THRU; PCD120, phase22.5deg; ISO4762 M6x20 + ISO7089 washer
- 02 22.961,130.433,58.000 ; axis 0,0,1 ; D6.600 depth8.000 ; D6.6 THRU; PCD120, phase22.5deg; ISO4762 M6x20 + ISO7089 washer
- 03 -22.961,130.433,58.000 ; axis 0,0,1 ; D6.600 depth8.000 ; D6.6 THRU; PCD120, phase22.5deg; ISO4762 M6x20 + ISO7089 washer
- 04 -55.433,97.961,58.000 ; axis 0,0,1 ; D6.600 depth8.000 ; D6.6 THRU; PCD120, phase22.5deg; ISO4762 M6x20 + ISO7089 washer
- 05 -55.433,52.039,58.000 ; axis 0,0,1 ; D6.600 depth8.000 ; D6.6 THRU; PCD120, phase22.5deg; ISO4762 M6x20 + ISO7089 washer
- 06 -22.961,19.567,58.000 ; axis 0,0,1 ; D6.600 depth8.000 ; D6.6 THRU; PCD120, phase22.5deg; ISO4762 M6x20 + ISO7089 washer
- 07 22.961,19.567,58.000 ; axis 0,0,1 ; D6.600 depth8.000 ; D6.6 THRU; PCD120, phase22.5deg; ISO4762 M6x20 + ISO7089 washer
- 08 55.433,52.039,58.000 ; axis 0,0,1 ; D6.600 depth8.000 ; D6.6 THRU; PCD120, phase22.5deg; ISO4762 M6x20 + ISO7089 washer
- 09 21.213,96.213,100.000 ; axis 0,0,-1 ; D6.800 depth20.000 ; M8x1.25-6H blind, full thread16, drill20; PCD60 phase45deg
- 10 -21.213,96.213,100.000 ; axis 0,0,-1 ; D6.800 depth20.000 ; M8x1.25-6H blind, full thread16, drill20; PCD60 phase45deg
- 11 -21.213,53.787,100.000 ; axis 0,0,-1 ; D6.800 depth20.000 ; M8x1.25-6H blind, full thread16, drill20; PCD60 phase45deg
- 12 21.213,53.787,100.000 ; axis 0,0,-1 ; D6.800 depth20.000 ; M8x1.25-6H blind, full thread16, drill20; PCD60 phase45deg


Threads shown as pilot bores. Use STEP + explicit callouts; do not scale views. Inspect actual apparatus before loads.

ENGINEERING REVIEW CANDIDATE - NOT PRODUCTION OR LOAD RELEASE


AUROMIX / ODRADEK | B06-TEST-01 | B06-T02-TEST-POST

INDEPENDENT BASE TEST FIXTURE - METAL ONLY - APPARATUS QUALIFICATION PENDING


TOP XY / fitted view, NTS

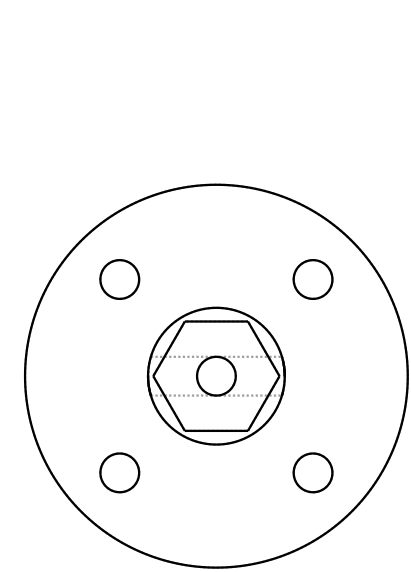

FRONT XZ / fitted view, NTS



SIDE YZ / fitted view, NTS



Material: S355; envelope 84.000 x 84.000 x 508.000 mm

Global X [-42.000,42.000] Y [33.000,117.000] Z [100.000,608.000]

Assembly datum: base upper plane Z58; axis XY(0,75). Machining coordinates below use this common datum.

Turn/mill from solid blank; no weld

Flange OD84 x8, shaft OD30 from Z108 to588, top AF24 x20; top Z608

Datum A flange underside Z100; flatness0.10; shaft perpendicularity0.15 over500

Review tolerances: OD30 +/-0.10; flange thickness +/-0.10; hole centres +/-0.10

Lateral force applied at Z558, 500mm above base datum; 300N gives150Nm at base

Top AF24 is torque-test drive; axial load through inspected rated M10 lifting accessory, not printed hardware

FEATURES / entry X,Y,Z mm / axis direction / bore and depth / required machining

- 01 21.213,96.213,100.000 ; axis 0,0,1 ; D8.500 depth8.000 ; D8.5 THRU; ISO4762 M8x25 + ISO7089 washer
- 02 -21.213,96.213,100.000 ; axis 0,0,1 ; D8.500 depth8.000 ; D8.5 THRU; ISO4762 M8x25 + ISO7089 washer
- 03 -21.213,53.787,100.000 ; axis 0,0,1 ; D8.500 depth8.000 ; D8.5 THRU; ISO4762 M8x25 + ISO7089 washer
- 04 21.213,53.787,100.000 ; axis 0,0,1 ; D8.500 depth8.000 ; D8.5 THRU; ISO4762 M8x25 + ISO7089 washer
- 05 -16.000,75.000,558.000 ; axis 1,0,0 ; D8.500 depth32.000 ; D8.5 THRU, load-pin centre Z558; rated pin/clevis selection pending
- 06 0.000,75.000,608.000 ; axis 0,0,-1 ; D8.500 depth20.000 ; M10x1.5-6H blind; full thread15, drill20; rated axial lifting accessory

Threads shown as pilot bores. Use STEP + explicit callouts; do not scale views. Inspect actual apparatus before loads.

ENGINEERING REVIEW CANDIDATE - NOT PRODUCTION OR LOAD RELEASE