


A16-C04-J2-mount-plate


mm | NOMINAL FIT ONLY | supported, unpowered, unloaded | original CAD axes

XY all edges, hidden included

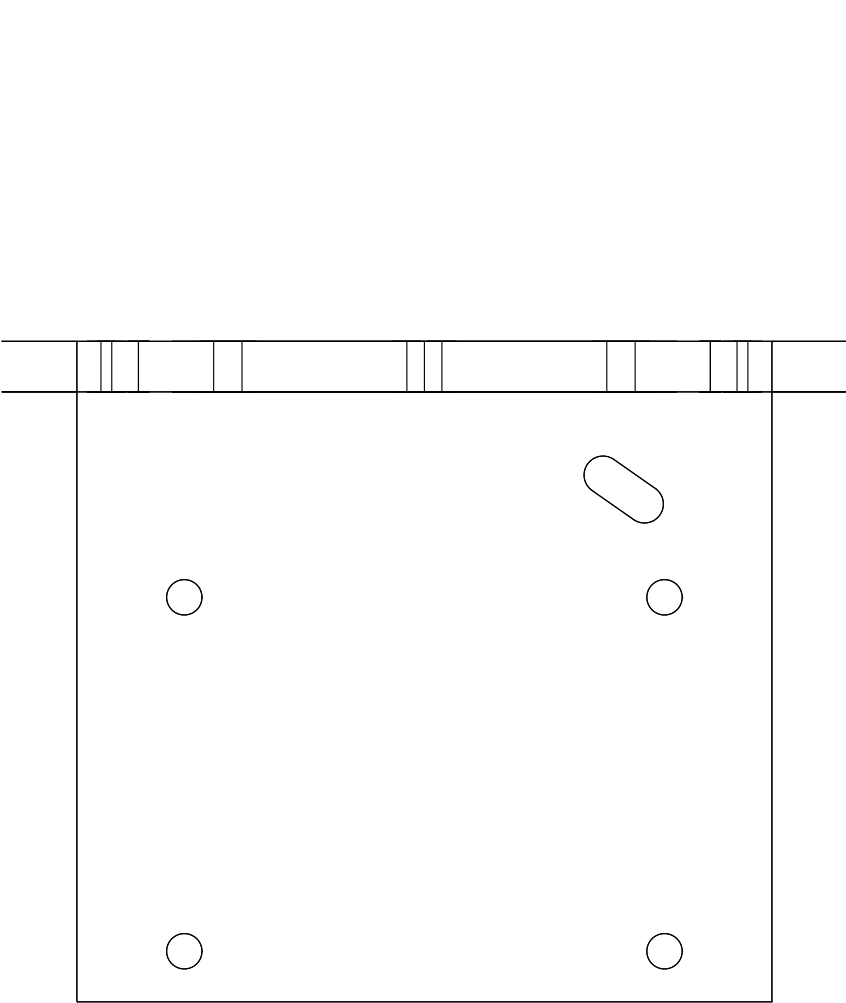


Overall134.000 x104.500; scale0.836

XZ all edges, hidden included

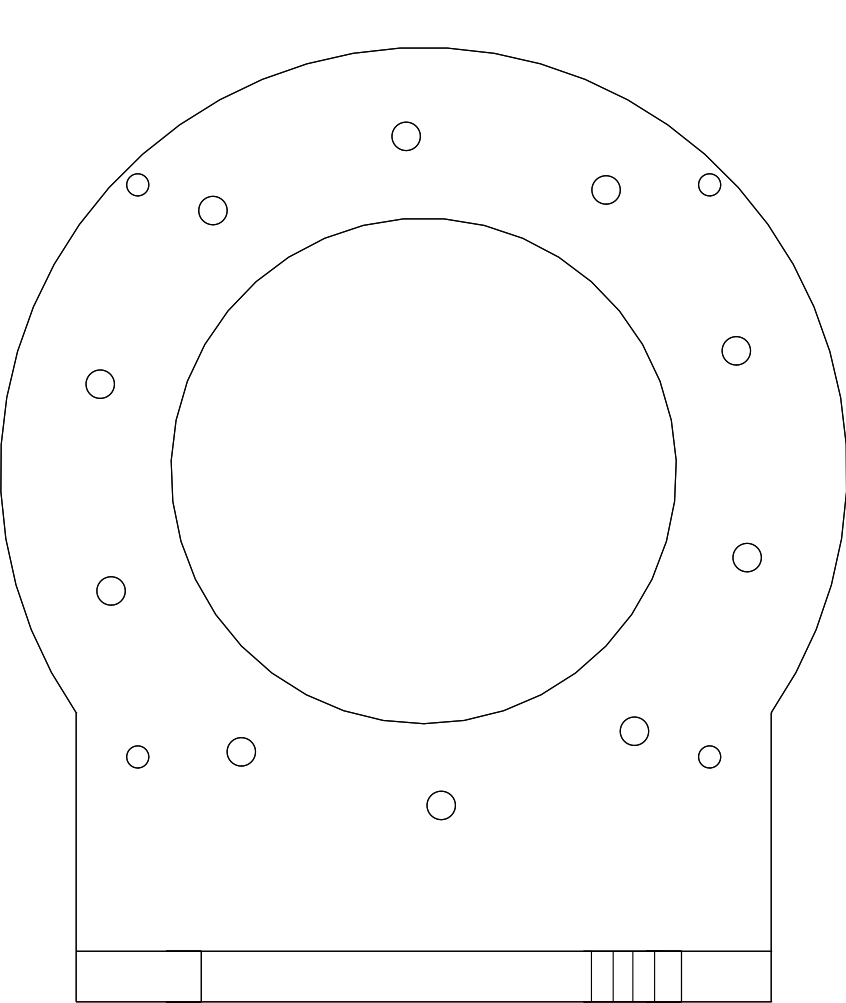

Overall134.000 x151.000; scale0.836

YZ all edges, hidden included



Overall104.500 x151.000; scale0.874

STEP defines complete nominal geometry; native holes retained. mount-table.csv lists added centres/axes.

RS04:4xD3.5 atR64,45/135/225/315deg; plate8, spacer0.5, ear3, head washer0.5.

RS04:4xM3x16 per joint,2 per cover half;8xOD7/ID3.2/H0.5 washers and4xAF5.5/H2.4 nuts.

Replacement parts only: never stack old bracket or old cowl. Base and motor native datums unchanged.

Trial printed linear +/-0.2 after coupon calibration; inspect washer seating and de-support internal ears.


Source dimensions, thread engagement and hardware envelopes do not certify plastic retention or metal GD&T.

Three named static poses and empty straight hex-key space only; motion, actual tools and load not released.

A16-C04-J2-cowl-a


mm | NOMINAL FIT ONLY | supported, unpowered, unloaded | original CAD axes

XY all edges, hidden included

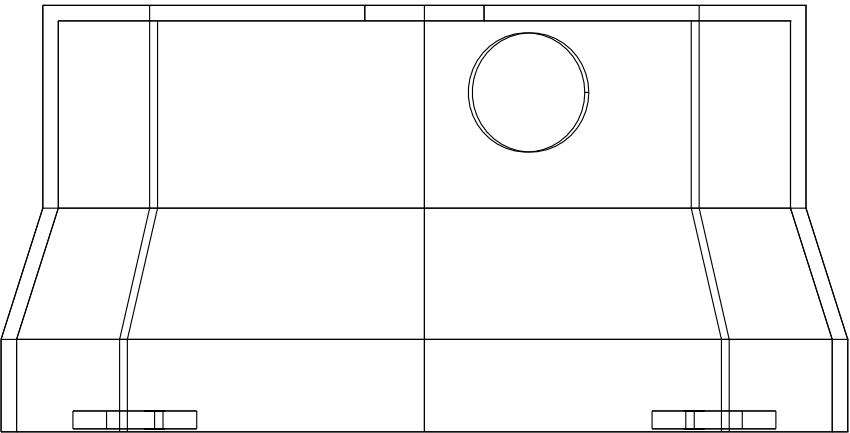


Overall142.000 x71.500; scale0.789

XZ all edges, hidden included

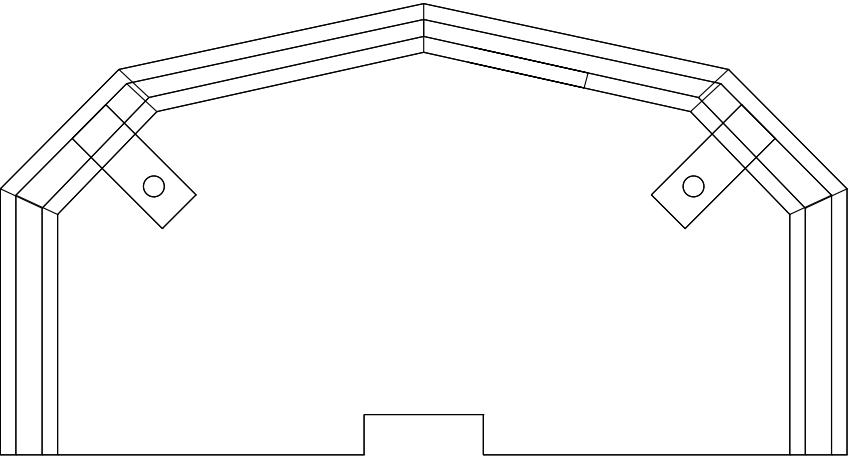

Overall142.000 x75.650; scale0.789

YZ all edges, hidden included

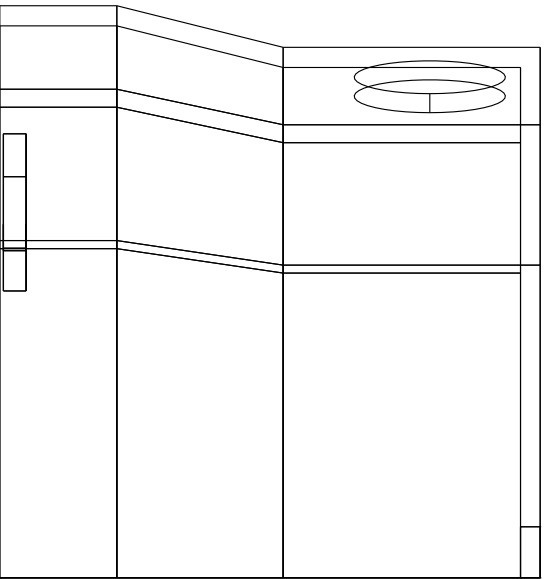

Overall71.500 x75.650; scale1.000

STEP defines complete nominal geometry; native holes retained. mount-table.csv lists added centres/axes.

RS04:4xD3.5 atR64,45/135/225/315deg; plate8, spacer0.5, ear3, head washer0.5.

RS04:4xM3x16 per joint,2 per cover half;8xOD7/ID3.2/H0.5 washers and4xAF5.5/H2.4 nuts.

Replacement parts only: never stack old bracket or old cowl. Base and motor native datums unchanged.

Trial printed linear +/-0.2 after coupon calibration; inspect washer seating and de-support internal ears.


Source dimensions, thread engagement and hardware envelopes do not certify plastic retention or metal GD&T.

Three named static poses and empty straight hex-key space only; motion, actual tools and load not released.

A16-C04-J2-cowl-b


mm | NOMINAL FIT ONLY | supported, unpowered, unloaded | original CAD axes

XY all edges, hidden included

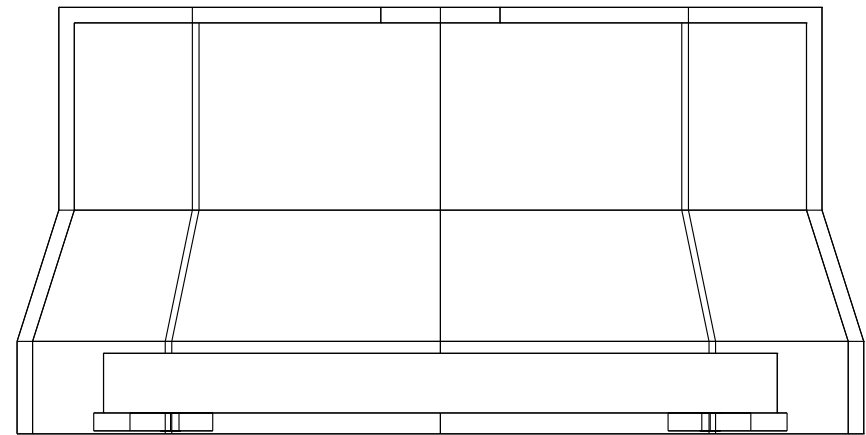


Overall142.000 x71.500; scale0.789

XZ all edges, hidden included

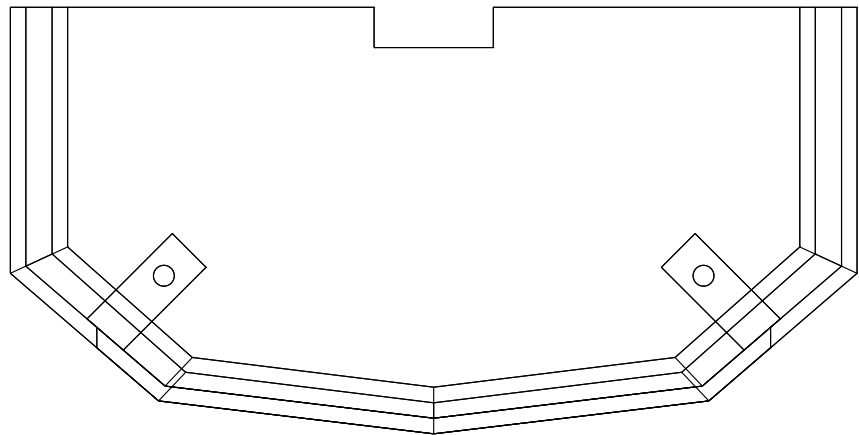

Overall142.000 x71.510; scale0.789

YZ all edges, hidden included

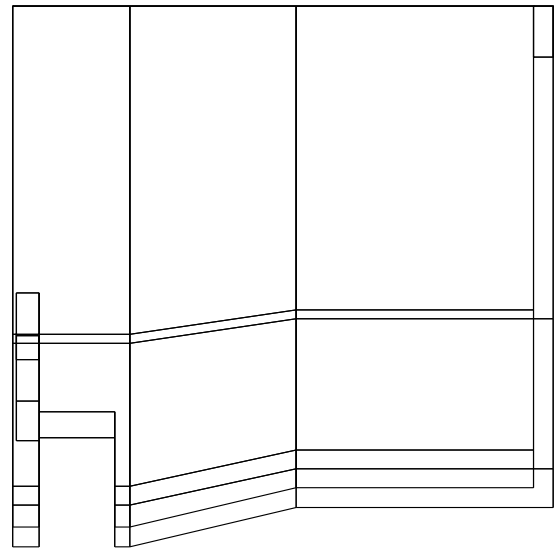

Overall71.500 x71.510; scale1.000

STEP defines complete nominal geometry; native holes retained. mount-table.csv lists added centres/axes.

RS04:4xD3.5 atR64,45/135/225/315deg; plate8, spacer0.5, ear3, head washer0.5.

RS04:4xM3x16 per joint,2 per cover half;8xOD7/ID3.2/H0.5 washers and4xAF5.5/H2.4 nuts.

Replacement parts only: never stack old bracket or old cowl. Base and motor native datums unchanged.

Trial printed linear +/-0.2 after coupon calibration; inspect washer seating and de-support internal ears.


Source dimensions, thread engagement and hardware envelopes do not certify plastic retention or metal GD&T.

Three named static poses and empty straight hex-key space only; motion, actual tools and load not released.

A16-C04-J3-mount-plate


mm | NOMINAL FIT ONLY | supported, unpowered, unloaded | original CAD axes

XY all edges, hidden included




Overall70.350 x150.000; scale0.880

XZ all edges, hidden included

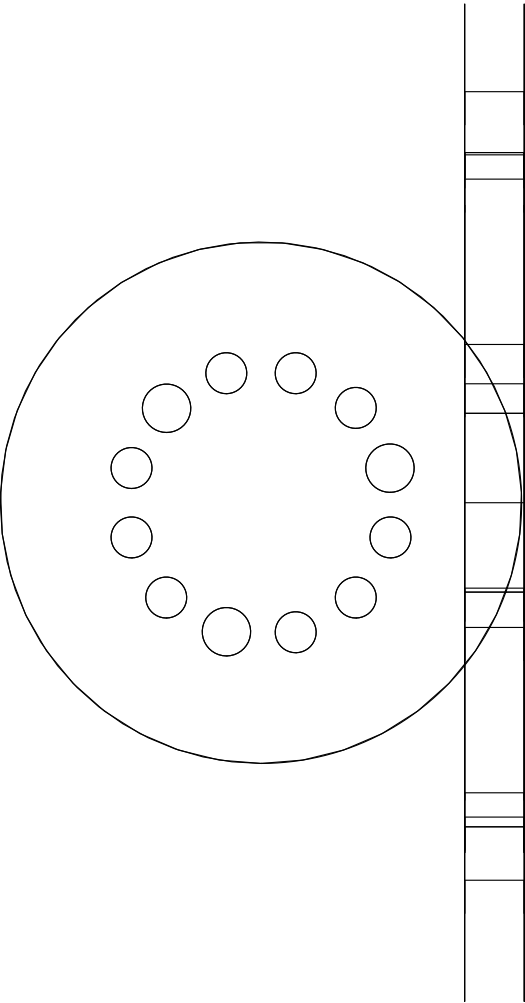

Overall70.350 x134.000; scale0.985

YZ all edges, hidden included

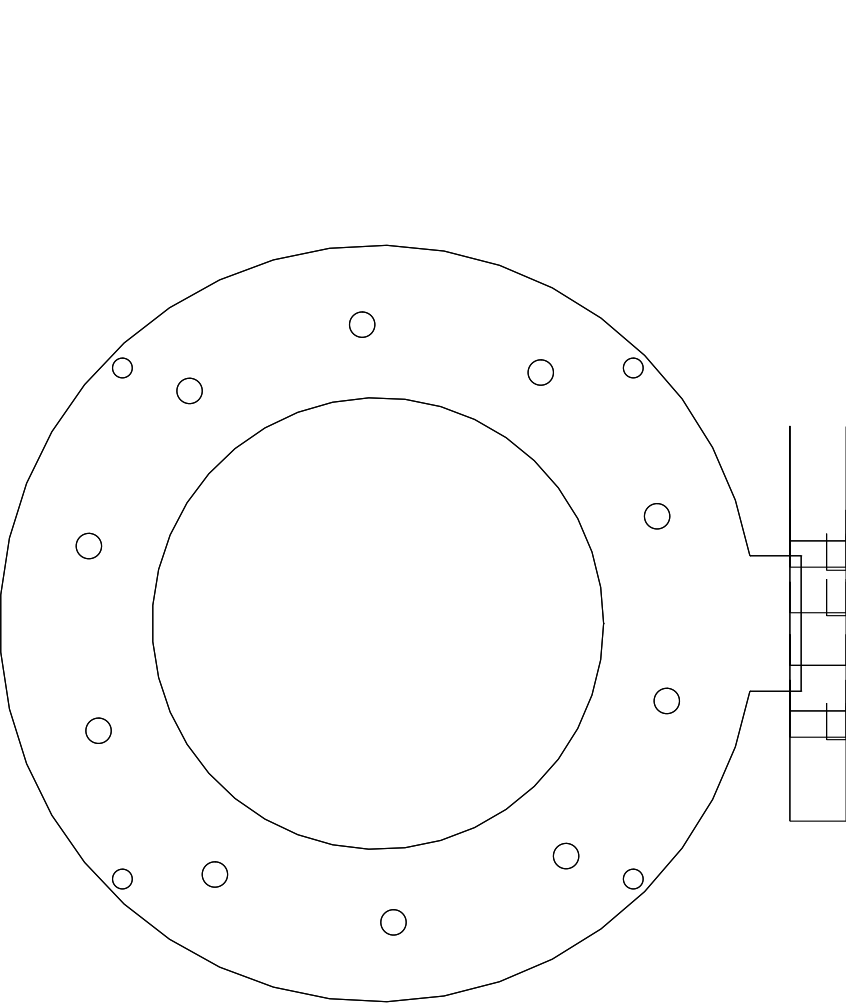

Overall150.000 x134.000; scale0.747

STEP defines complete nominal geometry; native holes retained. mount-table.csv lists added centres/axes.

RS04:4xD3.5 atR64,45/135/225/315deg; plate8, spacer0.5, ear3, head washer0.5.

RS04:4xM3x16 per joint,2 per cover half;8xOD7/ID3.2/H0.5 washers and4xAF5.5/H2.4 nuts.

Replacement parts only: never stack old bracket or old cowl. Base and motor native datums unchanged.

Trial printed linear +/-0.2 after coupon calibration; inspect washer seating and de-support internal ears.


Source dimensions, thread engagement and hardware envelopes do not certify plastic retention or metal GD&T.

Three named static poses and empty straight hex-key space only; motion, actual tools and load not released.

A16-C04-J3-cowl-a


mm | NOMINAL FIT ONLY | supported, unpowered, unloaded | original CAD axes

XY all edges, hidden included

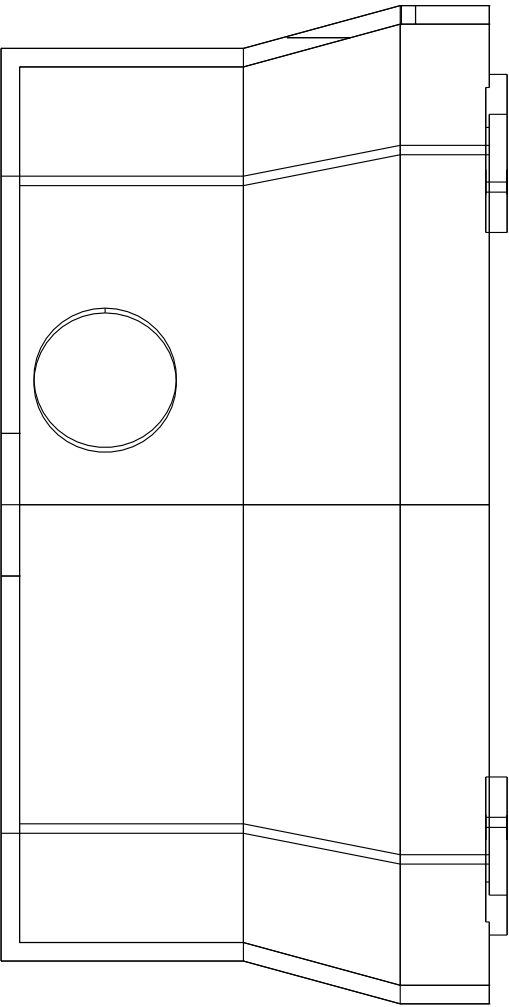


Overall71.000 x140.000; scale0.943

XZ all edges, hidden included

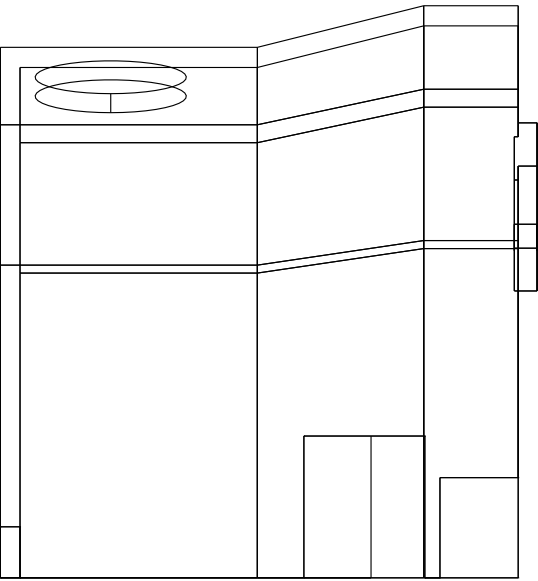

Overall71.000 x75.650; scale1.000

YZ all edges, hidden included

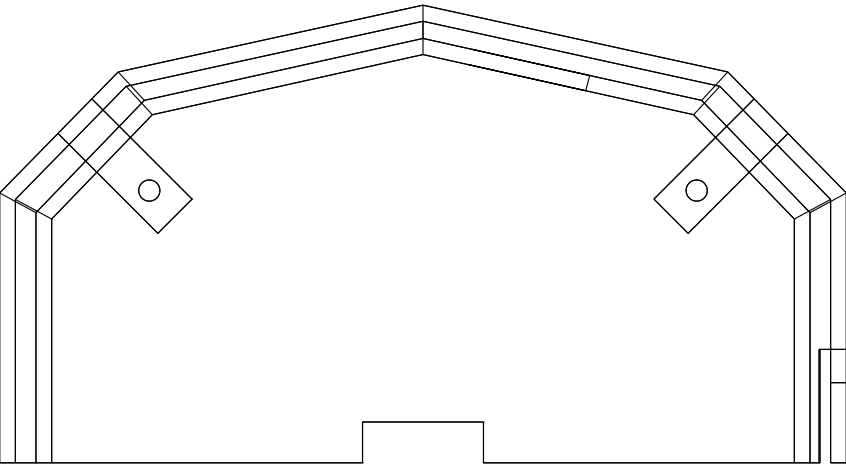

Overall140.000 x75.650; scale0.800

STEP defines complete nominal geometry; native holes retained. mount-table.csv lists added centres/axes.

RS04:4xD3.5 atR64,45/135/225/315deg; plate8, spacer0.5, ear3, head washer0.5.

RS04:4xM3x16 per joint,2 per cover half;8xOD7/ID3.2/H0.5 washers and4xAF5.5/H2.4 nuts.

Replacement parts only: never stack old bracket or old cowl. Base and motor native datums unchanged.

Trial printed linear +/-0.2 after coupon calibration; inspect washer seating and de-support internal ears.


Source dimensions, thread engagement and hardware envelopes do not certify plastic retention or metal GD&T.

Three named static poses and empty straight hex-key space only; motion, actual tools and load not released.

A16-C04-J3-cowl-b


mm | NOMINAL FIT ONLY | supported, unpowered, unloaded | original CAD axes

XY all edges, hidden included

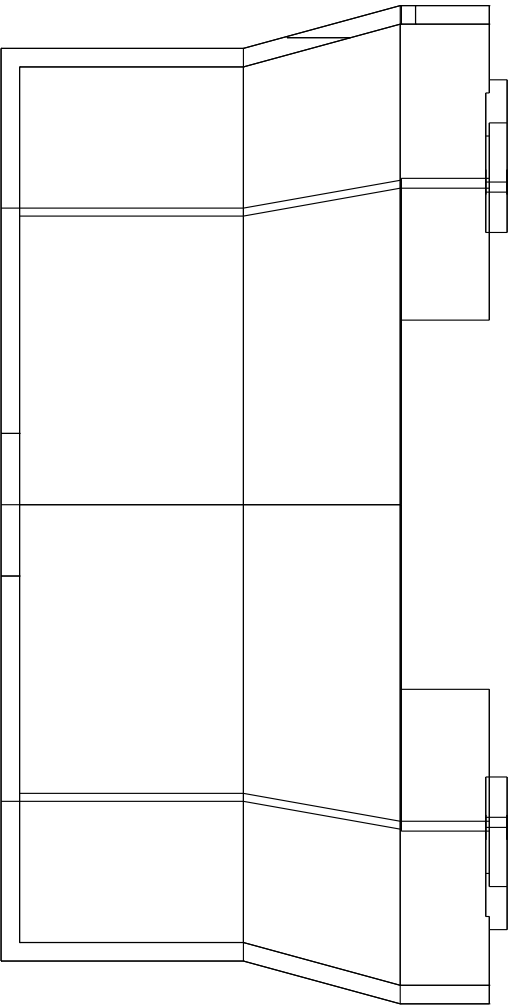


Overall71.000 x140.000; scale0.943

XZ all edges, hidden included

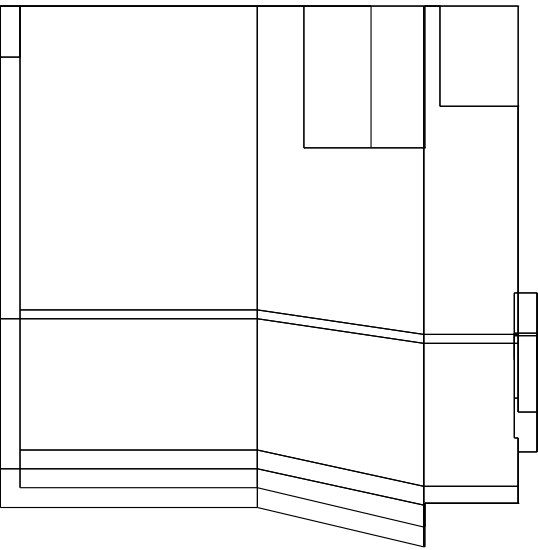

Overall71.000 x71.510; scale1.000

YZ all edges, hidden included

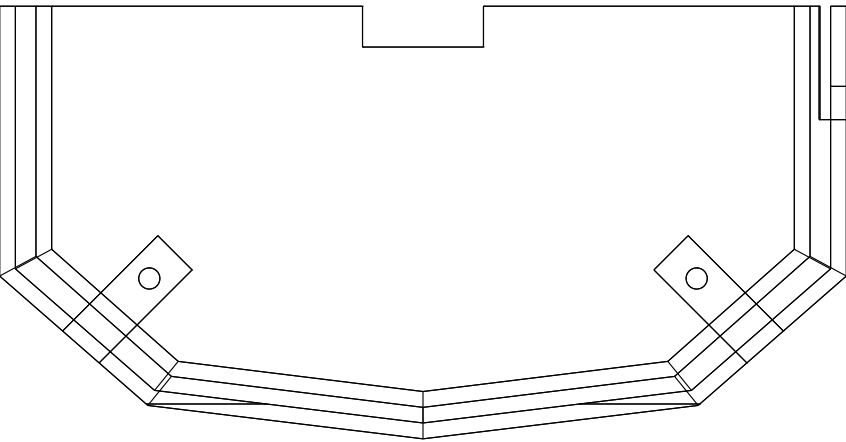

Overall140.000 x71.510; scale0.800

STEP defines complete nominal geometry; native holes retained. mount-table.csv lists added centres/axes.

RS04:4xD3.5 atR64,45/135/225/315deg; plate8, spacer0.5, ear3, head washer0.5.

RS04:4xM3x16 per joint,2 per cover half;8xOD7/ID3.2/H0.5 washers and4xAF5.5/H2.4 nuts.

Replacement parts only: never stack old bracket or old cowl. Base and motor native datums unchanged.

Trial printed linear +/-0.2 after coupon calibration; inspect washer seating and de-support internal ears.


Source dimensions, thread engagement and hardware envelopes do not certify plastic retention or metal GD&T.

Three named static poses and empty straight hex-key space only; motion, actual tools and load not released.

A16-C04-J4-mount-plate


mm | NOMINAL FIT ONLY | supported, unpowered, unloaded | original CAD axes

XY all edges, hidden included




Overall162.000 x49.350; scale0.691

XZ all edges, hidden included

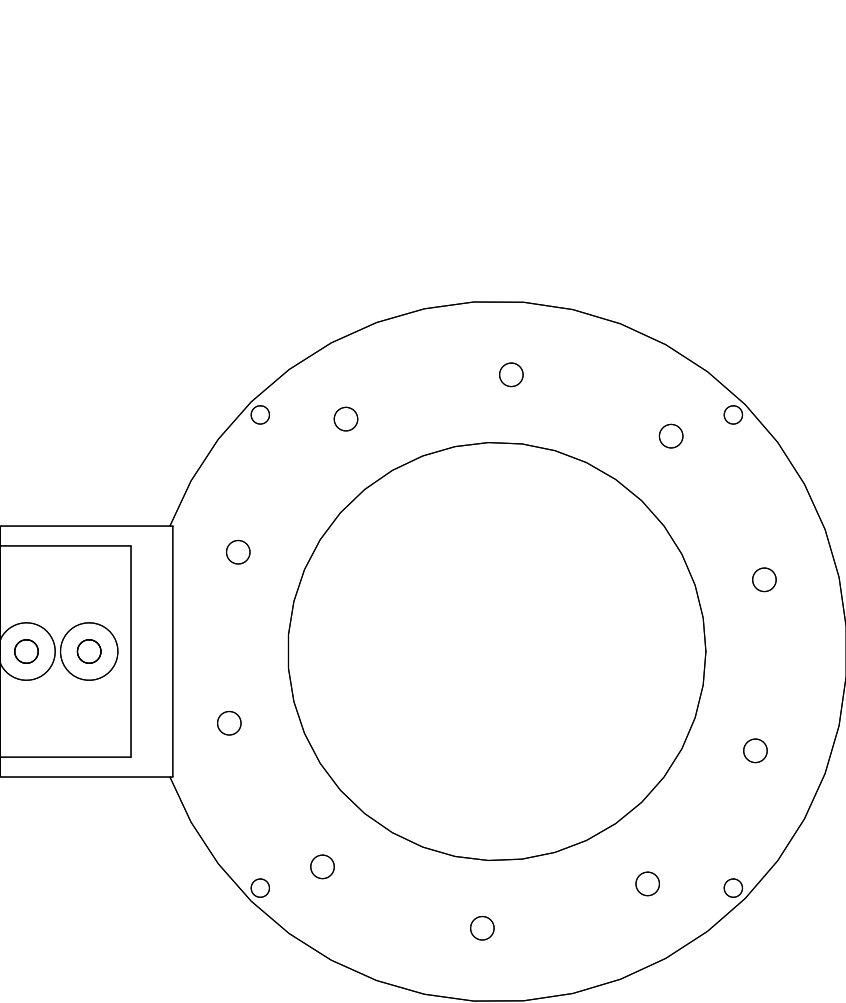

Overall162.000 x134.000; scale0.691

YZ all edges, hidden included

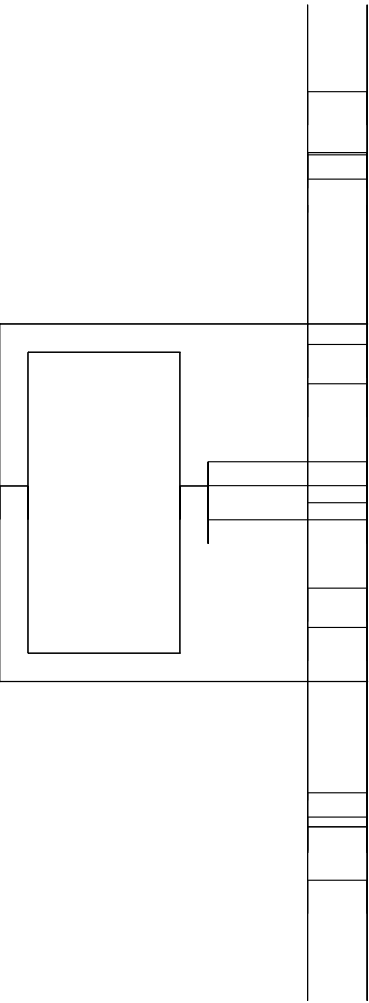

Overall49.350 x134.000; scale0.985

STEP defines complete nominal geometry; native holes retained. mount-table.csv lists added centres/axes.

RS04:4xD3.5 atR64,45/135/225/315deg; plate8, spacer0.5, ear3, head washer0.5.

RS04:4xM3x16 per joint,2 per cover half;8xOD7/ID3.2/H0.5 washers and4xAF5.5/H2.4 nuts.

Replacement parts only: never stack old bracket or old cowl. Base and motor native datums unchanged.

Trial printed linear +/-0.2 after coupon calibration; inspect washer seating and de-support internal ears.


Source dimensions, thread engagement and hardware envelopes do not certify plastic retention or metal GD&T.

Three named static poses and empty straight hex-key space only; motion, actual tools and load not released.

A16-C04-J4-cowl-a


mm | NOMINAL FIT ONLY | supported, unpowered, unloaded | original CAD axes

XY all edges, hidden included

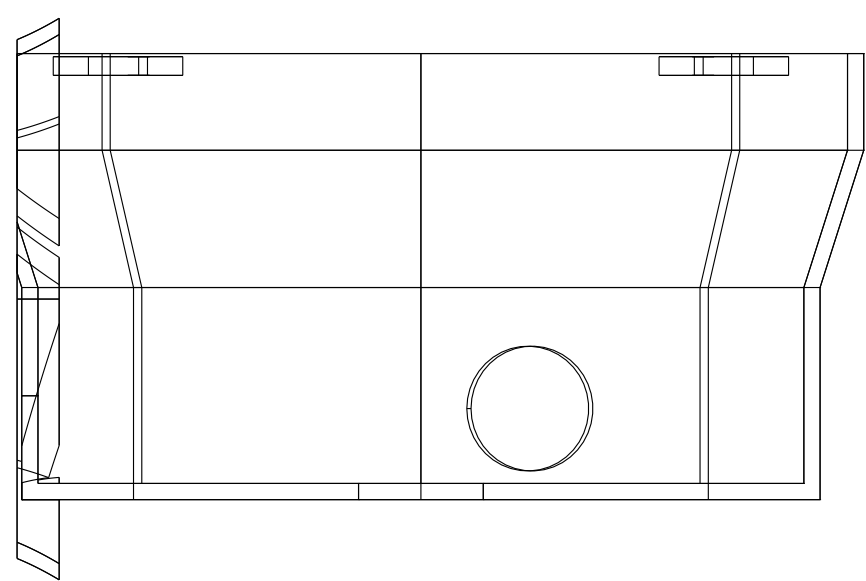


Overall135.750 x90.000; scale0.825

XZ all edges, hidden included

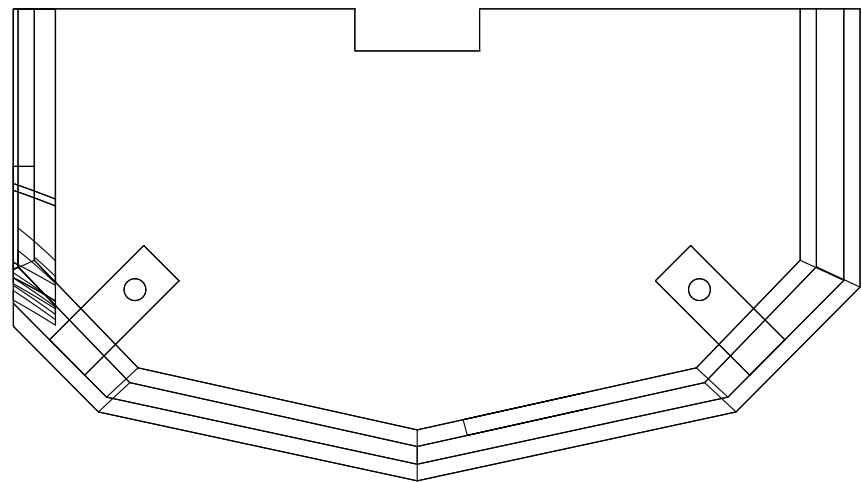

Overall135.750 x75.650; scale0.825

YZ all edges, hidden included

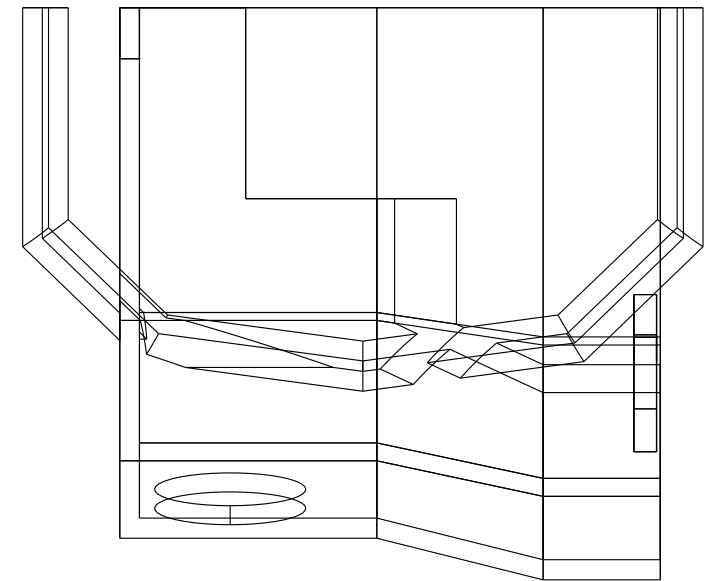

Overall90.000 x75.650; scale1.000

STEP defines complete nominal geometry; native holes retained. mount-table.csv lists added centres/axes.

RS04:4xD3.5 atR64,45/135/225/315deg; plate8, spacer0.5, ear3, head washer0.5.

RS04:4xM3x16 per joint,2 per cover half;8xOD7/ID3.2/H0.5 washers and4xAF5.5/H2.4 nuts.

Replacement parts only: never stack old bracket or old cowl. Base and motor native datums unchanged.

Trial printed linear +/-0.2 after coupon calibration; inspect washer seating and de-support internal ears.


Source dimensions, thread engagement and hardware envelopes do not certify plastic retention or metal GD&T.

Three named static poses and empty straight hex-key space only; motion, actual tools and load not released.

A16-C04-J4-cowl-b


mm | NOMINAL FIT ONLY | supported, unpowered, unloaded | original CAD axes

XY all edges, hidden included

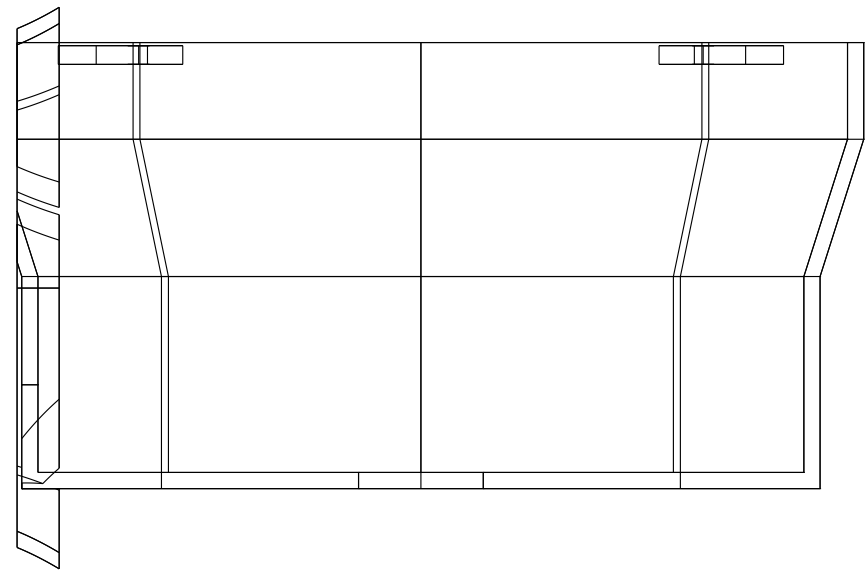


Overall135.750 x90.000; scale0.825

XZ all edges, hidden included

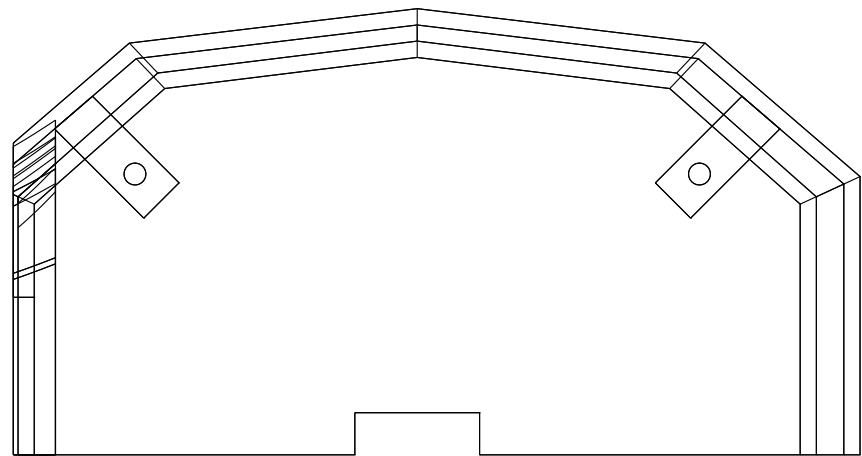

Overall135.750 x71.510; scale0.825

YZ all edges, hidden included

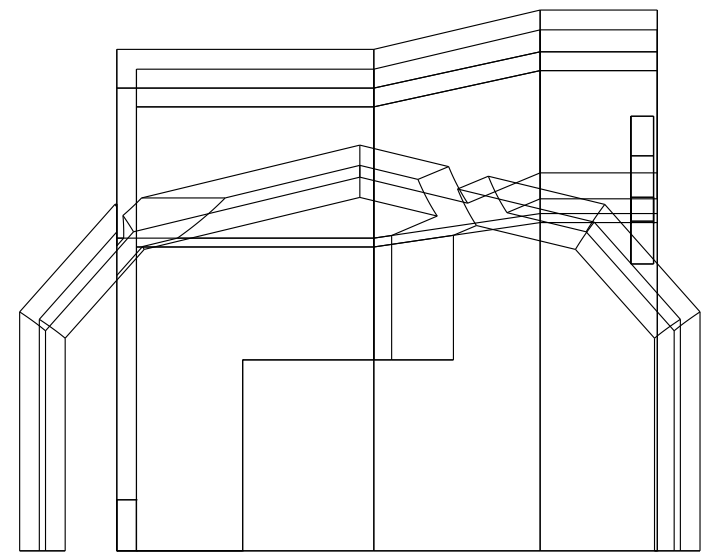

Overall90.000 x71.510; scale1.000

STEP defines complete nominal geometry; native holes retained. mount-table.csv lists added centres/axes.

RS04:4xD3.5 atR64,45/135/225/315deg; plate8, spacer0.5, ear3, head washer0.5.

RS04:4xM3x16 per joint,2 per cover half;8xOD7/ID3.2/H0.5 washers and4xAF5.5/H2.4 nuts.

Replacement parts only: never stack old bracket or old cowl. Base and motor native datums unchanged.

Trial printed linear +/-0.2 after coupon calibration; inspect washer seating and de-support internal ears.

Source dimensions, thread engagement and hardware envelopes do not certify plastic retention or metal GD&T.

Three named static poses and empty straight hex-key space only; motion, actual tools and load not released.