

09-MAR-2017

UAB-LTAG**1-10****AOI****AOI****GENERAL****Operational Hours****ATS Hours / AD ADMIN Hours:** H24**Airport Information****RFF:** FAA Index E / CAT 9**Fuel:** JP-8**PCN:** RWY 05/23: 82/R/AW/T**Customs:** MON-FRI 0500-1400‡, other times O/R not later than 1100‡. For weekends, not later than 1100‡ the FRI before weekend**Operation****Traffic Notes**

24HRS PPR required.

RWY Restrictions:

ACFT ARR/DEP following a C5/B747 may expect delay due to RWY inspection.

Taxi/Parking

Bravo Ramp, peripheral taxilane RESTR to MD11 or smaller ACFT.

Noise Abatement

Flight below 1200ft prohibited south of RWY.

Avoid overflying of Adana city below 3000ft AGL.

Avoid overflying of Mersan city below 5000ft within 5NM.

No overflights north of RWY 05/23.

Engine Run-up Area

Daily Quiet HRs: 0300-1900‡ north side of AD, 0500-1700‡ south side of AD.

Warnings**DAN DME** unusable:

R010-R055 beyond 25NM below 5000ft.

R010-R055 beyond 10NM below 3500ft.

R055-R065 beyond 20NM below 5000ft.

Intensive military flight training MON-FRI.

RWY 05/23 has non-standard overruns.

Exercise caution due to narrow TWY intersections.

Exercise caution due to uncontrolled TFC on APN and TWYs.

Expect less than normal BRKG action on RWY 05/23 when wet.

Be vigilant of kites in APCH/DEP ends of RWY 05/23.

Three unlit structures and an unlit TWR at the intersection of TWY S and west entrance of Charlie ramp 164ft from TWY S.

RWY edge lights 12ft away from usable RWY edge.

Birds in vicinity of AD.

09-MAR-2017

UAB-LTAG**1-20****AOI****AOI****ARRIVAL****Speed**

MAX IAS 250KT within TMA at or below FL100 (refer to RFCs).

Warnings**ILS RWY 05/23 MAINT:**

MON, WED, FRI 0200-0500‡ and TUE, THU 0000-0500‡.

Do not mistake Sakirpasa AD (LTAF) for Incirlik AD (LTAG) about 8NM west of AD.

Laser light incidents have been reported from multiple locations in vicinity of AD. Report incidents to ATC.

DEPARTURE**Take-off Minima**

RWY		23	
1+2 ENG	ft - m/km	0 - 1.5V	-
3+4 ENG		0 - 700V	

RWY		05	
1+2 ENG	ft - m/km	0 - 1.5V	MNM climb gradient 3.4% up to 900
3+4 ENG		0 - 700V	

Speed

MAX IAS 250KT within TMA at or below FL100 (refer to RFCs).

Departure Procedure

Start-up: For start-up PROC see CRAR Turkey.


24-MAY-2018

UAB-LTAG

Turkey Adana Incirlik

Incirlik Adana Turkey

2-10

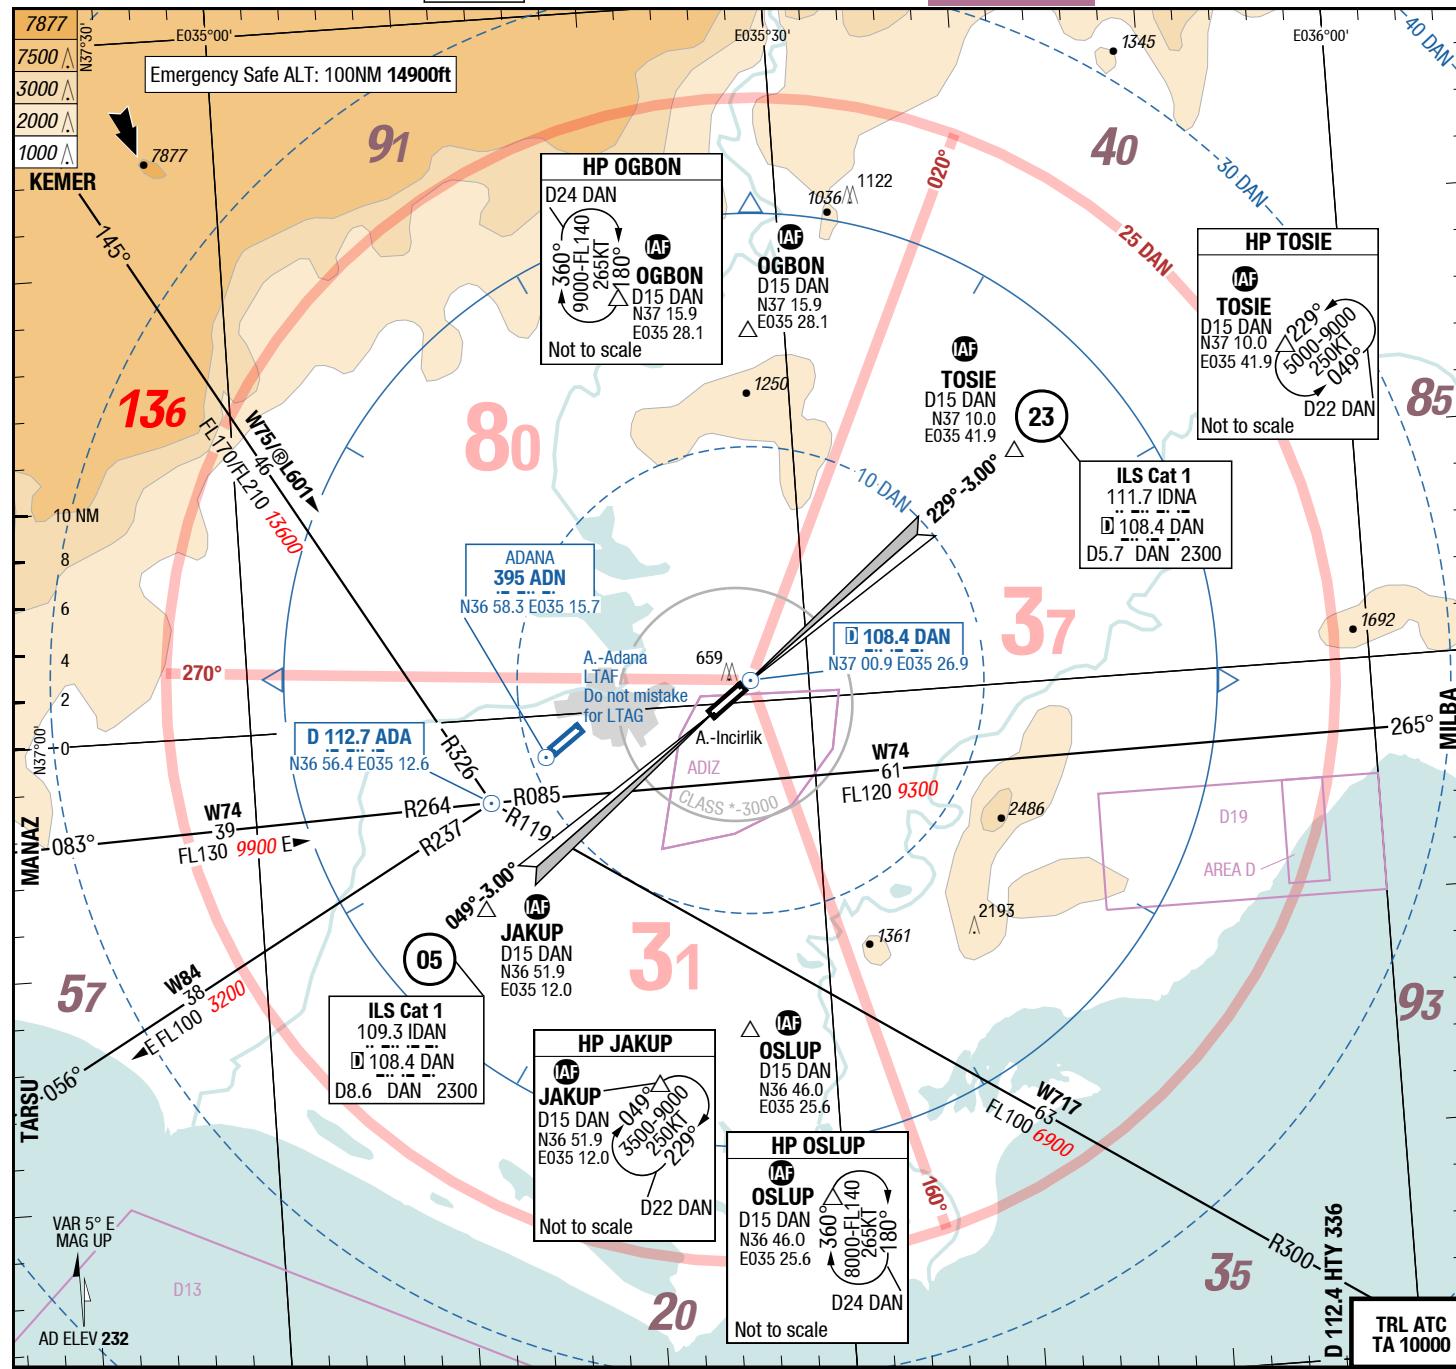


ATIS	129.750	AWOS
Incirlik APP	118.300	
	118.000	
	128.000	
	126.500	
Incirlik TWR	129.400	
	122.100	
Incirlik GND	121.950	
	123.025	

Landing RWY system:

Inciflik TWR

Incirlik GND

Landing RWY sys

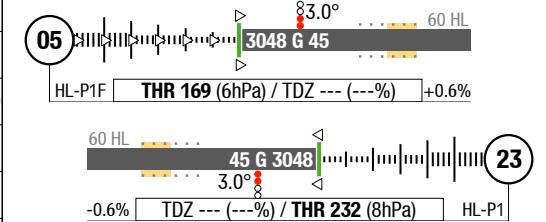

24-MAY-2018

UAB-LTAG

Turkey Adana Incirlik


3-20

AGC

AGC

Incirlik Adana Turkey

AGC

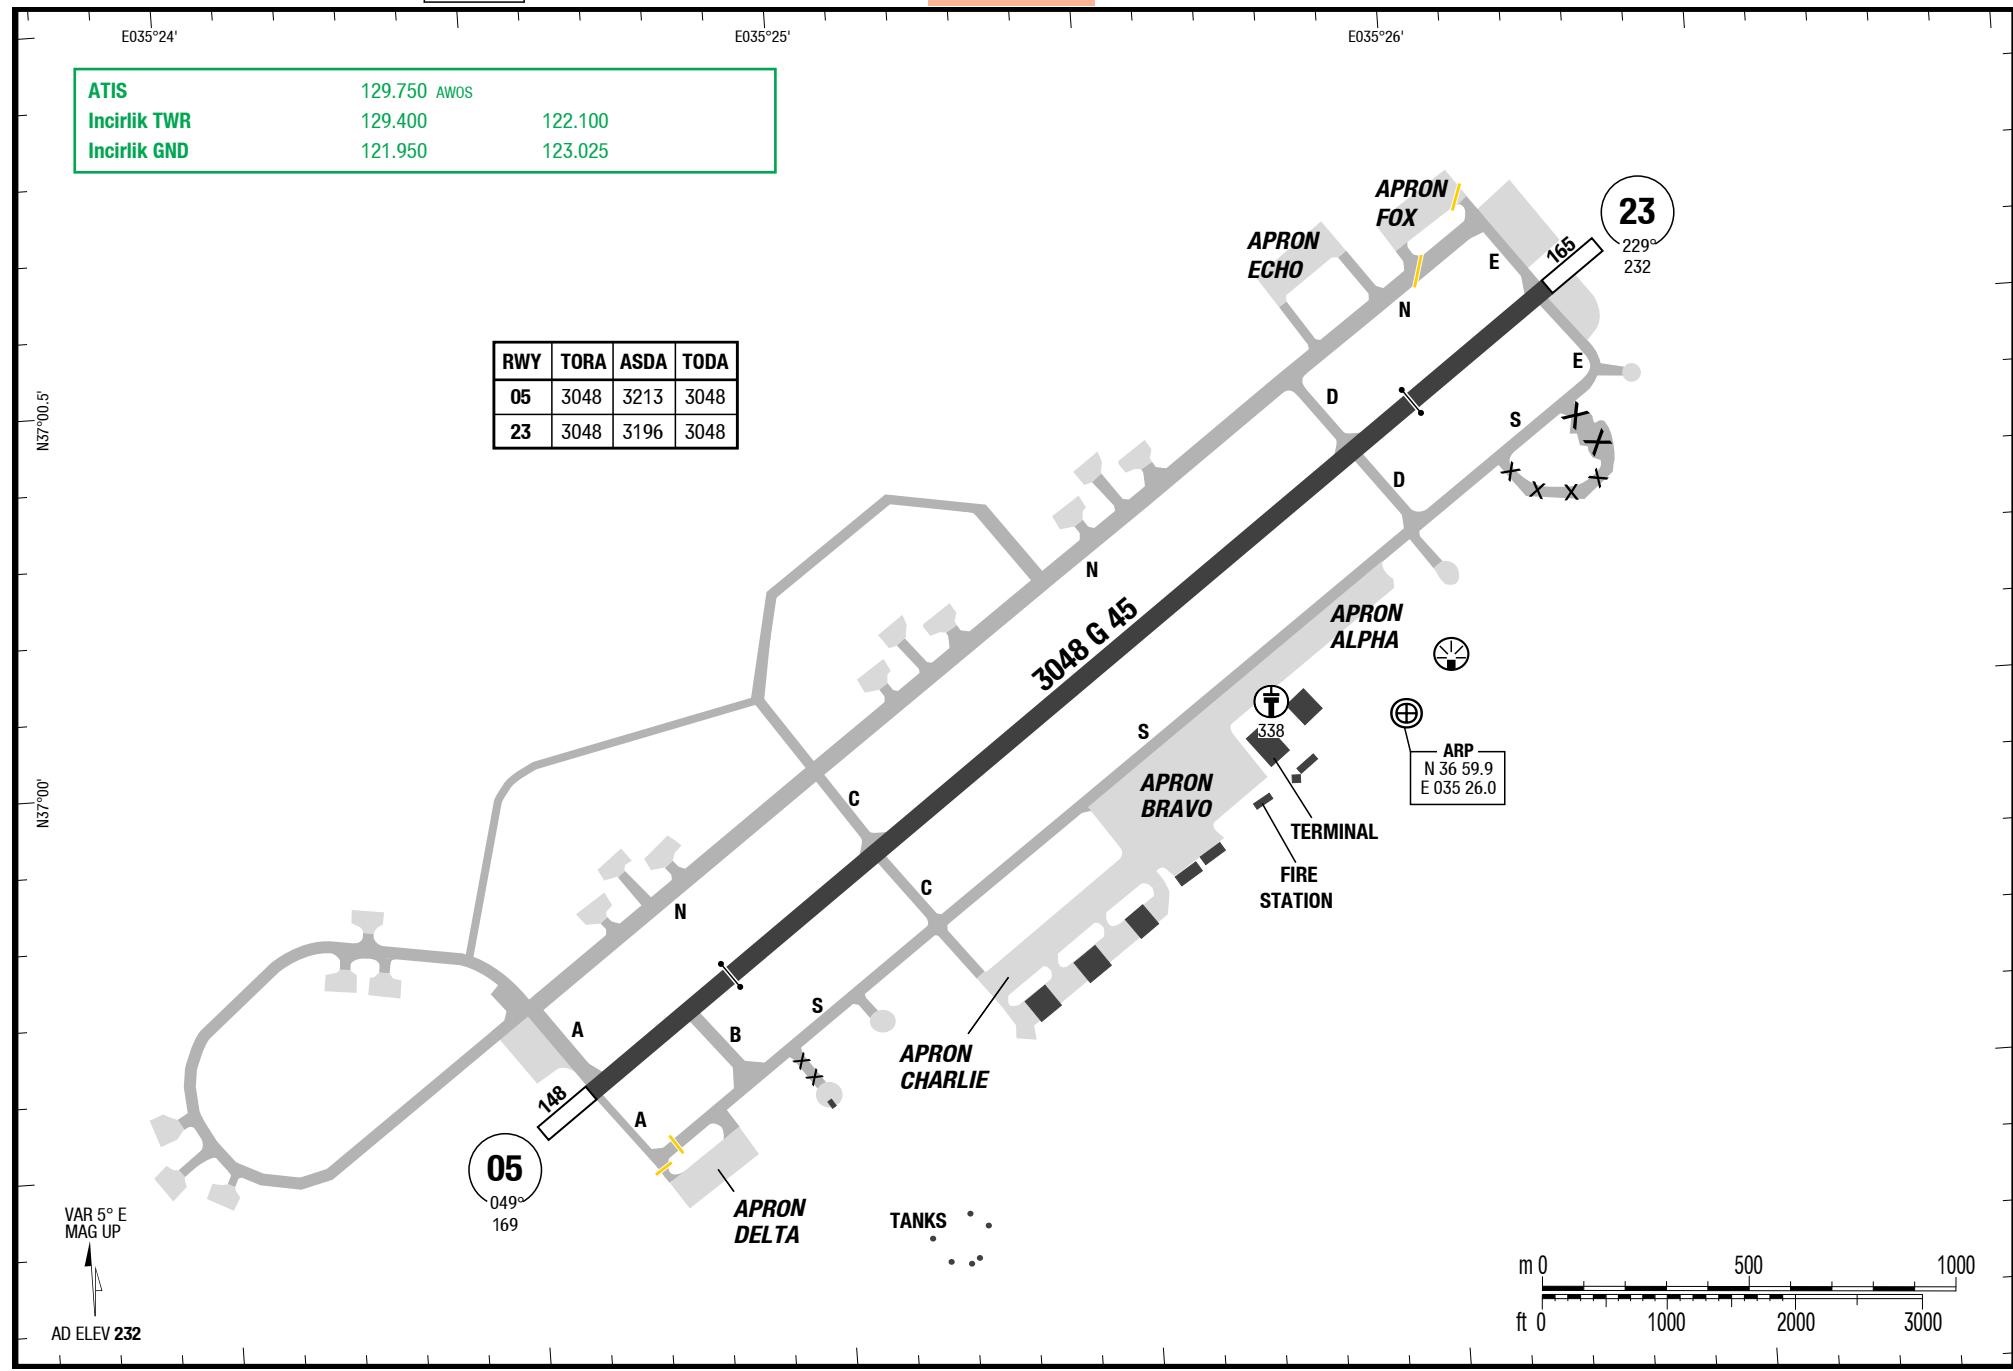

26-JAN-2017

UAB-LTAG**5-10****DEPARTUREs**

SIDPT

DEPARTUREs

	GS	120	150	180	210	240	270	
3.4%	ft/MIN	500	600	700	800	900	1000	

RWY**Routing****OMNIDIRECTIONAL DEP****RWY 05**

3.4% to 900

Climb HDG 049° until **1100**

Remain between 030° CW 070°

RWY 23Climb HDG 229° - at MNM **700** turn on course

Remain between 210° CW 250°


RWY**Notes****23**Building 2649ft from DER, 1168ft right of centerline, 50ft AGL/217ft MSL.
Building 1889ft from DER, 875ft left of centerline, 40ft AGL/201ft MSL.

24-MAY-2018

UAB-LTAG

7-10

ILS or LOC 05

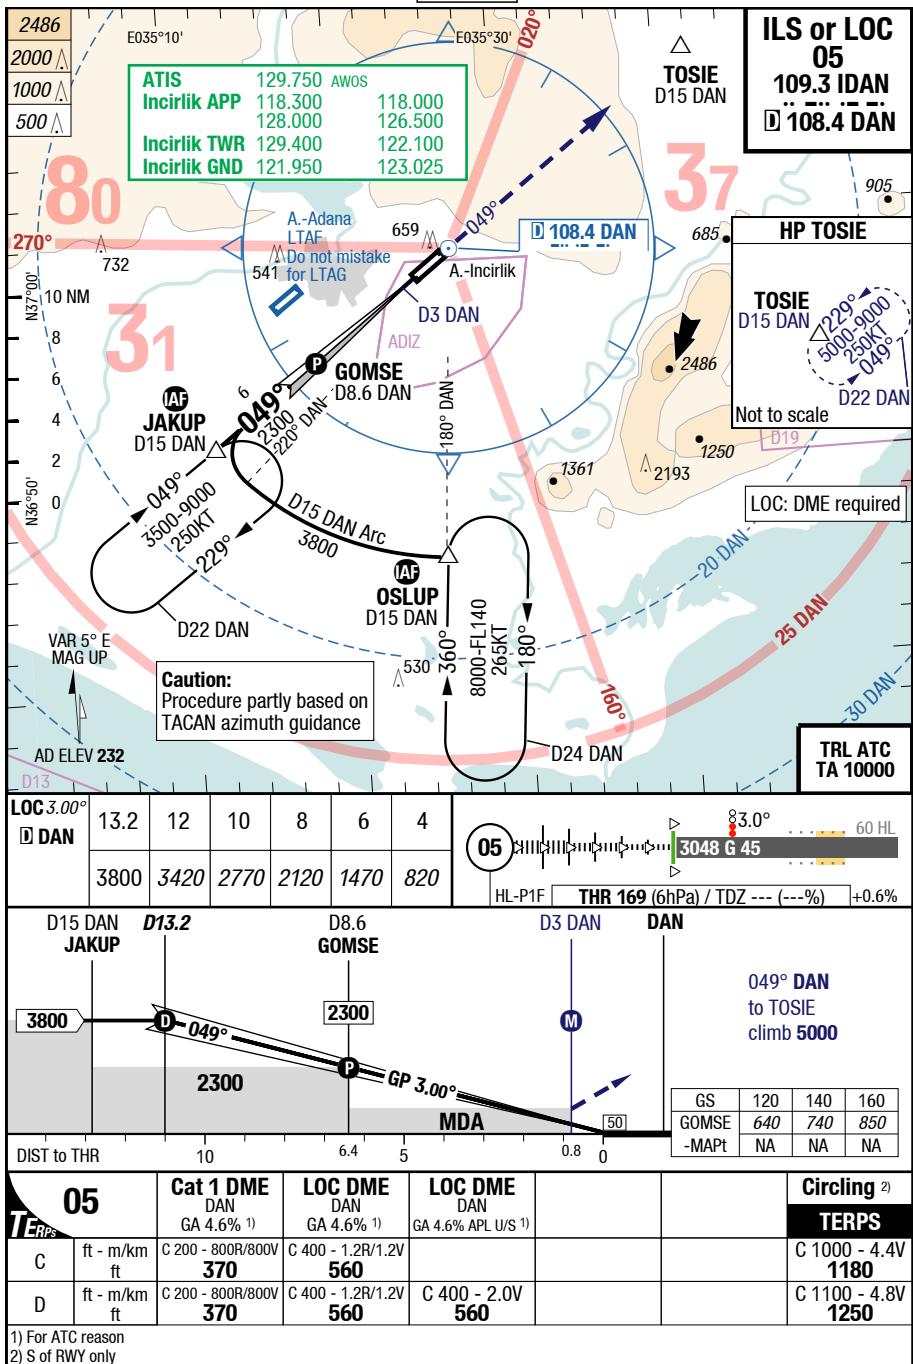

Changes: MIN, FREQ, APL


24-MAY-2018

UAB-LTAG

7-20

ILS or LOC 23

IAC

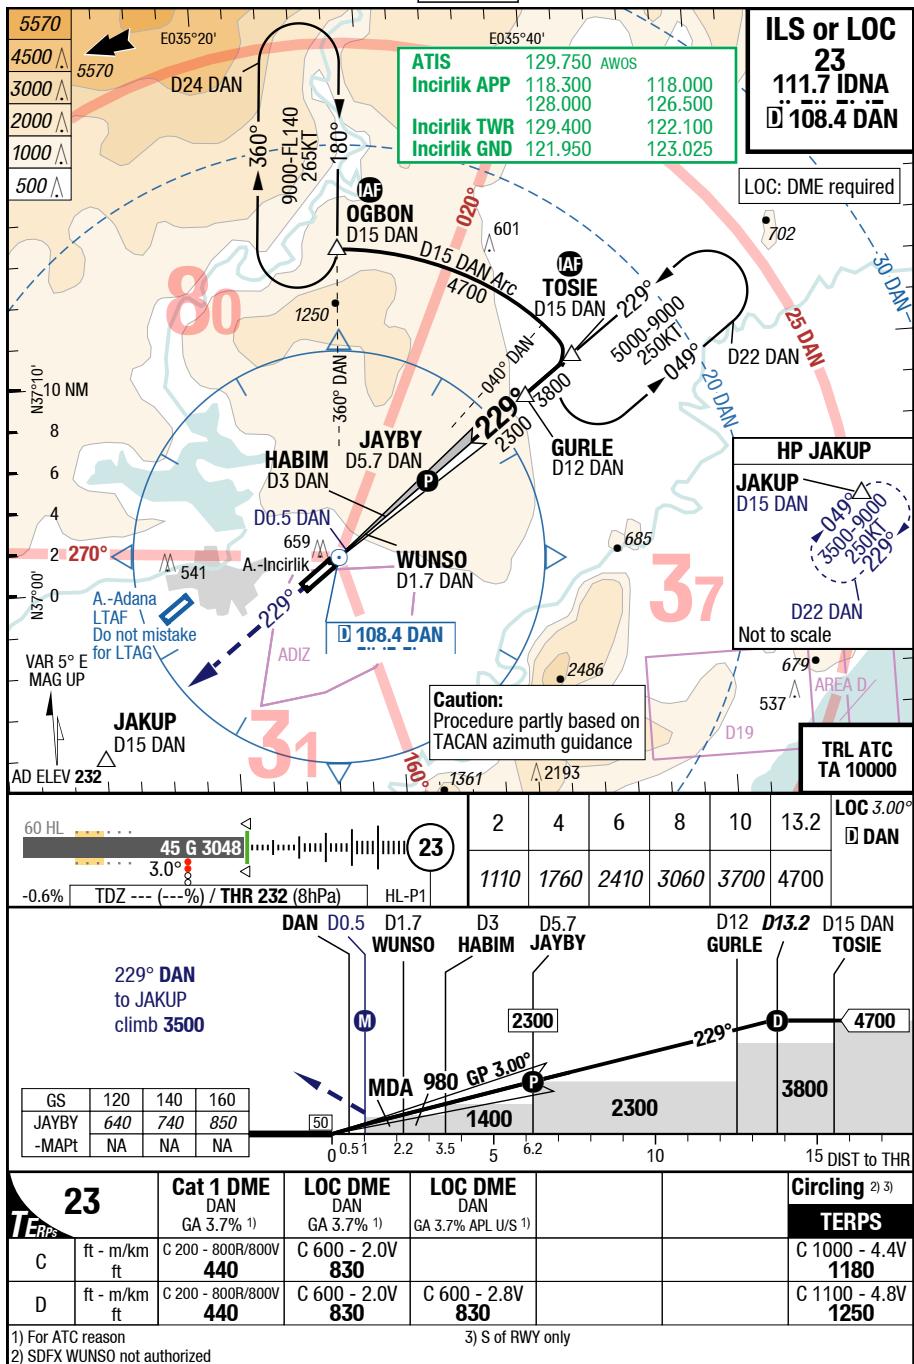


Changes: MIN, APL, FREQ

24-MAY-2018

UAB-LTAG

7-30

RNAV (GPS) 05

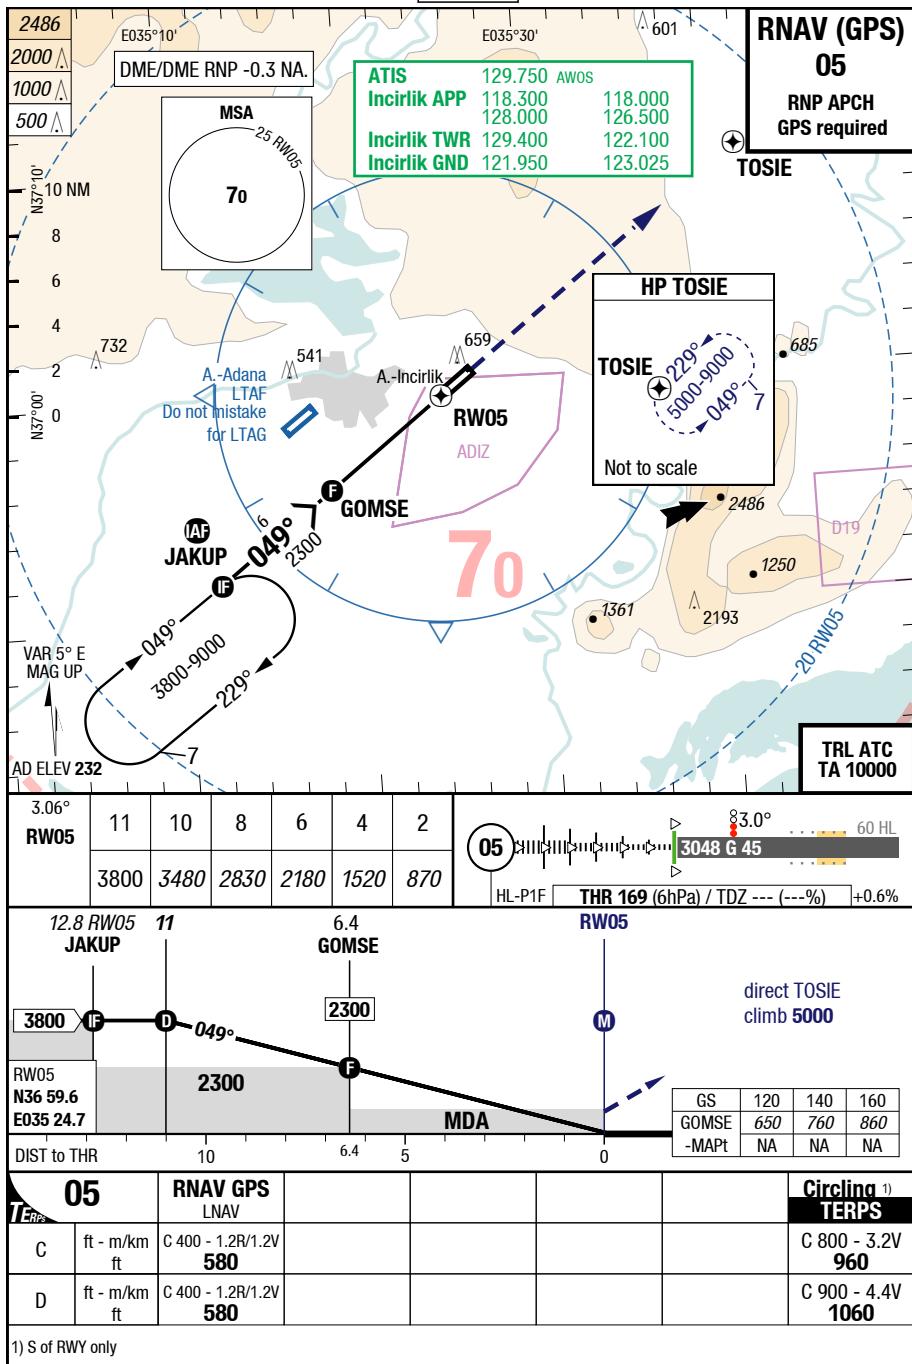


Changes: MIN, FREQ, APL

24-MAY-2018

UAB-LTAG

7-40

RNAV (GPS) 23

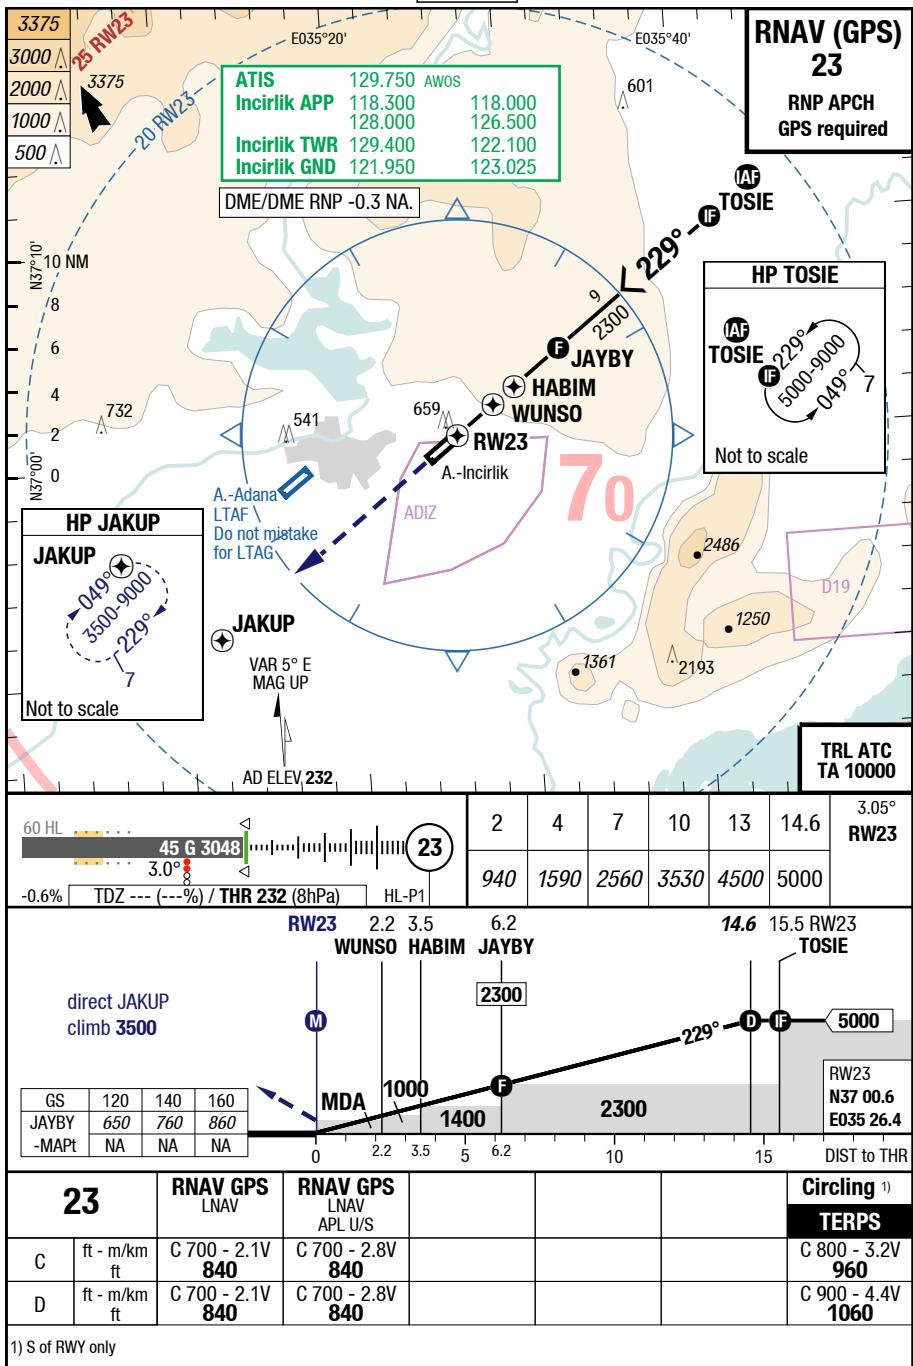

Changes: APL, FREQ

Effective 02-FEB-2017

26-JAN-2017

UAB-LTAG

Turkey Adana Incirlik

Incirlik Adana Turkey

RC

BC

11

MRC

8-10

