

03-MAY-2018

TCQ-SPTN

1-10

AOI

AOI

GENERAL**Operational Hours****ATS Hours:** 1100-0300, other times O/R**AD ADMIN Hours:** 1100-0300**Airport Information****RFF:** CAT 7**Fuel:** MON-SAT 1000-0200, other times O/R**PCN:** RWY 02/20: 39/F/A/X/T**Customs:** According SKED flights and O/R**Operation****Traffic Notes**

Non-SKED flights must coordinate flight plan 24HR before ETA with AD administration.

Taxi/Parking

ACFT must start taxiing with MNM PWR due to close proximity of the terminal building.

ARRIVAL**Speed**

MAX IAS 250KT below FL100 within airspace classes D, F and G.

Arrival Procedure**Non-standard GP Intercept Position on RWY 02**

GP intercepts RWY 02 at 349m / 1145ft after landing threshold.

Remaining DIST beyond GP is 2151m / 7057ft.

DEPARTURE**Take-off Minima**

RWY		02/20	
3+4 ENG	ft - m/km	0 - 800V	-
1+2 ENG		0 - 1600V	-

Speed

MAX IAS 250KT below FL100 within airspace classes D, F and G.

03-MAY-2018

Peru Tacna Coronel FAP Carlos Ciriani S.R. Intl.

AFC

Coronel FAP Carlos Ciriani S.R. Intl. Tacna Peru

TCQ-SPTN

2-10


AFC

AFC

AFC

AFC


Info	126.900 1100-0300 & OR
Lima South One RDR	135.000
Lima South Two RDR	128.800
TWR/APP	118.400 1100-0300 & OR

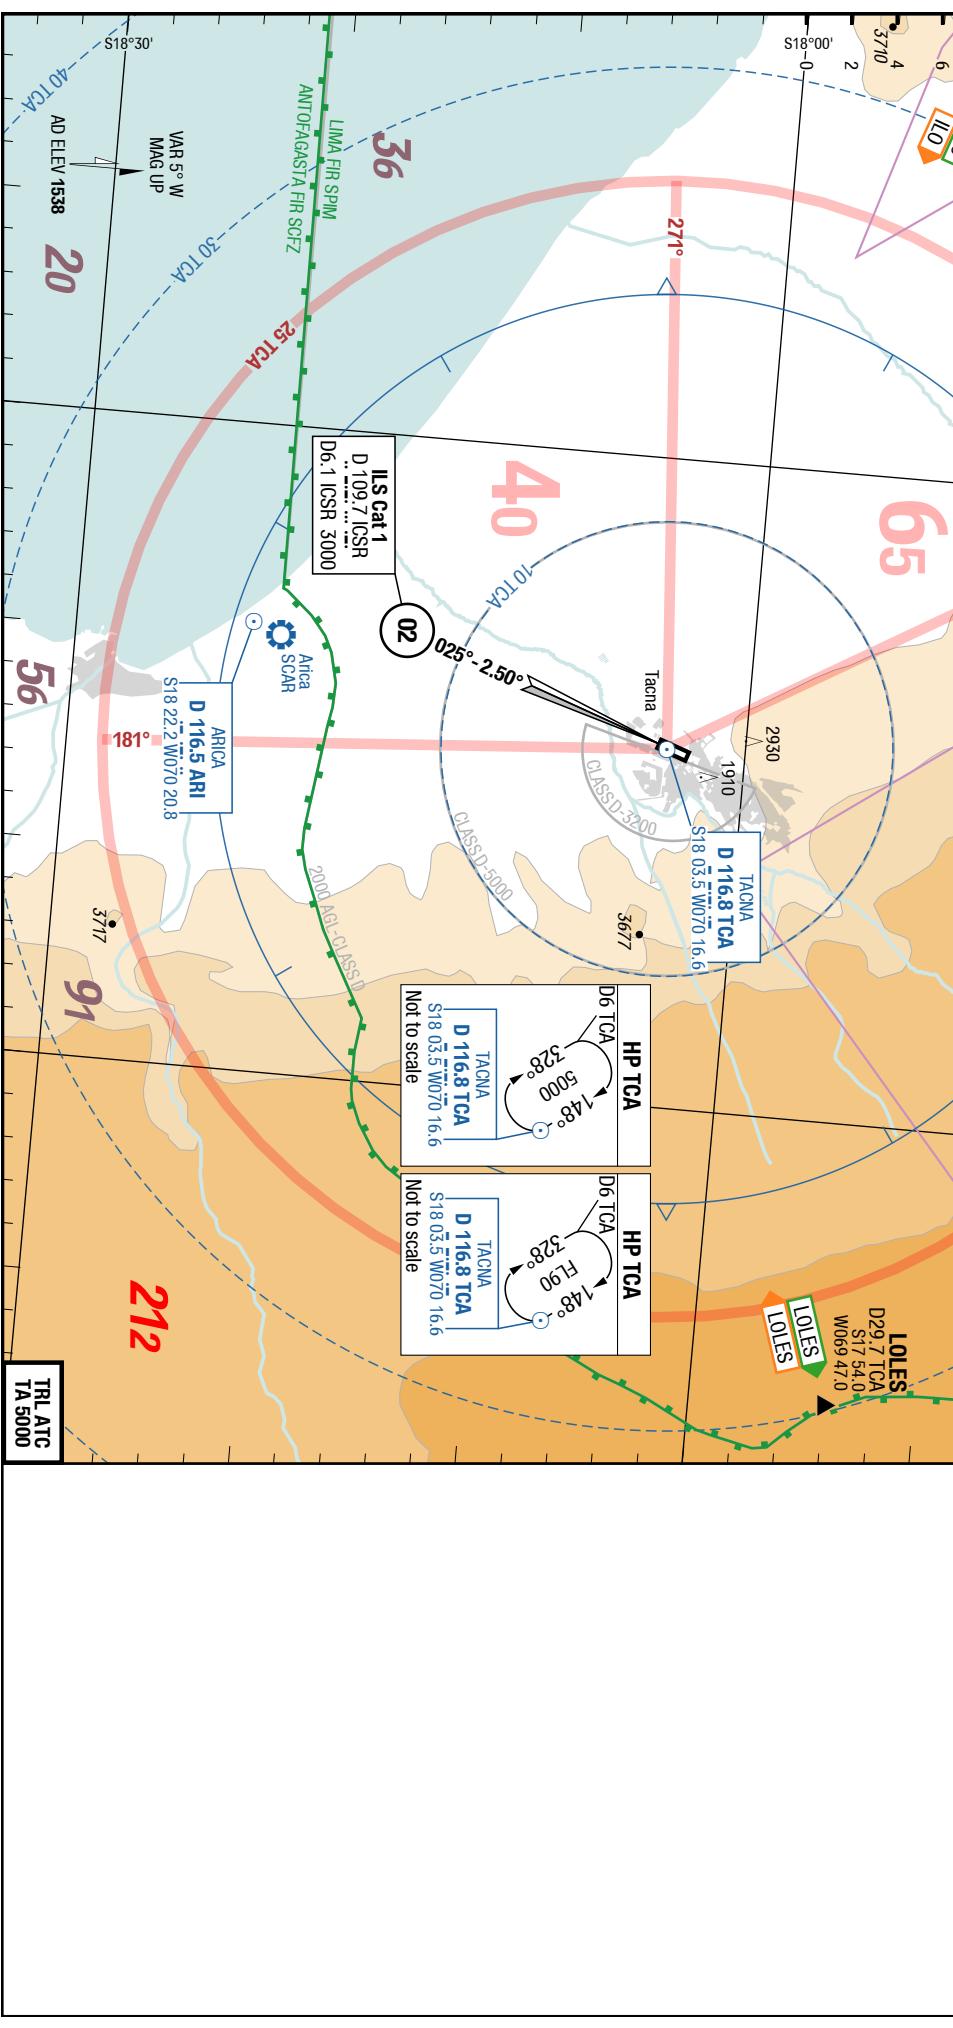

03-MAY-2018
TCQ-SPTN

Peru Tacna Coronel FAP Carlos Ciriani S.R. Intl.
3-20

Coronel FAP Carlos Ciriani S.R. Intl. Tacna Peru

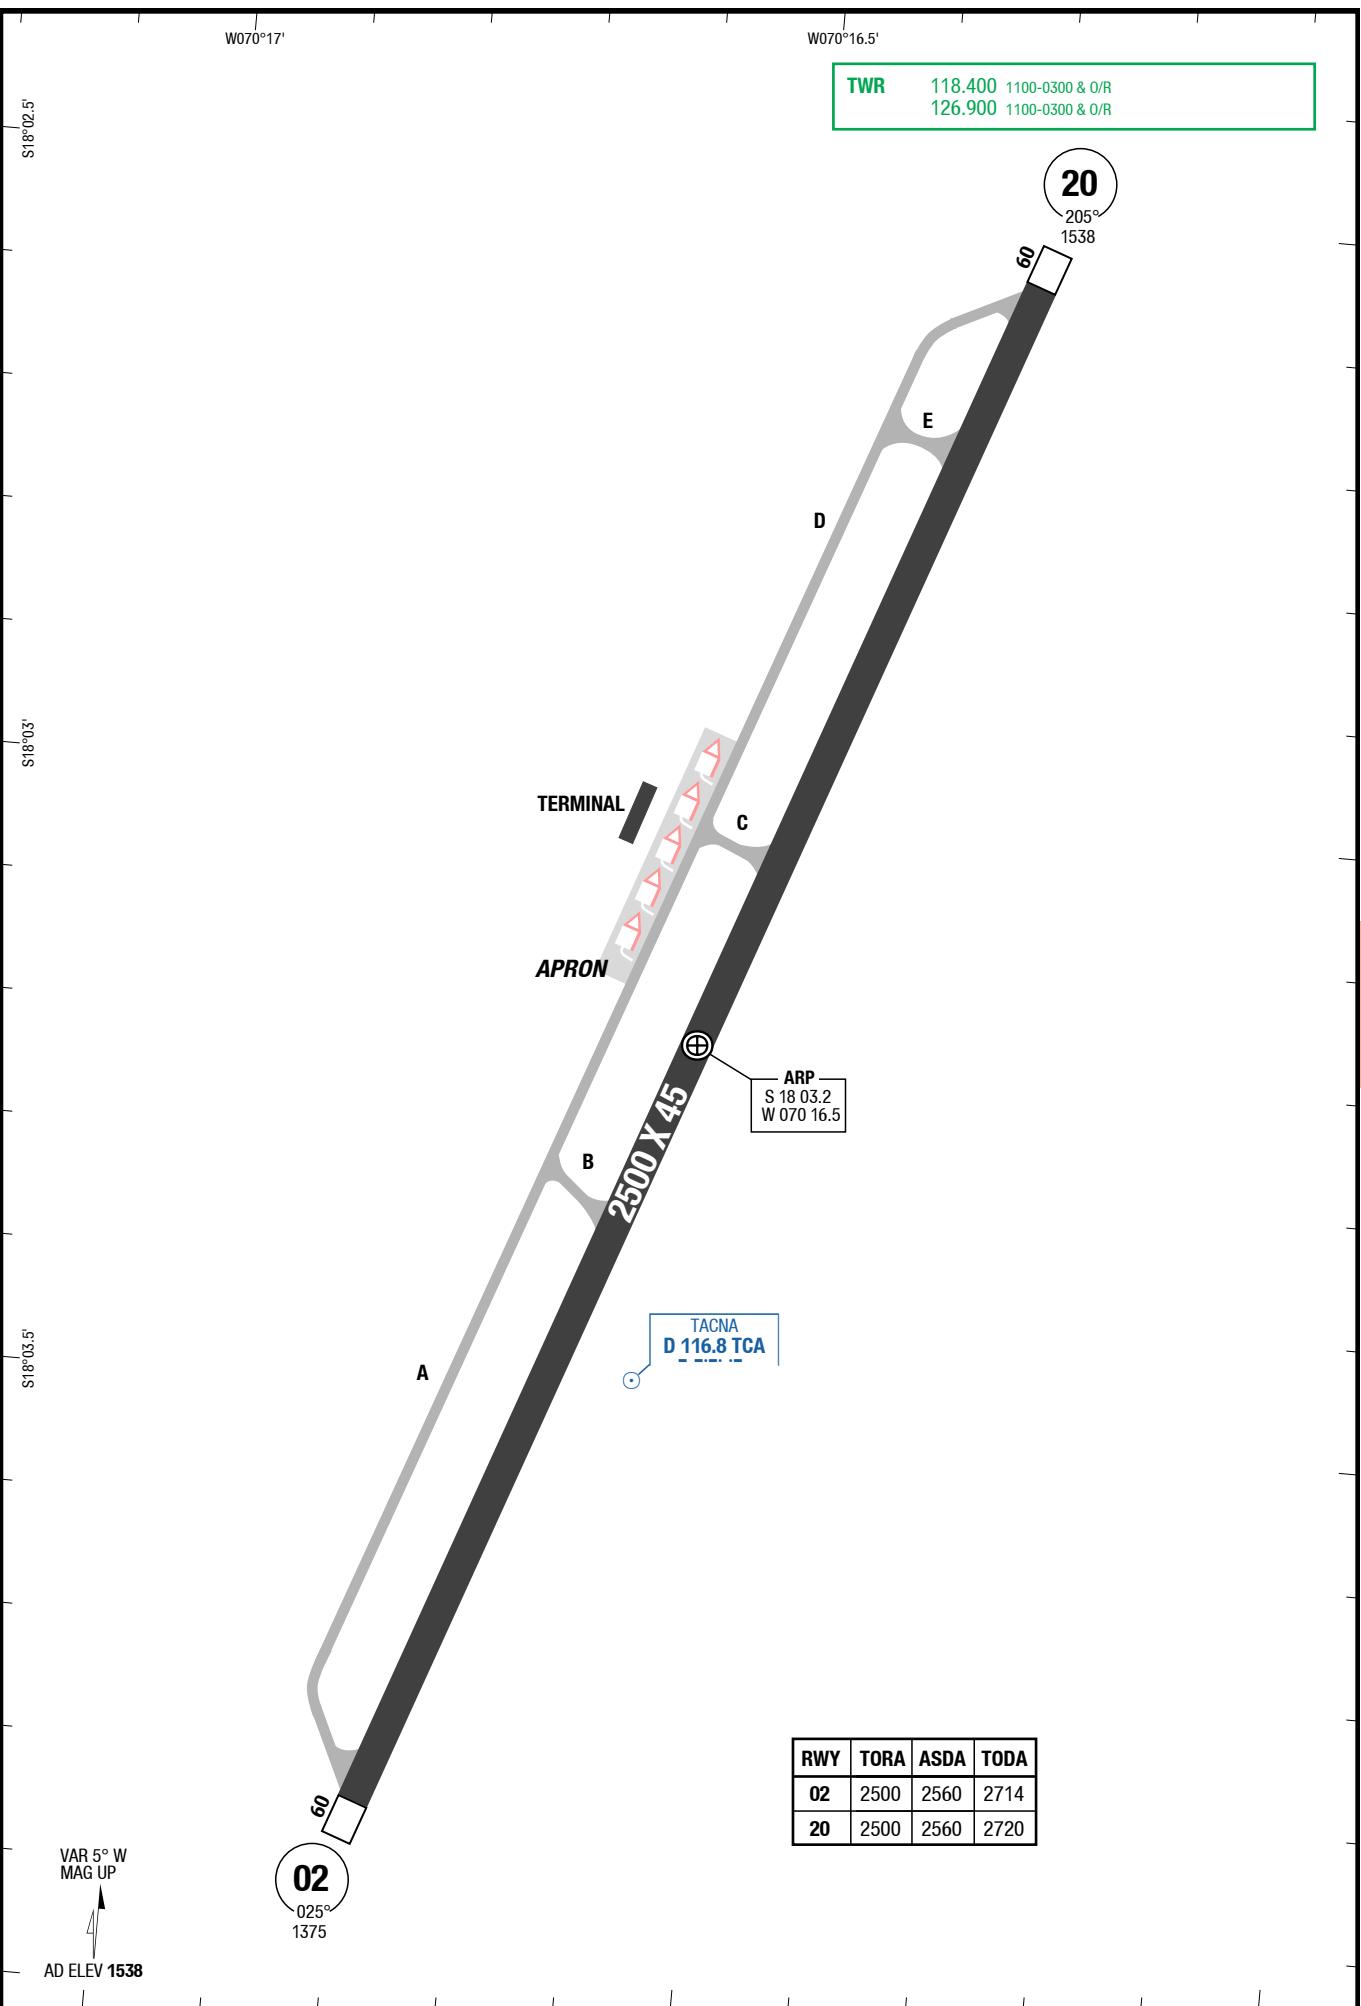

03-MAY-2018
TCQ-SPTN

Peru Tacna Coronel FAP Carlos Ciriaco S.R. Intl.

Coronel FAP Carlos Ciriaco S.R. Intl. Tacna Peru


4-10

SIDs ILO 3F / GAVAR 2G

SID
SID

SIDs ILO 3F / GAVAR 2G

TRL ATC
TA 5000

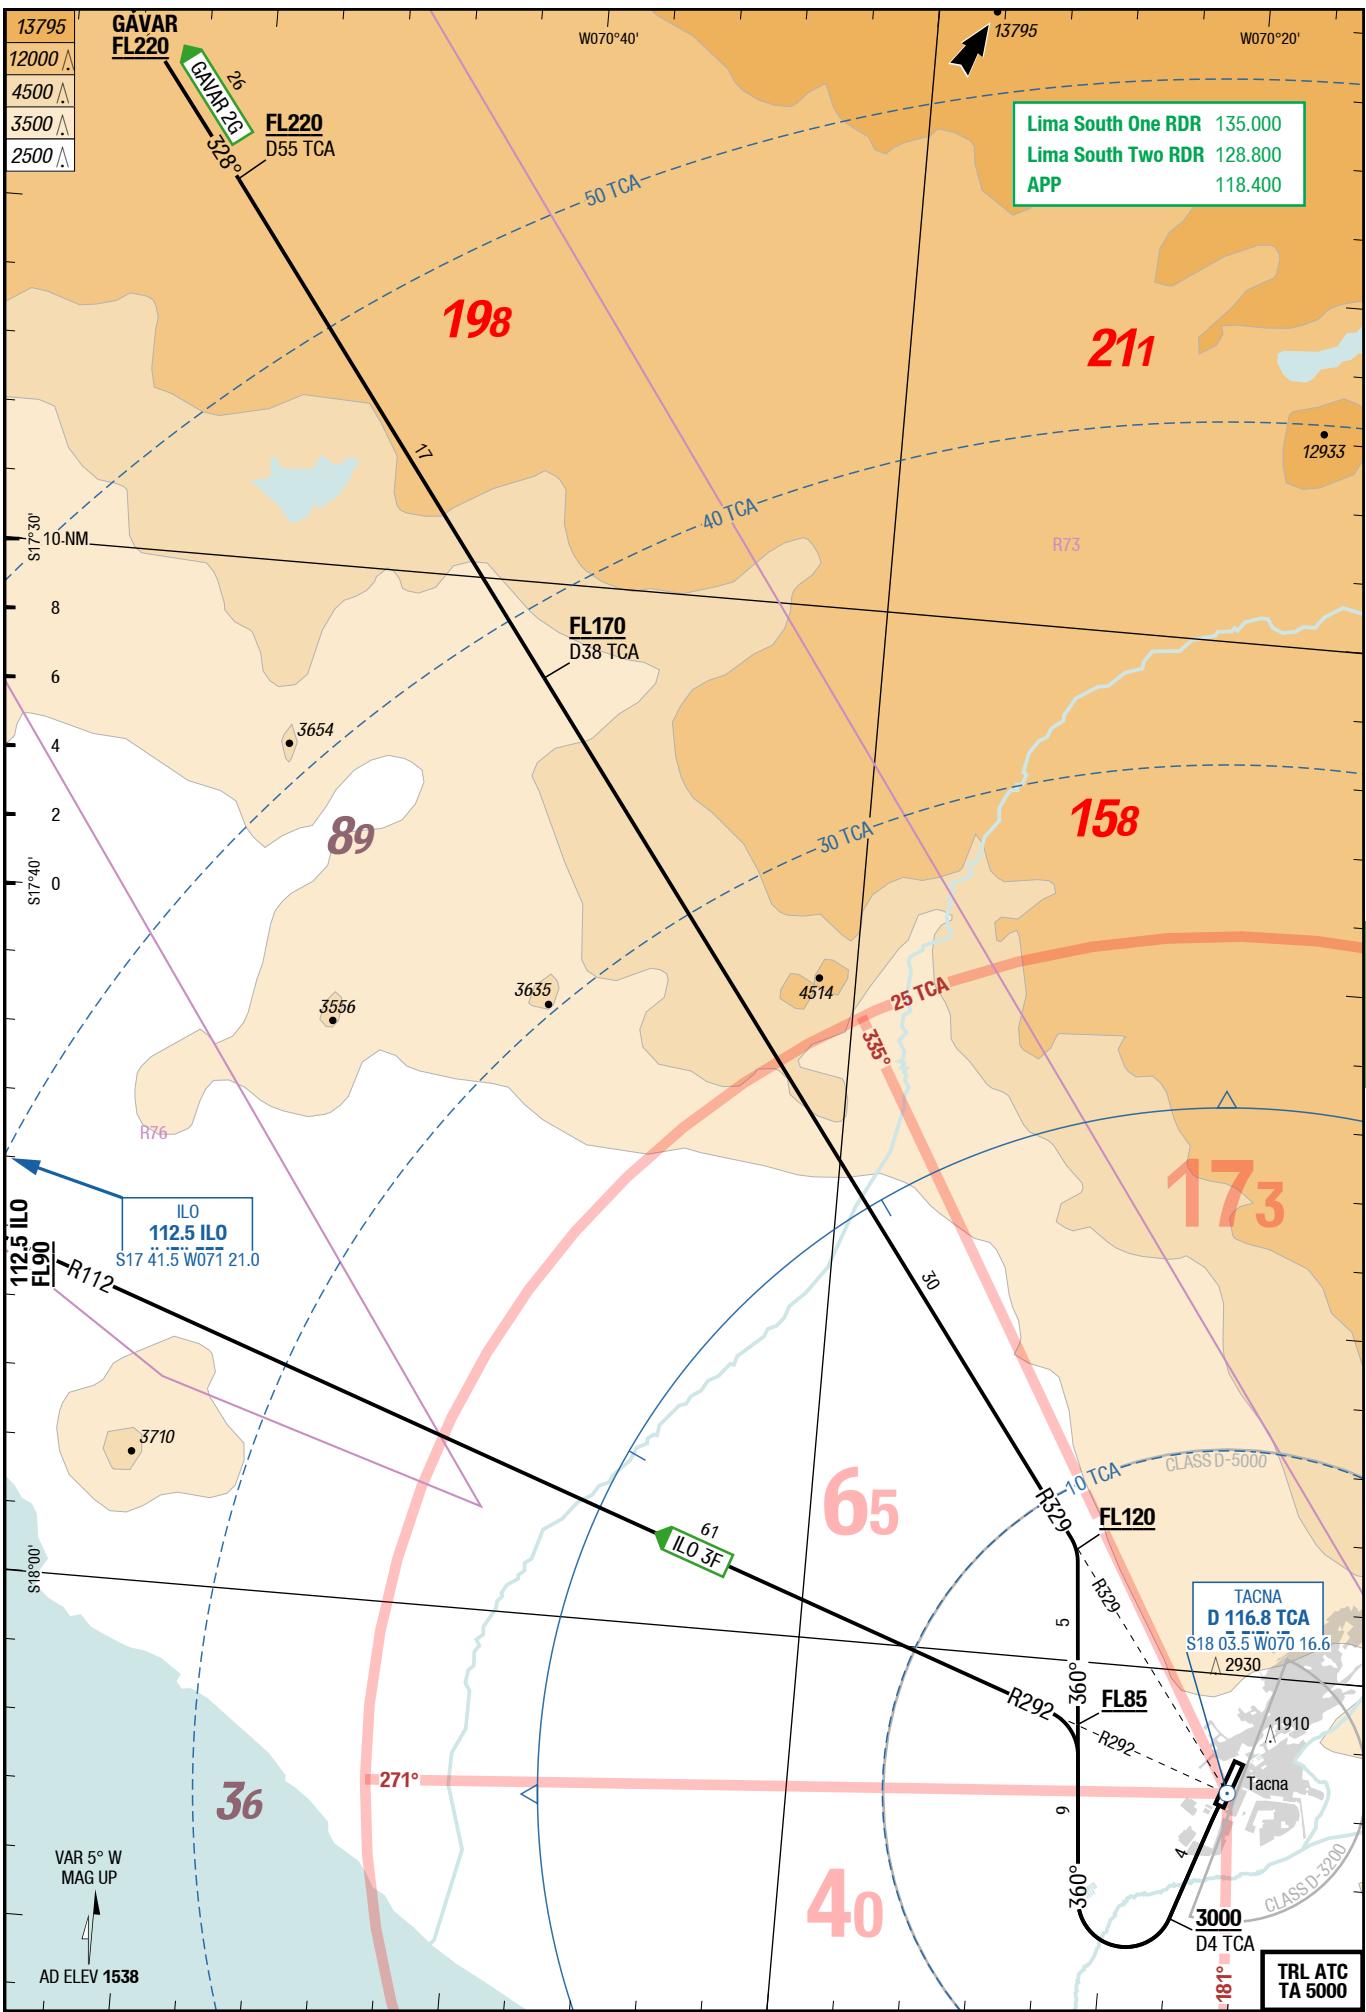

03-MAY-2018

TCQ-SPTN


Peru Tacna Coronel FAP Carlos Ciriani S.R. Intl.

4-20

SIDs ORALO 1 / LOLES 1 SID SID

SIDs ORALO 1 / LOLES 1

Coronel FAP Carlos Ciriani S.R. Intl. Tacna Peru

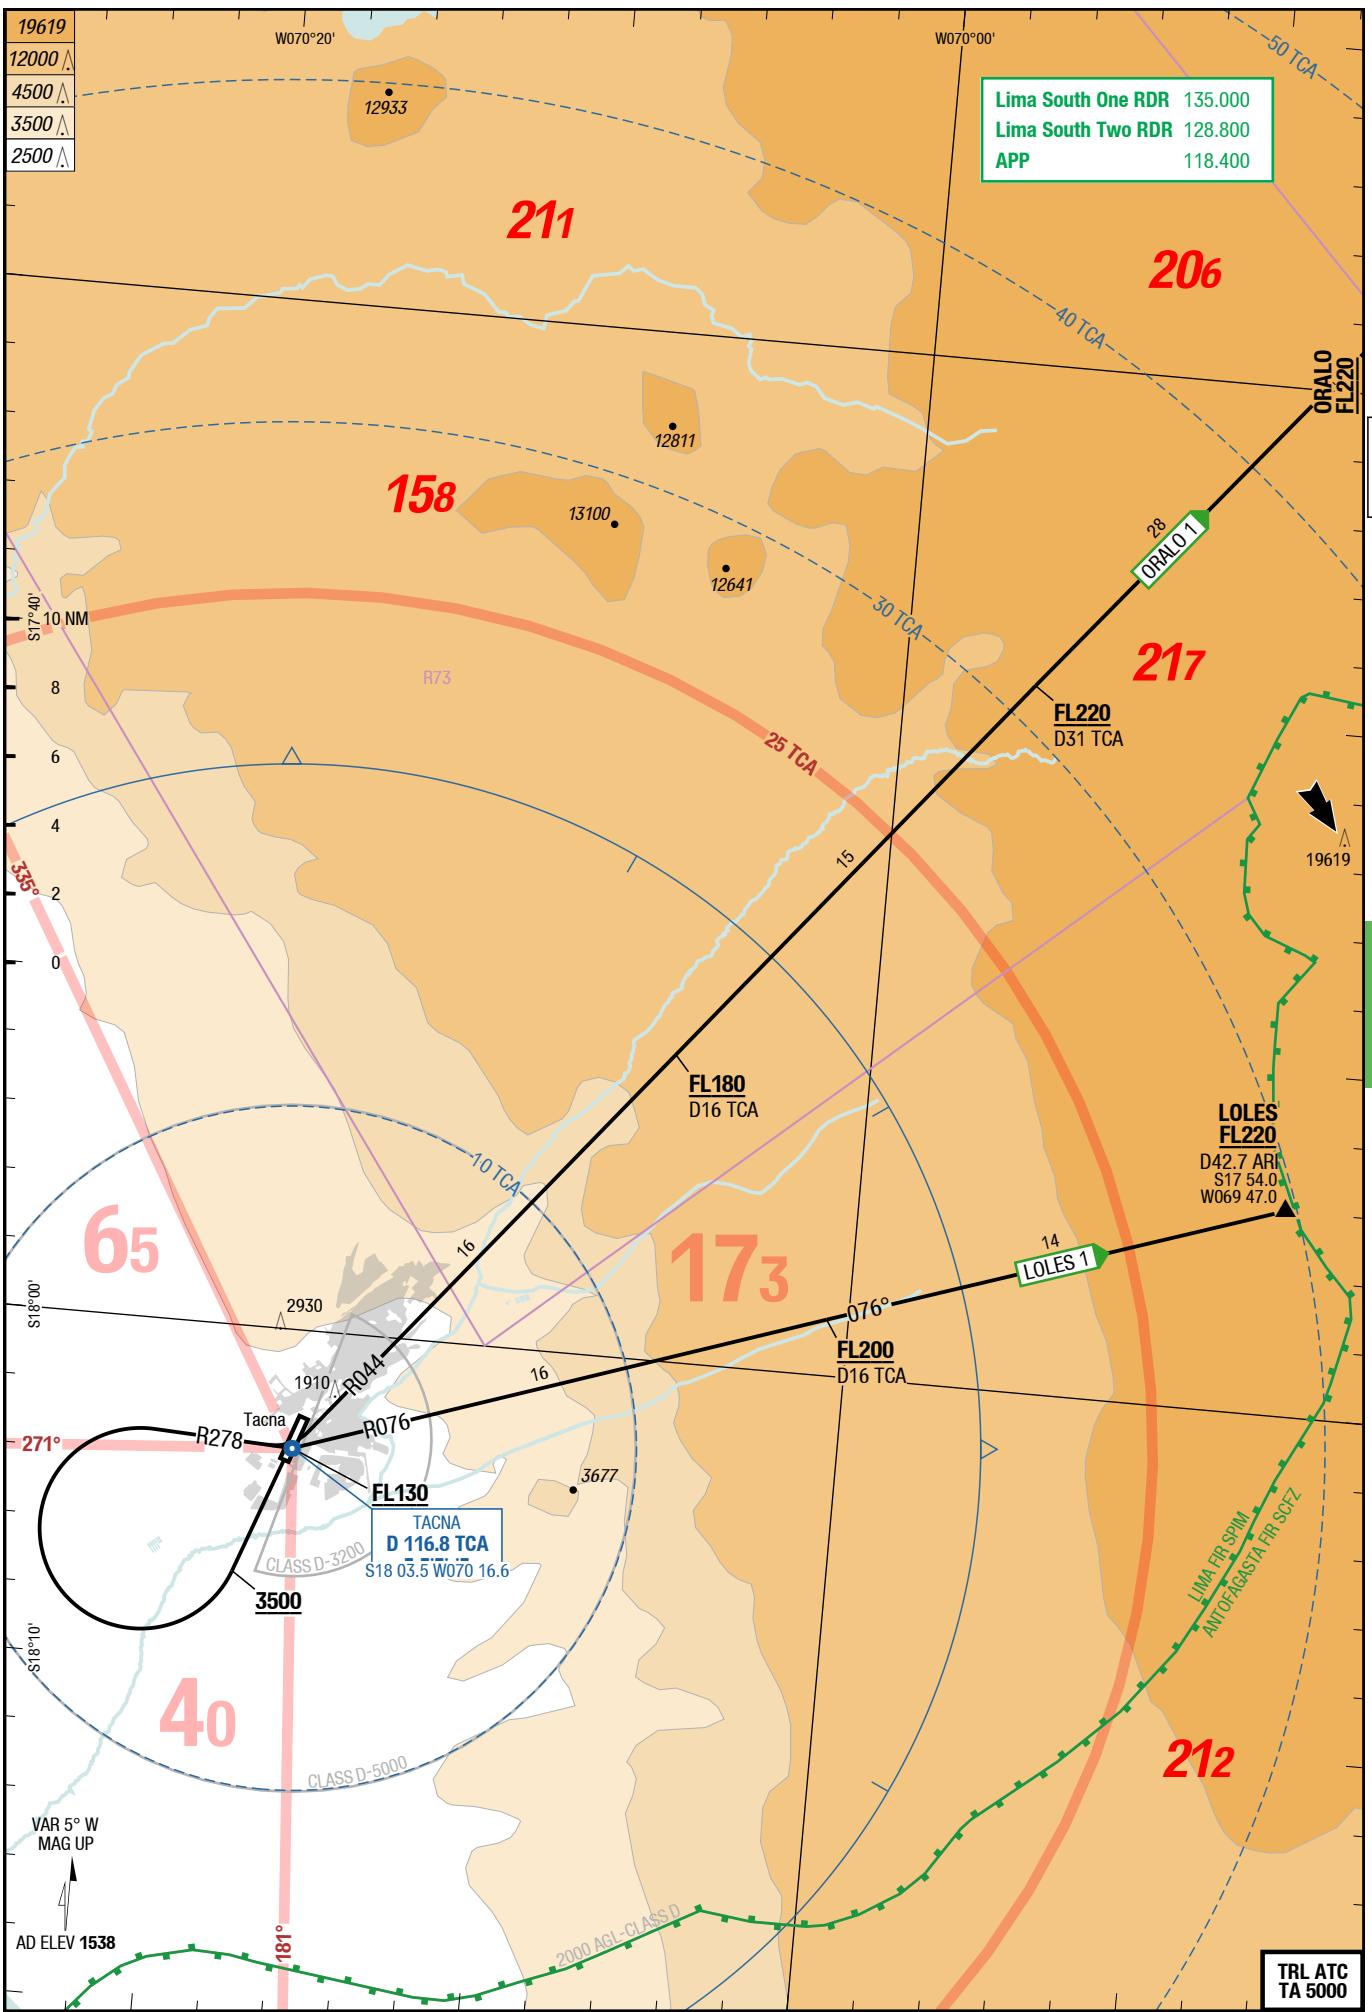

03-MAY-2018

TCQ-SPTN**5-10****SIDs ILO 3F / GAVAR 2G**

SIDPT

GAVAR 2G / ILO 3F

RWY 20 (205°)

DESIGNATOR	ROUTING	ALTITUDES
	Runway 20	
GAVAR 2G 135.000	at D4 TCA - RT 360° - intercept R329 TCA to GAVAR	R205/D4 TCA MNM 3000 crossing R292 TCA MNM FL85 R329 TCA MNM FL120 R329/D38 TCA MNM FL170 R329/D55 TCA MNM FL220 GAVAR MNM FL220
ILO 3F 135.000	at D4 TCA - RT 360° - intercept R292 TCA to ILO	R205/D4 TCA MNM 3000 crossing R292 TCA MNM FL85 ILO MNM FL90

03-MAY-2018

TCQ-SPTN**5-20****SIDs ORALO 1 / LOLES 1****LOLES 1 / ORALO 1**

RWY 20 (205°)


DESIGNATOR	ROUTING	ALTITUDES
	Runway 20	
LOLES 1 135.000	at MNM 3500 - RT intercept R278 inbound to TCA - R076 TCA to LOLES	TCA MNM FL130 R076/D16 TCA MNM FL200 LOLES MNM FL220
ORALO 1 135.000	at MNM 3500 - RT intercept R278 inbound to TCA - R044 TCA to ORALO	TCA MNM FL130 R044/D16 TCA MNM FL180 R044/D31 TCA MNM FL220 ORALO MNM FL220

03-MAY-2018

TCQ-SPTN

Peru Tacna Coronel FAP Carlos Ciriani S.R. Intl.

Coronel FAP Carlos Ciriani S.R. Intl. Tacna Peru

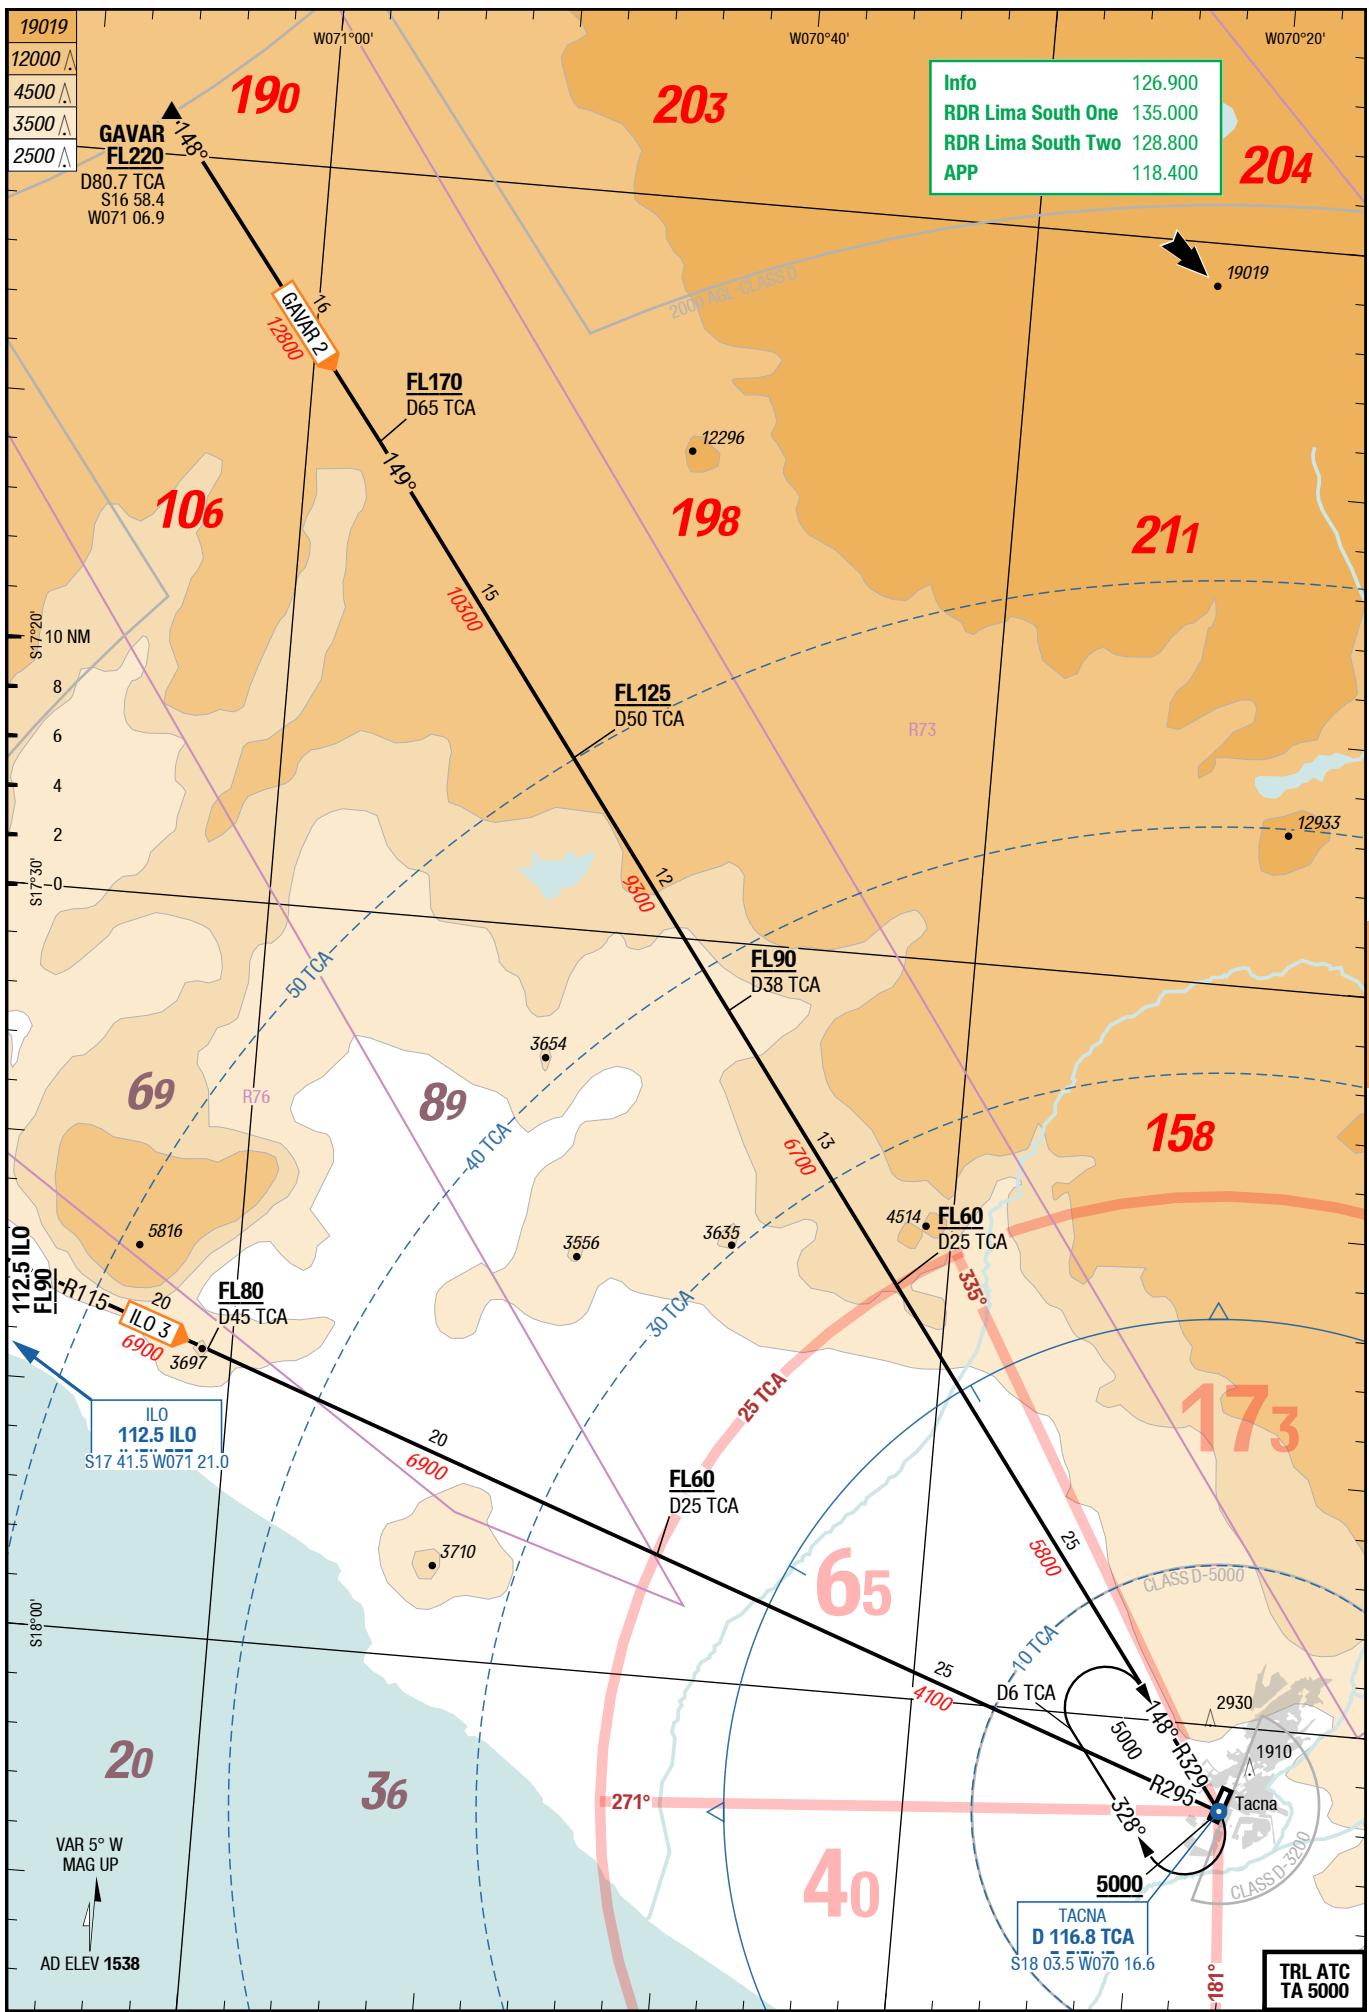

03-MAY-2018

TCQ-SPTN


Peru Tacna Coronel FAP Carlos Ciriani S.R. Intl.

Coronel FAP Carlos Ciriani S.R. Intl. Tacna Peru

6-20 STARS ORALO 3 / LOLES 3

STAR
STAR

STARS ORALO 3 / LOLES 3

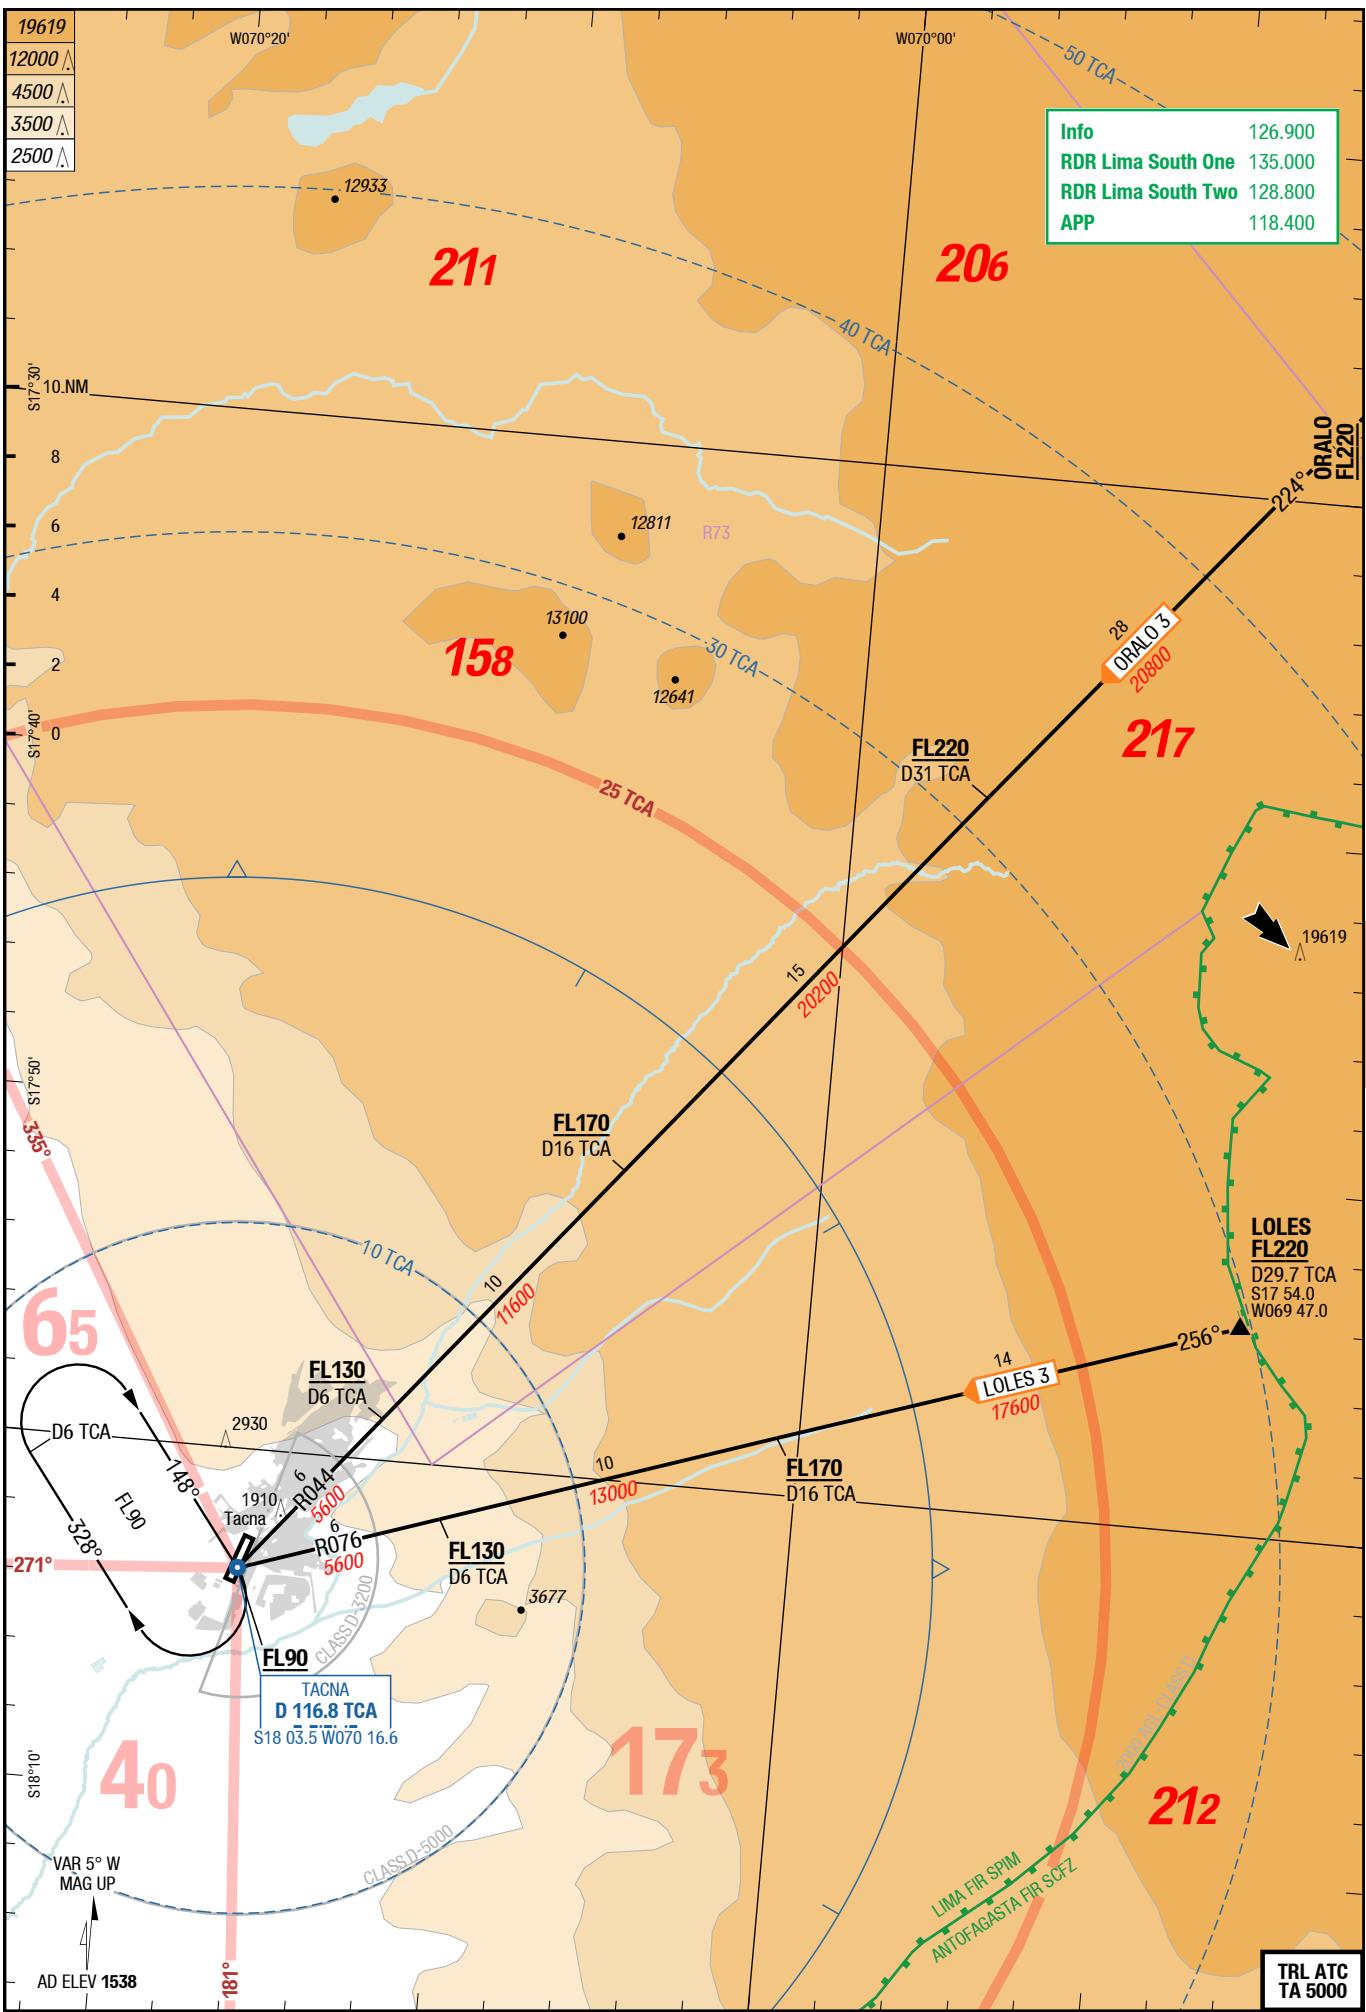


03-MAY-2018

TCQ-SPTN

7-10

ILS Z 02

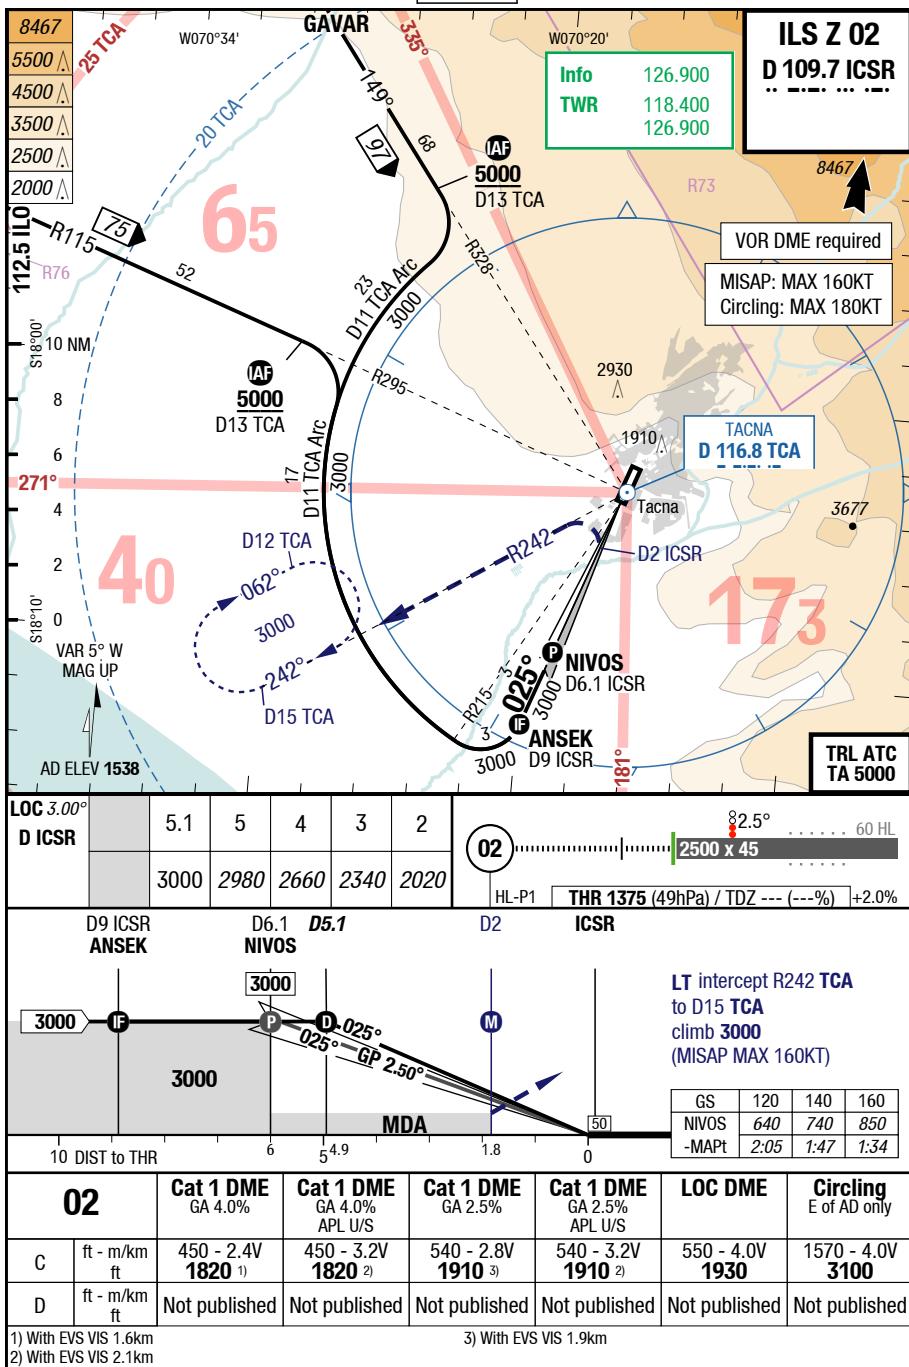


03-MAY-2018

TCQ-SPTN

7-20

ILS Y 02

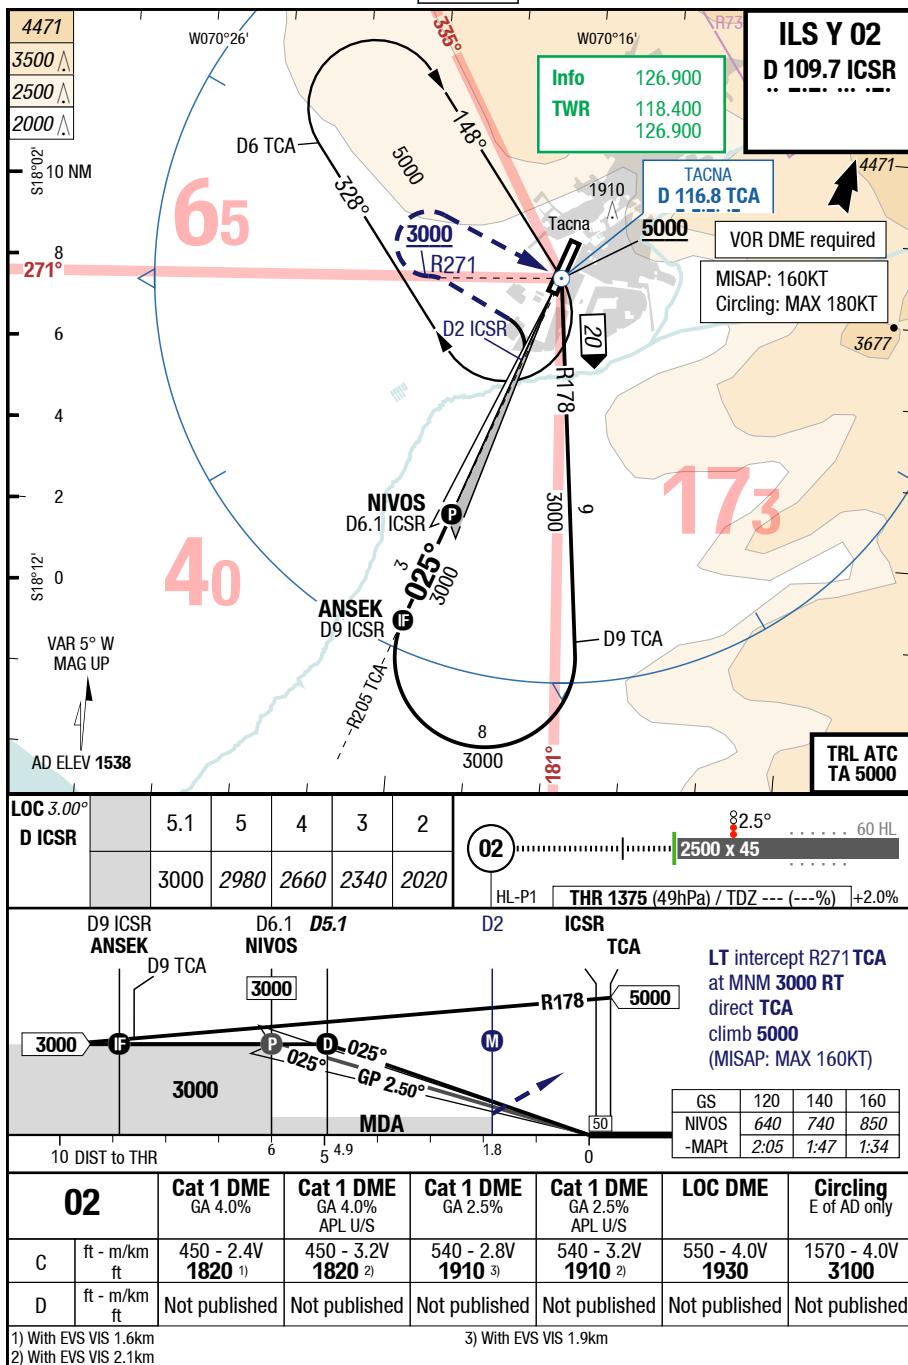


Changes: new

03-MAY-2018

TCQ-SPTN

7-30

VOR Z 02

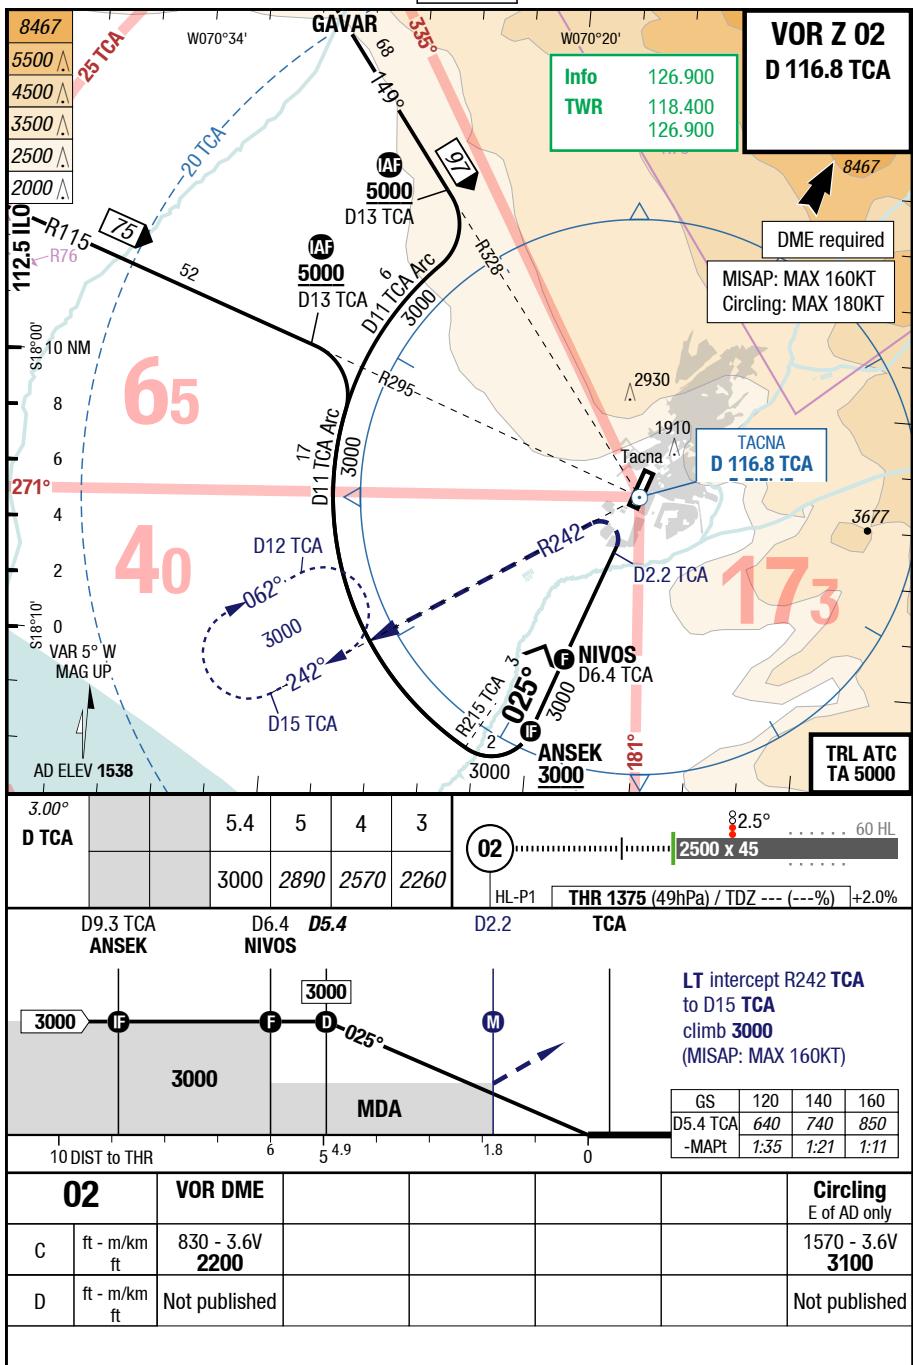


Changes: new

03-MAY-2018

TCQ-SPTN

7-40

VOR Y 02

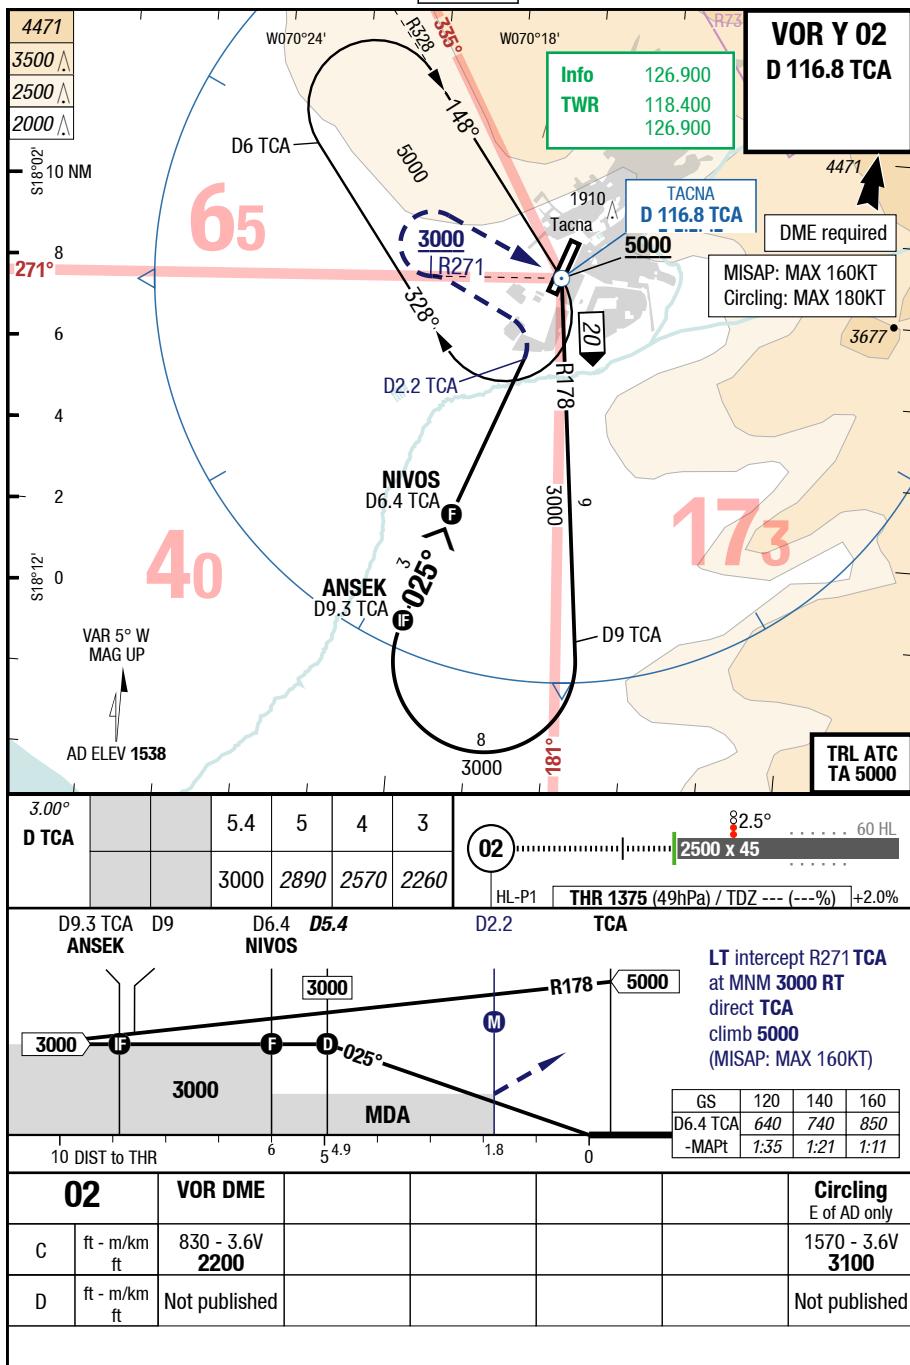

Changes: New