

GENERAL**Operational Hours****ATS Hours:** Uncontrolled AD**AD Hours:** H24**Airport Information****RFF:** CAT 5**Fuel:** Not AVBL**PCN:** RWY 10/28: 41/F/C/X/T**Customs:** Not AVBL**Operation****Traffic Note**

AD is PPR, at least 24HR in advance.

AD located within R8 area: all OPS require the authorization of the Colombian Air Force.

Preferential RWY

RWY 10: TKOF/LDG.

Warnings

Birds in vicinity of AD.

ARRIVAL**Speed**

MAX IAS 250KT below FL100 within airspace classes D and G.

Arrival Procedure**Arrival Note**

Once an ARR ACFT has notified passing IAF (GNSS) or CJN VOR/DME, it will have priority over other ARR or DEP ACFT.

DEPARTURE**Take-off Minima**

RWY		10/28		
Multi ENG	ft - m/km	0 - 500V	HJ only	REDL+RCLM
		0 - 800V	HN	By state permission
		0 - 800V	-	
		0 - 1.6V	-	
		0 - 3.0V	-	

Speed

MAX IAS 250KT below FL100 within airspace classes D and G.

ATC Slot, Clearance

The ACFT requesting taxiing permission first will have priority over other DEP ACFT.

Effective 16-AUG-2018

09-AUG-2018

Colombia Maicao Jorge Isaac

AGC

AFC


Jorge Isaac Maicao Colombia

AGC

AFC

LMA-SKLM

2-10

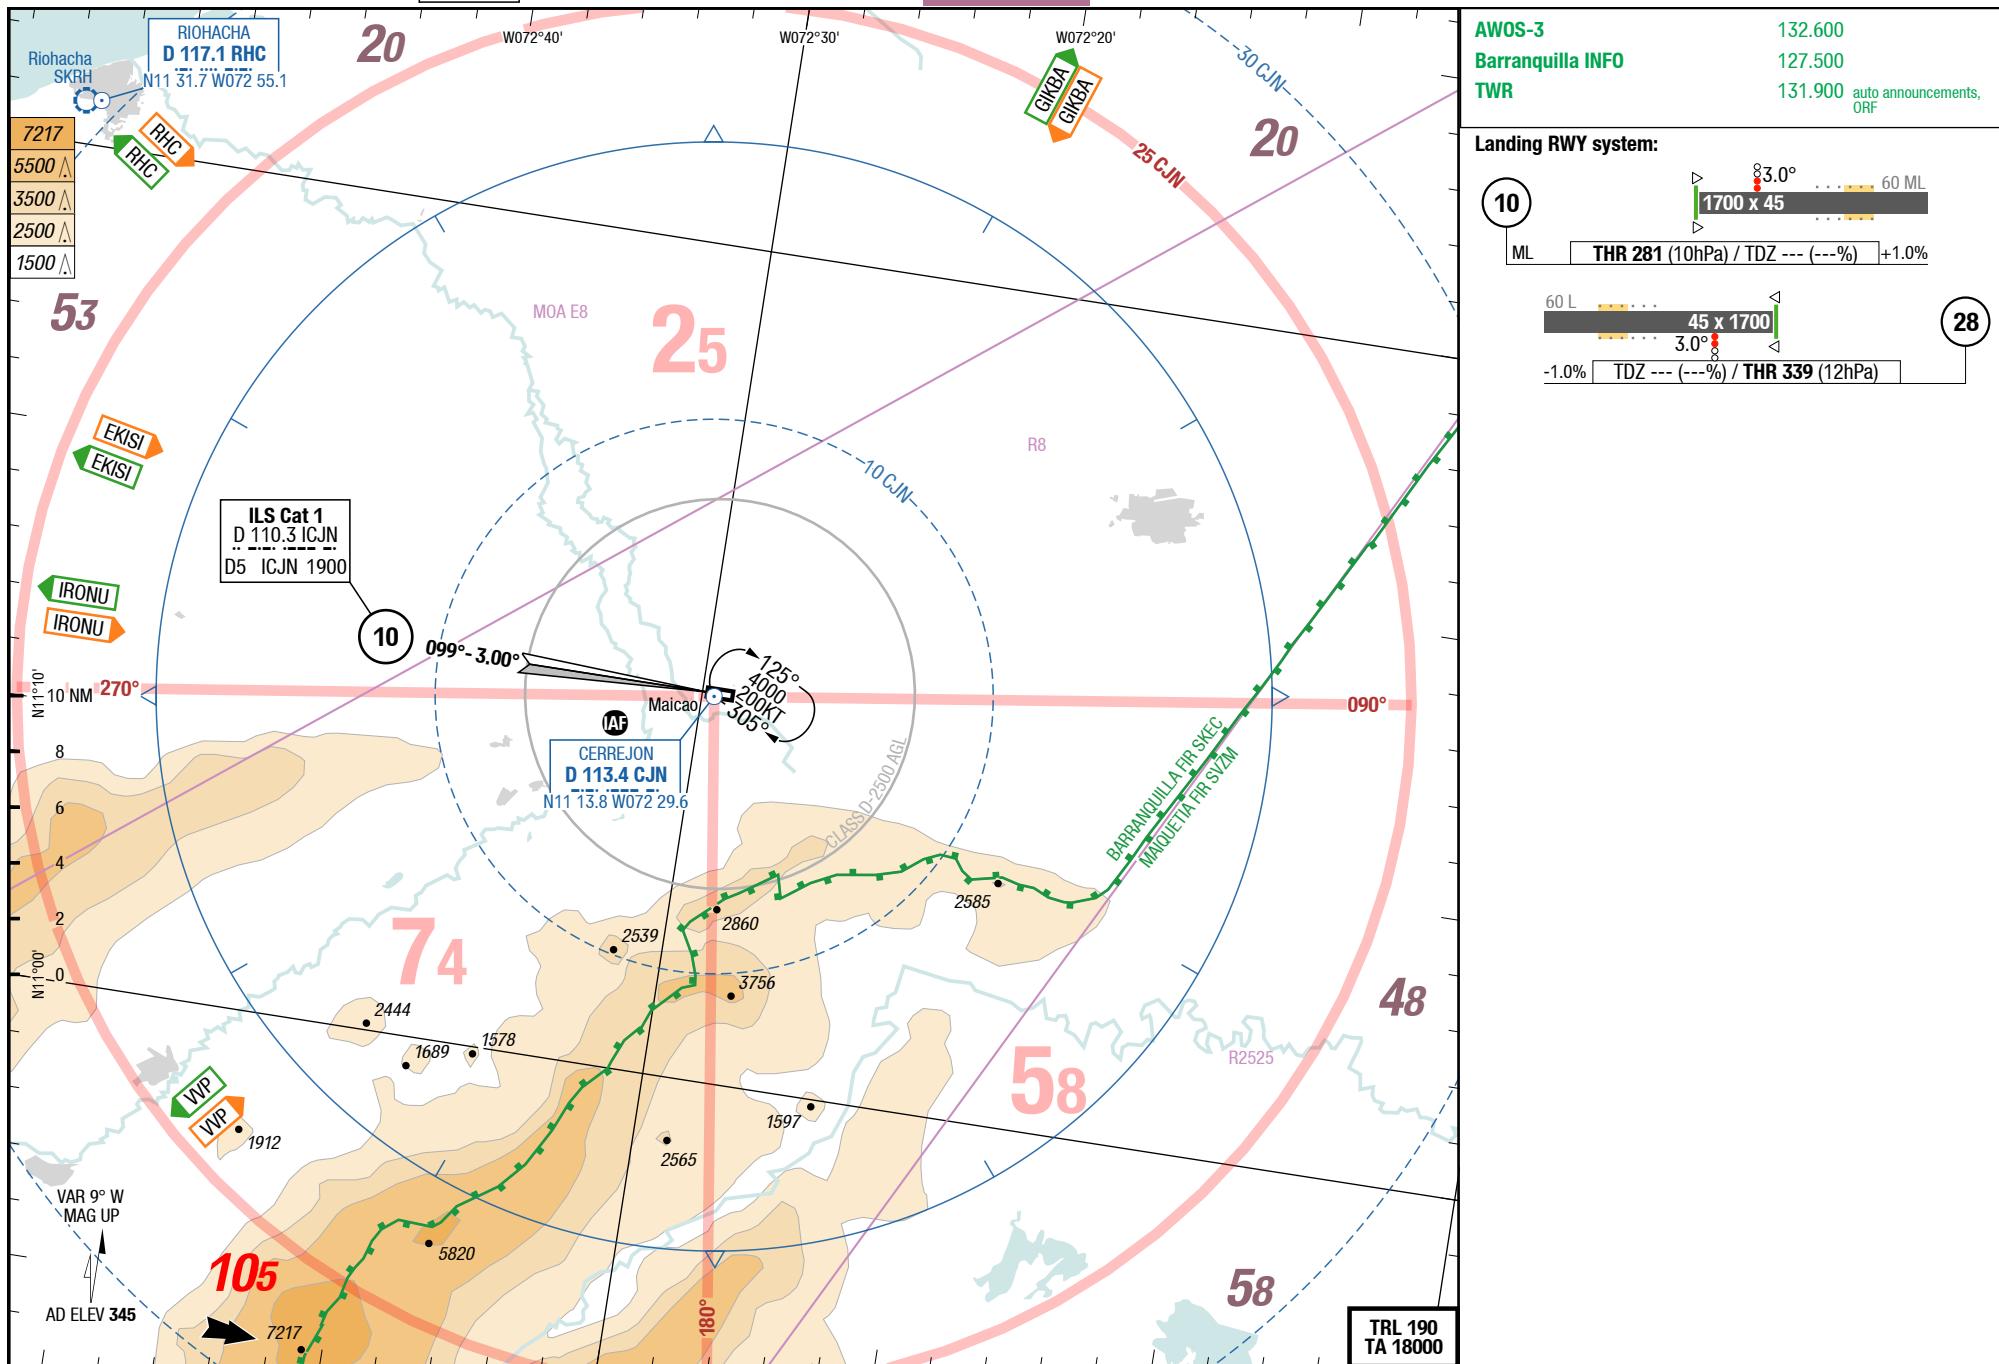

W072°30'

W072°29.5'

W072°29'

AWOS-3	132.600
Barranquilla INFO	127.500
TWR	131.900 auto announcements, ORF

(H) APRON

RWY	TORA	ASDA	TODA
10	1700	1800	2000

10
099°
281

1700 x 45


100

28
279°
339

ARP
N 11 14.0
W 072 29.4

CERREJON
D 113.4 CJN

VAR 0° W
MAG UP
AD ELEV 345

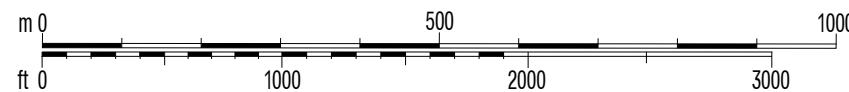

Effective 16-AUG-2018

09-AUG-2018

LMA-SKLM

Colombia **Maicao** Jorge Isaac

SIDs RWY 10

RNAV SIDs RWY 10

Jorge Isaac **Maicao** Colombia

SIDs RWY 10

RNAV SIDs RWY 10

Changes: PROC, chart layout, Note, Editorial

Effective 16-AUG-2018

09-AUG-2018

LMA-SKLM

Colombia Maicao Jorge Isaac

Jorge Isaac Maicao Colombia

4-20

SIDs RWY 10

8

8

SIDs RWY 10

Changes: chart layout, PROC, Editorial

LMA-SKLM

5-10

RNAV SIDs RWY 10

GIKBA 1C / RIOHACHA 1F / VALLEDUPAR 1E

RWY 10 (099°)

	GS	120	150	180	210	240	270
5.6%	ft/MIN	700	900	1100	1200	1400	1600

DESIGNATOR	ROUTING	ALTITUDES
	Runway 10	
GIKBA 1C 5.6% to LM022 127.500 ①	RW10 - LM003 - DCT LM022 - GIKBA	LM003 MNM 1200 LM022 MNM 5000
RIOHACHA 1F RHC 1F 5.6% to LM003 127.500 ①	RW10 - LM003 [L] - DCT LM019 - RHC	LM003 MNM 1200 LM019 MNM 5000
VALLEDUPAR 1E VVP 1E 5.6% to LM003 127.500 ①	RW10 - LM003 [L] - DCT LM038 - VVP	LM003 MNM 1200 LM038 MNM 8000

① CAT B/C only

LMA-SKLM

5-20

SIDs RWY 10

SIDPT

EKISI 1D / GIKBA 1B / IRONU 1B / RIOHACHA 1B

RWY 10 (099°)

	GS	120	150	180	210	240	270
5.6%	ft/MIN	700	900	1100	1200	1400	1600

DESIGNATOR	ROUTING	ALTITUDES
	Runway 10	
EKISI 1D 5.6% to MEA 127.500 ①	No procedure text published	R098/D7 CJN MNM 2500 EKISI MNM 5000
GIKBA 1B 5.6% to 5000 127.500 ①	No procedure text published	R098/D7 CJN MNM 2500
IRONU 1B 5.6% to MEA 127.500 ①	No procedure text published	R098/D7 CJN MNM 2500 IRONU MNM 11000
RIOHACHA 1B RHC 1B 5.6% to MEA 127.500 ①	No procedure text published	R098/D7 CJN MNM 2500

① CAT B/C only

Effective 16-AUG-2018
09-AUG-2018

Colombia Maicao Jorge Isaac

Jorge Isaac Maicao Colombia


LMA-SKLM


6-20 EKISI 1A / IRONU 1C / RHC 2A


STAR

STAR

EKISI 1A / IRONU 1C / RHC 2A

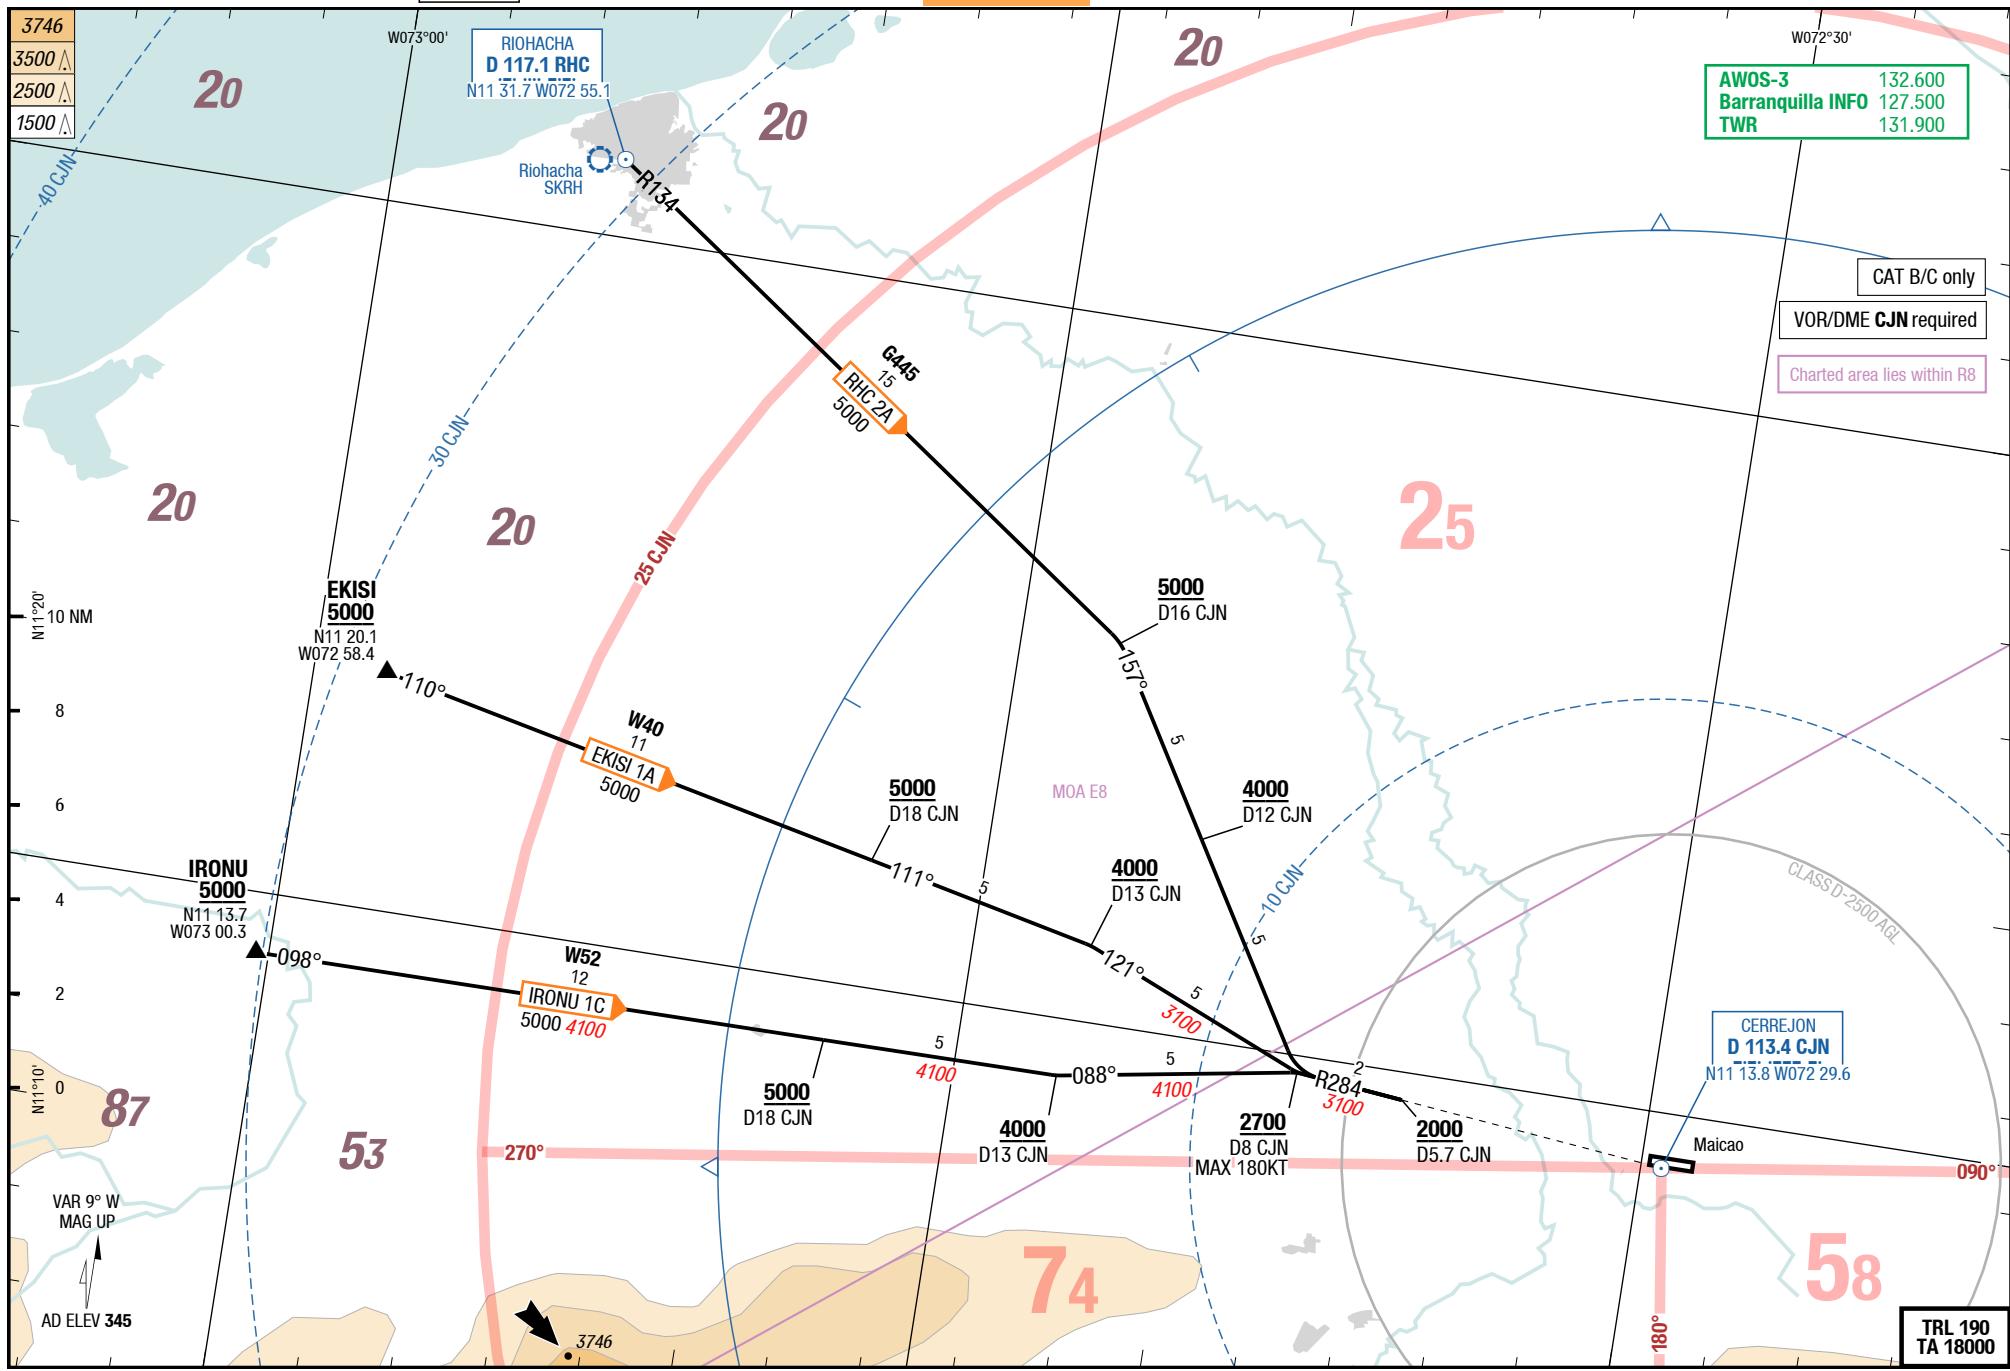

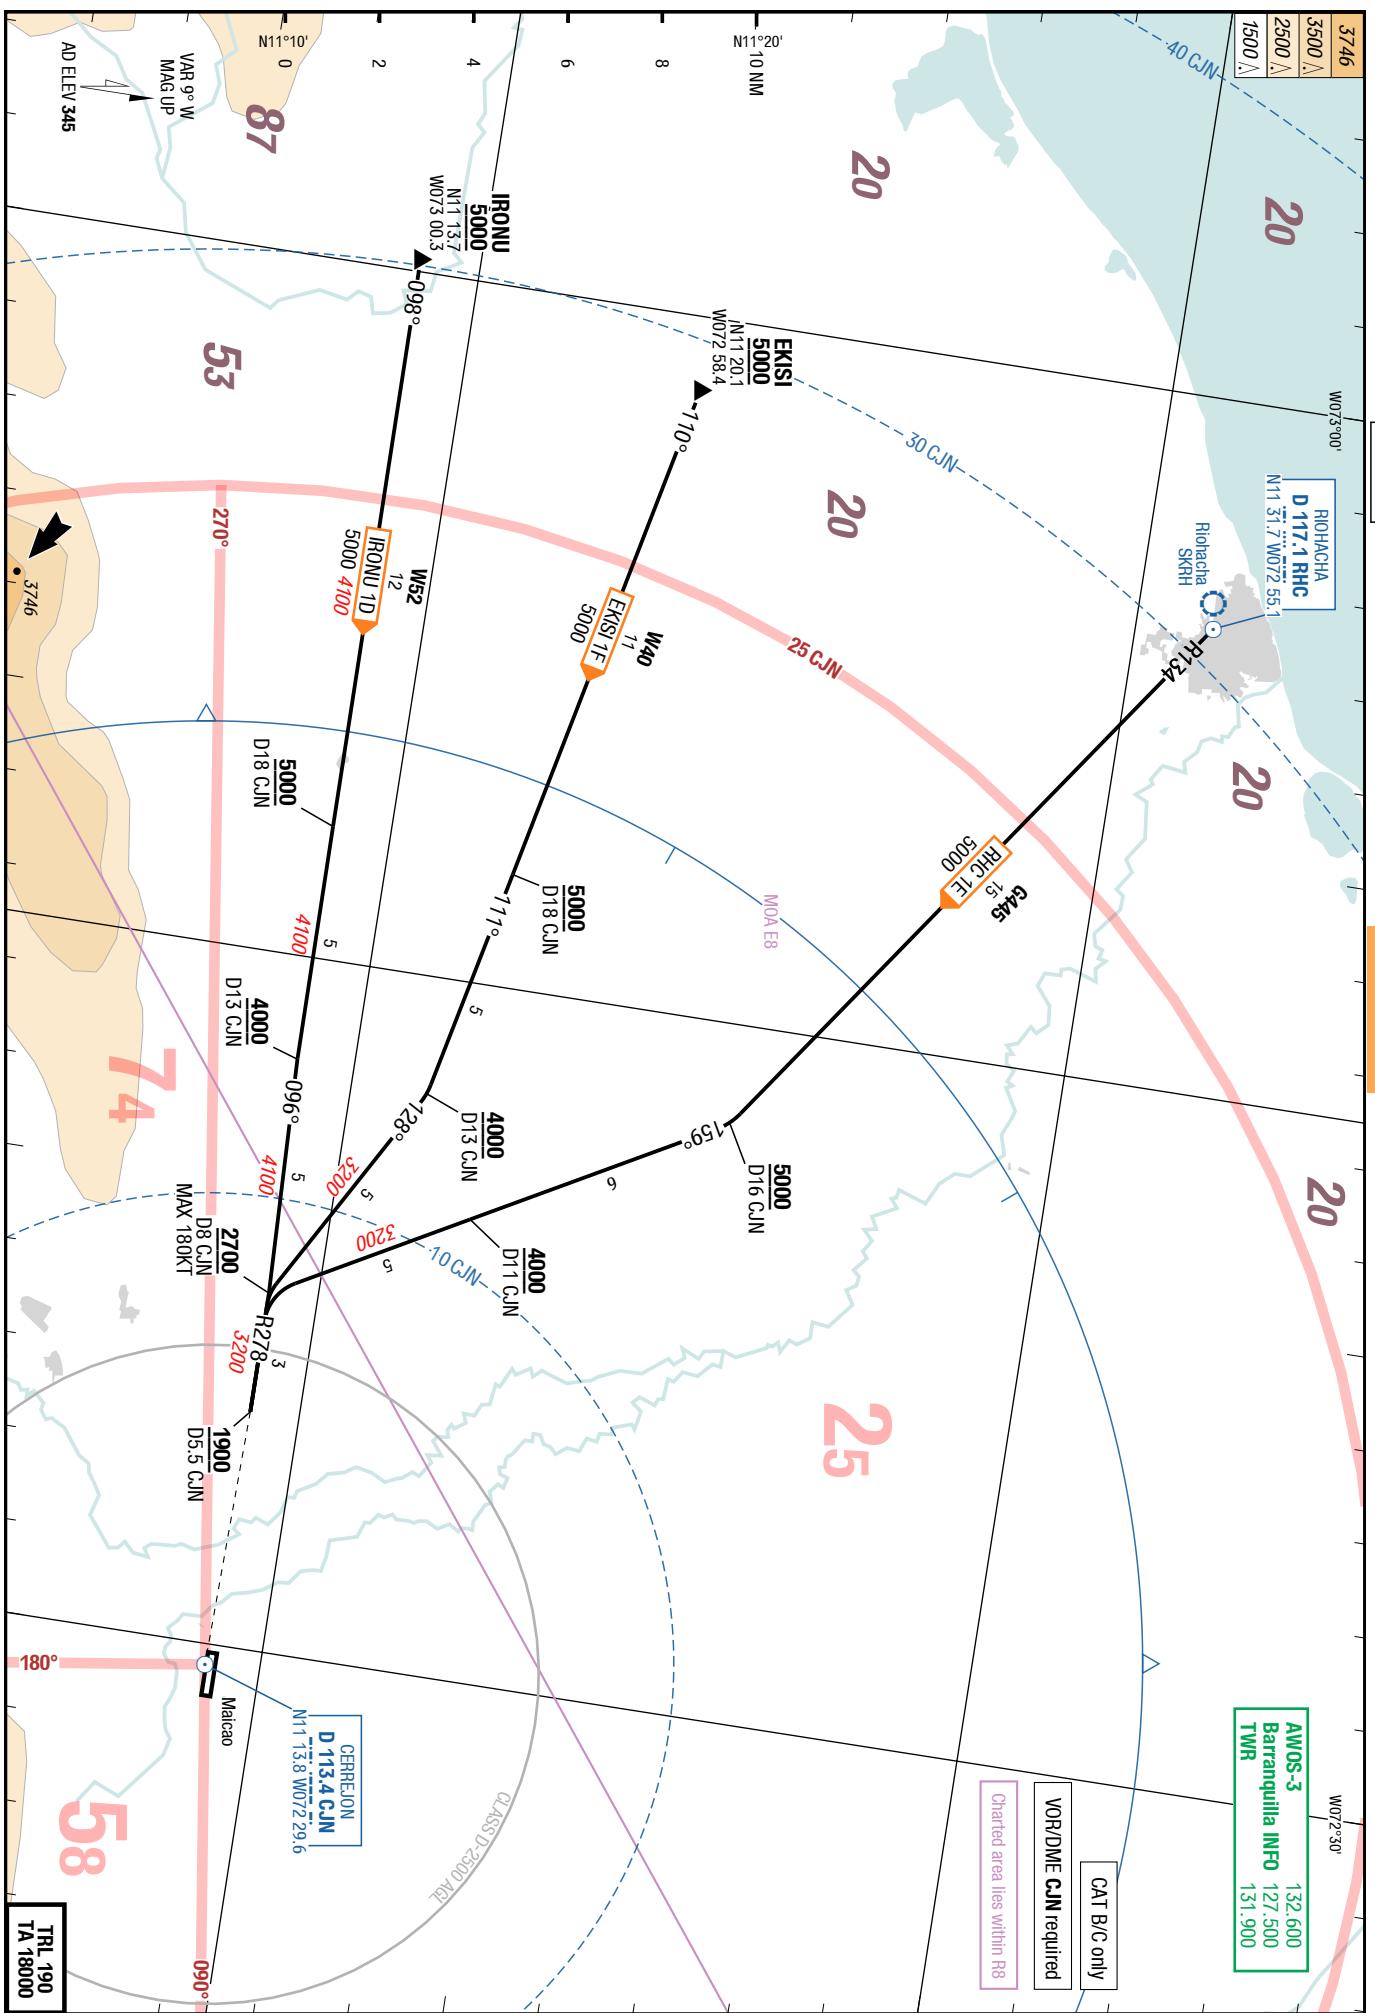

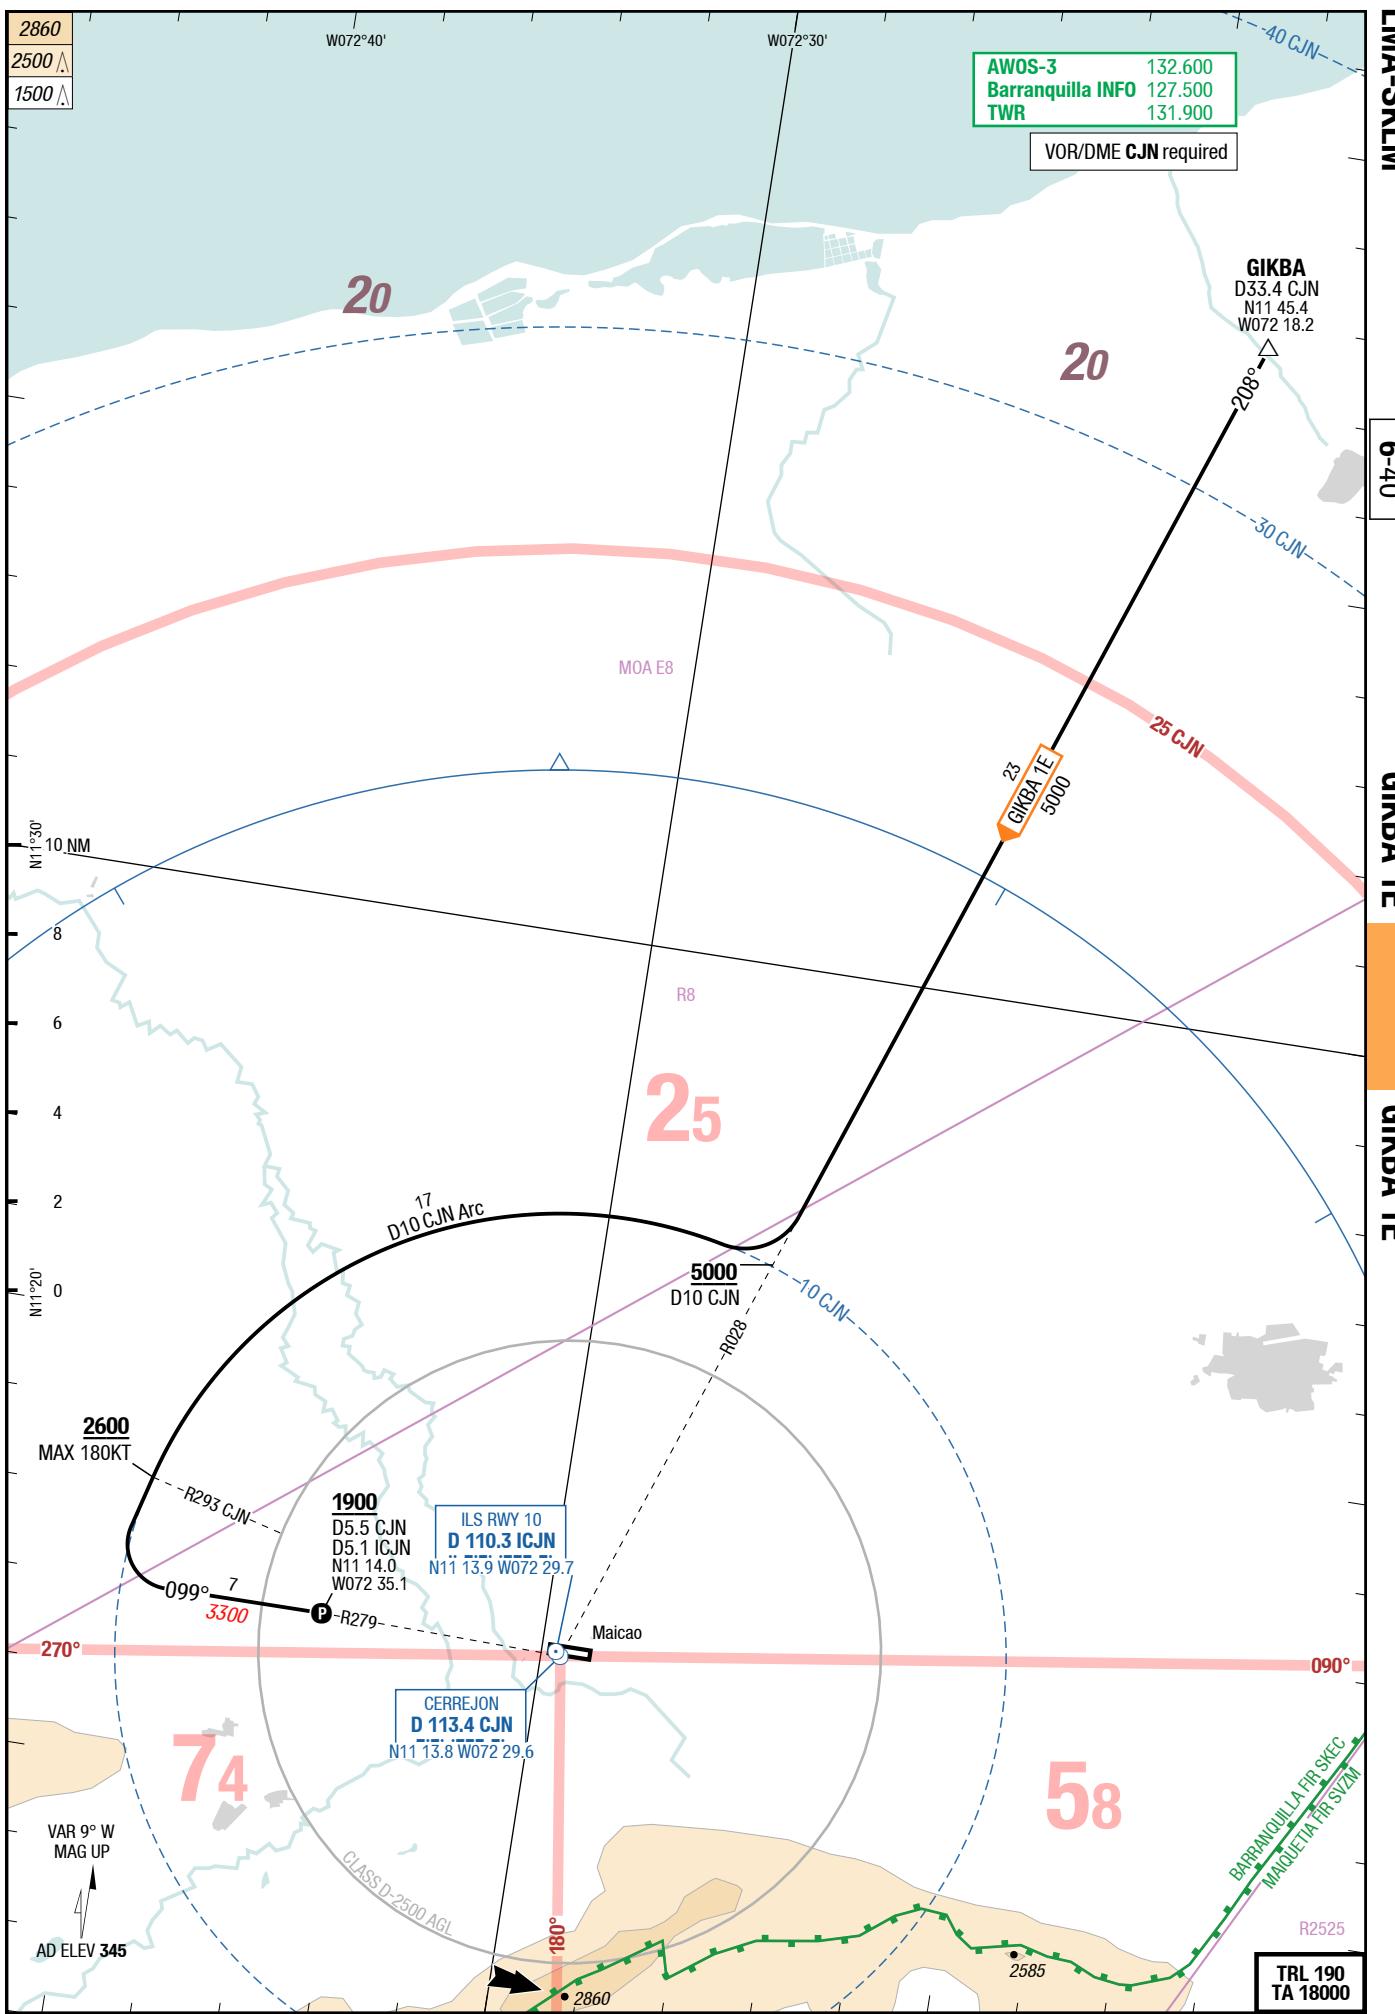

Effective 16-AUG-2018

09-AUG-2018

Colombia Maicao Jorge Isaac

Jorge Isaac Maicao Colombia

LMA-SKLM


6-50

WP 1F / 2C

STAR

STAR


Jorge Isaac **Malcao** Colombia
NIL
VVP 1F / 2C

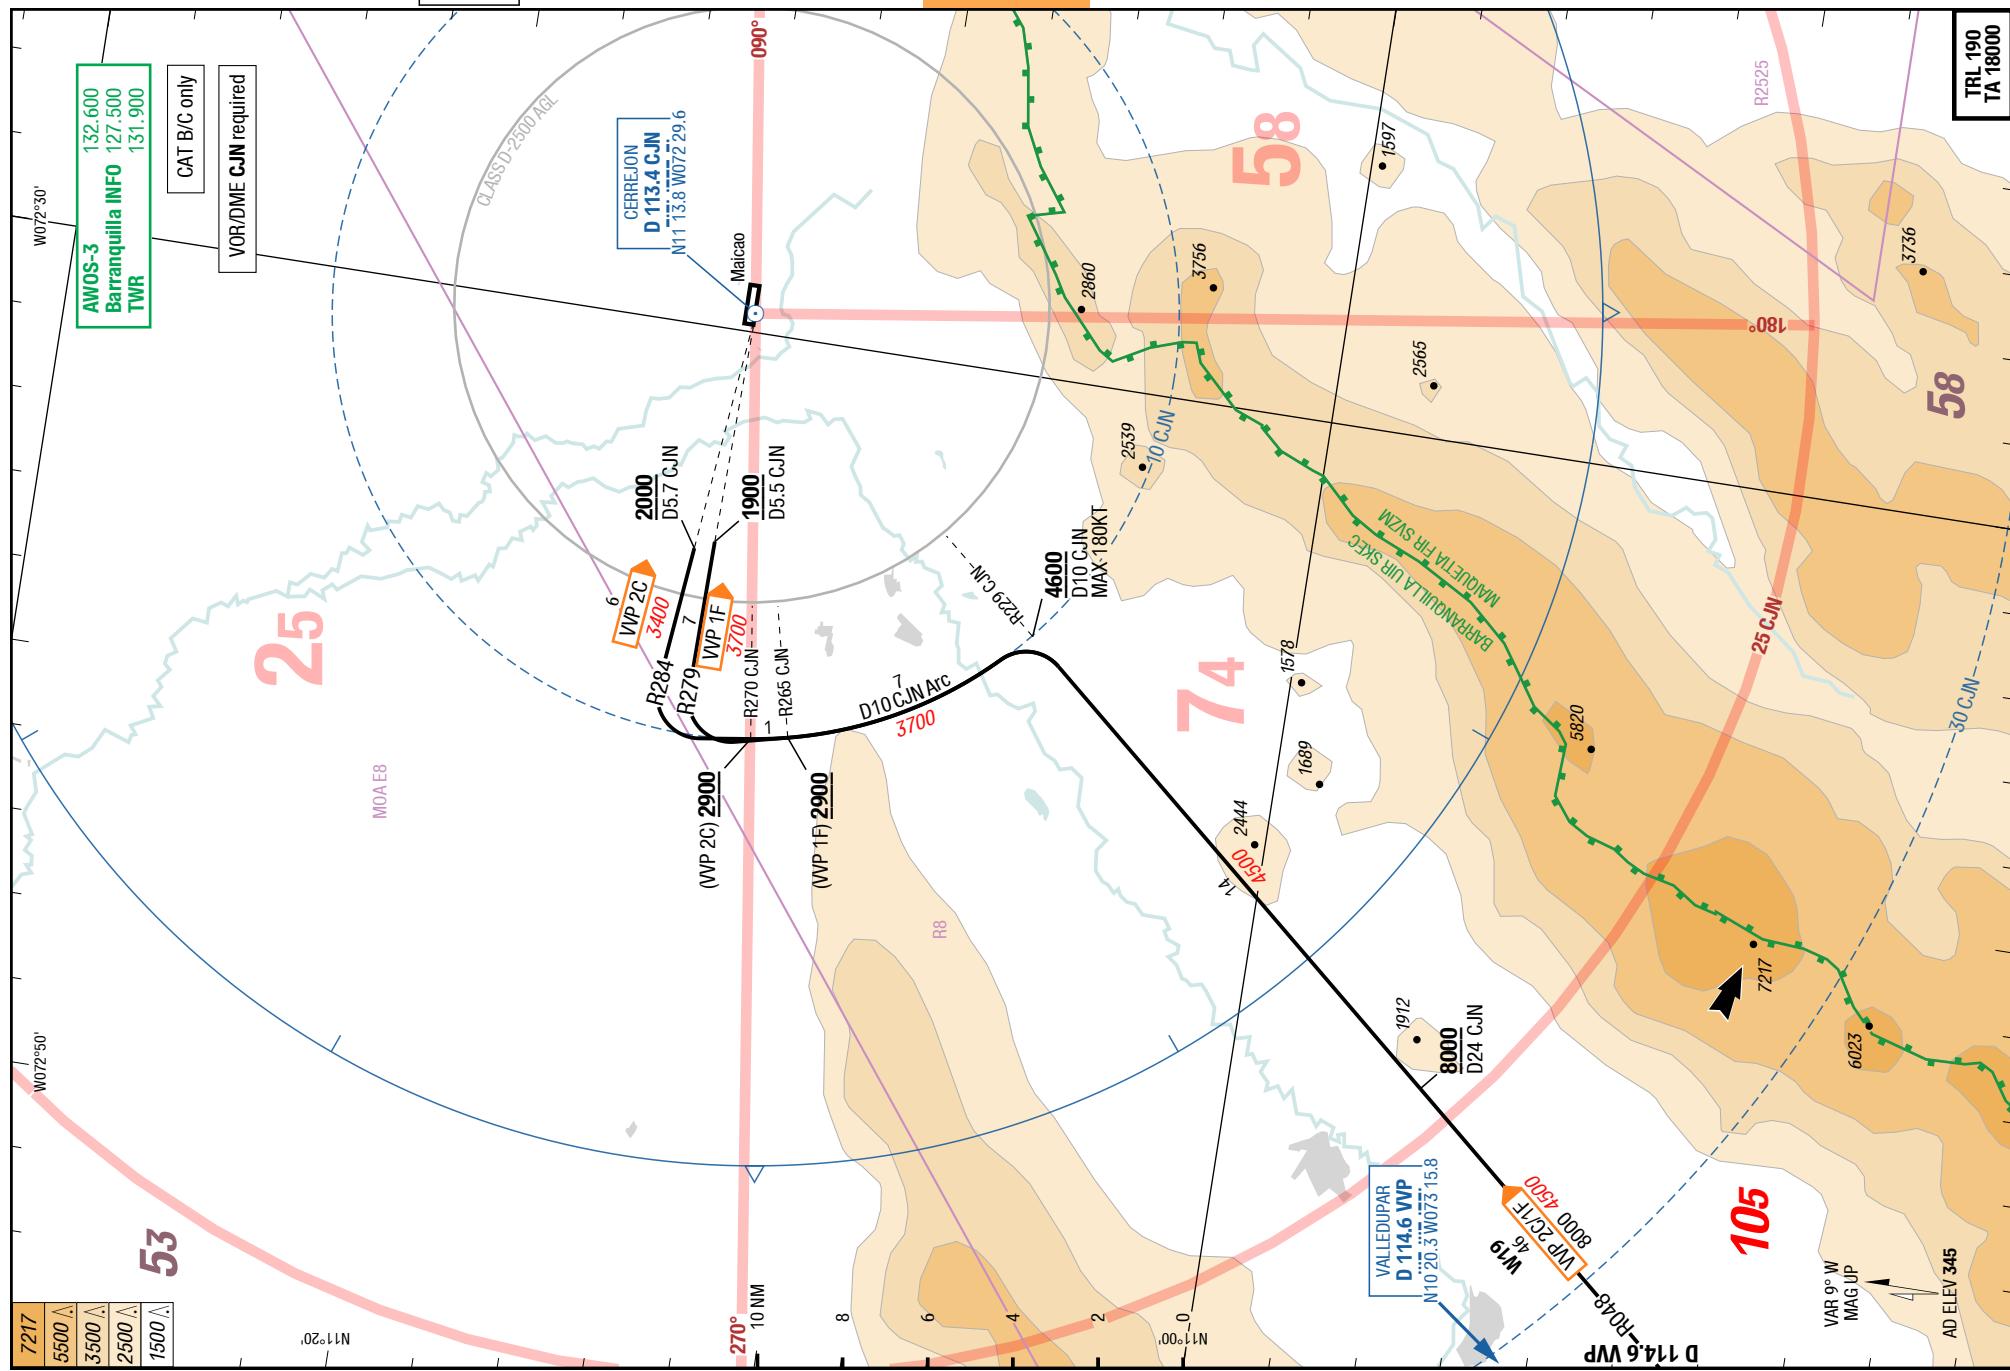

LMA-SKLM

7-10

ILS or LOC 10

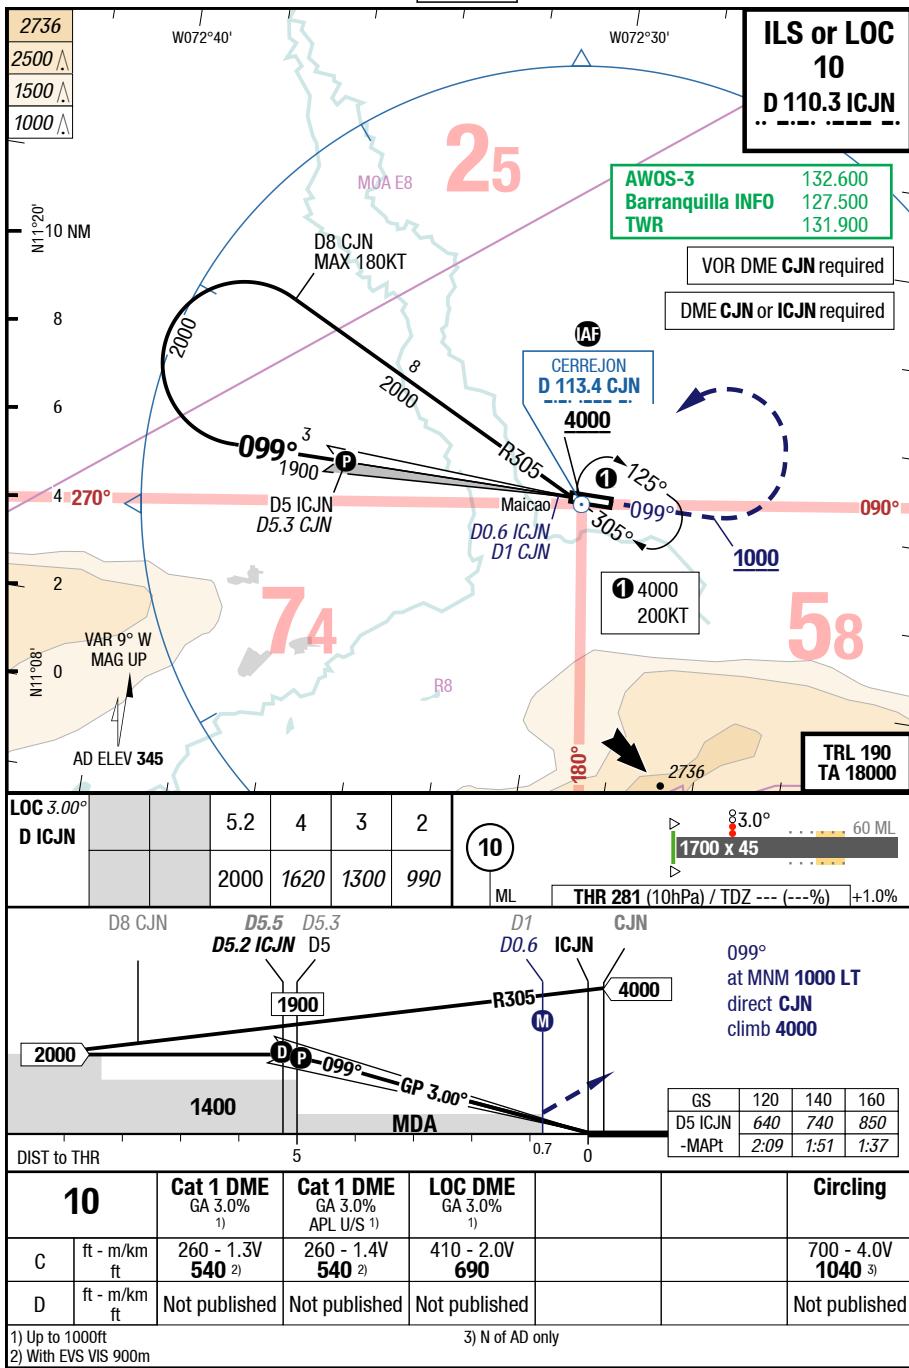


31-MAY-2018

LMA-SKLM

7-20

ILS Y 10

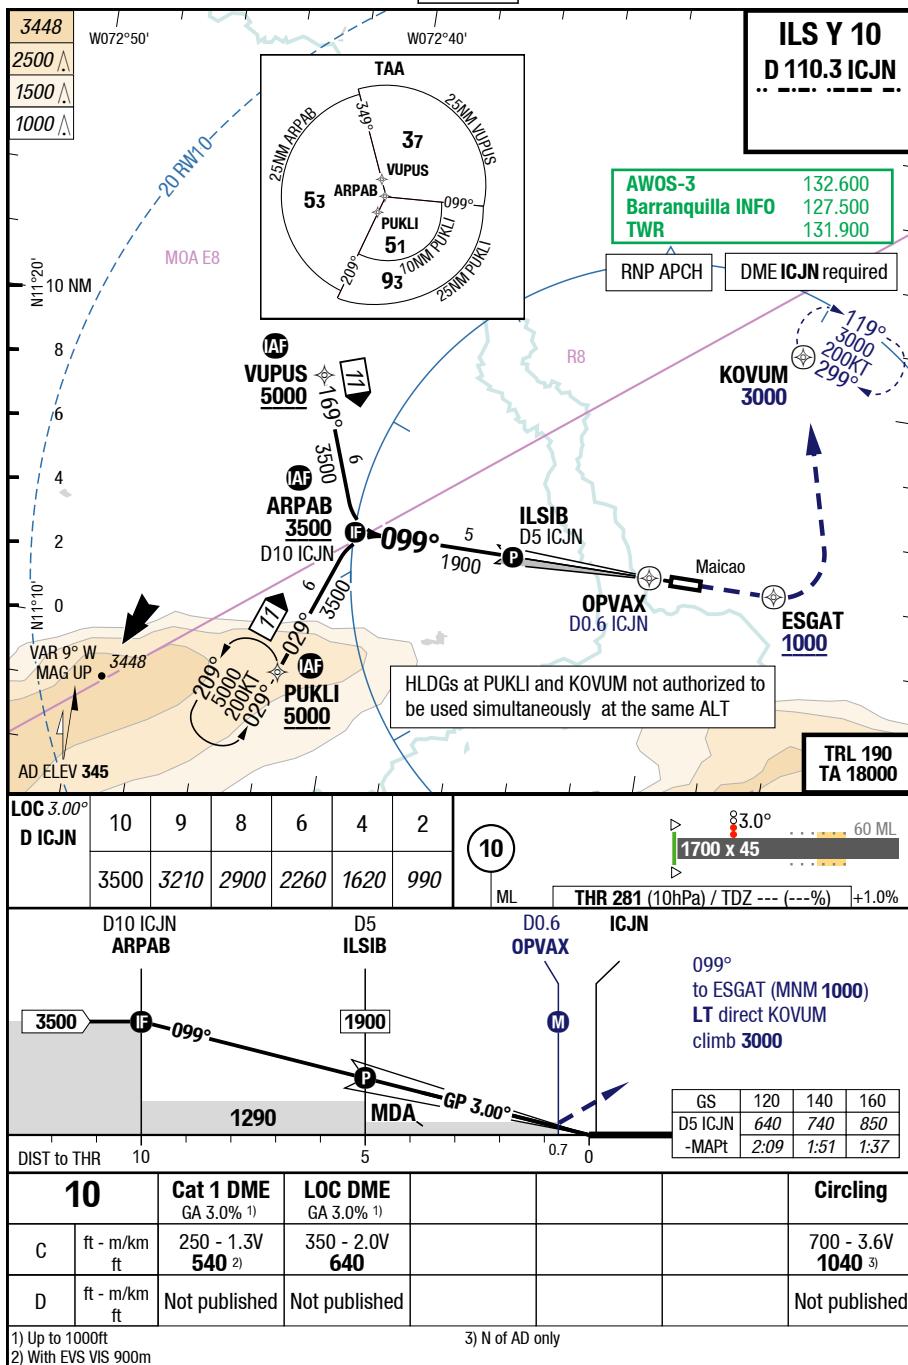


Changes: new

31-MAY-2018

LMA-SKLM

7-30

RNAV (GNSS) 10

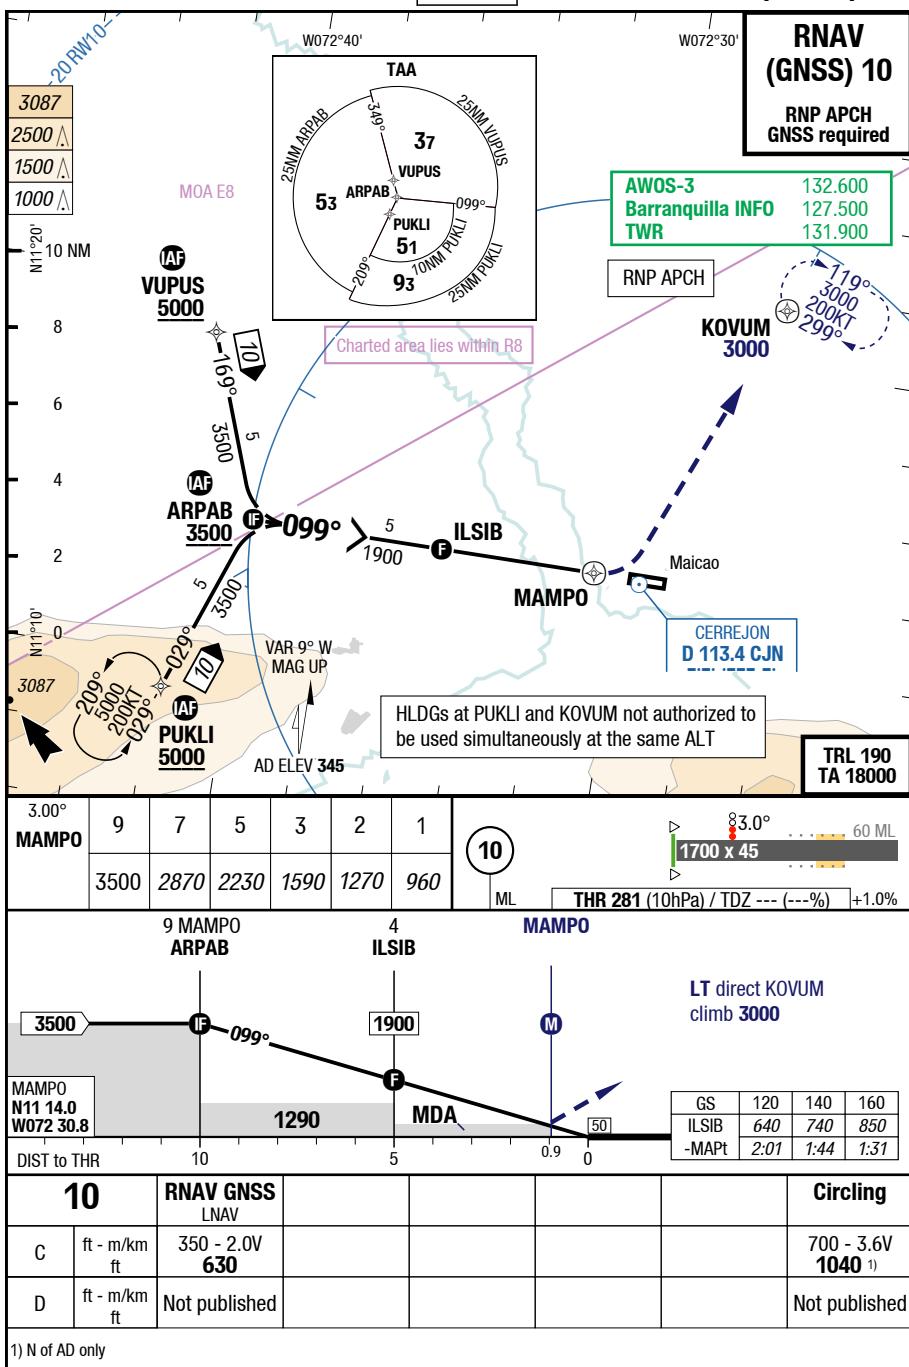

Changes: new

31-MAY-2018

Colombia Maicao Jorge Isaac

IAC

LMA-SKLM

7-50

VOR DME 10

