

26-NOV-2015

ZUM-CZUM**1-10****AOI****AOI****GENERAL****ATS Hours**

H24

Airport Information**RFF:** O/R**Fuel:** 1100-2000‡ MON-FRI; SAT, SUN and HOL O/R**PCN:** O/R**Customs:** Not published**Operation****Aerodrome Level of Service**

RWY 13/31: 1200R/0.25V

Warnings

Birds in vicinity of AD.

Occasional standing water on RWY.

Helicopter activity in vicinity of AD.

ARRIVAL**Speed**

MAX IAS 250KT below 10000ft.

MAX IAS 200KT below 3000ft AGL within 10NM of AD.

Communication**COM Failure:** See CRAR Canada**DEPARTURE****Take-off Minima**

RWY		13/31
All ACFT	ft - ft/SM	0 - 0.5V


Communication**COM Failure:** See CRAR Canada

26-NOV-2015

ZUM-CZUM**2-10**

Canada Churchill Falls
AFC **AFC** **AFC** **AFC**

Churchill Falls Canada
AFC

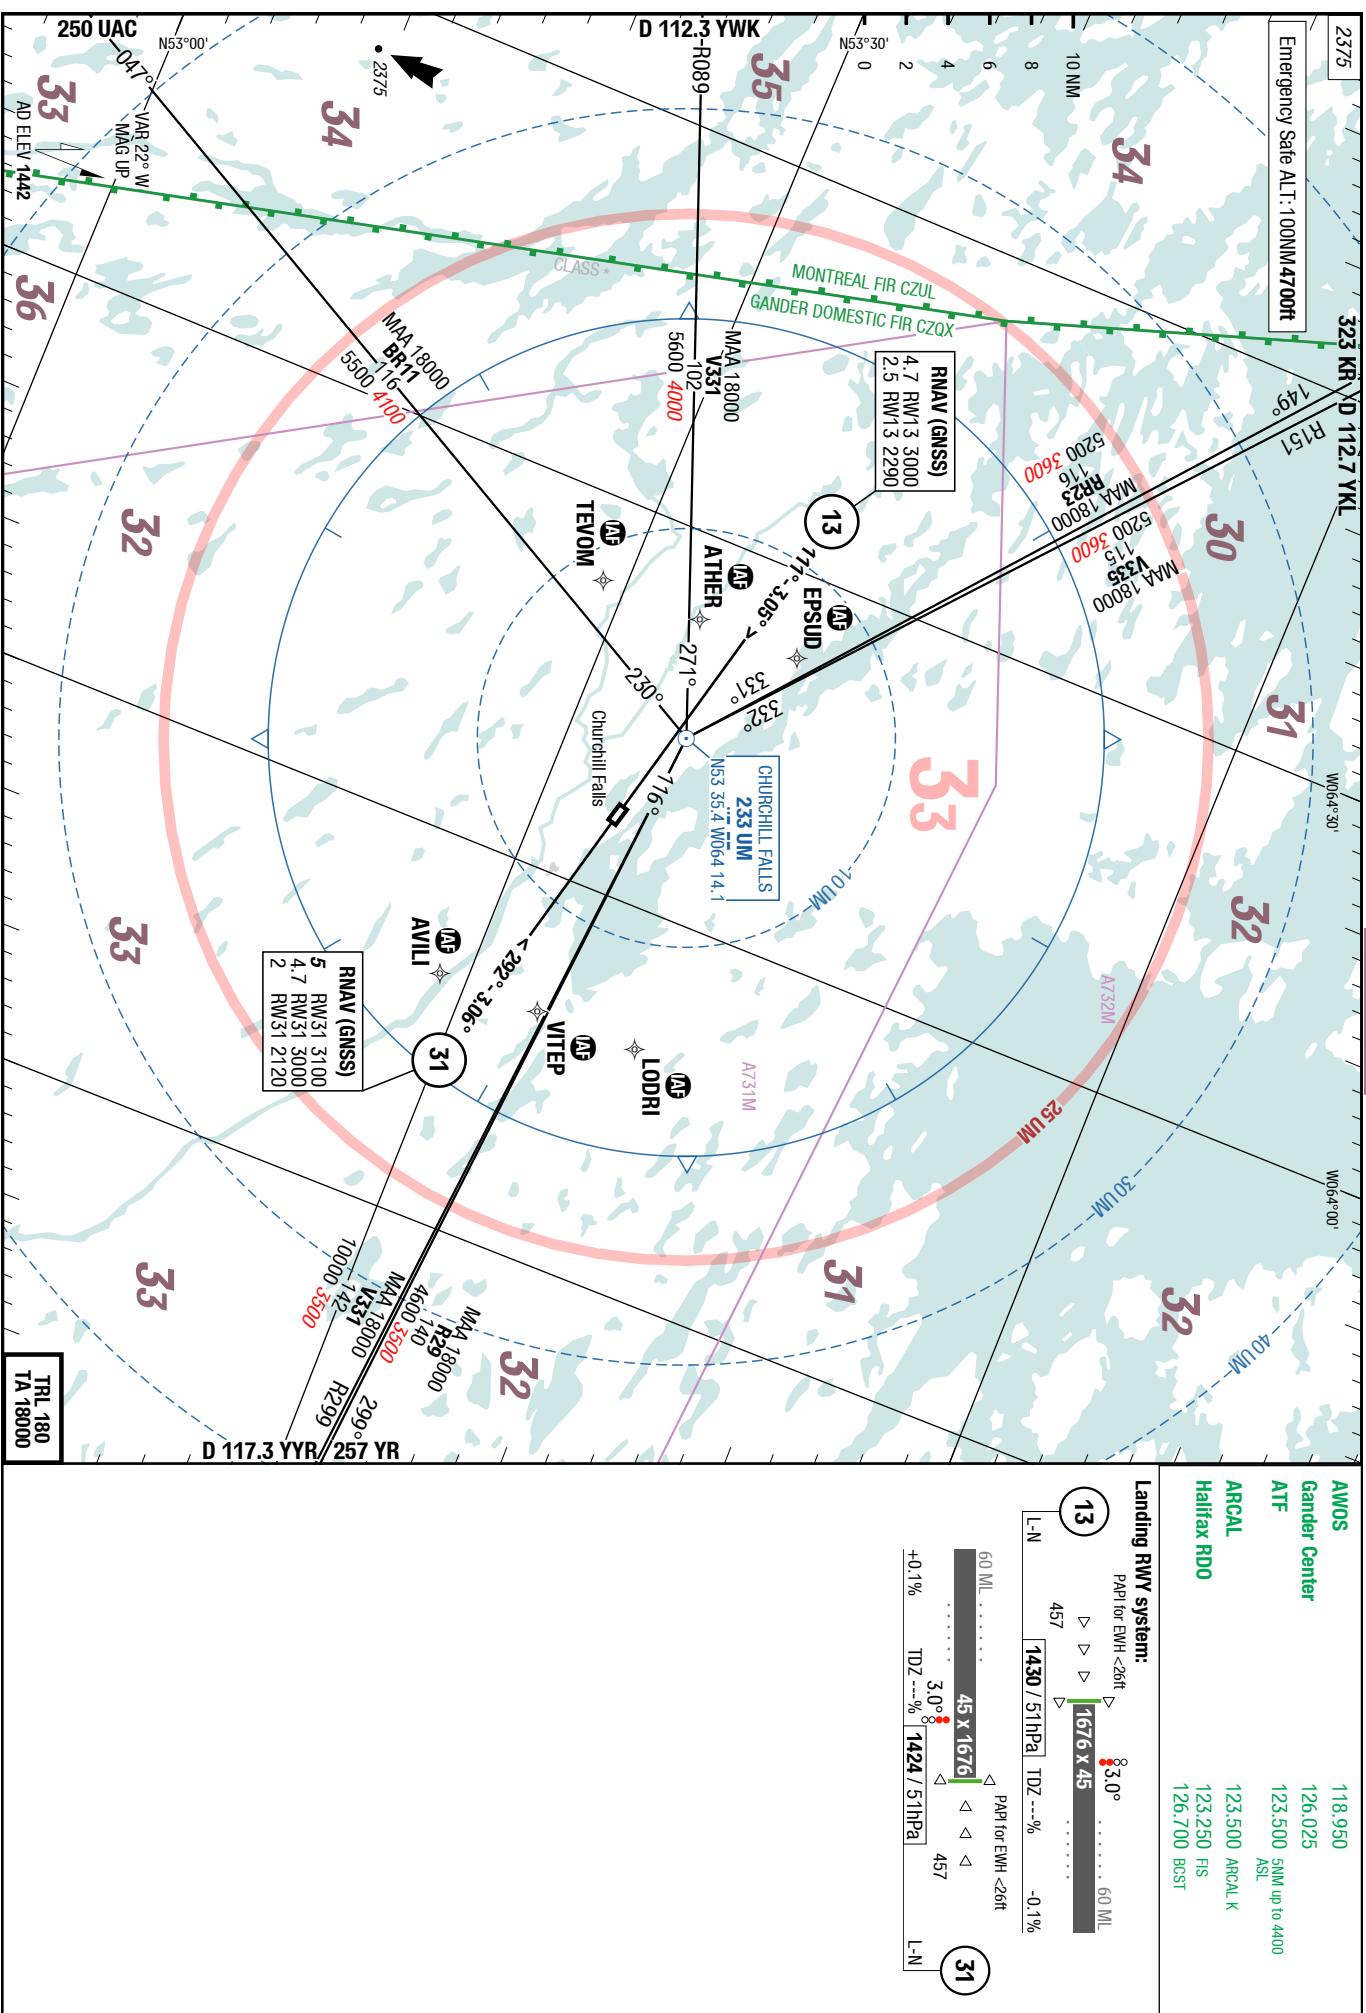

26-NOV-2015

ZUM-CZUM

3-20

Canada Churchill Falls

AGC

AGC
AGC

Churchill Falls Canada

AGC

AWOS	118.950
ATF	123.500 5NM up to 4400 ASL
ARCAL	123.500 ARCAL K
Halifax RDO	123.250 FIS 126.700 BCST

W064° 07'

W064° 06,5'

Changes: FREQ, HLDG POS

13

126°
1430

1676 x 45

ARP
N 53 33.8
W 064 06.4

31

306
1424

APRON

VAR 22° W
MAG UP
AD ELEV 1442



53° 33' N

26-NOV-2015

ZUM-CZUM**5-10****DEPARTUREs**

SIDPT

DEPARTUREs


RWY	Notes
13	Trees up to 1539ft MSL abeam DER, both left and right of centerline.
31	Power lines up to 1536ft MSL, APPROX 0.1NM from DER, 600ft left of centerline. Trees up to 1567ft MSL abeam DER, both left and right of centerline.

26-NOV-2015

ZUM-CZUM

7-10

RNAV (GNSS) 13

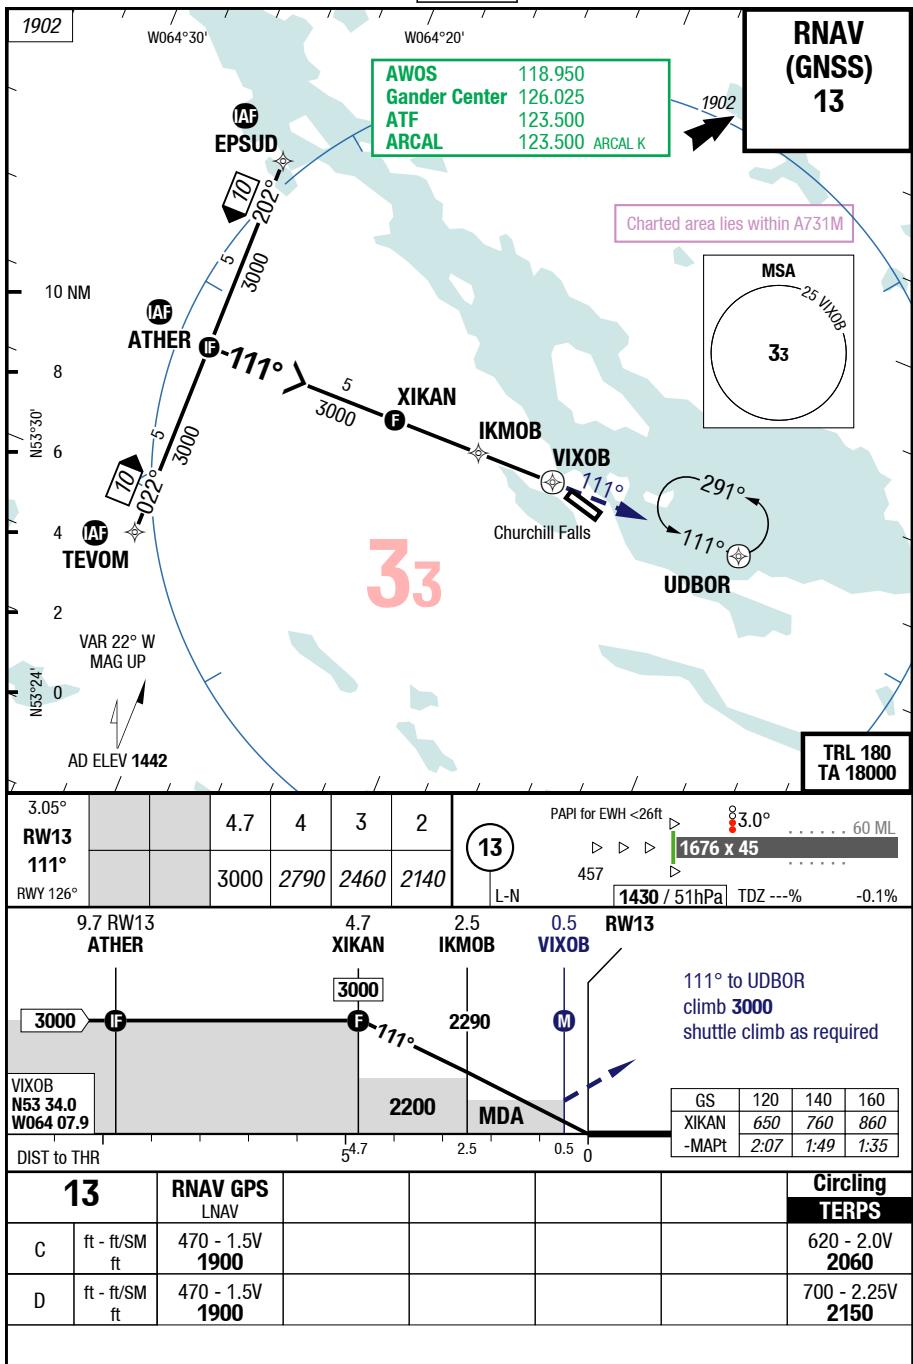

Changes: new


26-NOV-2015

ZUM-CZUM

7-20

RNAV (GNSS) 31

IAC

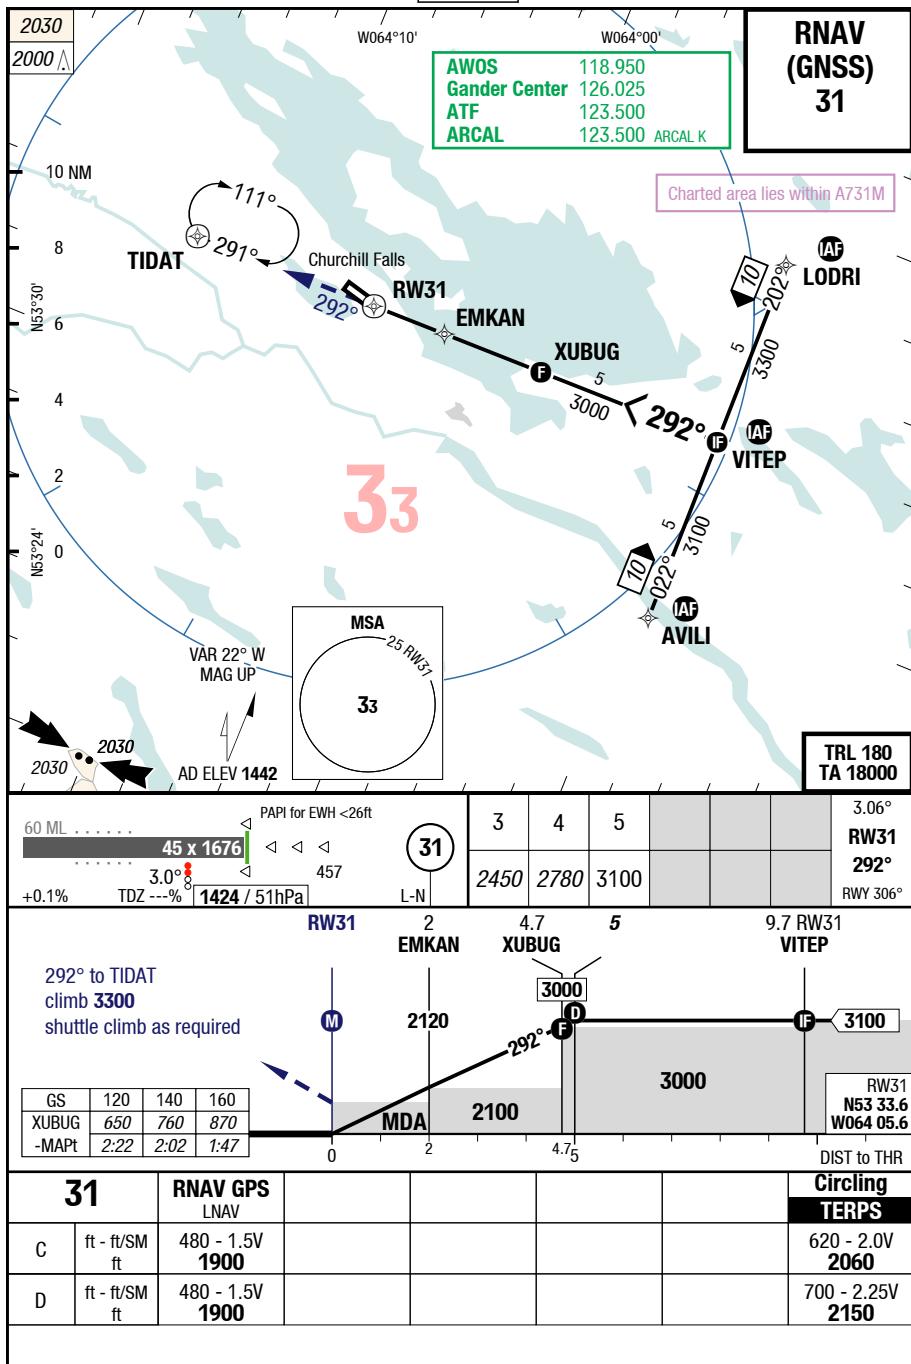

Changes: new

Canada Churchill Falls


IAC

26-NOV-2015

ZUM-CZUM

7-30

NDB 13

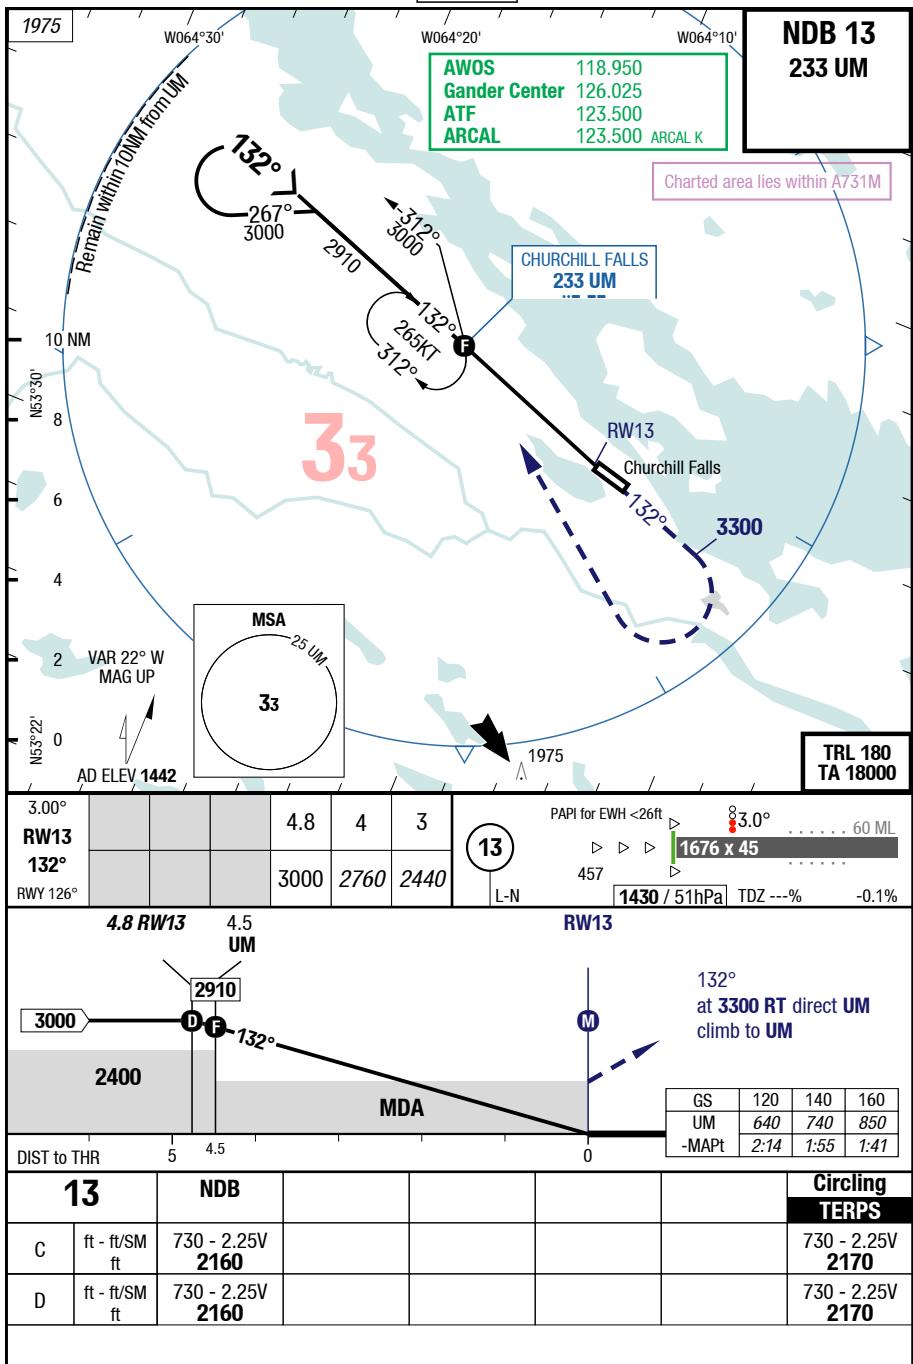

Changes: new