

31-MAY-2018

SRZ-SLET

1-10

AOI

AOI

GENERAL**Operational Hours****ATS Hours / AD ADMIN Hours:** HJ**Airport Information****RFF:** CAT 7**PCN:** RWY 15/33: 48/F/C/X/U**Customs:** Not AVBL**ARRIVAL****Speed**

MAX IAS 250KT below FL100 within airspace classes D, E and G.

DEPARTURE**Take-off Minima**

RWY		15/33	
A, B, C	ft - m/km	0 - 400V	HJ only
D		Not applicable	-

Speed

MAX IAS 250KT below FL100 within airspace classes D, E and G.

De-Icing


Not AVBL

24-MAY-2018

SRZ-SLET

Bolivia Santa Cruz El Trompillo
AFC  **AFC** **AFC**

AFC  El Trompillo Santa Cruz Bolivia

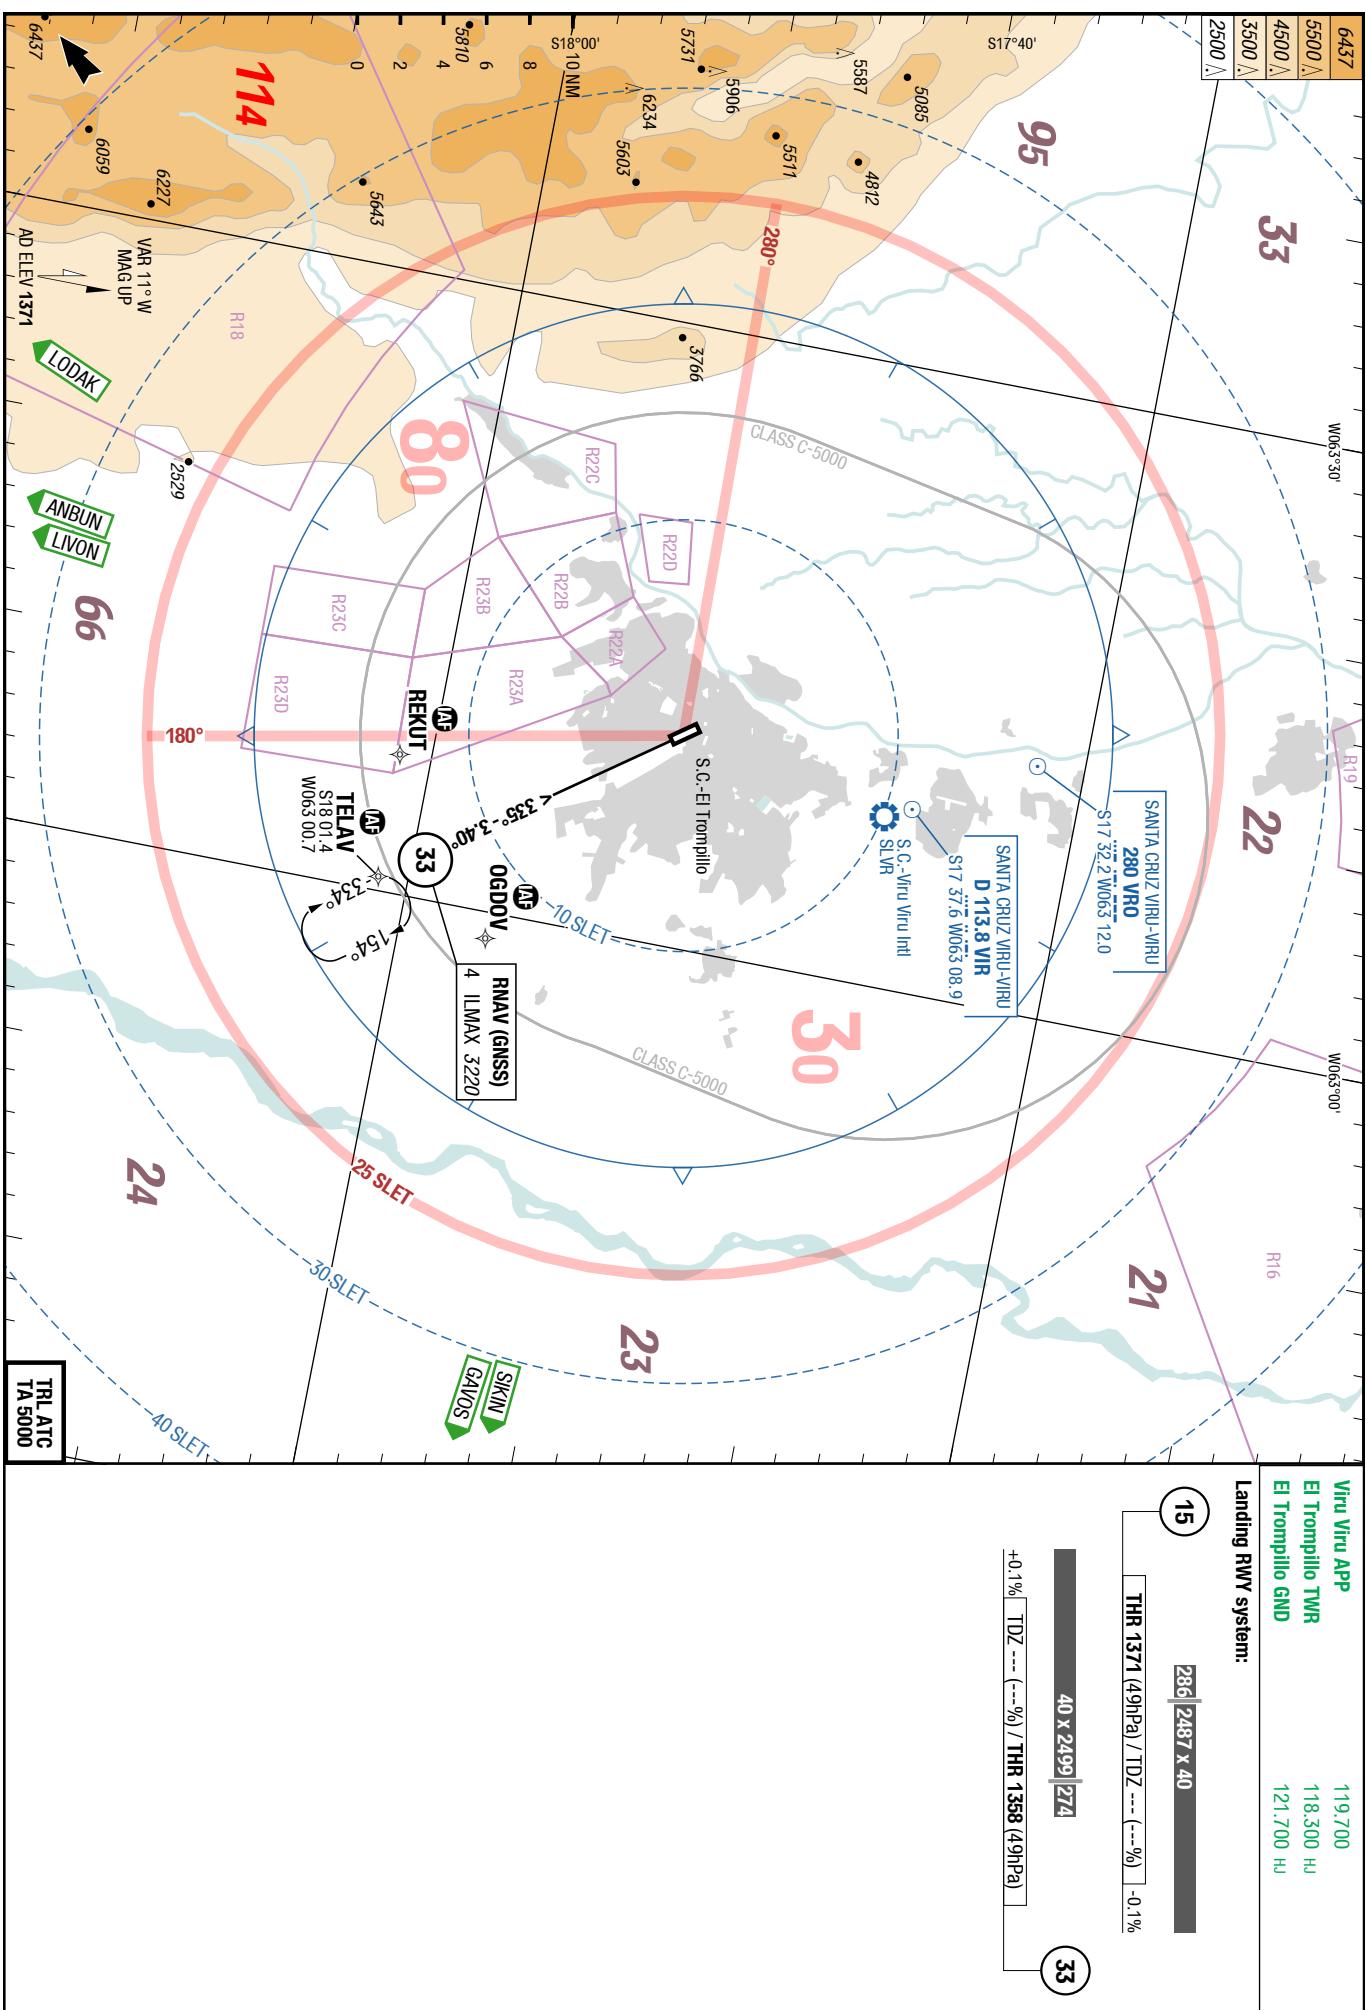

24-MAY-2018

SRZ-SLET

Bolivia Santa Cruz El Trompillo
AGC AGC
AGC AGC
AGC AGC

El Trompillo Santa Cruz Bolivia**3-20**

W063°10'

W063°10.5'

Changes: new

El Trompillo TWR	118.300 HZ
El Trompillo GND	121.700 HZ

Caution:
 No official airport graphic available.
 Chart contents are based on the best available information.
 NOTAMs may not be available.
 Use at your own discretion.

2713 X 40

ARP
 S 17 48.7
 W 063 10.2



RWY	TORA	ASDA	TODA
33	2773	2833	2773

VAR 11° W
 MAG UP
 AD ELEV 1371

m 0 250 500
 ft 0 500 1000 1500

33
 335°
 1358

24-MAY-2018

SRZ-SLET


Bolivia Santa Cruz El Trompillo

10

SIDs

El Trompillo **Santa Cruz Bolivia**

SIDs

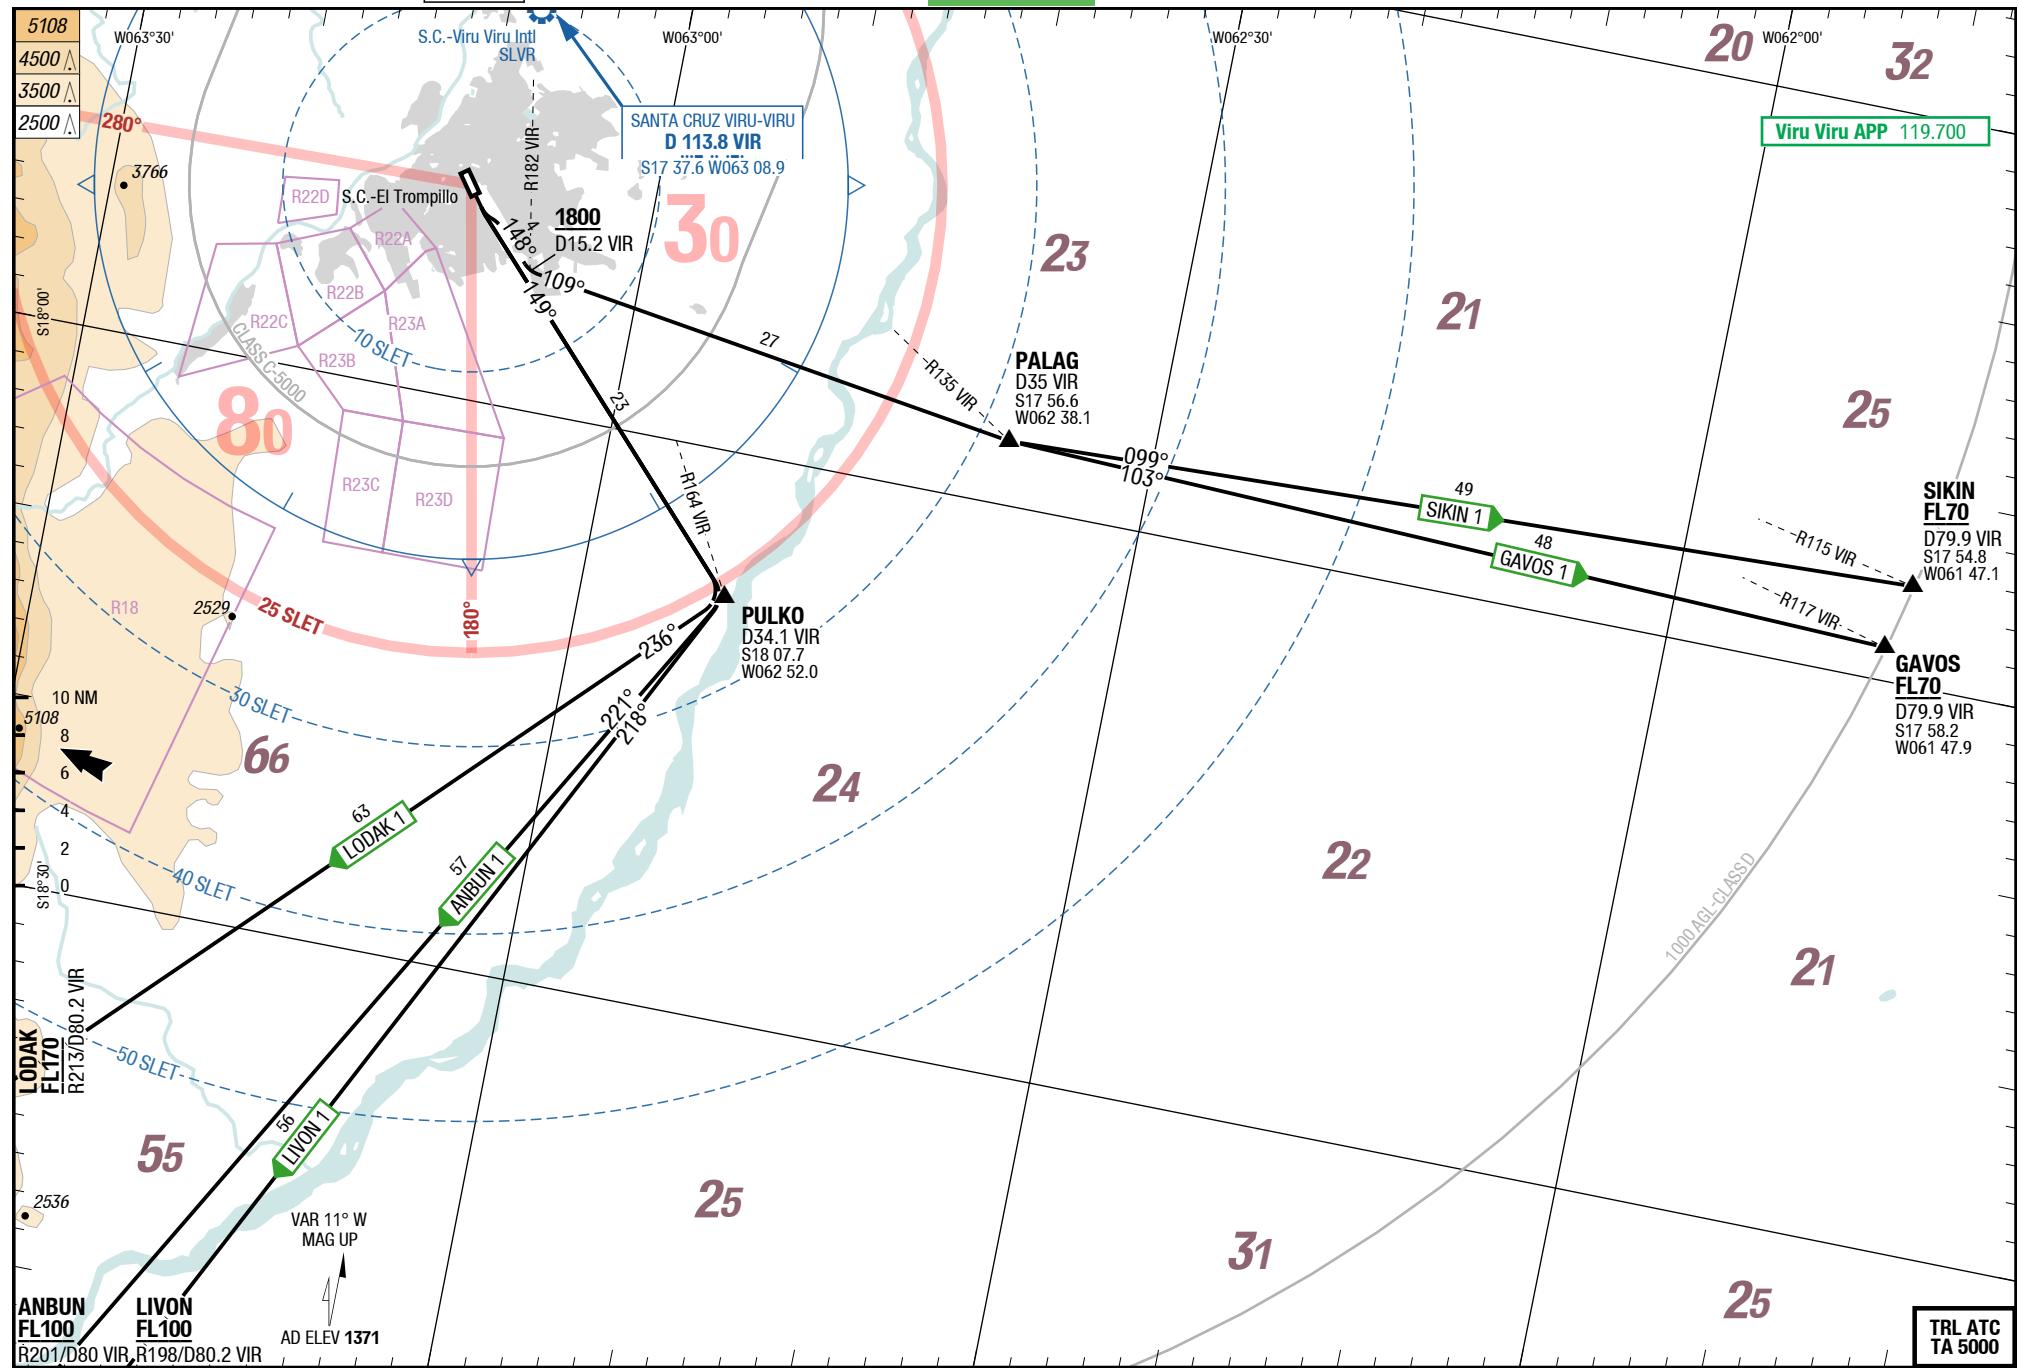

24-MAY-2018

SRZ-SLET**5-10****SIDs****ANBUN 1 / GAVOS 1 / LIVON 1 / LODAK 1 / SIKIN 1**

RWY 15 (155°)

DESIGNATOR	ROUTING	ALTITUDES
Runway 15		
ANBUN 1 119.700	LT 149° - at PULK0 RT 221° to ANBUN	ANBUN MNM FL100
GAVOS 1 119.700	LT 148° - at R182/D15.2 VIR LT 109° to PALAG - LT 103° to GAVOS	R182/D15.2 VIR MNM 1800 GAVOS MNM FL70
LIVON 1 119.700	LT 149° - at PULK0 RT 218° to LIVON	LIVON MNM FL100
LODAK 1 119.700	LT 149° - at PULK0 RT 236° to LODAK	LODAK MNM FL170
SIKIN 1 119.700	LT 148° - at R182/D15.2 VIR LT 109° to PALAG - LT 099° to SIKIN	R182/D15.2 VIR MNM 1800 SIKIN MNM FL70

24-MAY-2018

Bolivia Santa Cruz El Trompillo

SRZ-SLET

7-10

RNAV (GNSS) Z 33

IAC

