

05-APR-2018

NQN-SAZN**1-10****AOI****AOI****GENERAL****Operational Hours****ATS Hours:** H24**AD ADMIN Hours:** 1100-1700, working days only**Airport Information****RFF:** CAT 7**PCN:** RWY 09/27: 40/F/B/W/T**Customs:** O/R**Operation****Taxi/Parking**

Taxi at reduced speed and strictly follow TWY CL.

Taxi into/out of stands under own PWR with marshalling assistance, unless otherwise indicated by ATC.

Engine Run-up

Engine tests not allowed BTN 0100-1100.

Warnings

Birds and wildlife in vicinity of AD.

ARRIVAL**Speed**

MAX IAS 250KT below FL100 within airspace classes B, C, D and G.

Communication**COM Failure:** See CRAR.**Arrival Procedure****Non-standard GP Intercept Position on RWY 09**

GP intercepts RWY 09 at 320m / 1049ft after landing threshold.

Remaining DIST beyond GP is 2250m / 7383ft.

DEPARTURE**Take-off Minima**

RWY		09/27		
Multi ENG	ft - m/km	0 - 550V	HJ only	For conditions check CRAR
		0 - 800V	HN	

Speed

MAX IAS 250KT below FL100 within airspace classes B, C, D and G.

Communication**COM Failure:** See CRAR.**Departure Procedure****Noise Abatement Procedure:** Use TKOF PROC B.

29-MAR-2018


Argentina Neuquen Presidente Peron

AGC
AFC

Presidente Peron Neuquen Argentina

AGC
AFC

2-10

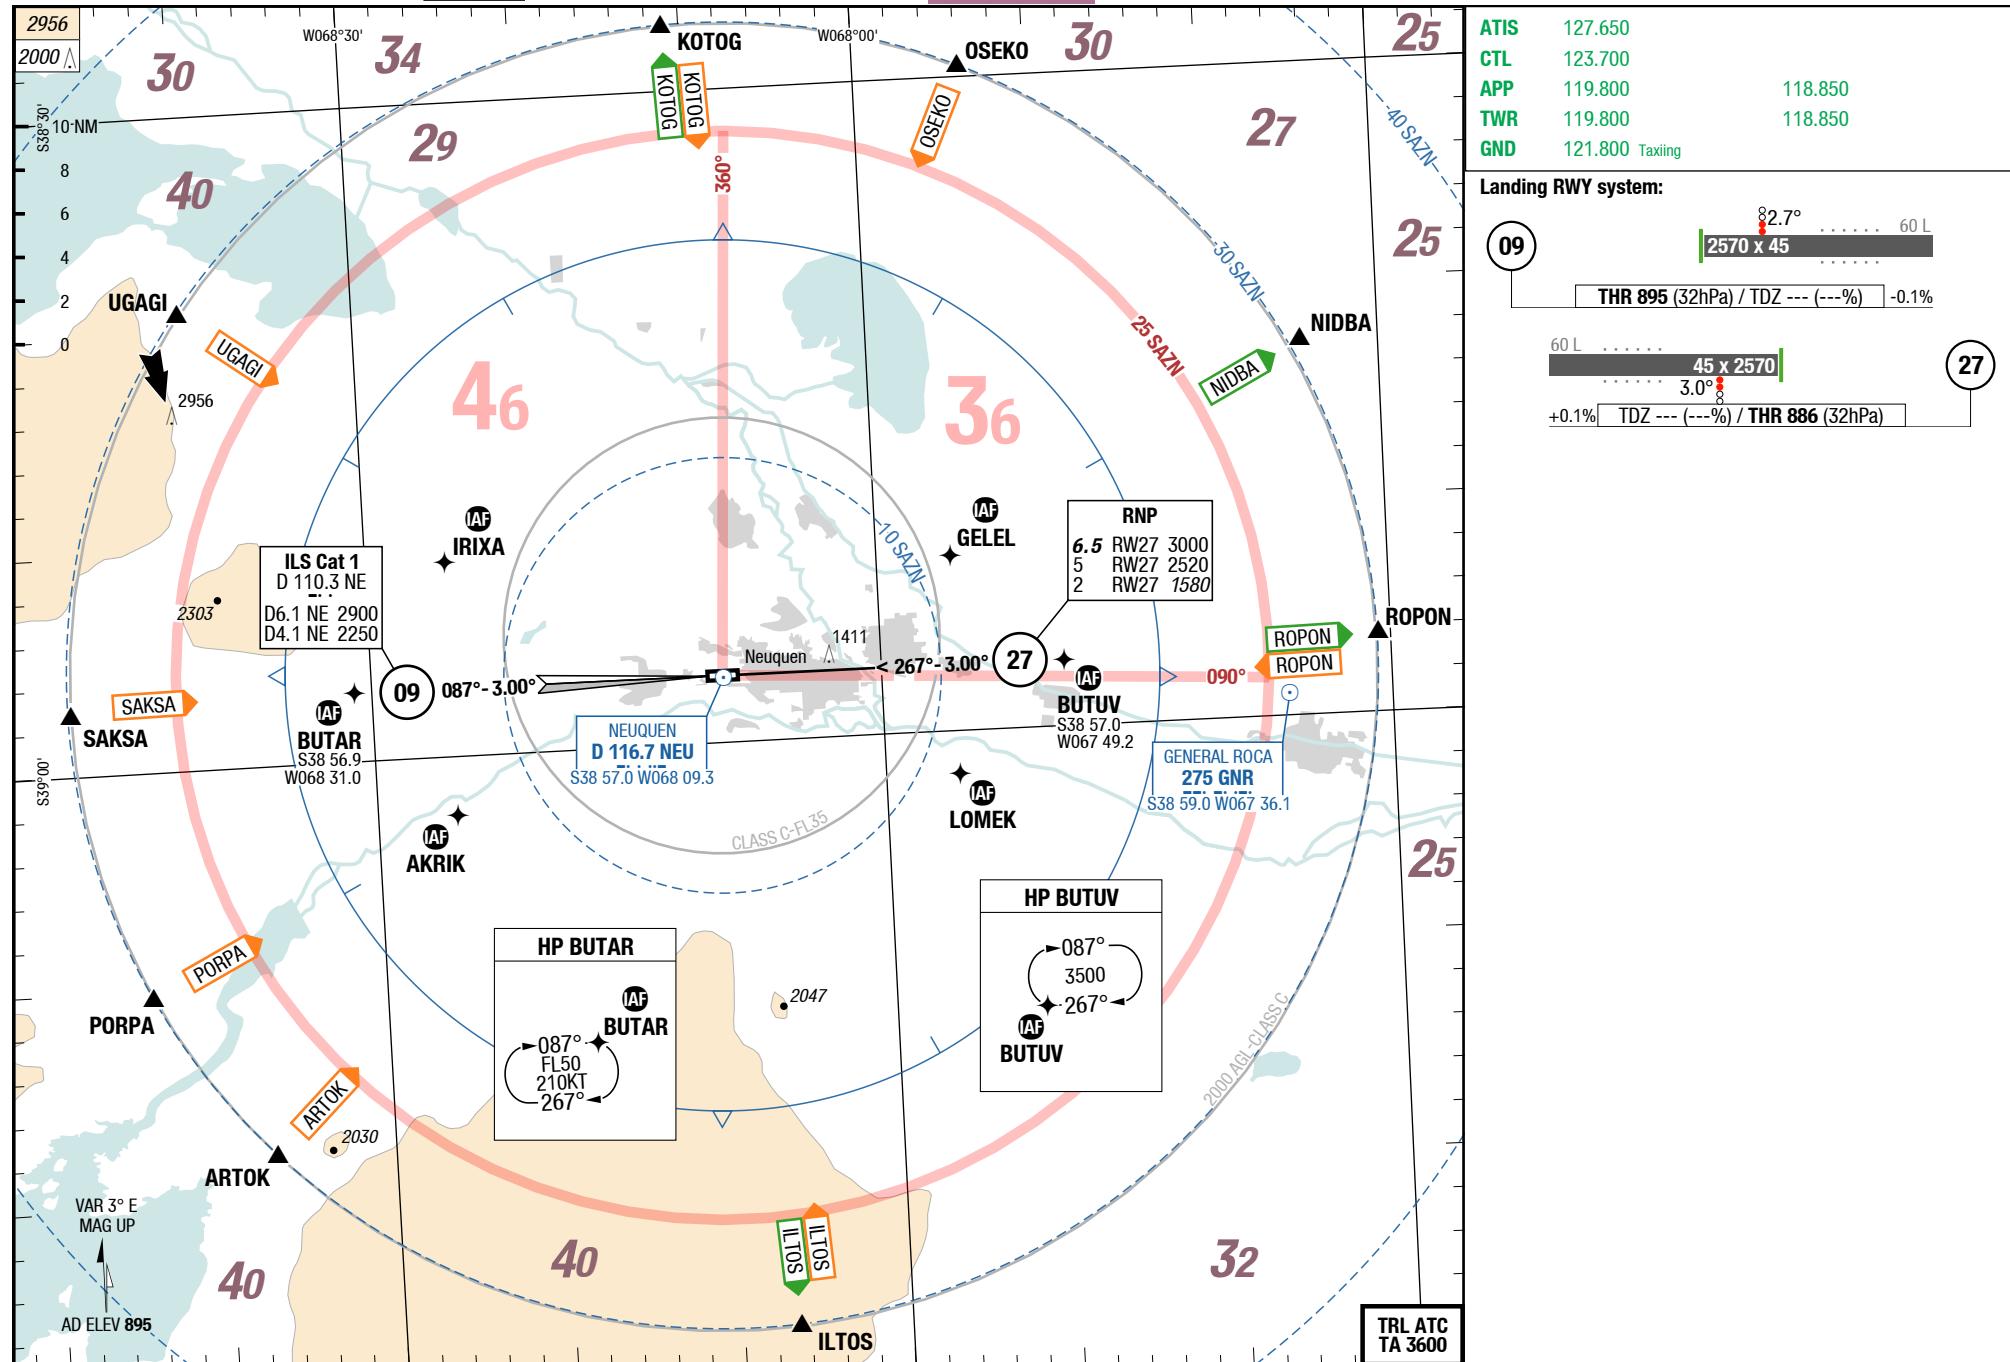

Changes: New

29-MAR-2018

NQN-SAZN

Argentina Neuquen Presidente Peron

3-20

AGC

AGC


Presidente Peron Neuquen Argentina

AGC

W068°10'

W068°09'

ATIS 127.650
TWR 119.800
118.850
GND 121.800 Taxiing

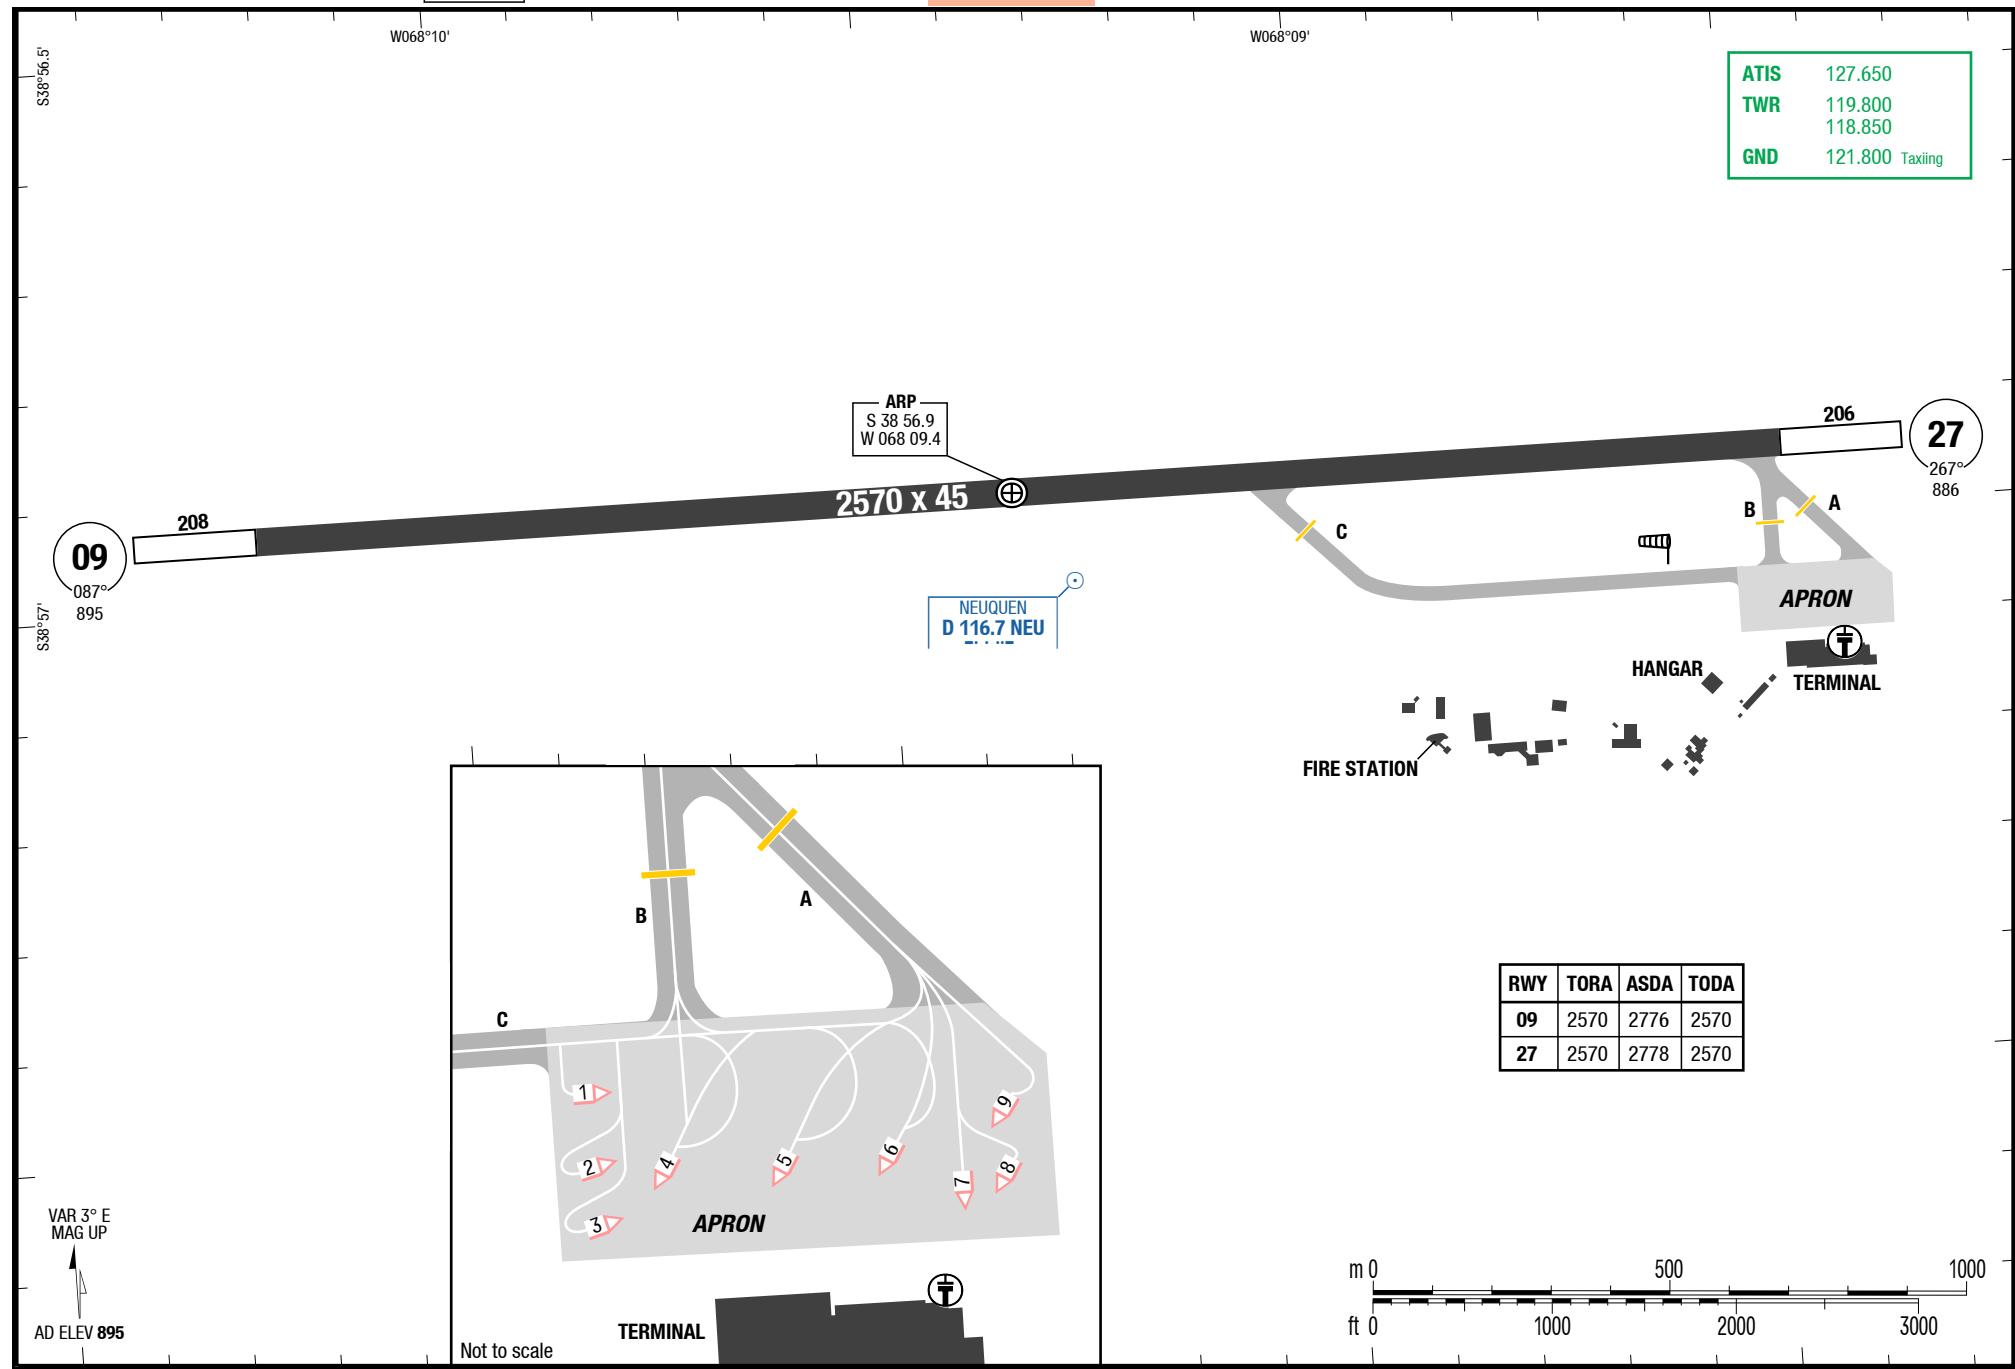

Changes: New

Not to scale

29-MAR-2018

NQN-SAZN

Argentina Neuquen Presidente Peron

4-10


RNP SIDs RWY 27

SID

SID

Presidente Peron Neuquen Argentina

RNP SIDs RWY 27

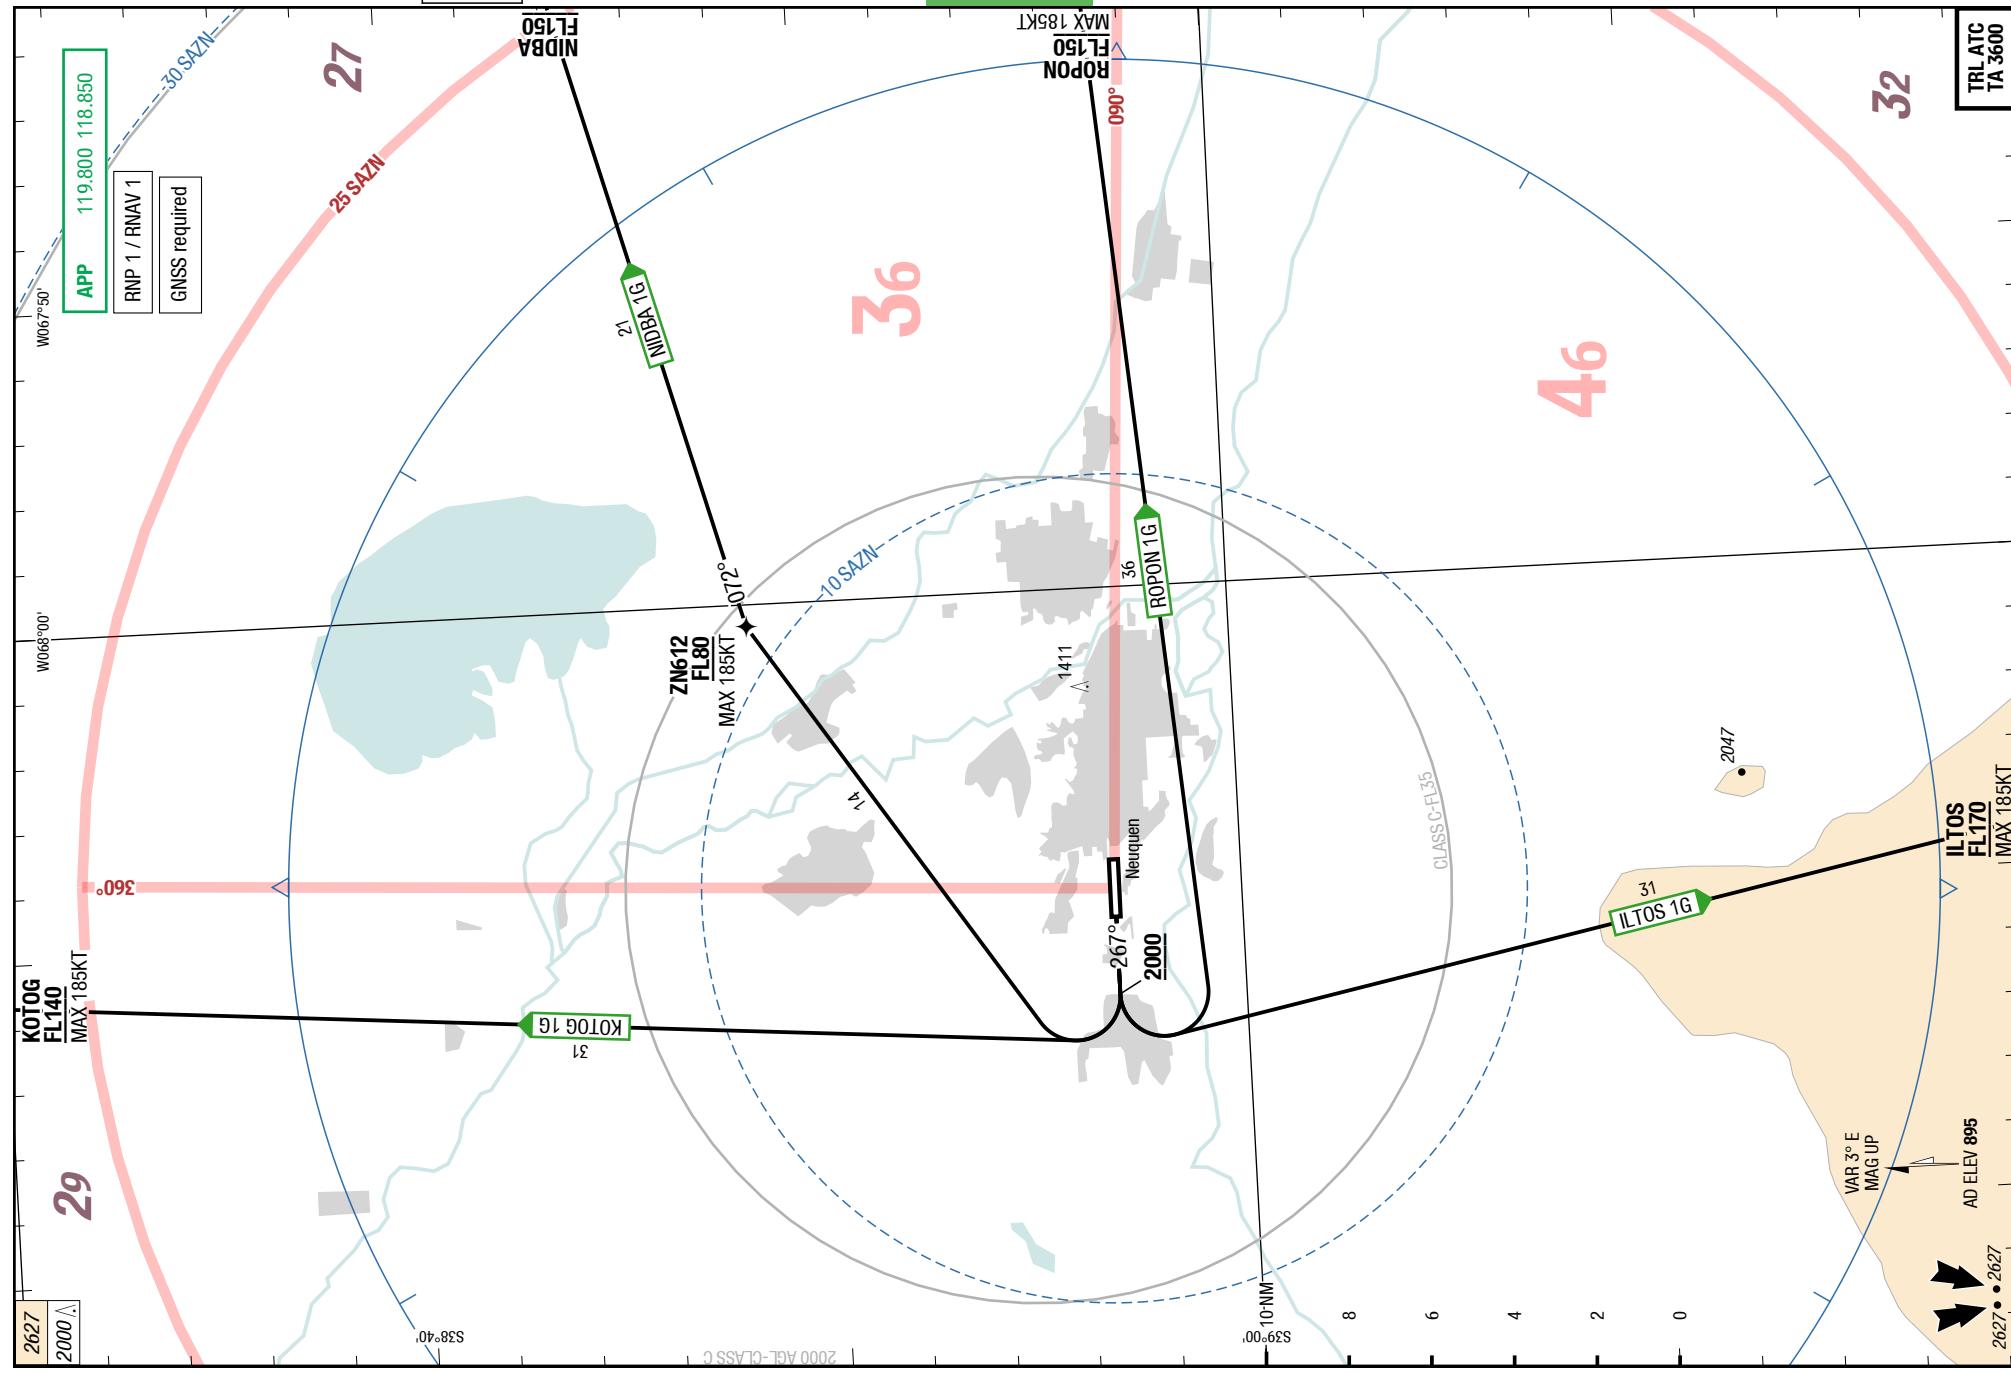

29-MAR-2018

Argentina Neuquen Presidente Peron

NQN-SAZN**5-10****RNP SIDs RWY 27**

SIDPT

ILTOS 1G / KOTOG 1G / NIDBA 1G / ROPON 1G

RWY 27 (267°)

DESIGNATOR	ROUTING	ALTITUDES
	Runway 27	
ILTOS 1G 119.800	267° [A2000+ ;L] - DCT ILTOS [K185-]	ILTOS MNM FL170
KOTOG 1G 119.800	267° [A2000+ ;R] - DCT KOTOG [K185-]	KOTOG MNM FL140
NIDBA 1G 119.800	267° [A2000+ ;R] - DCT ZN612 [K185-] - NIDBA	ZN612 MNM FL80 NIDBA MNM FL150
ROPON 1G 119.800	267° [A2000+ ;L] - DCT ROPON [K185-]	ROPON MNM FL150


29-MAR-2018

NON-SAZN

Argentina Neuquen Presidente Peron
RNP STARS RWY 27

6-10

RNP STARS RWY 09

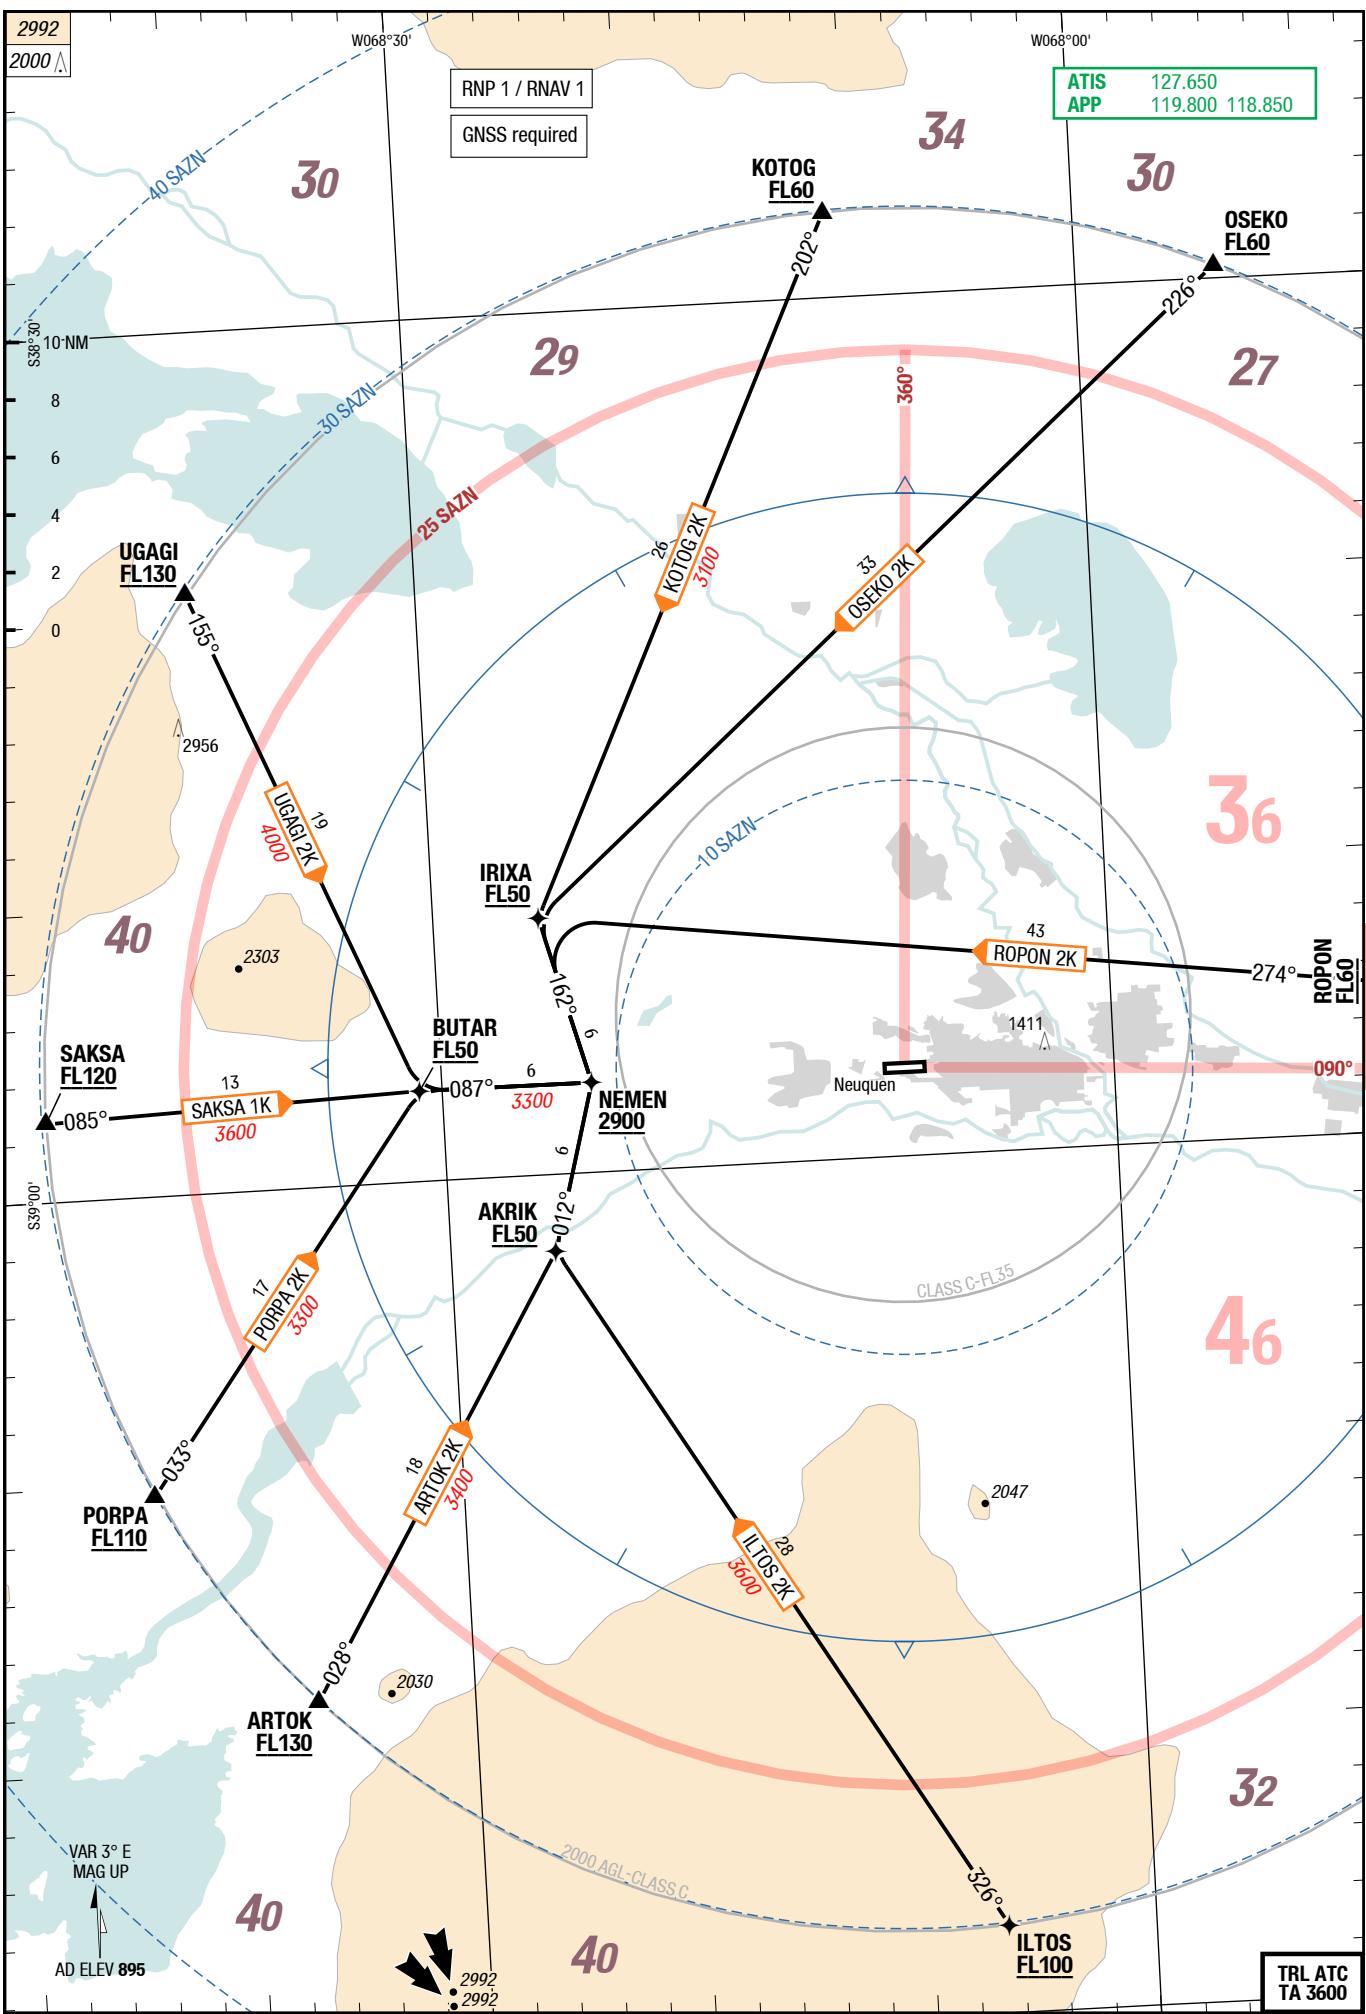STAR
STARPresidente Peron Neuquen Argentina
RNP STARS RWY 27

29-MAR-2018

Argentina Neuquen Presidente Peron


Presidente Peron Neuquen Argentina

NQN-SAZN

6-20

RNP STARS RWY 27

RNP STARS RWY 27

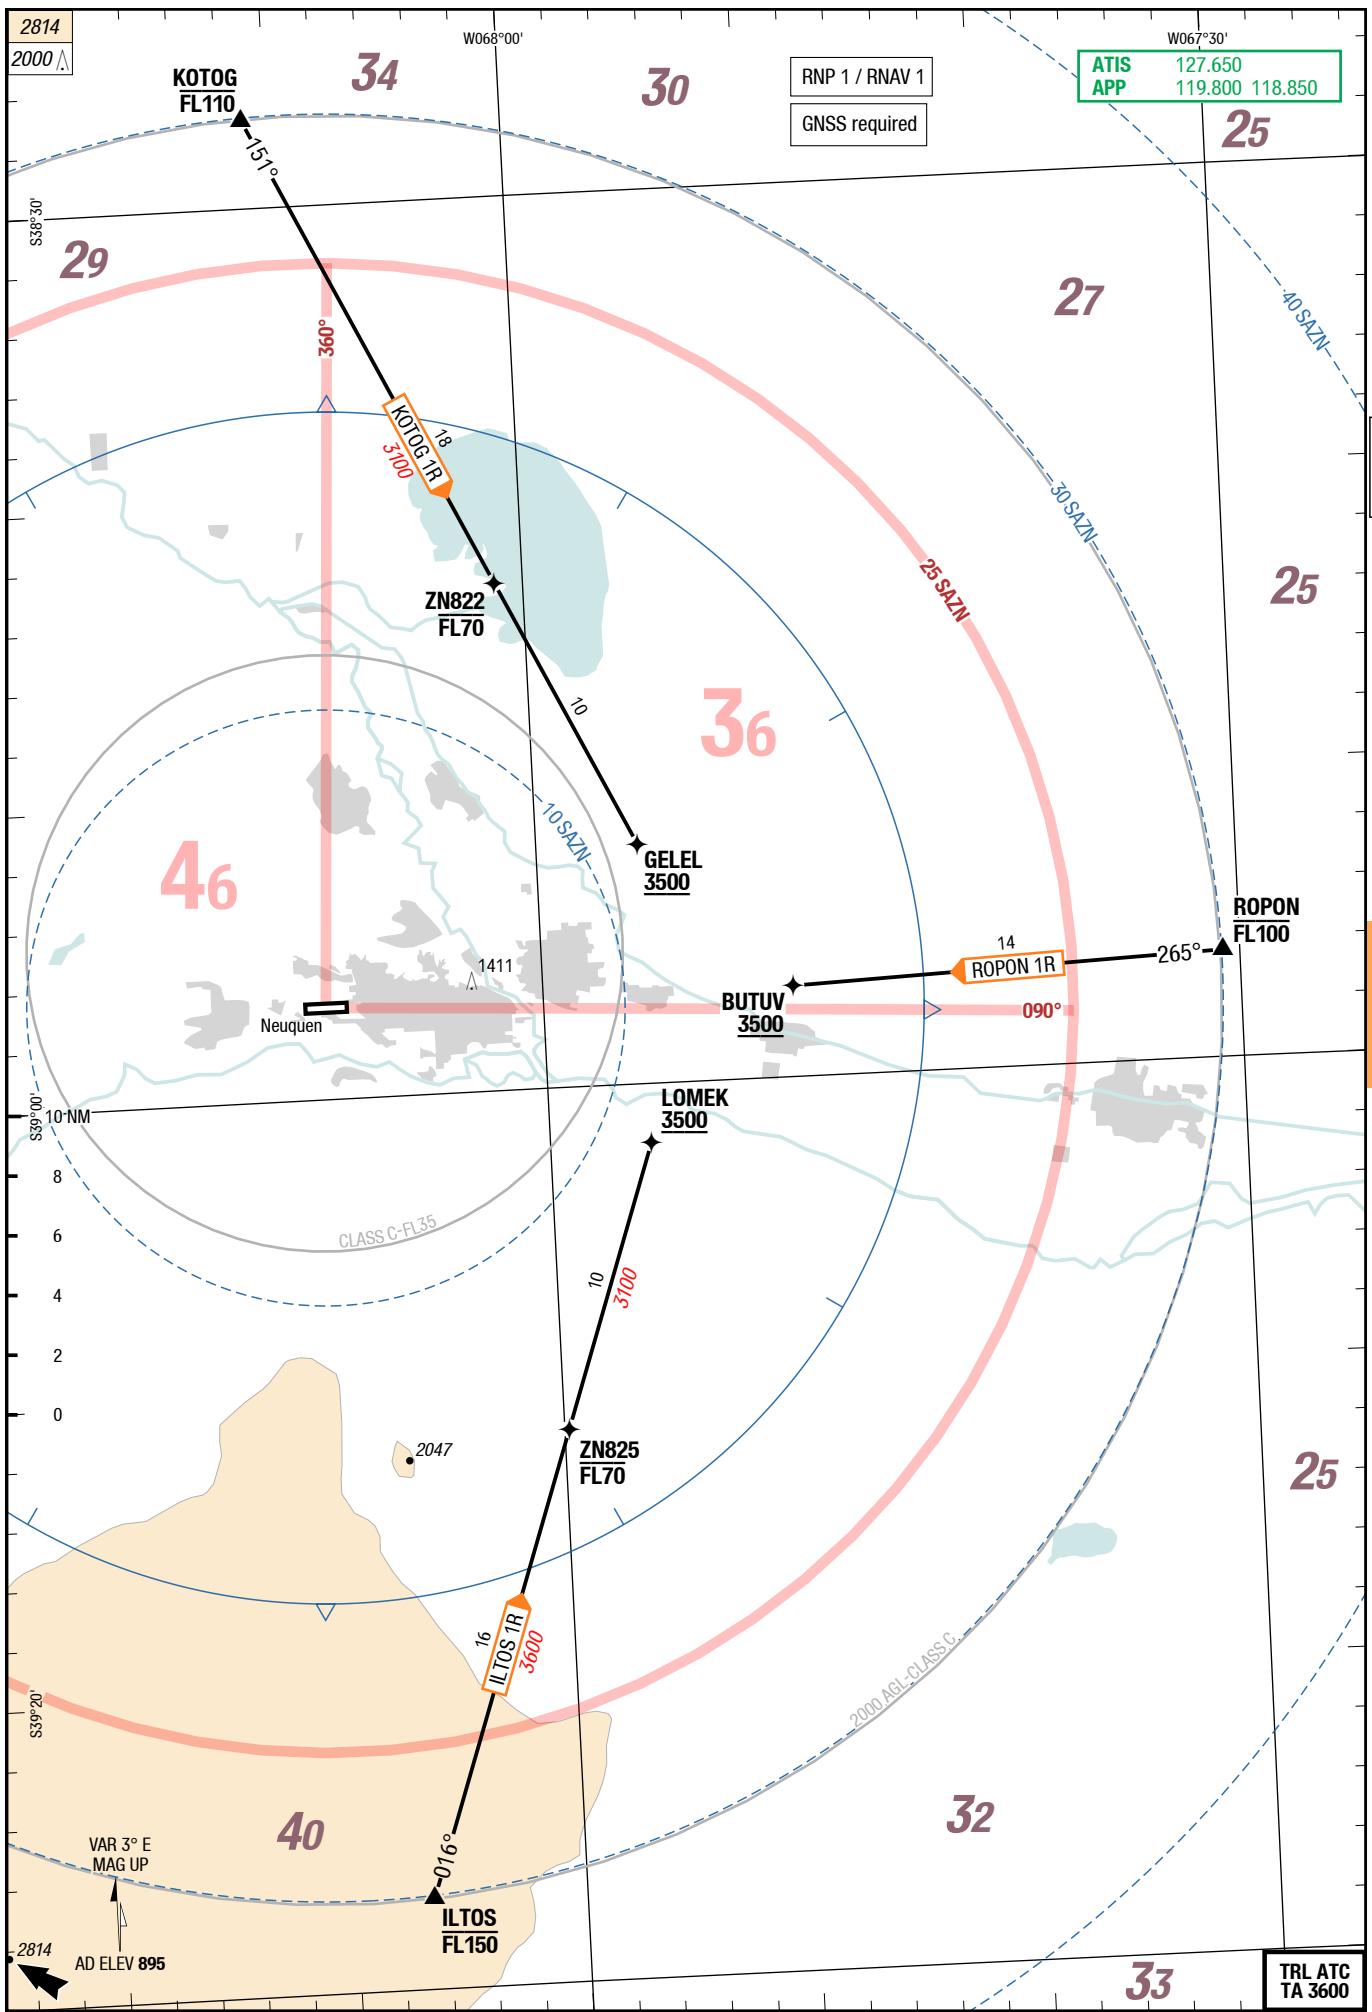

29-MAR-2018


Argentina Neuquen Presidente Peron

IAC

NQN-SAZN

7-10

ILS Z 09

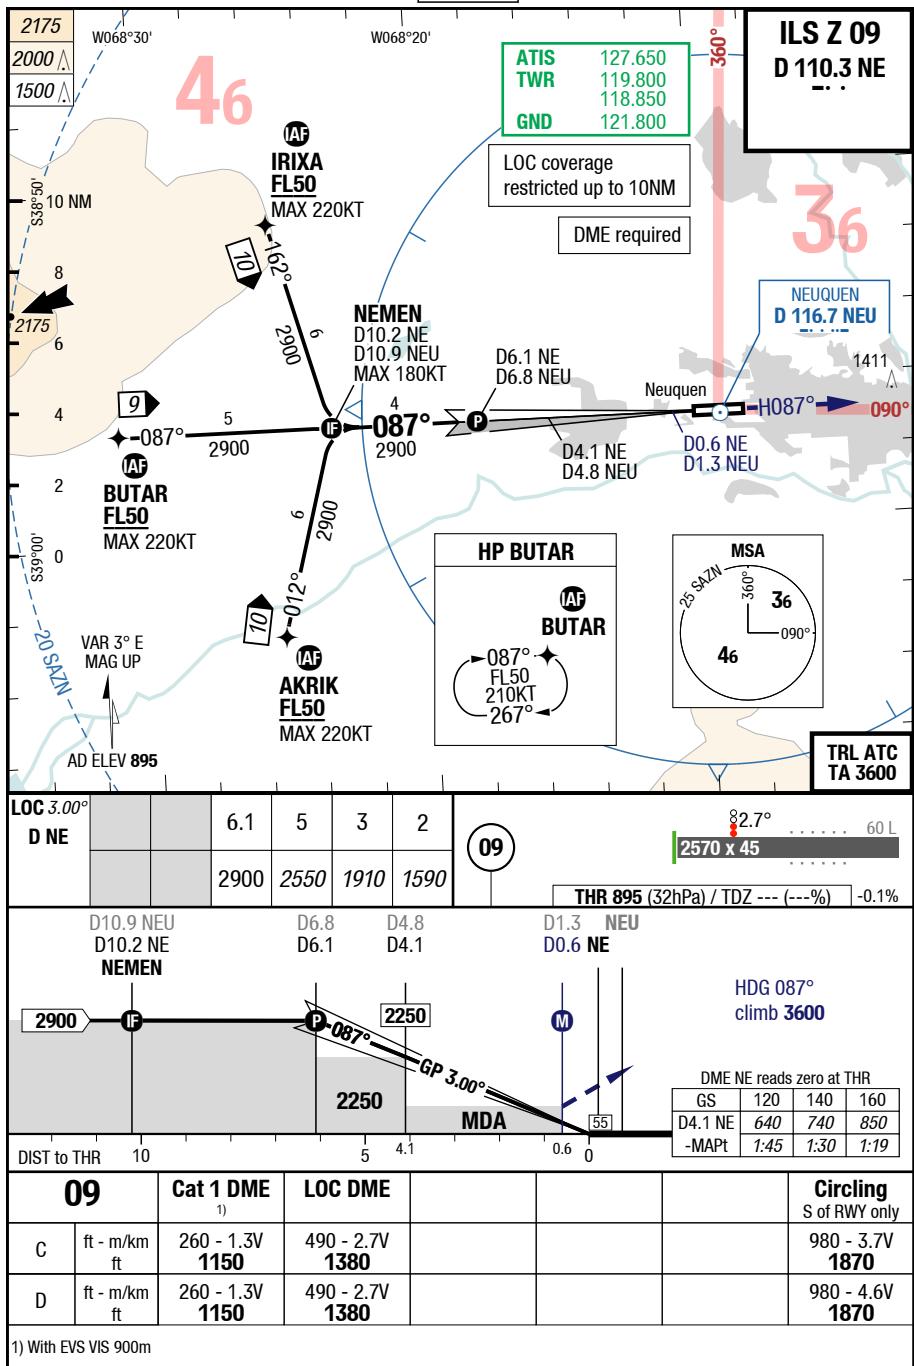

Changes: New


29-MAR-2018

NQN-SAZN

7-20

IAC

ILS Y 09

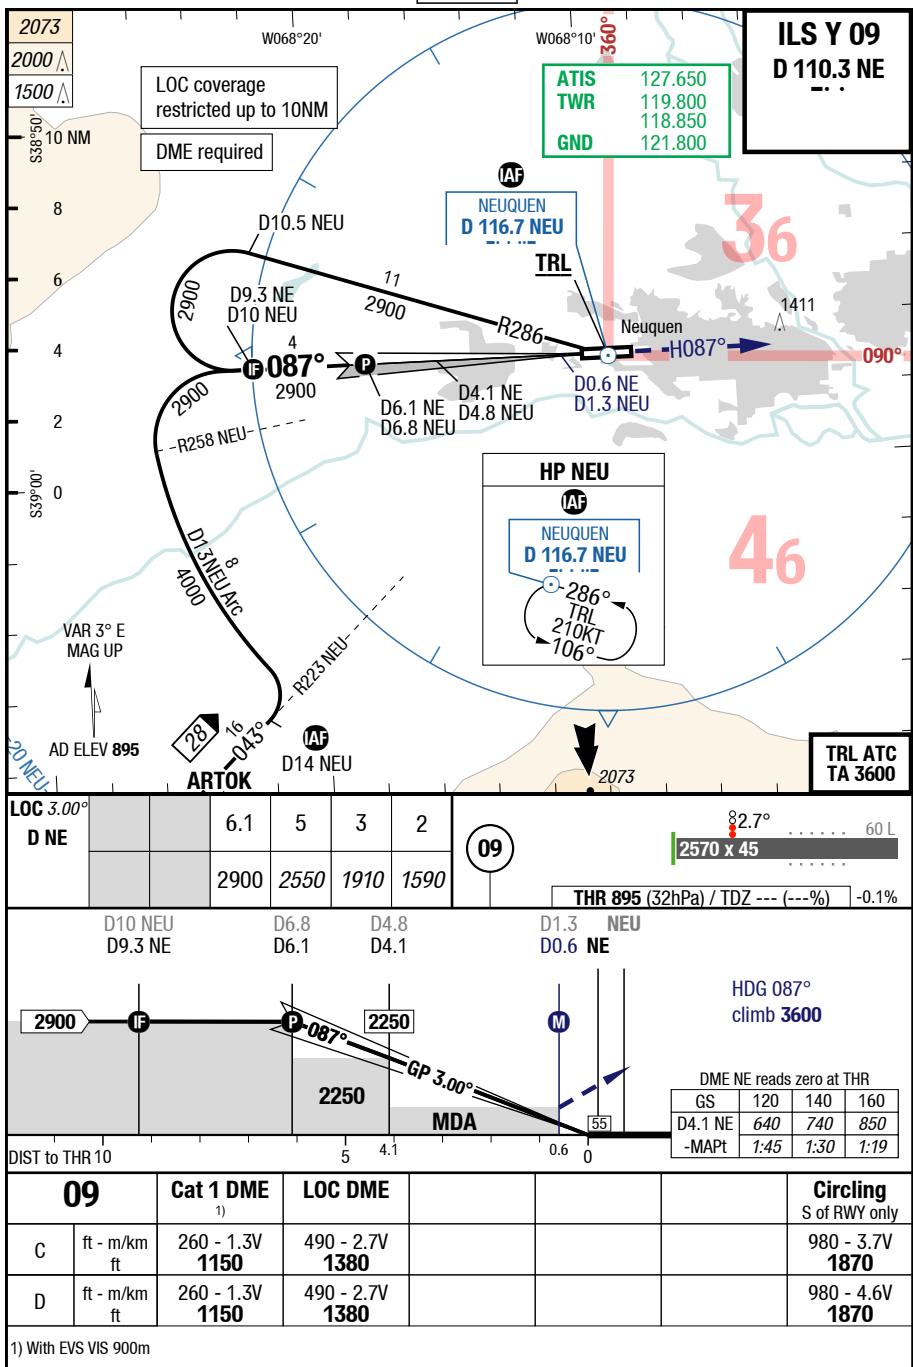

Changes: New


29-MAR-2018

Argentina Neuquen Presidente Peron

NQN-SAZN

7-30

RNP 27

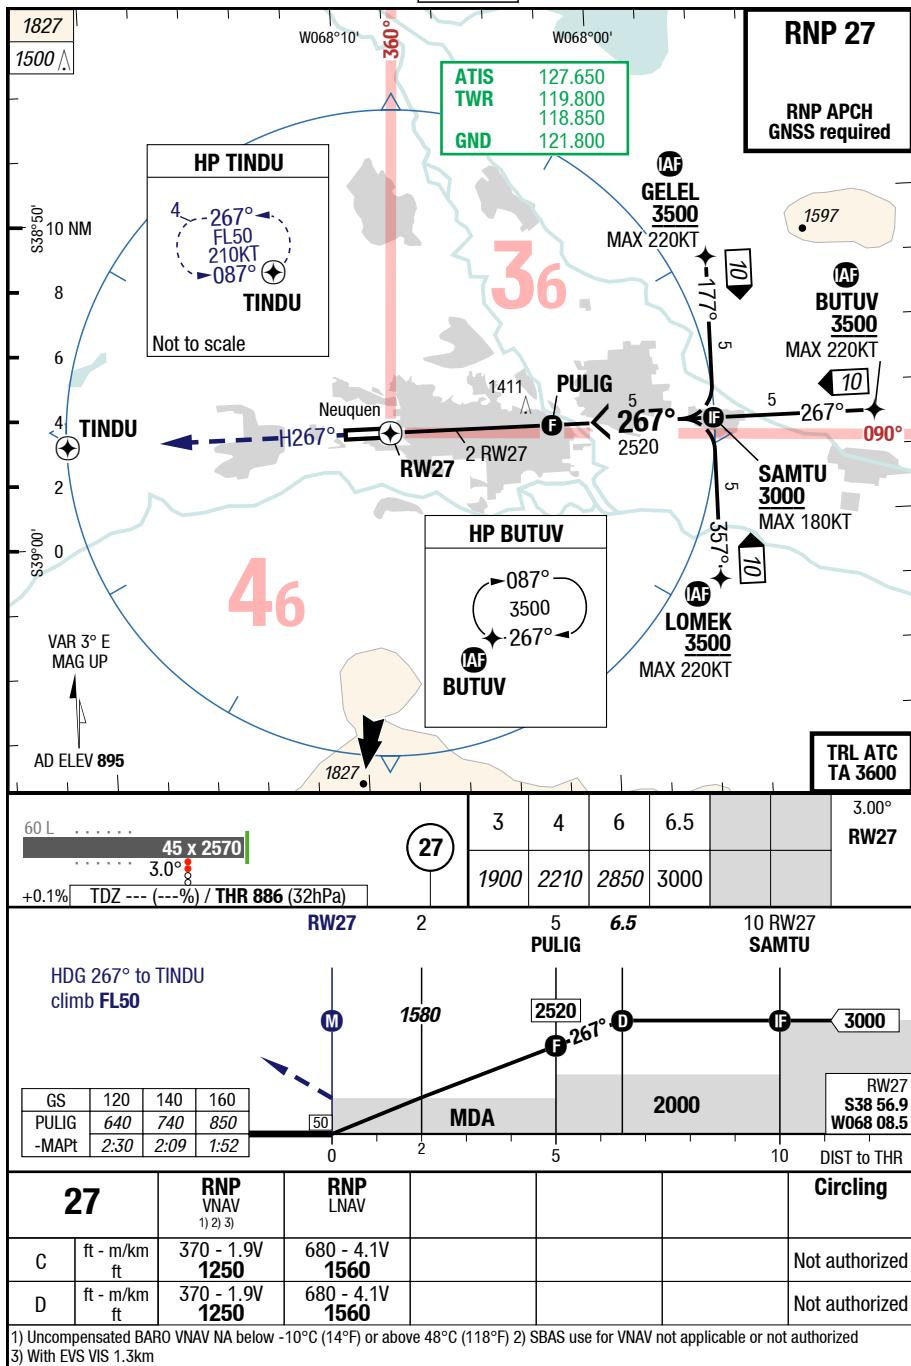

Changes: new

29-MAR-2018


Argentina Neuquen Presidente Peron

IAC

NQN-SAZN

7-50

VOR DME 09

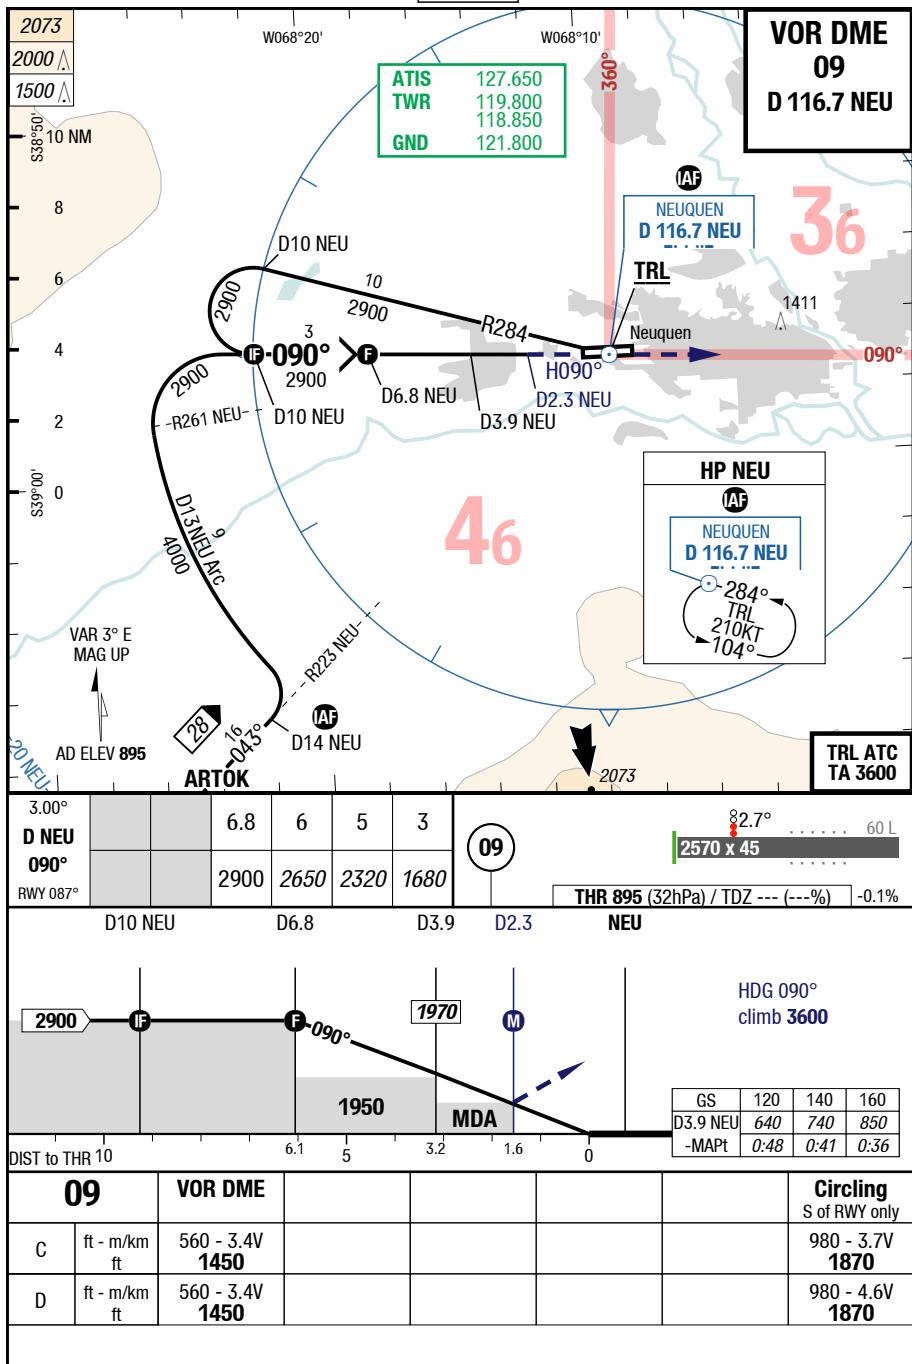

Changes: New

29-MAR-2018


Argentina Neuquen Presidente Peron

14

NQN-SAZN

7-60

VOR 09

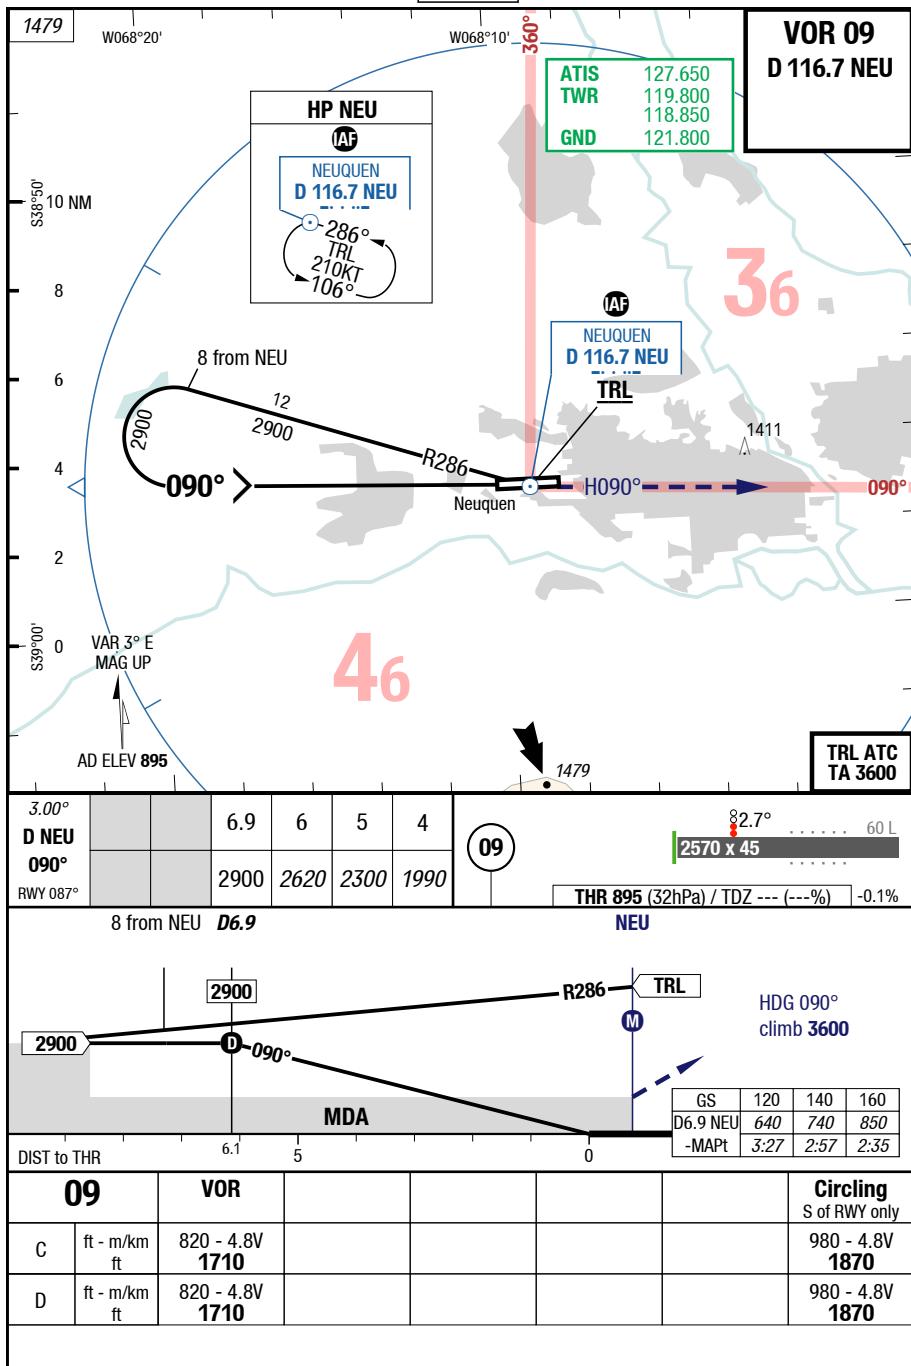

Changes: New

29-MAR-2018

NQN-SAZN

7-70

VOR DME 27

14

