

 MET.25479006		Task Card Title: NO. 2 ENG AFT MOUNT PYLON BOLTS INSP					
Task Card NO: 712211-05-1-002		Work Package: ASP/H-26 C7-CHK		A/C Registration: HZ-ASP			
A/C Type: 321		Block Taskcard		Main Skill: PP,INSP,II,ACFT_TECH		PROD Final Acceptance:	
Project No: 01BASPC72608		Related Task Card:		A/C Area: 02			
Internal Check:		Check Type:		Work Order NO: 31956352		Tally Sequence NO: 301	
ENCLOSURE: ☐ CMR: ☐ CPCP: ☐ ETOPS: ☐ CDCCL: ☐ AD: ☐ ALI: ☐							
Type Code: SDI		Special Code: PP		MSG Code: MRB		Request: JOB SETUP,INSPECTION, JOB-CLOSEUP	
I HEREBY CERTIFY THAT ALL WARNINGS AND CAUTIONS HAVE BEEN READ AND THE WORK HAS BEEN CARRIED OUT IN ACCORDING WITH ALL LAID DOWN PROCEDURES, ATTACHED NOTES AND INFORMATION.							
Zones: 460							
DOCUMENT REFERENCES:							
Doc Typ		Reference					
AMM		71-22-11-210-803-B					
AMM		712211-210-803					
SSI		712211-05-1					
ACCESS PANELS:							
447AL, 448AR, 461AL, 462AR							
MATERIAL REQUIREMENTS:							
Part Number		Description				Qty.	
MIL-L-25681		LUBRICANT COMPOUND. S/L 2 YRS.				1.0	
TOOLING REQUIREMENTS:							
Part Number		Description				Qty.	
98D27803500001		LOCK				1.0	
98D71203002002		CHEST TORQUE SET CFM56-5 ENG CHNG				0.0	
TASK PREPARATION							
Job Description							
NO. 2 ENGINE AFT MOUNT PYLON BOLTS TORQUE CHECK (TC) INSPECTION (ALI REQUIREMENT)							
A. PREPAR FOR NO. 2 ENGINE AFT MOUNT PYLON BOLTS TORQUE CHECK (TC) INSPECTION AS PER AMM TASK 71-22-11-210-803-B.							
STEP COMPLETION SIGN OFF:							
	Qualification / Skill	Number of employees	Duration		Number./Signature	Date	
				HRS		Day	Month
Mechanic/s	PP/ACFT_TECH			HRS			
Insp.				HRS			
TASK INSTRUCTIONS							
Job Description							



MET.25479006

Task Card Title:

NO. 2 ENG AFT MOUNT PYLON BOLTS INSP



Task Card NO:

712211-05-1-002

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

A. PERFORM SPECIAL DETAILED INSPECTION OF NO. 2 ENGINE AFT MOUNT PYLON BOLTS TORQUE CHECK (TC) AS PER AMM TASK 71-22-11-210-803-B, AND RECORD FINDINGS.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year
Mechanic/s	PP/ACFT_TECH		HRS				
Insp.	INSP/II		HRS				

TASK CLOSE UP

Job Description

A. PERFORM CLOSE UP AS PER AMM TASK 71-22-11-210-803-B.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year
Mechanic/s	PP/ACFT_TECH		HRS				
Insp.			HRS				

-Aircraft Maintenance Manual used: Revision No. _____ Dated. _____.

Task card finding (Tick Applicable Box) [] Yes [] No. If yes update the system and list Task card finding WO below

Work order No: _____

Note: Make sure to creat the finding Work Order on task card level.

Remark's: _____



MET.25479006

Task Card Title:

NO. 2 ENG AFT MOUNT PYLON BOLTS INSP

Task Card NO:

712211-05-1-002

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

(1) If Task card interrupted or performed by different personals updates the system and update the following accordingly (Tick Applicable Box)

- Interruption No. 1 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 2 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 3 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 4 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 5 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____

(2) Record any dimension or torque through the performed steps and sign-off as applicable:

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____

**Task Completion Close Up And
System Update**

Station**Date****Signature**

 MET.25426517		Task Card Title: NO. 1 ENG AFT MOUNT LINK LUGS INSP					
Task Card NO: 712212-01-1-001		Work Package: ASP/H-26 C7-CHK		A/C Registration: HZ-ASP			
A/C Type: 321		Block Taskcard		Main Skill: PP,INSP,II,ACFT_TECH		PROD Final Acceptance:	
Project No: 01BASPC72608		Related Task Card:		A/C Area: 01			
Internal Check:		Check Type:		Work Order NO: 31956352		Tally Sequence NO: 302	
ENCLOSURE: ☒ CMR: ☐ CPCP: ☐ ETOPS: ☐ CDCCL: ☐ AD: ☐ ALI: ☐							
Type Code: SDI		Special Code: INSP		MSG Code: MRB		Request: PRE INSP, PRE INSP, PRE INSP	
I HEREBY CERTIFY THAT ALL WARNINGS AND CAUTIONS HAVE BEEN READ AND THE WORK HAS BEEN CARRIED OUT IN ACCORDING WITH ALL LAID DOWN PROCEDURES, ATTACHED NOTES AND INFORMATION.							
Zones: 450							
DOCUMENT REFERENCES:							
Doc Typ		Reference					
AMM		71-22-12-210-802-B					
AMM		712212-210-802					
SSI		712212-01-1					
ACCESS PANELS:							
437AL, 438AR, 451AL, 452AR							
MATERIAL REQUIREMENTS:							
Part Number		Description				Qty.	
No parts assigned to this Task Item							
TOOLING REQUIREMENTS:							
Part Number		Description				Qty.	
No tools assigned to this Task Item							
TASK PREPARATION							
Job Description							
A. PERFORM JOB SETUP AS PER AMM TASK AS PER AMM TASK 71-22-12-210-802-B.							
STEP COMPLETION SIGN OFF:							
Qualification / Skill		Number of employees		Duration		Number./Signature	
Date							
Day Month Year							
Mechanic/s		PP/ACFT_TECH		HRS			
Insp.				HRS			
TASK INSTRUCTIONS							
Job Description							
A. PERFORM SPECIAL DETAILED INSPECTION (ENDOSCOPE) OF NO. 1 ENGINE AFT MOUNT LINK LUGS THIS INSPECTION CRITERIA IS ONLY FOR THOSE PARTS OF THE ENGINE THAT YOU CAN SEE WHEN THE ENGINE IS INSTALLED ON AN AIRPLANE. THE LIMITS AND REMARKS ARE NOT APPLICABLE TO THE AREAS OF THE MOUNT THAT YOU CANNOT SEE							



MET.25426517

Task Card Title:

NO. 1 ENG AFT MOUNT LINK LUGS INSP

Task Card NO:

712212-01-1-001

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

WHEN THE ENGINE IS INSTALLED AS PER AMM TASK 71-22-12-210-802-B.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year
Mechanic/s				HRS			
Insp.	INSP/II			HRS			

TASK CLOSE UP**Job Description**

A. PERFORM JOB CLOSE UP AS PER AMM TASK 71-22-12-210-802-B.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year
Mechanic/s	PP/ACFT_TECH			HRS			
Insp.				HRS			

-Aircraft Maintenance Manual used: Revision No. _____ Dated. _____.

Task card finding (Tick Applicable Box) [] Yes [] No. If yes update the system and list Task card finding WO below

Work order No: _____

Note: Make sure to create the finding Work Order on task card level.

Remark's: _____



MET.25426517

Task Card Title:

NO. 1 ENG AFT MOUNT LINK LUGS INSP

Task Card NO:

712212-01-1-001

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

(1) If Task card interrupted or performed by different personals updates the system and update the following according (Tick Applicable Box)

- Interruption No. 1 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 2 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 3 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 4 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 5 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____

(2) Record any dimension or torque through the performed steps and sign-off as applicable:

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____

**Task Completion Close Up And
System Update**

Station**Date****Signature**

 MET.25478211		Task Card Title: NO. 2 ENG AFT MOUNT LINK LUGS INSP					
Task Card NO: 712212-01-1-002		Work Package: ASP/H-26 C7-CHK		A/C Registration: HZ-ASP			
A/C Type: 321		Block Taskcard		Main Skill: PP,INSP,II,ACFT_TECH		PROD Final Acceptance:	
Project No: 01BASPC72608		Related Task Card:		A/C Area: 02			
Internal Check:		Check Type:		Work Order NO: 31956352		Tally Sequence NO: 303	
ENCLOSURE: ☒ CMR: ☐ CPCP: ☐ ETOPS: ☐ CDCCL: ☐ AD: ☐ ALI: ☐							
Type Code: SDI		Special Code: INSP		MSG Code: MRB		Request: PRE INSP, PRE INSP, PRE INSP	
I HEREBY CERTIFY THAT ALL WARNINGS AND CAUTIONS HAVE BEEN READ AND THE WORK HAS BEEN CARRIED OUT IN ACCORDING WITH ALL LAID DOWN PROCEDURES, ATTACHED NOTES AND INFORMATION.							
Zones: 460							
DOCUMENT REFERENCES:							
Doc Typ		Reference					
AMM		71-22-12-210-802-B					
AMM		712212-210-802					
SSI		SSI 712212-01-1					
ACCESS PANELS:							
447AL, 448AR, 461AL, 462AR							
MATERIAL REQUIREMENTS:							
Part Number		Description				Qty.	
No parts assigned to this Task Item							
TOOLING REQUIREMENTS:							
Part Number		Description				Qty.	
No tools assigned to this Task Item							
TASK PREPARATION							
Job Description							
A. PERFORM JOB SETUP AS PER AMM TASK AS PER AMM TASK 71-22-12-210-802-B.							
STEP COMPLETION SIGN OFF:							
	Qualification / Skill	Number of employees	Duration		Number./Signature	Date	
				HRS		Day	Month
Mechanic/s	PP/ACFT_TECH			HRS			
Insp.				HRS			
TASK INSTRUCTIONS							
Job Description							
A. PERFORM SPECIAL DETAILED INSPECTION (ENDOSCOPE) OF NO. 2 ENGINE AFT MOUNT LINK LUGS THIS INSPECTION CRITERIA IS ONLY FOR THOSE PARTS OF THE ENGINE THAT YOU CAN SEE WHEN THE ENGINE IS INSTALLED ON AN AIRPLANE. THE LIMITS AND REMARKS ARE NOT APPLICABLE TO THE AREAS OF THE MOUNT THAT YOU CANNOT SEE							



MET.25478211

Task Card Title:

NO. 2 ENG AFT MOUNT LINK LUGS INSP

Task Card NO:

712212-01-1-002

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

WHEN THE ENGINE IS INSTALLED AS PER AMM TASK 71-22-12-210-802-B.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year
Mechanic/s				HRS			
Insp.	INSP/II			HRS			

TASK CLOSE UP**Job Description**

A. PERFORM JOB CLOSE UP AS PER AMM TASK 71-22-12-210-802-B.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year
Mechanic/s	PP/ACFT_TECH			HRS			
Insp.				HRS			

-Aircraft Maintenance Manual used: Revision No. _____ Dated. _____.

Task card finding (Tick Applicable Box) [] Yes [] No. If yes update the system and list Task card finding WO below

Work order No: _____

Note: Make sure to create the finding Work Order on task card level.

Remark's: _____



MET.25478211

Task Card Title:

NO. 2 ENG AFT MOUNT LINK LUGS INSP

Task Card NO:

712212-01-1-002

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

(1) If Task card interrupted or performed by different personals updates the system and update the following accordingly (Tick Applicable Box)

- Interruption No. 1 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 2 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 3 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 4 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 5 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____

(2) Record any dimension or torque through the performed steps and sign-off as applicable:

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____

**Task Completion Close Up And
System Update**

Station**Date****Signature**

 MET.25425499		Task Card Title: NO. 1 ENGINE AFT MOUNT PINS INSP			
Task Card NO: 712213-01-1-001		Work Package: ASP/H-26 C7-CHK		A/C Registration: HZ-ASP	
A/C Type: 321		Block Taskcard		Main Skill: PP,INSP,II,RII,ACFT_TECH	
Project No: 01BASPC72608		Related Task Card:		A/C Area: 01	
Internal Check:		Check Type:		Work Order NO: 31956352	
				Tally Sequence NO: 304	
ENCLOSURE: ☒ CMR: ☐ CPCP: ☐ ETOPS: ☐ CDCCL: ☐ AD: ☐ ALI: ☐					
Type Code: SDI		Special Code: PP		MSG Code: MRB	
				Request: Phase: TION,INSPECTION,INSPECTION,INSPECTION, JOB-CLOSEUP	
I HEREBY CERTIFY THAT ALL WARNINGS AND CAUTIONS HAVE BEEN READ AND THE WORK HAS BEEN CARRID OUT IN ACCORDING WITH ALL LAID DOWN PROCEDURES, ATTACHED NOTES AND INFORMATION.					
Zones: 450					
DOCUMENT REFERENCES:					
Doc Typ		Reference			
AMM		71-22-11-210-802-B			
AMM		712211-210-802			
SSI		712213-01-1			
ACCESS PANELS:					
437AL, 438AR, 451AL, 452AR					
MATERIAL REQUIREMENTS:					
Part Number		Description			Qty.
TT-M-261		SOLVENT M.E.K. S/L 2YRS 5 LTR/CAN			1.0
ROYCO81MS		LUBRICANT COMPOUND. S/L 2 YRS.			1.0
TOOLING REQUIREMENTS:					
Part Number		Description			Qty.
RSE1098		WRENCH SET AFT ENGINE MOUNT			0.0
98D27803500001		LOCK			1.0
98D71203500000		BOOTSTRAP-SYSTEM			1.0
S487ETT2		ENGINE TROLLEY			1.0
S686CR56-5		ENGINE CRADLE			1.0
TASK PREPARATION					
Job Description					
A. PERFORM JOB SET UP AS PER AMM TASK 71-22-11-210-802-B.					
STEP COMPLETION SIGN OFF:					



MET.25425499

Task Card Title:

NO. 1 ENGINE AFT MOUNT PINS INSP



Task Card NO:

712213-01-1-001

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

	Qualification / Skill	Number of employees	Duration		Number./Signature	Date		
						Day	Month	Year
Mechanic/s	PP/ACFT_TECH			HRS				
Insp.				HRS				

TASK INSTRUCTIONS

Job Description

A. REMOVE AND CLEAN THE FOLLOWING AFT ENGINE MOUNT SHEAR BOLTS AND SHEAR PINS AT TURBINE CASE ATTACHMENT AS PER AMM TASK 71-22-11-210-802-B:

CAUTION : ONLY REMOVE ONE PIN AT A TIME.

- (1) L/H SHEAR BOLTS AND PINS.
- (2) MID SHEAR BOLTS AND PINS.
- (3) R/H SHEAR BOLTS AND PINS.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration		Number./Signature	Date		
						Day	Month	Year
Mechanic/s	PP/ACFT_TECH			HRS				
Insp.				HRS				

TASK INSTRUCTIONS

Job Description

B. PERFORM A SPECIAL DETAILED INSPECTION (ENDOSCOPE) OF THE TURBINE CASE SHEAR BOLTS AND SHEAR PINS AS PER AMM TASK 71-22-11-210-802-B:

- (1) L/H SHEAR BOLTS AND PINS.
- (2) MID SHEAR BOLTS AND PINS.
- (3) R/H SHEAR BOLTS AND PINS.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration		Number./Signature	Date		
						Day	Month	Year
Mechanic/s				HRS				
Insp.	INSP/II			HRS				

TASK INSTRUCTIONS

Job Description

C. INSTALL THE SHEAR BOLTS AND SHEAR PINS AT TURBINE CASE ATTACHMENT AS PER AMM TASK 71-22-11-210-802-B:

- (1) L/H SHEAR BOLTS AND PINS.
- (2) MID SHEAR BOLTS AND PINS.



MET.25425499

Task Card Title:

NO. 1 ENGINE AFT MOUNT PINS INSP

Task Card NO:

712213-01-1-001

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

(3) R/H SHEAR BOLTS AND PINS.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year
Mechanic/s	PP/ACFT_TECH		HRS				
Insp.	INSP/RII		HRS				

TASK INSTRUCTIONS**Job Description**

D. REMOVE AND CLEAN THE FOLLOWING AFT ENGINE MOUNT SHEAR BOLTS AND SHEAR PINS AT CROSS BEAM ATTACHMENT AS PER AMM TASK 71-22-11-210-802-B:

CAUTION : ONLY REMOVE ONE PIN AT A TIME.

NOTE: FOR L/H & R/H SHEAR BOLTS AND PINS, THERE ARE TWO TYPES (REF. SB: RA32071-164) REFER TO FIGURES IN AMM.

- (1) L/H SHEAR BOLTS AND PINS.
- (2) MID SHEAR BOLTS AND PINS.
- (3) R/H SHEAR BOLTS AND PINS.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year
Mechanic/s	PP/ACFT_TECH		HRS				
Insp.			HRS				

TASK INSTRUCTIONS**Job Description**

E. PERFORM A SPECIAL DETAILED INSPECTION (ENDOSCOPE) OF THE CROSS BEAM SHEAR BOLTS AND SHEAR PINS AS PER AMM TASK 71-22-11-210-802-B:

- (1) L/H SHEAR BOLTS AND PINS.
- (2) MID SHEAR BOLTS AND PINS.
- (3) R/H SHEAR BOLTS AND PINS.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year
Mechanic/s			HRS				
Insp.	INSP/II		HRS				

TASK INSTRUCTIONS**Job Description**

F. INSTALL THE SHEAR BOLTS AND SHEAR PINS AT CROSS BEAM ATTACHMENT AS PER AMM TASK 71-22-11-210-802-B:

NOTE: FOR L/H & R/H SHEAR BOLTS AND PINS, THERE ARE TWO TYPES (REF. SB: RA32071-164) REFER TO FIGURES IN AMM.



MET.25425499

Task Card Title:

NO. 1 ENGINE AFT MOUNT PINS INSP



Task Card NO:

712213-01-1-001

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

- (1) L/H SHEAR BOLTS AND PINS.
 (2) MID SHEAR BOLTS AND PINS.
 (3) R/H SHEAR BOLTS AND PINS.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year
Mechanic/s	PP/ACFT_TECH		HRS				
Insp.	INSP/RII		HRS				

TASK CLOSE UP

Job Description

A. PERFORM CLOSE UP AS PER AMM TASK 71-22-11-210-802-B.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year
Mechanic/s	PP/ACFT_TECH		HRS				
Insp.	INSP/II		HRS				

-Aircraft Maintenance Manual used: Revision No. _____ Dated. _____.

Task card finding (Tick Applicable Box) [] Yes [] No. If yes update the system and list Task card finding WO below

 Work order No: _____

Note: Make sure to create the finding Work Order on task card level.

 Remark's: _____



Task Card Title:

NO. 1 ENGINE AFT MOUNT PINS INSP

Task Card NO:

712213-01-1-001

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

(1) If Task card interrupted or performed by different personals updates the system and update the following according (Tick Applicable Box)

- Interruption No. 1 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 2 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 3 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 4 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 5 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____

(2) Record any dimension or torque through the performed steps and sign-off as applicable:

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____

**Task Completion Close Up And
System Update**

Station**Date****Signature**

Copyright of Saudia Technic - Regeneration is not allowed without prior approval by Saudia Technic.



MET.25478196

Task Card Title:

NO. 2 ENGINE AFT MOUNT PINS INSP



Task Card NO:

712213-01-1-002

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

	Qualification / Skill	Number of employees	Duration		Number./Signature	Date		
						Day	Month	Year
Mechanic/s	PP/ACFT_TECH			HRS				
Insp.				HRS				

TASK INSTRUCTIONS

Job Description

A. REMOVE AND CLEAN THE FOLLOWING AFT ENGINE MOUNT SHEAR BOLTS AND SHEAR PINS AT TURBINE CASE ATTACHMENT AS PER AMM TASK 71-22-11-210-802-B:

CAUTION : ONLY REMOVE ONE PIN AT A TIME.

- (1) L/H SHEAR BOLTS AND PINS.
- (2) MID SHEAR BOLTS AND PINS.
- (3) R/H SHEAR BOLTS AND PINS.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration		Number./Signature	Date		
						Day	Month	Year
Mechanic/s	PP/ACFT_TECH			HRS				
Insp.				HRS				

TASK INSTRUCTIONS

Job Description

B. PERFORM A SPECIAL DETAILED INSPECTION (ENDOSCOPE) OF THE TURBINE CASE SHEAR BOLTS AND SHEAR PINS AS PER AMM TASK 71-22-11-210-802-B:

- (1) L/H SHEAR BOLTS AND PINS.
- (2) MID SHEAR BOLTS AND PINS.
- (3) R/H SHEAR BOLTS AND PINS.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration		Number./Signature	Date		
						Day	Month	Year
Mechanic/s				HRS				
Insp.	INSP/II			HRS				

TASK INSTRUCTIONS

Job Description

C. INSTALL THE SHEAR BOLTS AND SHEAR PINS AT TURBINE CASE ATTACHMENT AS PER AMM TASK 71-22-11-210-802-B:

- (1) L/H SHEAR BOLTS AND PINS.
- (2) MID SHEAR BOLTS AND PINS.



MET.25478196

Task Card Title:

NO. 2 ENGINE AFT MOUNT PINS INSP



Task Card NO:

712213-01-1-002

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

(3) R/H SHEAR BOLTS AND PINS.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year
Mechanic/s	PP/ACFT_TECH		HRS				
Insp.	INSP/RII		HRS				

TASK INSTRUCTIONS

Job Description

D. REMOVE AND CLEAN THE FOLLOWING AFT ENGINE MOUNT SHEAR BOLTS AND SHEAR PINS AT CROSS BEAM ATTACHMENT AS PER AMM TASK 71-22-11-210-802-B:

CAUTION : ONLY REMOVE ONE PIN AT A TIME.

NOTE: FOR L/H & R/H SHEAR BOLTS AND PINS, THERE ARE TWO TYPES (REF. SB: RA32071-164) REFER TO FIGURES IN AMM.

- (1) L/H SHEAR BOLTS AND PINS.
- (2) MID SHEAR BOLTS AND PINS.
- (3) R/H SHEAR BOLTS AND PINS.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year
Mechanic/s	PP/ACFT_TECH		HRS				
Insp.			HRS				

TASK INSTRUCTIONS

Job Description

E. PERFORM A SPECIAL DETAILED INSPECTION (ENDOSCOPE) OF THE CROSS BEAM SHEAR BOLTS AND SHEAR PINS AS PER AMM TASK 71-22-11-210-802-B:

- (1) L/H SHEAR BOLTS AND PINS.
- (2) MID SHEAR BOLTS AND PINS.
- (3) R/H SHEAR BOLTS AND PINS.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year
Mechanic/s			HRS				
Insp.	II/INSP		HRS				

TASK INSTRUCTIONS

Job Description

F. INSTALL THE SHEAR BOLTS AND SHEAR PINS AT CROSS BEAM ATTACHMENT AS PER AMM TASK 71-22-11-210-802-B:

NOTE: FOR L/H & R/H SHEAR BOLTS AND PINS, THERE ARE TWO TYPES (REF. SB: RA32071-164) REFER TO FIGURES IN AMM.

 MET.25478196	Task Card Title: NO. 2 ENGINE AFT MOUNT PINS INSP						
Task Card NO: 712213-01-1-002	Work Package: ASP/H-26 C7-CHK	A/C Registration: HZ-ASP					
(1) L/H SHEAR BOLTS AND PINS. (2) MID SHEAR BOLTS AND PINS. (3) R/H SHEAR BOLTS AND PINS.							
STEP COMPLETION SIGN OFF:							
	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
Mechanic/s	PP/ACFT_TECH		HRS		Day	Month	Year
Insp.	INSP/RII		HRS				
TASK CLOSE UP							
Job Description							
A. PERFORM CLOSE UP AS PER AMM TASK 71-22-11-210-802-B.							
STEP COMPLETION SIGN OFF:							
	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
Mechanic/s	PP/ACFT_TECH		HRS		Day	Month	Year
Insp.	INSP/II		HRS				
-Aircraft Maintenance Manual used: Revision No. _____ Dated. _____. Task card finding (Tick Applicable Box) [] Yes [] No. If yes update the system and list Task card finding WO below Work order No: _____ _____ Note: Make sure to create the finding Work Order on task card level. Remark's: _____ _____							



MET.25478196

Task Card Title:

NO. 2 ENGINE AFT MOUNT PINS INSP

Task Card NO:

712213-01-1-002

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

(1) If Task card interrupted or performed by different personals updates the system and update the following according (Tick Applicable Box)

- Interruption No. 1 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 2 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 3 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 4 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 5 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____

(2) Record any dimension or torque through the performed steps and sign-off as applicable:

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____

**Task Completion Close Up And
System Update**

Station**Date****Signature**

 MET.28342477		Task Card Title: PRE C-CHK PRESERVATION ON ENG#1 OIL					
Task Card NO: 72-00-00-25-0-SVA-001		Work Package: ASP/H-26 C7-CHK		A/C Registration: HZ-ASP			
A/C Type: 321		Block Taskcard		Main Skill: ACFT_TECH,AP		PROD Final Acceptance:	
Project No: 01BASPC72608		Related Task Card:		A/C Area: 01			
Internal Check:		Check Type:		Work Order NO: 31956352		Tally Sequence NO: 306	
ENCLOSURE: ☐ CMR: ☐ CPCP: ☐ ETOPS: ☐ CDCCL: ☐ AD: ☐ ALI: ☐							
Type Code:		Special Code: AP		MSG Code: 4		Request:	
Phase: OPS/LK							
I HEREBY CERTIFY THAT ALL WARNINGS AND CAUTIONS HAVE BEEN READ AND THE WORK HAS BEEN CARRID OUT IN ACCORDING WITH ALL LAID DOWN PROCEDURES, ATTACHED NOTES AND INFORMATION.							
Zones: 400							
DOCUMENT REFERENCES:							
Doc Typ		Reference					
AMM		72-00-00-600-025-A					
CAP		S72-C10011.pdf					
ACCESS PANELS:							
MATERIAL REQUIREMENTS:							
Part Number		Description				Qty.	
MIL-D-3464		SILICA GEL DESSICANT BAGS ,BSG500				1.0	
MIL-PRF-6085		OIL				1.0	
TOOLING REQUIREMENTS:							
Part Number		Description				Qty.	
No tools assigned to this Task Item							
TASK INSTRUCTIONS							
Job Description							
NOTE: (1) THIS TASK SHOULD BE DONE BEFORE C-CHK OR AT THE FIRST DAY OF C-CHK. (2) THE PRESERVATION PROCEDURE MUST PERFORMED AT THE END OF ENGINE OPERATION OR NOT EARLIER THAN ONE DAY BEFORE AN ENGINE RETURN TO SHOP, WHEN THE ENGINE MUST NOT OPERATE FOR A PERIOD UP TO 90 DAYS. (3) THIS PROCEDURE IS ONLY APPLICABLE TO ON-WING INSTALLED ENGINES. A. PERFORM OPERABLE ENGINE PRESERVATION - PERIOD OF UP TO 90 DAYS OR OPERABLE ENGINE PRESERVATION ONE DAY BEFORE THE PRESERVATION PLAN-PERIOD OF UP TO 90 DAYS AS PER AMM TASK 72-00-00-600-025-A.							
STEP COMPLETION SIGN OFF:							
Qualification / Skill		Number of employees		Duration		Number./Signature	
Date							
Day Month Year							
Mechanic/s		ACFT_TECH/AP		HRS			
Insp.				HRS			



MET.28342477

Task Card Title:

PRE C-CHK PRESERVATION ON ENG#1 OIL

Task Card NO:

72-00-00-25-0-SVA-001

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

-Aircraft Maintenance Manual used: Revision No. _____ Dated. _____.

Task card finding (Tick Applicable Box) [] Yes [] No. If yes update the system and list Task card finding WO below

Work order No: _____

Note: Make sure to create the finding Work Order on task card level.

Remark's: _____

(1) If Task card interrupted or performed by different persons updates the system and update the following accordingly (Tick Applicable Box)

- Interruption No. 1 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

- Interruption No. 2 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

- Interruption No. 3 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

- Interruption No. 4 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

- Interruption No. 5 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

(2) Record any dimension or torque through the performed steps and sign-off as applicable:

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

**Task Completion Close Up And
System Update****Station****Date****Signature**

 MET.28342165		Task Card Title: PRE C-CHK PRESERVATION ON ENG#2 OIL					
Task Card NO: 72-00-00-25-0-SVA-002		Work Package: ASP/H-26 C7-CHK		A/C Registration: HZ-ASP			
A/C Type: 321		Block Taskcard		Main Skill: ACFT_TECH,AP		PROD Final Acceptance:	
Project No: 01BASPC72608		Related Task Card:		A/C Area: 01			
Internal Check:		Check Type:		Work Order NO: 31956352		Tally Sequence NO: 307	
ENCLOSURE: ☐ CMR: ☐ CPCP: ☐ ETOPS: ☐ CDCCL: ☐ AD: ☐ ALI: ☐							
Type Code:		Special Code: AP		MSG Code: 4		Request:	
Phase: OPS/LK							
I HEREBY CERTIFY THAT ALL WARNINGS AND CAUTIONS HAVE BEEN READ AND THE WORK HAS BEEN CARRIED OUT IN ACCORDING WITH ALL LAID DOWN PROCEDURES, ATTACHED NOTES AND INFORMATION.							
Zones: 400							
DOCUMENT REFERENCES:							
Doc Typ		Reference					
AMM		72-00-00-600-025-A					
CAP		S72-C10011.pdf					
ACCESS PANELS:							
MATERIAL REQUIREMENTS:							
Part Number		Description				Qty.	
MIL-D-3464		SILICA GEL DESSICANT BAGS ,BSG500				1.0	
MIL-PRF-6085		OIL				1.0	
TOOLING REQUIREMENTS:							
Part Number		Description				Qty.	
No tools assigned to this Task Item							
TASK INSTRUCTIONS							
Job Description							
NOTE: (1) THIS TASK SHOULD BE DONE BEFORE C-CHK OR AT THE FIRST DAY OF C-CHK. (2) THE PRESERVATION PROCEDURE MUST PERFORMED AT THE END OF ENGINE OPERATION OR NOT EARLIER THAN ONE DAY BEFORE AN ENGINE RETURN TO SHOP, WHEN THE ENGINE MUST NOT OPERATE FOR A PERIOD UP TO 90 DAYS. (3) THIS PROCEDURE IS ONLY APPLICABLE TO ON-WING INSTALLED ENGINES. A. PERFORM OPERABLE ENGINE PRESERVATION - PERIOD OF UP TO 90 DAYS OR OPERABLE ENGINE PRESERVATION ONE DAY BEFORE THE PRESERVATION PLAN-PERIOD OF UP TO 90 DAYS AS PER AMM TASK 72-00-00-600-025-A.							
STEP COMPLETION SIGN OFF:							
Qualification / Skill		Number of employees		Duration		Number./Signature	
Date							
Day Month Year							
Mechanic/s		ACFT_TECH/AP		HRS			
Insp.				HRS			



MET.28342165

Task Card Title:

PRE C-CHK PRESERVATION ON ENG#2 OIL

Task Card NO:

72-00-00-25-0-SVA-002

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

-Aircraft Maintenance Manual used: Revision No. _____ Dated. _____.

Task card finding (Tick Applicable Box) [] Yes [] No. If yes update the system and list Task card finding WO below

Work order No: _____

Note: Make sure to creat the finding Work Order on task card level.

Remark's: _____

(1) If Task card interrupted or performed by different personals updates the system and update the following accord (Tick Applicable Box)

- Interruption No. 1 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

- Interruption No. 2 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

- Interruption No. 3 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

- Interruption No. 4 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

- Interruption No. 5 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

(2) Record any dimension or torque through the performed steps and sign-off as applicable:

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

**Task Completion Close Up And
System Update****Station****Date****Signature**

 MET.28342229		Task Card Title: DEPERSERVATION OF ENG# 1 POST C-CHK							
Task Card NO: 72-00-00-27-0-SVA-001		Work Package: ASP/H-26 C7-CHK			A/C Registration: HZ-ASP				
A/C Type: 321		Block Taskcard		Main Skill: ACFT_TECH,AP		PROD Final Acceptance:			
Project No: 01BASPC72608		Related Task Card:		A/C Area: 01					
Internal Check:		Check Type:		Work Order NO: 31956352		Tally Sequence NO: 308			
ENCLOSURE: ☐ CMR: ☐ CPCP: ☐ ETOPS: ☐ CDCCL: ☐ AD: ☐ ALI: ☐									
Type Code:		Special Code: AP		MSG Code: 4		Request:			
Phase: OPS/LK									
I HEREBY CERTIFY THAT ALL WARNINGS AND CAUTIONS HAVE BEEN READ AND THE WORK HAS BEEN CARRID OUT IN ACCORDING WITH ALL LAID DOWN PROCEDURES, ATTACHED NOTES AND INFORMATION.									
Zones: 400									
DOCUMENT REFERENCES:									
Doc Typ		Reference							
AMM		72-00-00-600-027-A							
CAP		S72-C10011.pdf							
ACCESS PANELS:									
MATERIAL REQUIREMENTS:									
Part Number		Description				Qty.			
No parts assigned to this Task Item									
TOOLING REQUIREMENTS:									
Part Number		Description				Qty.			
No tools assigned to this Task Item									
TASK INSTRUCTIONS									
Job Description									
NOTE: (1) THIS TASK SHOULD BE DONE AT THE END OF C-CHK. (2) THIS IS A POST-CHECK TASK AND CAN'T BE DONE THE SAME DAY WITH TC'S# 72-00-00-25-0-SVA-001 AS IS A PRE-CHECK TASK. A. PERFORM NO. 1 ENG DEPRESERVATION AS PER AMM TASK 72-00-00-600-027-A.									
STEP COMPLETION SIGN OFF:									
		Qualification / Skill	Number of employees	Duration		Number./Signature	Date		
							Day	Month	Year
Mechanic/s		ACFT_TECH/AP			HRS				
Insp.					HRS				



MET.28342229

Task Card Title:

DEPERSERVATION OF ENG# 1 POST C-CHK

Task Card NO:

72-00-00-27-0-SVA-001

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

-Aircraft Maintenance Manual used: Revision No. _____ Dated. _____.

Task card finding (Tick Applicable Box) [] Yes [] No. If yes update the system and list Task card finding WO below

Work order No: _____

Note: Make sure to creat the finding Work Order on task card level.

Remark's: _____

(1) If Task card interrupted or performed by different personals updates the system and update the following accord (Tick Applicable Box)

- Interruption No. 1 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

- Interruption No. 2 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

- Interruption No. 3 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

- Interruption No. 4 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

- Interruption No. 5 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

(2) Record any dimension or torque through the performed steps and sign-off as applicable:

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

**Task Completion Close Up And
System Update****Station****Date****Signature**

 MET.28342218		Task Card Title: DEPERSERVATION OF ENG# 2 POST C-CHK										
Task Card NO: 72-00-00-27-0-SVA-002		Work Package: ASP/H-26 C7-CHK			A/C Registration: HZ-ASP							
A/C Type: 321		Block Taskcard		Main Skill: ACFT_TECH,AP		PROD Final Acceptance:						
Project No: 01BASPC72608		Related Task Card:		A/C Area: 02								
Internal Check:		Check Type:		Work Order NO: 31956352		Tally Sequence NO: 309						
ENCLOSURE: ☐ CMR: ☐ CPCP: ☐ ETOPS: ☐ CDCCL: ☐ AD: ☐ ALI: ☐												
Type Code:		Special Code: AP		MSG Code: 4		Request:						
Phase: OPS/LK												
I HEREBY CERTIFY THAT ALL WARNINGS AND CAUTIONS HAVE BEEN READ AND THE WORK HAS BEEN CARRID OUT IN ACCORDING WITH ALL LAID DOWN PROCEDURES, ATTACHED NOTES AND INFORMATION.												
Zones: 400												
DOCUMENT REFERENCES:												
Doc Typ		Reference										
AMM		72-00-00-600-027-A										
CAP		S72-C10011.pdf										
ACCESS PANELS:												
MATERIAL REQUIREMENTS:												
Part Number		Description				Qty.						
No parts assigned to this Task Item												
TOOLING REQUIREMENTS:												
Part Number		Description				Qty.						
No tools assigned to this Task Item												
TASK INSTRUCTIONS												
Job Description												
NOTE: (1) THIS TASK SHOULD BE DONE AT THE END OF C-CHK. (2) THIS IS A POST-CHECK TASK AND CAN'T BE DONE THE SAME DAY WITH TC'S# 72-00-00-25-0-SVA-001 AS IS A PRE-CHECK TASK. A. PERFORM NO. 2 ENG DEPRESERVATION AS PER AMM TASK 72-00-00-600-027-A.												
STEP COMPLETION SIGN OFF:												
		Qualification / Skill		Number of employees		Duration		Number./Signature		Date		
Mechanic/s		ACFT_TECH/AP				HRS						
Insp.						HRS						



MET.28342218

Task Card Title:

DEPERSERVATION OF ENG# 2 POST C-CHK

Task Card NO:

72-00-00-27-0-SVA-002

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

-Aircraft Maintenance Manual used: Revision No. _____ Dated. _____.

Task card finding (Tick Applicable Box) [] Yes [] No. If yes update the system and list Task card finding WO below

Work order No: _____

Note: Make sure to creat the finding Work Order on task card level.

Remark's: _____

(1) If Task card interrupted or performed by different personals updates the system and update the following accord (Tick Applicable Box)

- Interruption No. 1 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

- Interruption No. 2 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

- Interruption No. 3 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

- Interruption No. 4 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

- Interruption No. 5 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

(2) Record any dimension or torque through the performed steps and sign-off as applicable:

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

**Task Completion Close Up And
System Update****Station****Date****Signature**

 MET.19890151		Task Card Title: NO.1 ENGINE BLOCKER DOOR SEALS INSP					
Task Card NO: 783000-C2-1-001		Work Package: ASP/H-26 C7-CHK		A/C Registration: HZ-ASP			
A/C Type: 321		Block Taskcard		Main Skill: PP,INSP,II,ACFT_TECH		PROD Final Acceptance:	
Project No: 01BASPC72608		Related Task Card:		A/C Area: 01			
Internal Check:		Check Type:		Work Order NO: 31956352		Tally Sequence NO: 310	
ENCLOSURE: ☐ CMR: ☐ CPCP: ☐ ETOPS: ☐ CDCCL: ☐ AD: ☐ ALI: ☐							
Type Code: GVI		Special Code: INSP		MSG Code: LUR, 9, MRB		Request: JOB SETUP, INSPECTION, JOB-CLOSEUP	
I HEREBY CERTIFY THAT ALL WARNINGS AND CAUTIONS HAVE BEEN READ AND THE WORK HAS BEEN CARRIED OUT IN ACCORDING WITH ALL LAID DOWN PROCEDURES, ATTACHED NOTES AND INFORMATION.							
Zones: 450							
DOCUMENT REFERENCES:							
Doc Typ		Reference					
AMM		78-32-41-210-042-B					
ACCESS PANELS:							
437AL, 438AR							
MATERIAL REQUIREMENTS:							
Part Number		Description				Qty.	
NO PARTS ASSIGNED TO THIS TASK							
TOOLING REQUIREMENTS:							
Part Number		Description				Qty.	
HIX3005		SAFETY SLEEVE-PIVOTING DOOR ACTUATOR				1.0	
JOB SET UP							
Job Description							
A. PREPARE FOR ENGINE BLOCKER DOOR INSPECTION AS PER AMM TASK 78-32-41-210-042-B.							
STEP COMPLETION SIGN OFF:							
Qualification / Skill		Number of employees		Duration		Number./Signature	
Date							
Day Month Year							
Mechanic/s		PP/ACFT_TECH		HRS			
Insp.				HRS			
TASK PROCEDURE							
Job Description							
A. PERFORM GENERAL VISUAL INSPECTION OF THE ENGINE BLOCKER DOOR SEAL FOR DAMAGE, MISSING PARTS AND CUT AS PER AMM TASK 78-32-41-210-042-B.							
STEP COMPLETION SIGN OFF:							
Qualification / Skill		Number of employees		Duration		Number./Signature	
Date							
Day Month Year							

 MET.19890151	Task Card Title: NO.1 ENGINE BLOCKER DOOR SEALS INSP						
Task Card NO: 783000-C2-1-001		Work Package: ASP/H-26 C7-CHK			A/C Registration: HZ-ASP		
Mechanic/s				HRS			
Insp.	INSP/II			HRS			
CLOSE UP							
Job Description							
A. RETURN THE AIRCRAFT BACK TO NORMAL CONFIGURATION AS PER AMM TASK 78-32-41-210-042-B.							
STEP COMPLETION SIGN OFF:							
	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year
Mechanic/s	PP/ACFT_TECH			HRS			
Insp.				HRS			
-Aircraft Maintenance Manual used: Revision No. _____ Dated._____. Task card finding (Tick Applicable Box) [☐] Yes [☐] No. If yes update the system and list Task card finding WO below Work order No: _____ _____ Note: Make sure to creat the finding Work Order on task card level. Remark's: _____ _____							



MET.19890151

Task Card Title:

NO.1 ENGINE BLOCKER DOOR SEALS INSP

Task Card NO:

783000-C2-1-001

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

(1) If Task card interrupted or performed by different personals updates the system and update the following accordingly (Tick Applicable Box)

- Interruption No. 1 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 2 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 3 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 4 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 5 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____

(2) Record any dimension or torque through the performed steps and sign-off as applicable:

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____

**Task Completion Close Up And
System Update**

Station**Date****Signature**

 MET.19891043		Task Card Title: NO.2 ENGINE BLOCKER DOOR SEALS INSP					
Task Card NO: 783000-C2-1-002		Work Package: ASP/H-26 C7-CHK		A/C Registration: HZ-ASP			
A/C Type: 321		Block Taskcard		Main Skill: PP,II,INSP,ACFT_TECH		PROD Final Acceptance:	
Project No: 01BASPC72608		Related Task Card:		A/C Area: 02			
Internal Check:		Check Type:		Work Order NO: 31956352		Tally Sequence NO: 311	
ENCLOSURE: ☐ CMR: ☐ CPCP: ☐ ETOPS: ☐ CDCCL: ☐ AD: ☐ ALI: ☐							
Type Code: GVI		Special Code: INSP		MSG Code: MRB, LUR, 9		Request: JOB SETUP, INSPECTION, JOB-CLOSEUP	
I HEREBY CERTIFY THAT ALL WARNINGS AND CAUTIONS HAVE BEEN READ AND THE WORK HAS BEEN CARRIED OUT IN ACCORDING WITH ALL LAID DOWN PROCEDURES, ATTACHED NOTES AND INFORMATION.							
Zones: 460							
DOCUMENT REFERENCES:							
Doc Typ		Reference					
AMM		78-32-41-210-042-B					
ACCESS PANELS:							
447AL, 448AR							
MATERIAL REQUIREMENTS:							
Part Number		Description				Qty.	
NO PARTS ASSIGNED TO THIS TASK							
TOOLING REQUIREMENTS:							
Part Number		Description				Qty.	
HIX3005		SAFETY SLEEVE-PIVOTING DOOR ACTUATOR				1.0	
JOB SET UP							
Job Description							
A. PREPARE FOR ENGINE BLOCKER DOOR INSPECTION AS PER AMM TASK 78-32-41-210-042-B.							
STEP COMPLETION SIGN OFF:							
	Qualification / Skill	Number of employees	Duration		Number./Signature	Date	
				HRS		Day Month Year	
Mechanic/s	PP/ACFT_TECH			HRS			
Insp.				HRS			
TASK PROCEDURE							
Job Description							
A. PERFORM GENERAL VISUAL INSPECTION OF THE ENGINE BLOCKER DOOR SEAL FOR DAMAGE, MISSING PARTS AND CUT AS PER AMM TASK 78-32-41-210-042-B.							
STEP COMPLETION SIGN OFF:							
	Qualification / Skill	Number of employees	Duration		Number./Signature	Date	
						Day Month Year	

 MET.19891043	Task Card Title: NO.2 ENGINE BLOCKER DOOR SEALS INSP						
Task Card NO: 783000-C2-1-002		Work Package: ASP/H-26 C7-CHK		A/C Registration: HZ-ASP			
Mechanic/s				HRS			
Insp.	II/INSP			HRS			
CLOSE UP							
Job Description							
A. RETURN THE AIRCRAFT BACK TO NORMAL CONFIGURATION AS PER AMM TASK 78-32-41-210-042-B.							
STEP COMPLETION SIGN OFF:							
	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year
Mechanic/s	PP/ACFT_TECH			HRS			
Insp.				HRS			
-Aircraft Maintenance Manual used: Revision No. _____ Dated._____. Task card finding (Tick Applicable Box) [☐] Yes [☐] No. If yes update the system and list Task card finding WO below Work order No: _____ _____ Note: Make sure to creat the finding Work Order on task card level. Remark's: _____ _____							



MET.19891043

Task Card Title:

NO.2 ENGINE BLOCKER DOOR SEALS INSP

Task Card NO:

783000-C2-1-002

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

(1) If Task card interrupted or performed by different personals updates the system and update the following accordingly (Tick Applicable Box)

- Interruption No. 1 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 2 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 3 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 4 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 5 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____

(2) Record any dimension or torque through the performed steps and sign-off as applicable:

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____

**Task Completion Close Up And
System Update**

Station**Date****Signature**

 MET.25480102		Task Card Title: NO.1 ENG T/R TENSION HOK&AJCNT INSP					
Task Card NO: 783000-C4-1-001		Work Package: ASP/H-26 C7-CHK		A/C Registration: HZ-ASP			
A/C Type: 321		Block Taskcard		Main Skill: PP,INSP,II,ACFT_TECH		PROD Final Acceptance:	
Project No: 01BASPC72608		Related Task Card:		A/C Area: 01			
Internal Check:		Check Type:		Work Order NO: 31956352		Tally Sequence NO: 312	
ENCLOSURE: ☐ CMR: ☐ CPCP: ☐ ETOPS: ☐ CDCCL: ☐ AD: ☐ ALI: ☐							
Type Code: GVI		Special Code: INSP		MSG Code: MRB, 8		Request: JOB-SETUP,INSPECTION, JOB-CLOSEUP	
I HEREBY CERTIFY THAT ALL WARNINGS AND CAUTIONS HAVE BEEN READ AND THE WORK HAS BEEN CARRIED OUT IN ACCORDING WITH ALL LAID DOWN PROCEDURES, ATTACHED NOTES AND INFORMATION.							
Zones: 450							
DOCUMENT REFERENCES:							
Doc Typ		Reference					
AMM		78-36-41-210-040-B					
ACCESS PANELS:							
437AL, 438AR, 451AL, 452AR							
MATERIAL REQUIREMENTS:							
Part Number		Description				Qty.	
No parts assigned to this Task Item							
TOOLING REQUIREMENTS:							
Part Number		Description				Qty.	
No tools assigned to this Task Item							
NO. 1 ENG T/R HALF TENSION HOOK AND ADJACENT STRUCTURE INSPECTION							
Job Description							
A. PREPARE FOR THRUST REVERSER HALF TENSION HOOK AND ADJACENT STRUCTURE INSPECTION AS PER AMM TASK 78-36-41-210-040B.							
STEP COMPLETION SIGN OFF:							
Qualification / Skill		Number of employees		Duration		Number./Signature	
Mechanic/s		PP/ACFT_TECH		HRS		Date	
						Day Month Year	



Task Card Title:

NO.1 ENG T/R TENSION HOK&AJCNT INSP



Task Card NO:

783000-C4-1-001

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

Insp.

HRS

Job Description

B. PERFORM GENERAL VISUAL INSPECTION OF THE THRUST REVERSER HALF TENTION HOOK ANDADJACENT STRUCTURE AS PER AMM TASK 78-36-41-210-040B.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year
Mechanic/s			HRS				
Insp.	INSP/II		HRS				

Job Description

C. RETURN THE AIRCRAFT BACK TO NORMAL CONFIGURATION AS PER AMM TASK 78-36-41-210-040B.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year
Mechanic/s	PP/ACFT_TECH		HRS				
Insp.			HRS				

-Aircraft Maintenance Manual used: Revision No. _____ Dated. _____.

Task card finding (Tick Applicable Box) [] Yes [] No. If yes update the system and list Task card finding WO below

Work order No: _____

Note: Make sure to creat the finding Work Order on task card level.

Remark's: _____



MET.25480102

Task Card Title:

NO.1 ENG T/R TENSION HOK&AJCNT INSP

Task Card NO:

783000-C4-1-001

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

(1) If Task card interrupted or performed by different personals updates the system and update the following according (Tick Applicable Box)

- Interruption No. 1 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 2 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 3 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 4 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 5 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____

(2) Record any dimension or torque through the performed steps and sign-off as applicable:

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____

**Task Completion Close Up And
System Update**

Station**Date****Signature**

 MET.25478089		Task Card Title: NO.2 ENG T/R TENSSION HOK AJCNT INSP						
Task Card NO: 783000-C4-1-002		Work Package: ASP/H-26 C7-CHK		A/C Registration: HZ-ASP				
A/C Type: 321		Block Taskcard		Main Skill: PP,II,INSP,ACFT_TECH		PROD Final Acceptance:		
Project No: 01BASPC72608		Related Task Card:		A/C Area: 02				
Internal Check:		Check Type:		Work Order NO: 31956352		Tally Sequence NO: 313		
ENCLOSURE: ☐ CMR: ☐ CPCP: ☐ ETOPS: ☐ CDCCL: ☐ AD: ☐ ALI: ☐								
Type Code: GVI		Special Code: INSP		MSG Code: MRB, 8		Request: JOB-SETUP,INSPECTION, JOB-CLOSEUP		
I HEREBY CERTIFY THAT ALL WARNINGS AND CAUTIONS HAVE BEEN READ AND THE WORK HAS BEEN CARRID OUT IN ACCORDING WITH ALL LAID DOWN PROCEDURES, ATTACHED NOTES AND INFORMATION.								
Zones: 460								
DOCUMENT REFERENCES:								
Doc Typ		Reference						
AMM		78-36-41-210-040-B						
AMM		783641-210-040						
ACCESS PANELS:								
447AL, 448AR, 461AL, 462AR								
MATERIAL REQUIREMENTS:								
Part Number		Description				Qty.		
No parts assigned to this Task Item								
TOOLING REQUIREMENTS:								
Part Number		Description				Qty.		
No tools assigned to this Task Item								
NO. 2 ENG T/R HALF TENTION HOOK AND ADJACENT STRUCTURE INSPECTION								
Job Description								
A. PREPARE FOR THRUST REVERSER HALF TENTION HOOK AND ADJACENT STRUCTURE INSPECTION AS PER AMM TASK 78-36-41-210-040B.								
STEP COMPLETION SIGN OFF:								
	Qualification / Skill	Number of employees	Duration		Number./Signature	Date		
						Day	Month	Year
Mechanic/s	PP/ACFT_TECH			HRS				



MET.25478089

Task Card Title:

NO.2 ENG T/R TENSSION HOK AJCNT INSP



Task Card NO:

783000-C4-1-002

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

Insp.

HRS

Job Description

B. PERFORM GENERAL VISUAL INSPECTION OF THE THRUST REVERSER HALF TENTION HOOK ANDADJACENT STRUCTURE AS PER AMM TASK 78-36-41-210-040B.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year
Mechanic/s			HRS				
Insp.	II/INSP		HRS				

Job Description

C. RETURN THE AIRCRAFT BACK TO NORMAL CONFIGURATION AS PER AMM TASK 78-36-41-210-040B.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year
Mechanic/s	PP/ACFT_TECH		HRS				
Insp.			HRS				

-Aircraft Maintenance Manual used: Revision No. _____ Dated. _____.

Task card finding (Tick Applicable Box) ☐ Yes ☐ No. If yes update the system and list Task card finding WO below

Work order No: _____

Note: Make sure to creat the finding Work Order on task card level.

Remark's: _____



MET.25478089

Task Card Title:

NO.2 ENG T/R TENSSION HOK AJCNT INSP



Task Card NO:

783000-C4-1-002

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

(1) If Task card interrupted or performed by different personals updates the system and update the following accord (Tick Applicable Box)

- Interruption No. 1 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 2 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 3 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 4 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 5 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____

(2) Record any dimension or torque through the performed steps and sign-off as applicable:

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____

Task Completion Close Up And
System Update

Station

Date

Signature

 MET.25479266		Task Card Title: NO.1 ENGINE ACTU SECONDARY LOCK INSP					
Task Card NO: 783100-C6-1-001		Work Package: ASP/H-26 C7-CHK		A/C Registration: HZ-ASP			
A/C Type: 321		Block Taskcard		Main Skill: PP,ACFT_TECH		PROD Final Acceptance:	
Project No: 01BASPC72608		Related Task Card:		A/C Area: 01			
Internal Check:		Check Type:		Work Order NO: 31956352		Tally Sequence NO: 314	
ENCLOSURE: ☐ CMR: ☐ CPCP: ☐ ETOPS: ☐ CDCCL: ☐ AD: ☐ ALI: ☐							
Type Code: OPC		Special Code: PP		MSG Code: LUR, 8, MRB		Request: Phase: JOB SETUP, OPS/LK, JOB -CLOSEUP	
I HEREBY CERTIFY THAT ALL WARNINGS AND CAUTIONS HAVE BEEN READ AND THE WORK HAS BEEN CARRID OUT IN ACCORDING WITH ALL LAID DOWN PROCEDURES, ATTACHED NOTES AND INFORMATION.							
Zones: 450							
DOCUMENT REFERENCES:							
Doc Typ		Reference					
AMM		78-31-41-720-040-B					
AMM		783141-720-040					
ACCESS PANELS:							
437AL, 438AR							
MATERIAL REQUIREMENTS:							
Part Number		Description				Qty.	
No parts assigned to this Task Item							
TOOLING REQUIREMENTS:							
Part Number		Description				Qty.	
No tools assigned to this Task Item							
JOB SET UP							
Job Description							
A. PREPARE FOR THE ENGINE ACTUATOR SECONDARY LOCK MECHANISM OPERATIONAL TEST AS PER AMM TASK 78-31-41-720-040-B.							
STEP COMPLETION SIGN OFF:							
	Qualification / Skill	Number of employees	Duration		Number./Signature	Date	
				HRS		Day	Month
Mechanic/s	PP/ACFT_TECH			HRS			
Insp.				HRS			
TASK PROCEDURE							
Job Description							
A. PERFORM AN OPERATIONAL TEST OF THE ENGINE ACTUATOR SECONDARY LOCK MECHANISM AS PER AMM TASK 78-31-41-720-040-B.							
STEP COMPLETION SIGN OFF:							
	Qualification / Skill	Number of employees	Duration		Number./Signature	Date	
						Day	Month

 MET.25479266	Task Card Title: NO.1 ENGINE ACTU SECONDARY LOCK INSP						
Task Card NO: 783100-C6-1-001		Work Package: ASP/H-26 C7-CHK		A/C Registration: HZ-ASP			
Mechanic/s	PP/ACFT_TECH			HRS			
Insp.				HRS			
CLOSE UP							
Job Description							
A. RETURN THE AIRCRAFT BACK TO NORMAL CONFIGURATION AS PER AMM TASK 78-31-41-720-040-B.							
STEP COMPLETION SIGN OFF:							
Mechanic/s	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year
Mechanic/s	PP/ACFT_TECH		HRS				
Insp.			HRS				
-Aircraft Maintenance Manual used: Revision No. _____ Dated. _____. Task card finding (Tick Applicable Box) [☐] Yes [☐] No. If yes update the system and list Task card finding WO below Work order No: _____ _____ Note: Make sure to creat the finding Work Order on task card level. Remark's: _____ _____							



MET.25479266

Task Card Title:

NO.1 ENGINE ACTU SECONDARY LOCK INSP

Task Card NO:

783100-C6-1-001

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

(1) If Task card interrupted or performed by different personals updates the system and update the following according (Tick Applicable Box)

- Interruption No. 1 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 2 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 3 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 4 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 5 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____

(2) Record any dimension or torque through the performed steps and sign-off as applicable:

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____

**Task Completion Close Up And
System Update**

Station**Date****Signature**

 MET.19891153		Task Card Title: NO.2 ENGINE ACTU SECONDARY LOCK INSP					
Task Card NO: 783100-C6-1-002		Work Package: ASP/H-26 C7-CHK		A/C Registration: HZ-ASP			
A/C Type: 321		Block Taskcard		Main Skill: PP,ACFT_TECH		PROD Final Acceptance:	
Project No: 01BASPC72608		Related Task Card:		A/C Area: 02			
Internal Check:		Check Type:		Work Order NO: 31956352		Tally Sequence NO: 315	
ENCLOSURE: ☐ CMR: ☐ CPCP: ☐ ETOPS: ☐ CDCCL: ☐ AD: ☐ ALI: ☐							
Type Code: OPC		Special Code: PP		MSG Code: 8, MRB, LUR		Request: Phase: JOB SETUP, OPS/LK, JOB -CLOSEUP	
I HEREBY CERTIFY THAT ALL WARNINGS AND CAUTIONS HAVE BEEN READ AND THE WORK HAS BEEN CARRID OUT IN ACCORDING WITH ALL LAID DOWN PROCEDURES, ATTACHED NOTES AND INFORMATION.							
Zones: 460							
DOCUMENT REFERENCES:							
Doc Typ		Reference					
AMM		78-31-41-720-040-B					
ACCESS PANELS:							
447AL, 448AR							
MATERIAL REQUIREMENTS:							
Part Number		Description				Qty.	
No parts assigned to this Task Item							
TOOLING REQUIREMENTS:							
Part Number		Description				Qty.	
No tools assigned to this Task Item							
JOB SET UP							
Job Description							
A. PREPARE FOR THE ENGINE ACTUATOR SECONDARY LOCK MECHANISM OPERATIONAL TEST AS PER AMM TASK 78-31-41-720-040-B.							
STEP COMPLETION SIGN OFF:							
	Qualification / Skill	Number of employees	Duration		Number./Signature	Date	
				HRS		Day	Month
Mechanic/s	PP/ACFT_TECH			HRS			
Insp.				HRS			
TASK PROCEDURE							
Job Description							
A. PERFORM AN OPERATIONAL TEST OF THE ENGINE ACTUATOR SECONDARY LOCK MECHANISM AS PER AMM TASK 78-31-41-720-040-B.							
STEP COMPLETION SIGN OFF:							
	Qualification / Skill	Number of employees	Duration		Number./Signature	Date	
				HRS		Day	Month
Mechanic/s	PP/ACFT_TECH			HRS			

 MET.19891153	Task Card Title: NO.2 ENGINE ACTU SECONDARY LOCK INSP						
Task Card NO: 783100-C6-1-002		Work Package: ASP/H-26 C7-CHK		A/C Registration: HZ-ASP			
Insp.				HRS			
CLOSE UP							
Job Description							
A. RETURN THE AIRCRAFT BACK TO NORMAL CONFIGURATION AS PER AMM TASK 78-31-41-720-040-B.							
STEP COMPLETION SIGN OFF:							
	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year
Mechanic/s	PP/ACFT_TECH			HRS			
Insp.				HRS			
-Aircraft Maintenance Manual used: Revision No. _____ Dated. _____. Task card finding (Tick Applicable Box) [☐] Yes [☐] No. If yes update the system and list Task card finding WO below Work order No: _____ _____ Note: Make sure to creat the finding Work Order on task card level. Remark's: _____ _____							



Task Card Title:

NO.2 ENGINE ACTU SECONDARY LOCK INSP

Task Card NO:

783100-C6-1-002

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

(1) If Task card interrupted or performed by different personals updates the system and update the following accord (Tick Applicable Box)

- Interruption No. 1 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 2 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 3 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 4 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 5 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____

(2) Record any dimension or torque through the performed steps and sign-off as applicable:

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____

**Task Completion Close Up And
System Update**

Station**Date****Signature**

 MET.28342304		Task Card Title: NO.1 ENG PRIMARY LATCH MECHNISM INSP					
Task Card NO: 783100-C7-1-001		Work Package: ASP/H-26 C7-CHK		A/C Registration: HZ-ASP			
A/C Type: 321		Block Taskcard		Main Skill: PP,INSP,II,ACFT_TECH		PROD Final Acceptance:	
Project No: 01BASPC72608		Related Task Card:		A/C Area: 01			
Internal Check:		Check Type:		Work Order NO: 31956352		Tally Sequence NO: 316	
ENCLOSURE: ☐ CMR: ☐ CPCP: ☐ ETOPS: ☐ CDCCL: ☐ AD: ☐ ALI: ☐							
Type Code: GVI		Special Code: INSP		MSG Code: SOEE, 6, MRB, LUR		Request: Phase:	
I HEREBY CERTIFY THAT ALL WARNINGS AND CAUTIONS HAVE BEEN READ AND THE WORK HAS BEEN CARRID OUT IN ACCORDING WITH ALL LAID DOWN PROCEDURES, ATTACHED NOTES AND INFORMATION.							
Zones: 437,438							
DOCUMENT REFERENCES:							
Doc Typ		Reference					
AMM		78-31-00-210-041-B					
AMM		783100-210-041					
DO		SOEE TR SA00ME2302736					
ACCESS PANELS:							
437AL, 438AR							
MATERIAL REQUIREMENTS:							
Part Number		Description				Qty.	
No parts assigned to this Task Item							
TOOLING REQUIREMENTS:							
Part Number		Description				Qty.	
No tools assigned to this Task Item							
TASK INSTRUCTIONS							
Job Description							
A. PREPARE FOR PRIMARY LATCH MECHANISM BLOCKER DOOR INSPECTION PER AMM TASK 78-31-00-210-041-B.							
STEP COMPLETION SIGN OFF:							
	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year
Mechanic/s	PP/ACFT_TECH		HRS				
Insp.			HRS				
TASK INSTRUCTIONS							
Job Description							
B. PERFORM GENERAL VISUAL INSPECTION OF THE PRIMARY LATCH MECHANISM PER AMM TASK 78-31-00-210-041-B.							
STEP COMPLETION SIGN OFF:							
	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year

 MET.28342304	Task Card Title: NO.1 ENG PRIMARY LATCH MECHNISM INSP						
Task Card NO: 783100-C7-1-001		Work Package: ASP/H-26 C7-CHK		A/C Registration: HZ-ASP			
Mechanic/s				HRS			
Insp.	INSP/II			HRS			
TASK INSTRUCTIONS							
Job Description							
C. RETURN THE AIRCRAFT BACK TO NORMAL CONFIGURATION PER AMM TASK 78-31-00-210-041-B.							
STEP COMPLETION SIGN OFF:							
	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year
Mechanic/s	PP/ACFT_TECH			HRS			
Insp.				HRS			
-Aircraft Maintenance Manual used: Revision No. _____ Dated. _____. Task card finding (Tick Applicable Box) [☐] Yes [☐] No. If yes update the system and list Task card finding WO below Work order No: _____ _____ Note: Make sure to creat the finding Work Order on task card level. Remark's: _____ _____							



MET.28342304

Task Card Title:

NO.1 ENG PRIMARY LATCH MECHNISM INSP

Task Card NO:

783100-C7-1-001

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

(1) If Task card interrupted or performed by different personals updates the system and update the following according (Tick Applicable Box)

- Interruption No. 1 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 2 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 3 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 4 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 5 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____

(2) Record any dimension or torque through the performed steps and sign-off as applicable:

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____

**Task Completion Close Up And
System Update**

Station**Date****Signature**

 MET.28342469		Task Card Title: NO.2 ENG PRIMARY LATCH MECHNISM INSP					
Task Card NO: 783100-C7-1-002		Work Package: ASP/H-26 C7-CHK		A/C Registration: HZ-ASP			
A/C Type: 321		Block Taskcard		Main Skill: PP,INSP,II,ACFT_TECH		PROD Final Acceptance:	
Project No: 01BASPC72608		Related Task Card:		A/C Area: 02			
Internal Check:		Check Type:		Work Order NO: 31956352		Tally Sequence NO: 317	
ENCLOSURE: ☐ CMR: ☐ CPCP: ☐ ETOPS: ☐ CDCCL: ☐ AD: ☐ ALI: ☐							
Type Code: GVI		Special Code: INSP		MSG Code: SOEE, 6, MRB, LUR		Request: JOB SETUP, INSPECTION, JOB-CLOSEUP	
I HEREBY CERTIFY THAT ALL WARNINGS AND CAUTIONS HAVE BEEN READ AND THE WORK HAS BEEN CARRIED OUT IN ACCORDING WITH ALL LAID DOWN PROCEDURES, ATTACHED NOTES AND INFORMATION.							
Zones: 447,448							
DOCUMENT REFERENCES:							
Doc Typ		Reference					
AMM		78-31-00-210-041-B					
DO		SOEE TR SA00ME2302736					
ACCESS PANELS:							
447AL, 448AR							
MATERIAL REQUIREMENTS:							
Part Number		Description				Qty.	
No parts assigned to this Task Item							
TOOLING REQUIREMENTS:							
Part Number		Description				Qty.	
No tools assigned to this Task Item							
TASK INSTRUCTIONS							
Job Description							
A. PREPARE FOR PRIMARY LATCH MECHANISM BLOCKER DOOR INSPECTION PER AMM TASK 78-31-00-210-041-B.							
STEP COMPLETION SIGN OFF:							
	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year
Mechanic/s	PP/ACFT_TECH		HRS				
Insp.			HRS				
TASK INSTRUCTIONS							
Job Description							
B. PERFORM GENERAL VISUAL INSPECTION OF THE PRIMARY LATCH MECHANISM PER AMM TASK 78-31-00-210-041-B.							
STEP COMPLETION SIGN OFF:							
	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year
Mechanic/s			HRS				

 MET.28342469	Task Card Title: NO.2 ENG PRIMARY LATCH MECHNISM INSP						
Task Card NO: 783100-C7-1-002		Work Package: ASP/H-26 C7-CHK		A/C Registration: HZ-ASP			
Insp.	INSP/II			HRS			
TASK INSTRUCTIONS							
Job Description							
C. RETURN THE AIRCRAFT BACK TO NORMAL CONFIGURATION PER AMM TASK 78-31-00-210-041-B.							
STEP COMPLETION SIGN OFF:							
	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year
Mechanic/s	PP/ACFT_TECH			HRS			
Insp.				HRS			
-Aircraft Maintenance Manual used: Revision No. _____ Dated. _____. Task card finding (Tick Applicable Box) [☐] Yes [☐] No. If yes update the system and list Task card finding WO below Work order No: _____ _____ _____ Note: Make sure to creat the finding Work Order on task card level. Remark's: _____ _____ _____							



MET.28342469

Task Card Title:

NO.2 ENG PRIMARY LATCH MECHNISM INSP



Task Card NO:

783100-C7-1-002

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

(1) If Task card interrupted or performed by different personals updates the system and update the following accord (Tick Applicable Box)

- Interruption No. 1 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 2 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 3 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 4 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 5 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____

(2) Record any dimension or torque through the performed steps and sign-off as applicable:

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____

**Task Completion Close Up And
System Update**

Station

Date

Signature

 MET.32721875		Task Card Title: NO. 1 ENG "C" DUCT HINGE FITTINGS INSP					
Task Card NO: 783200-01-1-001		Work Package: ASP/H-26 C7-CHK		A/C Registration: HZ-ASP			
A/C Type: 321		Block Taskcard		Main Skill: PP,INSP,II,AF,ACFT_TECH		PROD Final Acceptance:	
Project No: 01BASPC72608		Related Task Card:		A/C Area: 01			
Internal Check:		Check Type:		Work Order NO: 31956352		Tally Sequence NO: 318	
ENCLOSURE: ☐ CMR: ☐ CPCP: ☐ ETOPS: ☐ CDCCL: ☐ AD: ☐ ALI: ☐							
Type Code: GVI		Special Code: INSP		MSG Code: MRB		Request: JOB-SETUP,INSPECTION, JOB-CLOSEUP, JOB-CLOSEUP	
I HEREBY CERTIFY THAT ALL WARNINGS AND CAUTIONS HAVE BEEN READ AND THE WORK HAS BEEN CARRIED OUT IN ACCORDING WITH ALL LAID DOWN PROCEDURES, ATTACHED NOTES AND INFORMATION.							
Zones: 451,452							
DOCUMENT REFERENCES:							
Doc Typ		Reference					
AMM		78-32-00-210-045-B					
AMM		783200-210-045					
SSI		783200-01-5					
ACCESS PANELS:							
437AL, 438AR							
MATERIAL REQUIREMENTS:							
Part Number		Description				Qty.	
No parts assigned to this Task Item							
TOOLING REQUIREMENTS:							
Part Number		Description				Qty.	
No tools assigned to this Task Item							
TASK PREPARATION							
Job Description							
A. PREPARE FOR ENGINE "C" DUCT HINGE FITTINGS INSPECTION AS PER AMM TASK 78-32-00-210-045-B.							
STEP COMPLETION SIGN OFF:							
	Qualification / Skill	Number of employees	Duration		Number./Signature	Date	
						Day Month Year	
Mechanic/s	PP/ACFT_TECH			HRS			
Insp.				HRS			
TASK INSTRUCTIONS							
Job Description							
A. PERFORM A GENERAL VISUAL INSPECTION OF THE THRUST REVERSER DOOR HINGES AND ATTACHMENT HARDWARE AS PER AMM TASK 78-32-00-210-045-B.							



MET.32721875

Task Card Title:

NO. 1 ENG "C" DUCT HINGE FITTINGS INSP



Task Card NO:

783200-01-1-001

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration		Number./Signature	Date		
						Day	Month	Year
Mechanic/s				HRS				
Insp.	INSP/II			HRS				

TASK CLOSE UP

Job Description

A. OK TO INSTALL THRUST REVERSER HINGE ACCESS PANEL.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration		Number./Signature	Date		
						Day	Month	Year
Mechanic/s				HRS				
Insp.	INSP/II			HRS				

TASK CLOSE UP

Job Description

B. INSTALL THE HINGE ACCESS PANEL ATTACH AS PER AMM TASK 78-32-00-210-045-B.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration		Number./Signature	Date		
						Day	Month	Year
Mechanic/s	AF/ACFT_TECH			HRS				
Insp.	INSP/II			HRS				

TASK CLOSE UP

Job Description

C. RETURN THE AIRCRAFT BACK TO NORMAL CONFIGURATION AS PER AMM TASK 78-32-00-210-045-B.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration		Number./Signature	Date		
						Day	Month	Year
Mechanic/s	PP/ACFT_TECH			HRS				
Insp.				HRS				

-Aircraft Maintenance Manual used: Revision No. _____ Dated. _____.

Task card finding (Tick Applicable Box) [] Yes [] No. If yes update the system and list Task card finding WO below
Work order No: _____

Note: Make sure to creat the finding Work Order on task card level.

Remark's: _____



Task Card Title:

NO. 1 ENG "C" DUCT HINGE FITTINGS INSP

Task Card NO:

783200-01-1-001

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

(1) If Task card interrupted or performed by different personals updates the system and update the following according (Tick Applicable Box)

- Interruption No. 1 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 2 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 3 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 4 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 5 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____

(2) Record any dimension or torque through the performed steps and sign-off as applicable:

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____

**Task Completion Close Up And
System Update**

Station**Date****Signature**

 MET.32721862		Task Card Title: NO. 2 ENG "C" DUCT HINGE FITTINGS INSP					
Task Card NO: 783200-01-1-002		Work Package: ASP/H-26 C7-CHK		A/C Registration: HZ-ASP			
A/C Type: 321		Block Taskcard		Main Skill: PP,INSP,II,AF,ACFT_TECH		PROD Final Acceptance:	
Project No: 01BASPC72608		Related Task Card:		A/C Area: 02			
Internal Check:		Check Type:		Work Order NO: 31956352		Tally Sequence NO: 319	
ENCLOSURE: ☐ CMR: ☐ CPCP: ☐ ETOPS: ☐ CDCCL: ☐ AD: ☐ ALI: ☐							
Type Code: GVI		Special Code: INSP		MSG Code: MRB		Request: JOB-SETUP,INSPECTION, JOB-CLOSEUP, JOB-CLOSEUP	
I HEREBY CERTIFY THAT ALL WARNINGS AND CAUTIONS HAVE BEEN READ AND THE WORK HAS BEEN CARRIED OUT IN ACCORDING WITH ALL LAID DOWN PROCEDURES, ATTACHED NOTES AND INFORMATION.							
Zones: 461,462							
DOCUMENT REFERENCES:							
Doc Typ		Reference					
AMM		78-32-00-210-045-B					
AMM		783200-210-045					
SSI		SSI 783200-01-5					
ACCESS PANELS:							
447AL, 448AR							
MATERIAL REQUIREMENTS:							
Part Number		Description				Qty.	
No parts assigned to this Task Item							
TOOLING REQUIREMENTS:							
Part Number		Description				Qty.	
No tools assigned to this Task Item							
TASK PREPARATION							
Job Description							
A. PREPARE FOR ENGINE "C" DUCT HINGE FITTINGS INSPECTION AS PER AMM TASK 78-32-00-210-045-B.							
STEP COMPLETION SIGN OFF:							
	Qualification / Skill	Number of employees	Duration		Number./Signature	Date	
				HRS		Day	Month
Mechanic/s	PP/ACFT_TECH			HRS			
Insp.				HRS			
TASK INSTRUCTIONS							
Job Description							
A. PERFORM A GENERAL VISUAL INSPECTION OF THE THRUST REVERSER DOOR HINGES AND ATTACHMENT HARDWARE AS PER AMM TASK 78-32-00-210-045-B.							



Task Card Title:

NO. 2 ENG "C" DUCT HINGE FITTINGS INSP



Task Card NO:

783200-01-1-002

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration		Number./Signature	Date		
						Day	Month	Year
Mechanic/s				HRS				
Insp.	INSP/II			HRS				

TASK CLOSE UP

Job Description

A. OK TO INSTALL THRUST REVERSER HINGE ACCESS PANEL.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration		Number./Signature	Date		
						Day	Month	Year
Mechanic/s				HRS				
Insp.	INSP/II			HRS				

TASK CLOSE UP

Job Description

B. INSTALL THE HINGE ACCESS PANEL ATTACH AS PER AMM TASK 78-32-00-210-045-B.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration		Number./Signature	Date		
						Day	Month	Year
Mechanic/s	AF/ACFT_TECH			HRS				
Insp.	INSP/II			HRS				

TASK CLOSE UP

Job Description

C. RETURN THE AIRCRAFT BACK TO NORMAL CONFIGURATION AS PER AMM TASK 78-32-00-210-045-B.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration		Number./Signature	Date		
						Day	Month	Year
Mechanic/s	PP/ACFT_TECH			HRS				
Insp.				HRS				

-Aircraft Maintenance Manual used: Revision No. _____ Dated. _____.

Task card finding (Tick Applicable Box) [] Yes [] No. If yes update the system and list Task card finding WO below
Work order No: _____

Note: Make sure to creat the finding Work Order on task card level.

Remark's: _____



MET.32721862

Task Card Title:

NO. 2 ENG "C" DUCT HINGE FITTINGS INSP



Task Card NO:

783200-01-1-002

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

(1) If Task card interrupted or performed by different personals updates the system and update the following accord (Tick Applicable Box)

- Interruption No. 1 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 2 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 3 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 4 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 5 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____

(2) Record any dimension or torque through the performed steps and sign-off as applicable:

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____

**Task Completion Close Up And
System Update**

Station

Date

Signature

 MET.32721970		Task Card Title: DETAILED INSPECTION OF THRUST REVERSER V-GROOVE ADAPTER RING.					
Task Card NO: 783209-01-1		Work Package: ASP/H-26 C7-CHK		A/C Registration: HZ-ASP			
A/C Type: 321		Block Taskcard		Main Skill: PP,INSP,II,ACFT_TECH		PROD Final Acceptance:	
Project No: 01BASPC72608		Related Task Card:		A/C Area:			
Internal Check:		Check Type:		Work Order NO: 31956352		Tally Sequence NO: 320	
ENCLOSURE: ☐ CMR: ☐ CPCP: ☒ ETOPS: ☐ CDCCL: ☐ AD: ☐ ALI: ☐							
Type Code: DET		Special Code: AF		MSG Code: MRB, CPCP		Request: Phase:	
I HEREBY CERTIFY THAT ALL WARNINGS AND CAUTIONS HAVE BEEN READ AND THE WORK HAS BEEN CARRIED OUT IN ACCORDING WITH ALL LAID DOWN PROCEDURES, ATTACHED NOTES AND INFORMATION.							
Zones: 220,451,452,461,462							
DOCUMENT REFERENCES:							
Doc Typ		Reference					
AMM		783642-220-801					
MRB		783209-01-1					
ACCESS PANELS:							
437AL, 438AR, 447AL, 448AR, 451AL, 452AR, 461AL, 462AR, 473AL							
MATERIAL REQUIREMENTS:							
Part Number		Description				Qty.	
No parts assigned to this task							
TOOLING REQUIREMENTS:							
Part Number		Description				Qty.	
HIX3010-0		"I" RING CHECK TOOL				1.0	
1- JOB SET-UP							
Job Description							
A. PERFORM A JOB SET-UP FOR THRUST REVERSER V-GROOVE AND OPEN ACCESS PANELS THE FOLLOWING AS PER AMM TASK 78-32-00-220-811-B. - ENGINE 1 (437AL, 438AR, 451AL, 452AR) - ENGINE 2 (447AL, 448AR, 461AL, 462AR)							
STEP COMPLETION SIGN OFF:							
	Qualification / Skill	Number of employees	Duration		Number./Signature	Date	
				HRS		Day	Month
Mechanic/s	PP/ACFT_TECH			HRS			
Insp.				HRS			
2- INSPECTION							
Job Description							
A. PERFORM A DETAILED INSPECTION OF THRUST REVERSER V-GROOVE ADAPTER RING AS PER AMM TASK							



Task Card Title:

DETAILED INSPECTION OF THRUST REVERSER V-GROOVE**ADAPTER RING.**

Task Card NO:

783209-01-1

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

78-32-00-220-811-B.

NOTE

Ensure to fill the attached TSV# 92-634 along with this task

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration		Number./Signature	Date		
						Day	Month	Year
Mechanic/s				HRS				
Insp.	INSP/II			HRS				

3- CLOSE UP**Job Description**

C. PERFORM JOB CLOSE UP AS PER AMM TASK 78-32-00-220-811-B.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration		Number./Signature	Date		
						Day	Month	Year
Mechanic/s	PP/ACFT_TECH			HRS				
Insp.				HRS				

-Aircraft Maintenance Manual used: Revision No. _____ Dated. _____.

Task card finding (Tick Applicable Box) [] Yes [] No. If yes update the system and list Task card finding WO below

Work order No: _____

Note: Make sure to create the finding Work Order on task card level.

Remark's: _____



Task Card Title:

DETAILED INSPECTION OF THRUST REVERSER V-GROOVE**ADAPTER RING.**

Task Card NO:

783209-01-1

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

(1) If Task card interrupted or performed by different personals updates the system and update the following accordingly (Tick Applicable Box)

- Interruption No. 1 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 2 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 3 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 4 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 5 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____

(2) Record any dimension or torque through the performed steps and sign-off as applicable:

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____

**Task Completion Close Up And
System Update**

Station**Date****Signature**

 MET.32721909		Task Card Title: LOWER HALF OF FUSELAGE ZONAL INSP					
Task Card NO: ZL-100-02-1		Work Package: ASP/H-26 C7-CHK		A/C Registration: HZ-ASP			
A/C Type: 321		Block Taskcard		Main Skill: INSP,II		PROD Final Acceptance:	
Project No: 01BASPC72608		Related Task Card:		A/C Area: 09			
Internal Check:		Check Type:		Work Order NO: 31956352		Tally Sequence NO: 321	
ENCLOSURE: ☐ CMR: ☐ CPCP: ☐ ETOPS: ☐ CDCCL: ☐ AD: ☐ ALI: ☐							
Type Code: GVI		Special Code: INSP		MSG Code: SOEE, MRB		Request: 	
Phase: PRE INSP							
I HEREBY CERTIFY THAT ALL WARNINGS AND CAUTIONS HAVE BEEN READ AND THE WORK HAS BEEN CARRIED OUT IN ACCORDING WITH ALL LAID DOWN PROCEDURES, ATTACHED NOTES AND INFORMATION.							
Zones: 100							
DOCUMENT REFERENCES:							
Doc Typ		Reference					
AMM		05-21-00-200-002-A					
AMM		052100-200-002					
DO		SOEE TR SA00ME2302736					
ACCESS PANELS:							
MATERIAL REQUIREMENTS:							
Part Number		Description					Qty.
No parts assigned to this Task Item							
TOOLING REQUIREMENTS:							
Part Number		Description					Qty.
No tools assigned to this Task Item							
Job Description							
NOTE: The inspection must be performed from within a touching distance (unless otherwise stated), using visual inspection aids i.e. inspection mirror, spot light etc., as required, with all identified access panels open. The purpose of the inspection is to determine the general condition and security of visible system installations / components / structure contained in the zone including checking for evidence of degradation, chafing of tubing, loose duct support, wiring damage, cable and pulley wear, fluid leaks, inadequate drainage and other conditions that could lead to corrosion / damage and general condition of the access panels / fairings removed. A. Perform Zonal General Visual Inspection of the lower half of the fuselage up to the Stringer 19 LH and RH and the doors surrounds per AMM TASK 05-21-00-200-002-A.							
STEP COMPLETION SIGN OFF:							
		Qualification / Skill	Number of employees	Duration	Number./Signature	Date	
						Day	Month
						Year	



Task Card Title:

LOWER HALF OF FUSELAGE ZONAL INSP



Task Card NO:

ZL-100-02-1

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

Mechanic/s				HRS				
Insp.	INSP/II			HRS				

-Aircraft Maintenance Manual used: Revision No. _____ Dated. _____.

Task card finding (Tick Applicable Box) [] Yes [] No. If yes update the system and list Task card finding WO below

Work order No: _____

_____, _____, _____, _____, _____, _____, _____, _____, _____, _____

Note: Make sure to create the finding Work Order on task card level.

Remark's: _____

_____, _____, _____, _____, _____, _____, _____, _____, _____, _____

(1) If Task card interrupted or performed by different personals updates the system and update the following according (Tick Applicable Box)

- Interruption No. 1 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

- Interruption No. 2 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

- Interruption No. 3 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

- Interruption No. 4 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

- Interruption No. 5 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

(2) Record any dimension or torque through the performed steps and sign-off as applicable:

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

_____, _____, _____, _____, _____, _____, _____, _____, _____, _____

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

_____, _____, _____, _____, _____, _____, _____, _____, _____, _____

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

_____, _____, _____, _____, _____, _____, _____, _____, _____, _____

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

_____, _____, _____, _____, _____, _____, _____, _____, _____, _____

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

_____, _____, _____, _____, _____, _____, _____, _____, _____, _____

Task Completion Close Up And
System Update

Station

Date

Signature

 MET.32721922		Task Card Title: NOSE LANDING GEAR WELL ZONAL INSP			
Task Card NO: ZL-123-02-1		Work Package: ASP/H-26 C7-CHK		A/C Registration: HZ-ASP	
A/C Type: 321		Block Taskcard		Main Skill: II,INSP	
Project No: 01BASPC72608		Related Task Card:		A/C Area: 09	
Internal Check:		Check Type:		Work Order NO: 31956352	
				Tally Sequence NO: 322	
ENCLOSURE: ☐ CMR: ☐ CPCP: ☐ ETOPS: ☐ CDCCL: ☐ AD: ☐ ALI: ☐					
Type Code: GVI		Special Code: INSP		MSG Code: SOLE, MRB, EWIS, GAC A	
				Request:	
				Phase: PRE INSP	
I HEREBY CERTIFY THAT ALL WARNINGS AND CAUTIONS HAVE BEEN READ AND THE WORK HAS BEEN CARRID OUT IN ACCORDING WITH ALL LAID DOWN PROCEDURES, ATTACHED NOTES AND INFORMATION.					
Zones: 123,124					
DOCUMENT REFERENCES:					
Doc Typ		Reference			
AMM		05-21-20-200-012-A			
AMM		052120-200-012			
DO		(EWIS)			
DO		SOEE TR SA00ME2302736			
ACCESS PANELS:					
713, 714					
MATERIAL REQUIREMENTS:					
Part Number		Description		Qty.	
No parts assigned to this Task Item					
TOOLING REQUIREMENTS:					
Part Number		Description		Qty.	
No tools assigned to this Task Item					
TASK INSTRUCTIONS					
Job Description					
NOTE: THE INSPECTION MUST BE PERFORMED FROM WITHIN A TOUCHING DISTANCE (UNLESS OTHERWISE STATED), USING VISUAL INSPECTION AIDS I.E. INSPECTION MIRROR, SPOT LIGHT ETC., AS REQUIRED, WITH ALL IDENTIFIED ACCESS PANELS OPEN. THE PURPOSE OF THE INSPECTION IS TO DETERMINE THE GENERAL CONDITION AND SECURITY OF VISIBLE SYSTEM INSTALLATIONS / COMPONENTS / STRUCTURE CONTAINED IN THE ZONE INCLUDING CHECKING FOR EVIDENCE OF DEGRADATION, CHAFING OF TUBING, LOOSE DUCT SUPPORT, WIRING DAMAGE, CABLE AND PULLEY WEAR, FLUID LEAKS, INADEQUATE DRAINAGE AND OTHER CONDITIONS THAT COULD LEAD TO CORROSION / DAMAGE AND GENERAL CONDITION OF THE ACCESS PANELS / FAIRINGS REMOVED. A. PERFORM ZONAL GENERAL VISUAL INSPECTION OF THE NOSE GEAR WELL (ZONES 123 AND 124) PER AMM TASK 05-21-20-200-012-A.					



MET.32721922

Task Card Title:

NOSE LANDING GEAR WELL ZONAL INSP



Task Card NO:

ZL-123-02-1

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year
Mechanic/s			HRS				
Insp.	II/INSP		HRS				

-Aircraft Maintenance Manual used: Revision No. _____ Dated. _____.

Task card finding (Tick Applicable Box) [] Yes [] No. If yes update the system and list Task card finding WO below

Work order No: _____

Note: Make sure to creat the finding Work Order on task card level.

Remark's: _____

(1) If Task card interrupted or performed by different personals updates the system and update the following accord (Tick Applicable Box)

- Interruption No. 1 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

- Interruption No. 2 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

- Interruption No. 3 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

- Interruption No. 4 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

- Interruption No. 5 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

(2) Record any dimension or torque through the performed steps and sign-off as applicable:

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

Task Completion Close Up And
System Update

Station

Date

Signature

 MET.32721955	Task Card Title: FWD CARGO COMPARTMENT ZONAL INSP					
Task Card NO: ZL-131-01-1		Work Package: ASP/H-26 C7-CHK		A/C Registration: HZ-ASP		
A/C Type: 321		Block Taskcard		Main Skill: INSP,II		PROD Final Acceptance:
Project No: 01BASPC72608		Related Task Card:		A/C Area: 09		
Internal Check:		Check Type:		Work Order NO: 31956352		Tally Sequence NO: 323
ENCLOSURE: ☐ CMR: ☐ CPCP: ☐ ETOPS: ☐ CDCCL: ☐ AD: ☐ ALI: ☐						
Type Code: GVI		Special Code: INSP		MSG Code: MRB, EWIS, GACA		Request: Phase: INSPECTION
I HEREBY CERTIFY THAT ALL WARNINGS AND CAUTIONS HAVE BEEN READ AND THE WORK HAS BEEN CARRID OUT IN ACCORDING WITH ALL LAID DOWN PROCEDURES, ATTACHED NOTES AND INFORMATION.						
Zones: 131,132						
DOCUMENT REFERENCES:						
Doc Typ		Reference				
AMM		05-21-30-200-001-A				
ACCESS PANELS:						
825						
MATERIAL REQUIREMENTS:						
Part Number		Description				Qty.
No parts assigned to this Task Item						
TOOLING REQUIREMENTS:						
Part Number		Description				Qty.
No tools assigned to this Task Item						
TASK INSTRUCTIONS						
Job Description						
NOTE: THE INSPECTION MUST BE PERFORMED FROM WITHIN A TOUCHING DISTANCE (UNLESS OTHERWISE STATED), USING VISUAL INSPECTION AIDS I.E. INSPECTION MIRROR, SPOT LIGHT ETC., AS REQUIRED, WITH ALL IDENTIFIED ACCESS PANELS OPEN. THE PURPOSE OF THE INSPECTION IS TO DETERMINE THE GENERAL CONDITION AND SECURITY OF VISIBLE SYSTEM INSTALLATIONS / COMPONENTS / STRUCTURE CONTAINED IN THE ZONE INCLUDING CHECKING FOR EVIDENCE OF DEGRADATION, CHAFING OF TUBING, LOOSE DUCT SUPPORT, WIRING DAMAGE, CABLE AND PULLEY WEAR, FLUID LEAKS, INADEQUATE DRAINAGE AND OTHER CONDITIONS THAT COULD LEAD TO CORROSION / DAMAGE AND GENERAL CONDITION OF THE ACCESS PANELS / FAIRINGS REMOVED. A. PERFORM ZONAL GENERAL VISUAL INSPECTION OF THE FWD CARGO COMPARTMENT PER AMM TASK 05-21-30-200-001-A.						
STEP COMPLETION SIGN OFF:						
Qualification / Skill		Number of employees		Duration		Number./Signature
						Date Day Month Year



Task Card Title:

FWD CARGO COMPARTMENT ZONAL INSP

Task Card NO:

ZL-131-01-1

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

Mechanic/s				HRS				
Insp.	INSP/II			HRS				

-Aircraft Maintenance Manual used: Revision No. _____ Dated. _____.

Task card finding (Tick Applicable Box) [] Yes [] No. If yes update the system and list Task card finding WO below

Work order No: _____

Note: Make sure to create the finding Work Order on task card level.

Remark's: _____

(1) If Task card interrupted or performed by different personals updates the system and update the following according (Tick Applicable Box)

- Interruption No. 1 [] Task card [] AMM [] Other specify. _____
Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 2 [] Task card [] AMM [] Other specify. _____
Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 3 [] Task card [] AMM [] Other specify. _____
Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 4 [] Task card [] AMM [] Other specify. _____
Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 5 [] Task card [] AMM [] Other specify. _____
Performed by: _____ Page No. _____ Step From _____ To _____

(2) Record any dimension or torque through the performed steps and sign-off as applicable:

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
Remark's: _____

**Task Completion Close Up And
System Update**

Station**Date****Signature**

 MET.32721857		Task Card Title: AFT CARGO COMPARTMENT ZONAL INSP				
Task Card NO: ZL-151-01-1		Work Package: ASP/H-26 C7-CHK		A/C Registration: HZ-ASP		
A/C Type: 321		Block Taskcard		Main Skill: INSP,II		PROD Final Acceptance:
Project No: 01BASPC72608		Related Task Card:		A/C Area: 09		
Internal Check:		Check Type:		Work Order NO: 31956352		Tally Sequence NO: 324
ENCLOSURE: ☐ CMR: ☐ CPCP: ☐ ETOPS: ☐ CDCCL: ☐ AD: ☐ ALI: ☐						
Type Code: GVI		Special Code: INSP		MSG Code: MRB		Request: Phase: INSPECTION
I HEREBY CERTIFY THAT ALL WARNINGS AND CAUTIONS HAVE BEEN READ AND THE WORK HAS BEEN CARRIED OUT IN ACCORDING WITH ALL LAID DOWN PROCEDURES, ATTACHED NOTES AND INFORMATION.						
Zones: 151,152						
DOCUMENT REFERENCES:						
Doc Typ		Reference				
AMM		05-21-50-200-001-A				
AMM		052150-200-001				
ACCESS PANELS:						
826						
MATERIAL REQUIREMENTS:						
Part Number		Description				Qty.
No parts assigned to this Task Item						
TOOLING REQUIREMENTS:						
Part Number		Description				Qty.
No tools assigned to this Task Item						
TASK INSTRUCTIONS						
Job Description						
NOTE: THE INSPECTION MUST BE PERFORMED FROM WITHIN A TOUCHING DISTANCE (UNLESS OTHERWISE STATED), USING VISUAL INSPECTION AIDS I.E. INSPECTION MIRROR, SPOT LIGHT ETC., AS REQUIRED WITH ALL IDENTIFIED ACCESS PANELS OPEN. THE PURPOSE OF THE INSPECTION IS TO DETERMINE THE GENERAL CONDITION AND SECURITY OF VISIBLE SYSTEM INSTALLATIONS / COMPONENTS / STRUCTURE CONTAINED IN THE ZONE INCLUDING CHECKING FOR EVIDENCE OF DEGRADATION, CHAFING OF TUBING, LOOSE DUCT SUPPORT, WIRING DAMAGE, CABLE AND PULLEY WEAR, FLUID LEAKS, INADEQUATE DRAINAGE AND OTHER CONDITIONS THAT COULD LEAD TO CORROSION / DAMAGE AND GENERAL CONDITION OF THE ACCESS PANELS / FAIRINGS REMOVED. A. PERFORM ZONAL GENERAL VISUAL INSPECTION OF THE AFT CARGO COMPARTMENT [AS FAR AS VISIBLE, IF ADDITIONAL CENTER TANK (ACT) INSTALLED] PER AMM TASK 05-21-50-200-001-A.						
STEP COMPLETION SIGN OFF:						



MET.32721857

Task Card Title:

AFT CARGO COMPARTMENT ZONAL INSP

Task Card NO:

ZL-151-01-1

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

	Qualification / Skill	Number of employees	Duration		Number./Signature	Date		
						Day	Month	Year
Mechanic/s				HRS				
Insp.	INSP/II			HRS				

-Aircraft Maintenance Manual used: Revision No. _____ Dated. _____.

Task card finding (Tick Applicable Box) [] Yes [] No. If yes update the system and list Task card finding WO below

Work order No: _____

_____, _____, _____, _____, _____, _____, _____, _____, _____, _____

Note: Make sure to creat the finding Work Order on task card level.

Remark's: _____

(1) If Task card interrupted or performed by different personals updates the system and update the following accord (Tick Applicable Box)

- Interruption No. 1 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

- Interruption No. 2 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

- Interruption No. 3 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

- Interruption No. 4 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

- Interruption No. 5 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

(2) Record any dimension or torque through the performed steps and sign-off as applicable:

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

**Task Completion Close Up And
System Update****Station****Date****Signature**

 MET.32721945		Task Card Title: BULK CARGO COMPARTMENT ZONAL INSP				
Task Card NO: ZL-161-01-1		Work Package: ASP/H-26 C7-CHK		A/C Registration: HZ-ASP		
A/C Type: 321		Block Taskcard		Main Skill: II,INSP		
Project No: 01BASPC72608		Related Task Card:		A/C Area: 00		
Internal Check:		Check Type:		Work Order NO: 31956352		
				Tally Sequence NO: 325		
ENCLOSURE: ☐ CMR: ☐ CPCP: ☐ ETOPS: ☐ CDCCL: ☐ AD: ☐ ALI: ☐						
Type Code: GVI		Special Code: INSP		MSG Code: MRB		
				Request: INSPECTION		
I HEREBY CERTIFY THAT ALL WARNINGS AND CAUTIONS HAVE BEEN READ AND THE WORK HAS BEEN CARRID OUT IN ACCORDING WITH ALL LAID DOWN PROCEDURES, ATTACHED NOTES AND INFORMATION.						
Zones: 161,162						
DOCUMENT REFERENCES:						
Doc Typ		Reference				
AMM		05-21-60-200-001-A				
AMM		052160-200-001				
ACCESS PANELS:						
826						
MATERIAL REQUIREMENTS:						
Part Number		Description			Qty.	
No parts assigned to this Task Item						
TOOLING REQUIREMENTS:						
Part Number		Description			Qty.	
No tools assigned to this Task Item						
TASK INSTRUCTIONS						
Job Description						
NOTE: THE INSPECTION MUST BE PERFORMED FROM WITHIN A TOUCHING DISTANCE (UNLESS OTHERWISE STATED), USING VISUAL INSPECTION AIDS I.E. INSPECTION MIRROR, SPOT LIGHT ETC., AS REQUIRED, WITH ALL IDENTIFIED ACCESS PANELS OPEN. THE PURPOSE OF THE INSPECTION IS TO DETERMINE THE GENERAL CONDITION AND SECURITY OF VISIBLE SYSTEM INSTALLATIONS / COMPONENTS / STRUCTURE CONTAINED IN THE ZONE INCLUDING CHECKING FOR EVIDENCE OF DEGRADATION, CHAFING OF TUBING, LOOSE DUCT SUPPORT, WIRING DAMAGE, CABLE AND PULLEY WEAR, FLUID LEAKS, INADEQUATE DRAINAGE AND OTHER CONDITIONS THAT COULD LEAD TO CORROSION / DAMAGE AND GENERAL CONDITION OF THE ACCESS PANELS / FAIRINGS REMOVED. A. PERFORM ZONAL GENERAL VISUAL INSPECTION OF THE BULK CARGO COMPARTMENT PER AMM TASK 05-21-60-200-001-A.						
STEP COMPLETION SIGN OFF:						



MET.32721945

Task Card Title:

BULK CARGO COMPARTMENT ZONAL INSP

Task Card NO:

ZL-161-01-1

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

	Qualification / Skill	Number of employees	Duration		Number./Signature	Date		
						Day	Month	Year
Mechanic/s				HRS				
Insp.	II/INSP			HRS				

-Aircraft Maintenance Manual used: Revision No. _____ Dated. _____.

Task card finding (Tick Applicable Box) [] Yes [] No. If yes update the system and list Task card finding WO below

Work order No: _____

_____, _____, _____, _____, _____, _____, _____, _____

Note: Make sure to creat the finding Work Order on task card level.

Remark's: _____

(1) If Task card interrupted or performed by different personals updates the system and update the following accord (Tick Applicable Box)

- Interruption No. 1 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

- Interruption No. 2 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

- Interruption No. 3 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

- Interruption No. 4 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

- Interruption No. 5 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

(2) Record any dimension or torque through the performed steps and sign-off as applicable:

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

**Task Completion Close Up And
System Update****Station****Date****Signature**

 MET.32721864	Task Card Title: AFT CABIN UNDERFLOOR COMPART INSP					
Task Card NO: ZL-171-01-1		Work Package: ASP/H-26 C7-CHK		A/C Registration: HZ-ASP		
A/C Type: 321		Block Taskcard		Main Skill: INSP,IL,AF,ACFT_TECH		PROD Final Acceptance:
Project No: 01BASPC72608		Related Task Card:		A/C Area: 09		
Internal Check:		Check Type:		Work Order NO: 31956352		Tally Sequence NO: 326
ENCLOSURE: ☐ CMR: ☐ CPCP: ☐ ETOPS: ☐ CDCCL: ☐ AD: ☐ ALI: ☐						
Type Code: GVI		Special Code: INSP		MSG Code: MRB		Request: Phase: PRE INSP,
I HEREBY CERTIFY THAT ALL WARNINGS AND CAUTIONS HAVE BEEN READ AND THE WORK HAS BEEN CARRID OUT IN ACCORDING WITH ALL LAID DOWN PROCEDURES, ATTACHED NOTES AND INFORMATION.						
Zones: 171,172						
DOCUMENT REFERENCES:						
Doc Typ		Reference				
AMM		05-21-70-200-001-A				
AMM		052170-200-001				
ACCESS PANELS:						
161DW, 162DW, 171AL, 172AR, 826						
MATERIAL REQUIREMENTS:						
Part Number		Description				Qty.
No parts assigned to this Task Item						
TOOLING REQUIREMENTS:						
Part Number		Description				Qty.
No tools assigned to this Task Item						
TASK PREPARATION						
Job Description						
A. PERFORM LOB SET UP AND REMOVE THE PARTITION PANELS AT FR65 (REF. AMM TASK 25-55-12-000-001-A) AS PER AMM TASK 05-21-70-200-001-A.						
STEP COMPLETION SIGN OFF:						
		Qualification / Skill	Number of employees	Duration	Number./Signature	Date
						Day Month Year



Task Card Title:

AFT CABIN UNDERFLOOR COMPART INSP

Task Card NO:

ZL-171-01-1

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

Mechanic/s	AF/ACFT_TECH			HRS				
Insp.				HRS				

TASK INSTRUCTIONS**Job Description**

NOTE:

The inspection must be performed from within a touching distance (unless otherwise stated), using visual inspection aids i.e. inspection mirror, spot light etc., as required, with all identified access panels open.

The purpose of the inspection is to determine the general condition and security of visible system installations / components / structure contained in the zone including checking for evidence of degradation, chafing of tubing, loose duct support, wiring damage, cable and pulley wear, fluid leaks, inadequate drainage and other conditions that could lead to corrosion / damage and general condition of the access panels / fairings removed.

A. Perform Zonal General Visual Inspection of the tail section of the aft cabin underfloor compartment (Zones 171 and 172) per AMM TASK 05-21-70-200-001-A.

Note: This task is an EWIS (Electrical Wiring Interconnection System) procedure. EWIS is defined in ESPM 20-33-11.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year
Mechanic/s			HRS				
Insp.	INSP/II		HRS				

TASK CLOSE UP**Job Description**

A. OK TO CLSE THE PARTITION PANELS AT FR65.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year
Mechanic/s			HRS				
Insp.	II/INSP		HRS				

TASK CLOSE UP**Job Description**

B. CLOSE THE PATITION PANELS AT FR65 (REF. AMM TASK 25-55-12-400-001-A) AND PERFORM CLOSE UP AS PER AMM TASK 25-21-70-200-001-A.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year
Mechanic/s	AF/ACFT_TECH		HRS				
Insp.	II/INSP		HRS				



Task Card Title:

AFT CABIN UNDERFLOOR COMPART INSP

Task Card NO:

ZL-171-01-1

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

-Aircraft Maintenance Manual used: Revision No. _____ Dated. _____.

Task card finding (Tick Applicable Box) [] Yes [] No. If yes update the system and list Task card finding WO below

Work order No: _____

Note: Make sure to create the finding Work Order on task card level.

Remark's: _____

(1) If Task card interrupted or performed by different persons updates the system and update the following accordingly (Tick Applicable Box)

- Interruption No. 1 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

- Interruption No. 2 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

- Interruption No. 3 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

- Interruption No. 4 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

- Interruption No. 5 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

(2) Record any dimension or torque through the performed steps and sign-off as applicable:

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

**Task Completion Close Up And
System Update****Station****Date****Signature**

 MET.32721898		Task Card Title: STABILIZERS&CONE/REAR FUSELAGE INSP				
Task Card NO: ZL-300-02-1		Work Package: ASP/H-26 C7-CHK		A/C Registration: HZ-ASP		
A/C Type: 321		Block Taskcard		Main Skill: INSP,II		PROD Final Acceptance:
Project No: 01BASPC72608		Related Task Card:		A/C Area: 10		
Internal Check:		Check Type:		Work Order NO: 31956352		Tally Sequence NO: 327
ENCLOSURE: ☐ CMR: ☐ CPCP: ☐ ETOPS: ☐ CDCCL: ☐ AD: ☐ ALI: ☐						
Type Code: GVI		Special Code: INSP		MSG Code: MRB		Request: Phase: INSPECTION
I HEREBY CERTIFY THAT ALL WARNINGS AND CAUTIONS HAVE BEEN READ AND THE WORK HAS BEEN CARRIED OUT IN ACCORDING WITH ALL LAID DOWN PROCEDURES, ATTACHED NOTES AND INFORMATION.						
Zones: 300						
DOCUMENT REFERENCES:						
Doc Typ		Reference				
AMM		05-23-00-200-002-A				
AMM		052300-200-002				
ACCESS PANELS:						
MATERIAL REQUIREMENTS:						
Part Number		Description				Qty.
No parts assigned to this Task Item						
TOOLING REQUIREMENTS:						
Part Number		Description				Qty.
No tools assigned to this Task Item						
TASK INSTRUCTION						
Job Description						
NOTE: THE INSPECTION MUST BE PERFORMED FROM WITHIN A TOUCHING DISTANCE (UNLESS OTHERWISE STATED), USING VISUAL INSPECTION AIDS I.E. INSPECTION MIRROR, SPOT LIGHT ETC., AS REQUIRED, WITH ALL IDENTIFIED ACCESS PANELS OPEN. THE PURPOSE OF THE INSPECTION IS TO DETERMINE THE GENERAL CONDITION AND SECURITY OF VISIBLE SYSTEM INSTALLATIONS / COMPONENTS / STRUCTURE CONTAINED IN THE ZONE INCLUDING CHECKING FOR EVIDENCE OF DEGRADATION, CHAFING OF TUBING, LOOSE DUCT SUPPORT, WIRING DAMAGE, CABLE AND PULLEY WEAR, FLUID LEAKS, INADEQUATE DRAINAGE AND OTHER CONDITIONS THAT COULD LEAD TO CORROSION / DAMAGE AND GENERAL CONDITION OF THE ACCESS PANELS/FAIRINGS REMOVED. A. PERFORM ZONAL GENERAL VISUAL INSPECTION OF THE STABILIZERS AND CONE/REAR FUSELAGE AS PER AMM TASK 05-23-00-200-002-A.						
STEP COMPLETION SIGN OFF:						



HZ-ASP

 MET.32721842		Task Card Title: GENERAL VISUAL INSPECTION OF TAIL CONE APU AND ACCESSORY COMPARTMENT (EWIS)				
Task Card NO: ZL-315-01-1		Work Package: ASP/H-26 C7-CHK		A/C Registration: HZ-ASP		
A/C Type: 321		Block Taskcard		Main Skill: INSP,II		PROD Final Acceptance:
Project No: 01BASPC72608		Related Task Card:		A/C Area:		
Internal Check:		Check Type:		Work Order NO: 31956352		Tally Sequence NO: 328
ENCLOSURE: ☐ CMR: ☐ CPCP: ☐ ETOPS: ☐ CDCCL: ☐ AD: ☐ ALI: ☐						
Type Code: GVI		Special Code: INSP		MSG Code: MRB		Request: Phase: INSPECTION
I HEREBY CERTIFY THAT ALL WARNINGS AND CAUTIONS HAVE BEEN READ AND THE WORK HAS BEEN CARRIED OUT IN ACCORDING WITH ALL LAID DOWN PROCEDURES, ATTACHED NOTES AND INFORMATION.						
Zones: 315,316						
DOCUMENT REFERENCES:						
Doc Typ		Reference				
AMM		05-23-10-200-003-A				
AMM		52-41-00-010-001-A				
AMM		52-41-00-410-001-A				
AMM		052310-200-003				
ACCESS PANELS:						
315AL, 316AR						
MATERIAL REQUIREMENTS:						
Part Number		Description				Qty.
No parts assigned to this Task Item						
TOOLING REQUIREMENTS:						
Part Number		Description				Qty.
No tools assigned to this Task Item						
Job Description						
NOTE: THE INSPECTION MUST BE PERFORMED FROM WITHIN A TOUCHING DISTANCE (UNLESS OTHERWISE STATED), USING VISUAL INSPECTION AIDS I.E. INSPECTION MIRROR, SPOT LIGHT ETC., AS REQUIRED, WITH ALL IDENTIFIED ACCESS PANELS OPEN. THE PURPOSE OF THE INSPECTION IS TO DETERMINE THE GENERAL CONDITION AND SECURITY OF VISIBLE SYSTEM INSTALLATIONS / COMPONENTS / STRUCTURE CONTAINED IN THE ZONE INCLUDING CHECKING FOR EVIDENCE OF DEGRADATION, CHAFING OF TUBING, LOOSE DUCT SUPPORT, WIRING DAMAGE, CABLE AND PULLEY WEAR, FLUID LEAKS, INADEQUATE DRAINAGE AND OTHER CONDITIONS THAT COULD LEAD TO CORROSION / DAMAGE, AND GENERAL CONDITION OF THE ACCESS PANELS / FAIRINGS REMOVED.						



Task Card Title:

GENERAL VISUAL INSPECTION OF TAIL CONE APU AND A**CESSORY COMPARTMENT (EWIS)**

Task Card NO:

ZL-315-01-1

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

1. INSPECTION:

A. PERFORM ZONAL GENERAL VISUAL INSPECTION OF TAIL CONE, APU ACCESSORY COMPARTMENT (ZONES 315 AND 316) PER AMM TASK 05-23-10-200-003-A.

NOTE: THIS IS AN EWIS (ELECTRICAL WIRING INTERCONNECTION SYSTEM).
PROCEDURE EWIS IS DEFINED IN ESPM 20-33-11.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year
Mechanic/s			HRS				
Insp.	INSP/II		HRS				

-Aircraft Maintenance Manual used: Revision No. _____ Dated. _____.

Task card finding (Tick Applicable Box) [] Yes [] No. If yes update the system and list Task card finding WO below

Work order No: _____

Note: Make sure to creat the finding Work Order on task card level.

Remark's: _____



Task Card Title:

GENERAL VISUAL INSPECTION OF TAIL CONE APU AND A**CESSORY COMPARTMENT (EWIS)**

Task Card NO:

ZL-315-01-1

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

(1) If Task card interrupted or performed by different personals updates the system and update the following according (Tick Applicable Box)

- Interruption No. 1 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 2 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 3 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 4 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 5 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____

(2) Record any dimension or torque through the performed steps and sign-off as applicable:

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____

**Task Completion Close Up And
System Update**

Station**Date****Signature**

 MET.32721885		Task Card Title: THS TRAILING EDGE ZONAL INSPECTION				
Task Card NO: ZL-334-01-1		Work Package: ASP/H-26 C7-CHK		A/C Registration: HZ-ASP		
A/C Type: 321		Block Taskcard		Main Skill: II,INSP		
Project No: 01BASPC72608		Related Task Card:		A/C Area: 10		
Internal Check:		Check Type:		Work Order NO: 31956352		
				Tally Sequence NO: 329		
ENCLOSURE: ☐ CMR: ☐ CPCP: ☐ ETOPS: ☐ CDCCL: ☐ AD: ☐ ALI: ☐						
Type Code: GVI		Special Code: INSP		MSG Code: EWIS, MRB		
				Request: INSPECTION		
I HEREBY CERTIFY THAT ALL WARNINGS AND CAUTIONS HAVE BEEN READ AND THE WORK HAS BEEN CARRIED OUT IN ACCORDING WITH ALL LAID DOWN PROCEDURES, ATTACHED NOTES AND INFORMATION.						
Zones: 334,344						
DOCUMENT REFERENCES:						
Doc Typ		Reference				
AMM		05-23-30-200-004-A				
AMM		052330-200-004				
ACCESS PANELS:						
334BB, 334DB, 334FB, 334HB, 344BB, 344DB, 344FB, 344HB						
MATERIAL REQUIREMENTS:						
Part Number		Description			Qty.	
No parts assigned to this Task Item						
TOOLING REQUIREMENTS:						
Part Number		Description			Qty.	
No tools assigned to this Task Item						
TASK INSTRUCTIONS						
Job Description						
NOTE: THE INSPECTION MUST BE PERFORMED FROM WITHIN A TOUCHING DISTANCE (UNLESS OTHERWISE STATED), USING VISUAL INSPECTION AIDS I.E. INSPECTION MIRROR, SPOT LIGHT ETC., AS REQUIRED, WITH ALL IDENTIFIED ACCESS PANELS OPEN. THE PURPOSE OF THE INSPECTION IS TO DETERMINE THE GENERAL CONDITION AND SECURITY OF VISIBLE SYSTEM INSTALLATIONS / COMPONENTS / STRUCTURE CONTAINED IN THE ZONE INCLUDING CHECKING FOR EVIDENCE OF DEGRADATION, CHAFING OF TUBING, LOOSE DUCT SUPPORT, WIRING DAMAGE, CABLE AND PULLEY WEAR, FLUID LEAKS, INADEQUATE DRAINAGE AND OTHER CONDITIONS THAT COULD LEAD TO CORROSION / DAMAGE AND GENERAL CONDITION OF THE ACCESS PANELS / FAIRINGS REMOVED. A. PERFORM ZONAL GENERAL VISUAL INSPECTION OF THE TRIMMABLE HORIZONTAL STABILIZER (THS) TRAILING EDGE PER AMM TASK 05-23-30-200-004-A.						
STEP COMPLETION SIGN OFF:						



MET.32721885

Task Card Title:

THS TRAILING EDGE ZONAL INSPECTION

Task Card NO:

ZL-334-01-1

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

	Qualification / Skill	Number of employees	Duration		Number./Signature	Date		
						Day	Month	Year
Mechanic/s				HRS				
Insp.	II/INSP			HRS				

-Aircraft Maintenance Manual used: Revision No. _____ Dated. _____.

Task card finding (Tick Applicable Box) [] Yes [] No. If yes update the system and list Task card finding WO below

Work order No: _____

_____, _____, _____, _____, _____, _____, _____, _____

Note: Make sure to creat the finding Work Order on task card level.

Remark's: _____

(1) If Task card interrupted or performed by different personals updates the system and update the following accord (Tick Applicable Box)

- Interruption No. 1 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

- Interruption No. 2 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

- Interruption No. 3 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

- Interruption No. 4 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

- Interruption No. 5 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

(2) Record any dimension or torque through the performed steps and sign-off as applicable:

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

**Task Completion Close Up And
System Update****Station****Date****Signature**

 MET.32721854		Task Card Title: NO. 1 ENGINE UPPER FORWARD PYLON					
Task Card NO: ZL-411-01-3-001		Work Package: ASP/H-26 C7-CHK		A/C Registration: HZ-ASP			
A/C Type: 321		Block Taskcard		Main Skill: INSP,II		PROD Final Acceptance:	
Project No: 01BASPC72608		Related Task Card:		A/C Area: 01			
Internal Check:		Check Type:		Work Order NO: 31956352		Tally Sequence NO: 330	
ENCLOSURE: ☐ CMR: ☐ CPCP: ☐ ETOPS: ☐ CDCCL: ☐ AD: ☐ ALI: ☐							
Type Code: GVI		Special Code: INSP		MSG Code: MRB		Request:	
Phase: INSPECTION							
I HEREBY CERTIFY THAT ALL WARNINGS AND CAUTIONS HAVE BEEN READ AND THE WORK HAS BEEN CARRIED OUT IN ACCORDING WITH ALL LAID DOWN PROCEDURES, ATTACHED NOTES AND INFORMATION.							
Zones: 411,413,414							
DOCUMENT REFERENCES:							
Doc Typ		Reference					
AMM		05-24-10-200-001-A					
AMM		052410-200-001					
ACCESS PANELS:							
413AL, 413AR, 413BL, 413BR, 413CL, 413CR, 413DT, 471AL, 471AR							
MATERIAL REQUIREMENTS:							
Part Number		Description					Qty.
No parts assigned to this Task Item							
TOOLING REQUIREMENTS:							
Part Number		Description					Qty.
No tools assigned to this Task Item							
TASK INSTRUCTIONS							
Job Description							
NOTE: THE INSPECTION MUST BE PERFORMED FROM WITHIN A TOUCHING DISTANCE (UNLESS OTHERWISE STATED), USING VISUAL INSPECTION AIDS I.E. INSPECTION MIRROR, SPOT LIGHT ETC., AS REQUIRED, WITH ALL IDENTIFIED ACCESS PANELS OPEN. THE PURPOSE OF THE INSPECTION IS TO DETERMINE THE GENERAL CONDITION AND SECURITY OF VISIBLE SYSTEM INSTALLATIONS / COMPONENTS / STRUCTURE CONTAINED IN THE ZONE INCLUDING CHECKING FOR EVIDENCE OF DEGRADATION, CHAFING OF TUBING, LOOSE DUCT SUPPORT, WIRING DAMAGE, CABLE AND PULLEY WEAR, FLUID LEAKS, INADEQUATE DRAINAGE AND OTHER CONDITIONS THAT COULD LEAD TO CORROSION / DAMAGE AND GENERAL CONDITION OF THE ACCESS PANELS / FAIRINGS REMOVED. A. PERFORM ZONAL GENERAL VISUAL INSPECTION OF NO. 1 ENGINE UPPER FORWARD PYLON (ZONES 411, 413 AND 414) AS PER AMM TASK 05-24-10-200-001-A.							
STEP COMPLETION SIGN OFF:							
	Qualification / Skill	Number of employees	Duration		Number./Signature	Date	
				HRS		Day	Month
Mechanic/s							



MET.32721854

Task Card Title:

NO. 1 ENGINE UPPER FORWARD PYLON

Task Card NO:

ZL-411-01-3-001

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

Insp.

INSP/II

HRS

-Aircraft Maintenance Manual used: Revision No. _____ Dated. _____.

Task card finding (Tick Applicable Box) [] Yes [] No. If yes update the system and list Task card finding WO below

Work order No: _____

Note: Make sure to creat the finding Work Order on task card level.

Remark's: _____

(1) If Task card interrupted or performed by different personals updates the system and update the following accord (Tick Applicable Box)

- Interruption No. 1 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 2 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 3 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 4 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 5 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____

(2) Record any dimension or torque through the performed steps and sign-off as applicable:

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____

**Task Completion Close Up And
System Update**

Station

Date

Signature

 MET.32721971		Task Card Title: NO. 2 ENGINE UPPER FORWARD PYLON					
Task Card NO: ZL-411-01-3-002		Work Package: ASP/H-26 C7-CHK		A/C Registration: HZ-ASP			
A/C Type: 321		Block Taskcard		Main Skill: II,INSP		PROD Final Acceptance:	
Project No: 01BASPC72608		Related Task Card:		A/C Area: 02			
Internal Check:		Check Type:		Work Order NO: 31956352		Tally Sequence NO: 331	
ENCLOSURE: ☐ CMR: ☐ CPCP: ☐ ETOPS: ☐ CDCCL: ☐ AD: ☐ ALI: ☐							
Type Code: GVI		Special Code: INSP		MSG Code: MRB		Request: 	
Phase: INSPECTION							
I HEREBY CERTIFY THAT ALL WARNINGS AND CAUTIONS HAVE BEEN READ AND THE WORK HAS BEEN CARRIED OUT IN ACCORDING WITH ALL LAID DOWN PROCEDURES, ATTACHED NOTES AND INFORMATION.							
Zones: 421,423,424							
DOCUMENT REFERENCES:							
Doc Typ		Reference					
AMM		05-24-10-200-001-A					
AMM		052410-200-001					
ACCESS PANELS:							
413AL, 413AR, 413BL, 413BR, 413CL, 413CR, 413DT, 423AL, 423AR, 423BL, 423BR, 423CL, 423CR, 423DT, 481AL, 481AR							
MATERIAL REQUIREMENTS:							
Part Number		Description				Qty.	
No parts assigned to this Task Item							
TOOLING REQUIREMENTS:							
Part Number		Description				Qty.	
No tools assigned to this Task Item							
TASK INSTRUCTIONS							
Job Description							
NOTE: THE INSPECTION MUST BE PERFORMED FROM WITHIN A TOUCHING DISTANCE (UNLESS OTHERWISE STATED), USING VISUAL INSPECTION AIDS I.E. INSPECTION MIRROR, SPOT LIGHT ETC., AS REQUIRED, WITH ALL IDENTIFIED ACCESS PANELS OPEN. THE PURPOSE OF THE INSPECTION IS TO DETERMINE THE GENERAL CONDITION AND SECURITY OF VISIBLE SYSTEM INSTALLATIONS / COMPONENTS / STRUCTURE CONTAINED IN THE ZONE INCLUDING CHECKING FOR EVIDENCE OF DEGRADATION, CHAFING OF TUBING, LOOSE DUCT SUPPORT, WIRING DAMAGE, CABLE AND PULLEY WEAR, FLUID LEAKS, INADEQUATE DRAINAGE AND OTHER CONDITIONS THAT COULD LEAD TO CORROSION / DAMAGE AND GENERAL CONDITION OF THE ACCESS PANELS / FAIRINGS REMOVED. A. PERFORM ZONAL GENERAL VISUAL INSPECTION OF NO. 2 ENGINE UPPER FORWARD PYLON (ZONES 411, 413 AND 414) AS PER AMM TASK 05-24-10-200-001-A.							
STEP COMPLETION SIGN OFF:							
Qualification / Skill		Number of employees		Duration		Number./Signature	
Date		Day		Month		Year	
Mechanic/s				HRS			



Task Card Title:

NO. 2 ENGINE UPPER FORWARD PYLON

Task Card NO:

ZL-411-01-3-002

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

Insp.

II/INSP

HRS

-Aircraft Maintenance Manual used: Revision No. _____ Dated. _____.

Task card finding (Tick Applicable Box) [] Yes [] No. If yes update the system and list Task card finding WO below

Work order No: _____

_____, _____, _____, _____, _____, _____, _____, _____

Note: Make sure to create the finding Work Order on task card level.

Remark's: _____

(1) If Task card interrupted or performed by different persons updates the system and update the following accordingly (Tick Applicable Box)

- Interruption No. 1 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

- Interruption No. 2 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

- Interruption No. 3 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

- Interruption No. 4 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

- Interruption No. 5 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

(2) Record any dimension or torque through the performed steps and sign-off as applicable:

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

**Task Completion Close Up And
System Update****Station****Date****Signature**

 MET.32721940		Task Card Title: GENERAL VISUAL INSPECTION OF FAN COWL NO.1 ENGIN					
Task Card NO: ZL-437-01-1-001		Work Package: ASP/H-26 C7-CHK		A/C Registration: HZ-ASP			
A/C Type: 321		Block Taskcard		Main Skill: INSP,II		PROD Final Acceptance:	
Project No: 01BASPC72608		Related Task Card:		A/C Area: 01			
Internal Check:		Check Type:		Work Order NO: 31956352		Tally Sequence NO: 332	
ENCLOSURE: ☐ CMR: ☐ CPCP: ☐ ETOPS: ☐ CDCCL: ☐ AD: ☐ ALI: ☐							
Type Code: GVI		Special Code: INSP		MSG Code: MRB, EWIS		Request:	
						Phase: INSPECTION	
I HEREBY CERTIFY THAT ALL WARNINGS AND CAUTIONS HAVE BEEN READ AND THE WORK HAS BEEN CARRIED OUT IN ACCORDING WITH ALL LAID DOWN PROCEDURES, ATTACHED NOTES AND INFORMATION.							
Zones: 437,438							
DOCUMENT REFERENCES:							
Doc Typ		Reference					
AMM		05-24-30-200-003-A					
AMM		052430-200-003					
ACCESS PANELS:							
437AL, 438AR							
MATERIAL REQUIREMENTS:							
Part Number		Description				Qty.	
No parts assigned to this Task Item							
TOOLING REQUIREMENTS:							
Part Number		Description				Qty.	
No tools assigned to this Task Item							
TASK INSTRUCTIONS							
Job Description							
NOTE: THE INSPECTION MUST BE PERFORMED FROM WITHIN A TOUCHING DISTANCE (UNLESS OTHERWISE STATED), USING VISUAL INSPECTION AIDS I.E. INSPECTION MIRROR, SPOT LIGHT ETC., AS REQUIRED, WITH ALL IDENTIFIED ACCESS PANELS OPEN. THE PURPOSE OF THE INSPECTION IS TO DETERMINE THE GENERAL CONDITION AND SECURITY OF VISIBLE SYSTEM INSTALLATIONS / COMPONENTS / STRUCTURE CONTAINED IN THE ZONE INCLUDING CHECKING FOR EVIDENCE OF DEGRADATION, CHAFING OF TUBING, LOOSE DUCT SUPPORT, WIRING DAMAGE, CABLE AND PULLEY WEAR, FLUID LEAKS, INADEQUATE DRAINAGE AND OTHER CONDITIONS THAT COULD LEAD TO CORROSION / DAMAGE, AND GENERAL CONDITION OF THE ACCESS PANELS / FAIRINGS REMOVED.							
A. PERFORM A ZONAL GENERAL VISUAL INSPECTION OF NO.1 ENGINE FAN COWLING PER AMM TASK 05-24-30-200-003-A.							
STEP COMPLETION SIGN OFF:							
	Qualification / Skill	Number of employees	Duration		Number./Signature	Date	
				HRS		Day	Month
Mechanic/s				HRS			
Insp.	INSP/II			HRS			



MET.32721940

Task Card Title:

GENERAL VISUAL INSPECTION OF FAN COWL NO.1 ENGIN

Task Card NO:

ZL-437-01-1-001

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

-Aircraft Maintenance Manual used: Revision No. _____ Dated. _____.

Task card finding (Tick Applicable Box) [] Yes [] No. If yes update the system and list Task card finding WO below

Work order No: _____

Note: Make sure to create the finding Work Order on task card level.

Remark's: _____

(1) If Task card interrupted or performed by different persons updates the system and update the following accordingly (Tick Applicable Box)

- Interruption No. 1 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

- Interruption No. 2 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

- Interruption No. 3 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

- Interruption No. 4 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

- Interruption No. 5 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

(2) Record any dimension or torque through the performed steps and sign-off as applicable:

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

**Task Completion Close Up And
System Update****Station****Date****Signature**

 MET.32721892		Task Card Title: GENERAL VISUAL INSPECTION OF FAN COWL NO.2 ENGIN					
Task Card NO: ZL-437-01-1-002		Work Package: ASP/H-26 C7-CHK		A/C Registration: HZ-ASP			
A/C Type: 321		Block Taskcard		Main Skill: II,INSP		PROD Final Acceptance:	
Project No: 01BASPC72608		Related Task Card:		A/C Area: 02			
Internal Check:		Check Type:		Work Order NO: 31956352		Tally Sequence NO: 333	
ENCLOSURE: ☐ CMR: ☐ CPCP: ☐ ETOPS: ☐ CDCCL: ☐ AD: ☐ ALI: ☐							
Type Code: GVI		Special Code: INSP		MSG Code: EWIS, MRB		Request:	
						Phase: INSPECTION	
I HEREBY CERTIFY THAT ALL WARNINGS AND CAUTIONS HAVE BEEN READ AND THE WORK HAS BEEN CARRID OUT IN ACCORDING WITH ALL LAID DOWN PROCEDURES, ATTACHED NOTES AND INFORMATION.							
Zones: 447,448							
DOCUMENT REFERENCES:							
Doc Typ		Reference					
AMM		05-24-30-200-003-A					
AMM		052430-200-003					
ACCESS PANELS:							
447AL, 448AR							
MATERIAL REQUIREMENTS:							
Part Number		Description				Qty.	
No parts assigned to this Task Item							
TOOLING REQUIREMENTS:							
Part Number		Description				Qty.	
No tools assigned to this Task Item							
TASK INSTRUCTIONS							
Job Description							
NOTE: THE INSPECTION MUST BE PERFORMED FROM WITHIN A TOUCHING DISTANCE (UNLESS OTHERWISE STATED), USING VISUAL INSPECTION AIDS I.E. INSPECTION MIRROR, SPOT LIGHT ETC., AS REQUIRED, WITH ALL IDENTIFIED ACCESS PANELS OPEN. THE PURPOSE OF THE INSPECTION IS TO DETERMINE THE GENERAL CONDITION AND SECURITY OF VISIBLE SYSTEM INSTALLATIONS / COMPONENTS / STRUCTURE CONTAINED IN THE ZONE INCLUDING CHECKING FOR EVIDENCE OF DEGRADATION, CHAFING OF TUBING, LOOSE DUCT SUPPORT, WIRING DAMAGE, CABLE AND PULLEY WEAR, FLUID LEAKS, INADEQUATE DRAINAGE AND OTHER CONDITIONS THAT COULD LEAD TO CORROSION / DAMAGE, AND GENERAL CONDITION OF THE ACCESS PANELS / FAIRINGS REMOVED.							
A. PERFORM A ZONAL GENERAL VISUAL INSPECTION OF NO.2 ENGINE FAN COWLING PER AMM TASK 05-24-30-200-003-A.							
STEP COMPLETION SIGN OFF:							
	Qualification / Skill	Number of employees	Duration		Number./Signature	Date	
				HRS		Day	Month
Mechanic/s				HRS			
Insp.	II/INSP			HRS			



MET.32721892

Task Card Title:

GENERAL VISUAL INSPECTION OF FAN COWL NO.2 ENGIN

Task Card NO:

ZL-437-01-1-002

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

-Aircraft Maintenance Manual used: Revision No. _____ Dated. _____.

Task card finding (Tick Applicable Box) [] Yes [] No. If yes update the system and list Task card finding WO below

Work order No: _____

Note: Make sure to creat the finding Work Order on task card level.

Remark's: _____

(1) If Task card interrupted or performed by different personals updates the system and update the following accord (Tick Applicable Box)

- Interruption No. 1 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

- Interruption No. 2 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

- Interruption No. 3 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

- Interruption No. 4 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

- Interruption No. 5 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

(2) Record any dimension or torque through the performed steps and sign-off as applicable:

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

**Task Completion Close Up And
System Update****Station****Date****Signature**

 MET.28342298		Task Card Title: NO. 1 ENGINE THRUST REVERSER COWLING							
Task Card NO: ZL-451-01-1-001		Work Package: ASP/H-26 C7-CHK		A/C Registration: HZ-ASP					
A/C Type: 321		Block Taskcard		Main Skill: PP,II,INSP,ACFT_TECH		PROD Final Acceptance:			
Project No: 01BASPC72608		Related Task Card:		A/C Area: 01					
Internal Check:		Check Type:		Work Order NO: 31956352		Tally Sequence NO: 334			
ENCLOSURE: ☐ CMR: ☐ CPCP: ☐ ETOPS: ☐ CDCCL: ☐ AD: ☐ ALI: ☐									
Type Code: GVI		Special Code: PP		MSG Code: MRB, EWIS		Request: Phase: JOB-SETUP,INSPECTION, JOB-CLOSEUP			
I HEREBY CERTIFY THAT ALL WARNINGS AND CAUTIONS HAVE BEEN READ AND THE WORK HAS BEEN CARRID OUT IN ACCORDING WITH ALL LAID DOWN PROCEDURES, ATTACHED NOTES AND INFORMATION.									
Zones: 451,452									
DOCUMENT REFERENCES:									
Doc Typ		Reference							
AMM		05-24-50-200-001-A							
AMM		052450-200-001							
ACCESS PANELS:									
437AL, 438AR, 451AL, 452AR									
MATERIAL REQUIREMENTS:									
Part Number		Description				Qty.			
No parts assigned to this Task Item									
TOOLING REQUIREMENTS:									
Part Number		Description				Qty.			
No tools assigned to this Task Item									
TASK PREPARATION									
Job Description									
A. PREPARE FOR TASK ACCOMPLISHMENT AS PER AMM TASK 05-24-50-200-001-A.									
STEP COMPLETION SIGN OFF:									
		Qualification / Skill	Number of employees	Duration		Number./Signature	Date		
							Day	Month	Year
Mechanic/s		PP/ACFT_TECH		HRS					
Insp.				HRS					



Task Card Title:

NO. 1 ENGINE THRUST REVERSER COWLING

Task Card NO:

ZL-451-01-1-001

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP**TASK INSTRUCTIONS****Job Description**

NOTE: THE INSPECTION MUST BE PERFORMED FROM WITHIN A TOUCHING DISTANCE (UNLESS OTHERWISE STATED), USING VISUAL INSPECTION AIDS I.E. INSPECTION MIRROR, SPOT LIGHT ETC., AS REQUIRED, WITH ALL IDENTIFIED ACCESS PANELS OPEN.

THE PURPOSE OF THE INSPECTION IS TO DETERMINE THE GENERAL CONDITION AND SECURITY OF VISIBLE SYSTEM INSTALLATIONS / COMPONENTS / STRUCTURE CONTAINED IN THE ZONE INCLUDING CHECKING FOR EVIDENCE OF DEGRADATION, CHAFING OF TUBING, LOOSE DUCT SUPPORT, WIRING DAMAGE, CABLE AND PULLEY WEAR, FLUID LEAKS, INADEQUATE DRAINAGE AND OTHER CONDITIONS THAT COULD LEAD TO CORROSION / DAMAGE, AND GENERAL CONDITION OF THE ACCESS PANELS / FAIRINGS REMOVED.

A. PERFORM A ZONAL GENERAL VISUAL INSPECTION OF THE NO.1 ENGINE THRUST REVERSER (T/R) AND THE AREA BELOW THE THRUST REVERSER AS PER AMM TASK 05-24-50-200-001-A.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration		Number./Signature	Date		
						Day	Month	Year
Mechanic/s				HRS				
Insp.	II/INSP			HRS				

CLOSE UP**Job Description**

A. RETURN THE AIRCRAFT TO ITS NORMAL CONFIGURATION AS PER AMM TASK 05-24-50-200-001-A.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration		Number./Signature	Date		
						Day	Month	Year
Mechanic/s	PP/ACFT_TECH			HRS				
Insp.				HRS				

-Aircraft Maintenance Manual used: Revision No. _____ Dated. _____.

Task card finding (Tick Applicable Box) [] Yes [] No. If yes update the system and list Task card finding WO below

Work order No: _____

Note: Make sure to create the finding Work Order on task card level.

Remark's: _____



Task Card Title:

NO. 1 ENGINE THRUST REVERSER COWLING

Task Card NO:

ZL-451-01-1-001

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

(1) If Task card interrupted or performed by different personals updates the system and update the following accord (Tick Applicable Box)

- Interruption No. 1 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 2 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 3 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 4 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 5 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____

(2) Record any dimension or torque through the performed steps and sign-off as applicable:

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____

**Task Completion Close Up And
System Update**

Station**Date****Signature**

 MET.28342209		Task Card Title: NO. 2 ENGINE THRUST REVERSER COWLING					
Task Card NO: ZL-451-01-1-002		Work Package: ASP/H-26 C7-CHK		A/C Registration: HZ-ASP			
A/C Type: 321		Block Taskcard		Main Skill: PP,II,INSP,ACFT_TECH		PROD Final Acceptance:	
Project No: 01BASPC72608		Related Task Card:		A/C Area: 02			
Internal Check:		Check Type:		Work Order NO: 31956352		Tally Sequence NO: 335	
ENCLOSURE: ☐ CMR: ☐ CPCP: ☐ ETOPS: ☐ CDCCL: ☐ AD: ☐ ALI: ☐							
Type Code: GVI		Special Code: PP		MSG Code: MRB, EWIS		Request: JOB-SETUP,INSPECTION, JOB-CLOSEUP	
I HEREBY CERTIFY THAT ALL WARNINGS AND CAUTIONS HAVE BEEN READ AND THE WORK HAS BEEN CARRIED OUT IN ACCORDING WITH ALL LAID DOWN PROCEDURES, ATTACHED NOTES AND INFORMATION.							
Zones: 461,462							
DOCUMENT REFERENCES:							
Doc Typ		Reference					
AMM		05-24-50-200-001-A					
AMM		052450-200-001					
ACCESS PANELS:							
447AL, 448AR, 461AL, 462AR							
MATERIAL REQUIREMENTS:							
Part Number		Description				Qty.	
No parts assigned to this Task Item							
TOOLING REQUIREMENTS:							
Part Number		Description				Qty.	
No tools assigned to this Task Item							
TASK PREPARATION							
Job Description							
A. PREPARE FOR TASK ACCOMPLISHMENT AS PER AMM TASK 05-24-50-200-001-A.							
STEP COMPLETION SIGN OFF:							
	Qualification / Skill	Number of employees	Duration		Number./Signature	Date	
				HRS		Day	Month
Mechanic/s	PP/ACFT_TECH			HRS			
Insp.				HRS			



Task Card Title:

NO. 2 ENGINE THRUST REVERSER COWLING

Task Card NO:

ZL-451-01-1-002

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP**TASK INSTRUCTIONS****Job Description**

NOTE: THE INSPECTION MUST BE PERFORMED FROM WITHIN A TOUCHING DISTANCE (UNLESS OTHERWISE STATED), USING VISUAL INSPECTION AIDS I.E. INSPECTION MIRROR, SPOT LIGHT ETC., AS REQUIRED, WITH ALL IDENTIFIED ACCESS PANELS OPEN.

THE PURPOSE OF THE INSPECTION IS TO DETERMINE THE GENERAL CONDITION AND SECURITY OF VISIBLE SYSTEM INSTALLATIONS / COMPONENTS / STRUCTURE CONTAINED IN THE ZONE INCLUDING CHECKING FOR EVIDENCE OF DEGRADATION, CHAFING OF TUBING, LOOSE DUCT SUPPORT, WIRING DAMAGE, CABLE AND PULLEY WEAR, FLUID LEAKS, INADEQUATE DRAINAGE AND OTHER CONDITIONS THAT COULD LEAD TO CORROSION / DAMAGE, AND GENERAL CONDITION OF THE ACCESS PANELS / FAIRINGS REMOVED.

A. PERFORM A ZONAL GENERAL VISUAL INSPECTION OF THE NO.2 ENGINE THRUST REVERSER (T/R) AND THE AREA BELOW THE THRUST REVERSER AS PER AMM TASK 05-24-50-200-001-A.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration		Number./Signature	Date		
						Day	Month	Year
Mechanic/s				HRS				
Insp.	II/INSP			HRS				

CLOSE UP**Job Description**

A. RETURN THE AIRCRAFT TO ITS NORMAL CONFIGURATION AS PER AMM TASK 05-24-50-200-001-A.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration		Number./Signature	Date		
						Day	Month	Year
Mechanic/s	PP/ACFT_TECH			HRS				
Insp.				HRS				

-Aircraft Maintenance Manual used: Revision No. _____ Dated. _____.

Task card finding (Tick Applicable Box) [] Yes [] No. If yes update the system and list Task card finding WO below

Work order No: _____

Note: Make sure to create the finding Work Order on task card level.

Remark's: _____



Task Card Title:

NO. 2 ENGINE THRUST REVERSER COWLING

Task Card NO:

ZL-451-01-1-002

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

(1) If Task card interrupted or performed by different personals updates the system and update the following accord (Tick Applicable Box)

- Interruption No. 1 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 2 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 3 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 4 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 5 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____

(2) Record any dimension or torque through the performed steps and sign-off as applicable:

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____

**Task Completion Close Up And
System Update**

Station**Date****Signature**

 MET.32721972		Task Card Title: NO.1 ENGINE HOT SECTION ZONAL INSP					
Task Card NO: ZL-453-01-1-001		Work Package: ASP/H-26 C7-CHK		A/C Registration: HZ-ASP			
A/C Type: 321		Block Taskcard		Main Skill: INSP,II		PROD Final Acceptance:	
Project No: 01BASPC72608		Related Task Card:		A/C Area: 01			
Internal Check:		Check Type:		Work Order NO: 31956352		Tally Sequence NO: 336	
ENCLOSURE: ☐ CMR: ☐ CPCP: ☐ ETOPS: ☐ CDCCL: ☐ AD: ☐ ALI: ☐							
Type Code: GVI		Special Code: INSP		MSG Code: EWIS, MRB		Request:	
						Phase: INSPECTION	
I HEREBY CERTIFY THAT ALL WARNINGS AND CAUTIONS HAVE BEEN READ AND THE WORK HAS BEEN CARRIED OUT IN ACCORDING WITH ALL LAID DOWN PROCEDURES, ATTACHED NOTES AND INFORMATION.							
Zones: 453,454							
DOCUMENT REFERENCES:							
Doc Typ		Reference					
AMM		05-24-50-200-002-A					
AMM		052450-200-002					
ACCESS PANELS:							
437AL, 438AR, 451AL, 452AR							
MATERIAL REQUIREMENTS:							
Part Number		Description				Qty.	
No parts assigned to this Task Item							
TOOLING REQUIREMENTS:							
Part Number		Description				Qty.	
No tools assigned to this Task Item							
TASK INSTRUCTIONS							
Job Description							
NOTE: THE INSPECTION MUST BE PERFORMED FROM WITHIN A TOUCHING DISTANCE (UNLESS OTHERWISE STATED), USING VISUAL INSPECTION AIDS I.E. INSPECTION MIRROR, SPOT LIGHT ETC., AS REQUIRED, WITH ALL IDENTIFIED ACCESS PANELS OPEN. THE PURPOSE OF THE INSPECTION IS TO DETERMINE THE GENERAL CONDITION AND SECURITY OF VISIBLE SYSTEM INSTALLATIONS / COMPONENTS / STRUCTURE CONTAINED IN THE ZONE INCLUDING CHECKING FOR EVIDENCE OF DEGRADATION, CHAFING OF TUBING, LOOSE DUCT SUPPORT, WIRING DAMAGE, CABLE AND PULLEY WEAR, FLUID LEAKS, INADEQUATE DRAINAGE AND OTHER CONDITIONS THAT COULD LEAD TO CORROSION / DAMAGE, AND GENERAL CONDITION OF THE ACCESS PANELS / FAIRINGS REMOVED.							
A. PERFORM A ZONAL GENERAL VISUAL INSPECTION OF NO.1 ENGINE HOT SECTION PER AMM TASK 05-24-50-200-002-A.							
STEP COMPLETION SIGN OFF:							
	Qualification / Skill	Number of employees	Duration		Number./Signature	Date	
				HRS		Day	Month
Mechanic/s				HRS			
Insp.	INSP/II			HRS			



MET.32721972

Task Card Title:

NO.1 ENGINE HOT SECTION ZONAL INSP

Task Card NO:

ZL-453-01-1-001

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

-Aircraft Maintenance Manual used: Revision No. _____ Dated. _____.

Task card finding (Tick Applicable Box) [] Yes [] No. If yes update the system and list Task card finding WO below

Work order No: _____

Note: Make sure to create the finding Work Order on task card level.

Remark's: _____

(1) If Task card interrupted or performed by different persons updates the system and update the following accordingly (Tick Applicable Box)

- Interruption No. 1 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

- Interruption No. 2 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

- Interruption No. 3 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

- Interruption No. 4 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

- Interruption No. 5 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

(2) Record any dimension or torque through the performed steps and sign-off as applicable:

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

**Task Completion Close Up And
System Update****Station****Date****Signature**

 MET.32721878		Task Card Title: NO.2 ENGINE HOT SECTION ZONAL INSP					
Task Card NO: ZL-453-01-1-002		Work Package: ASP/H-26 C7-CHK		A/C Registration: HZ-ASP			
A/C Type: 321		Block Taskcard		Main Skill: II,INSP		PROD Final Acceptance:	
Project No: 01BASPC72608		Related Task Card:		A/C Area: 02			
Internal Check:		Check Type:		Work Order NO: 31956352		Tally Sequence NO: 337	
ENCLOSURE: ☐ CMR: ☐ CPCP: ☐ ETOPS: ☐ CDCCL: ☐ AD: ☐ ALI: ☐							
Type Code: GVI		Special Code: INSP		MSG Code: EWIS, MRB		Request: Phase: INSPECTION	
I HEREBY CERTIFY THAT ALL WARNINGS AND CAUTIONS HAVE BEEN READ AND THE WORK HAS BEEN CARRID OUT IN ACCORDING WITH ALL LAID DOWN PROCEDURES, ATTACHED NOTES AND INFORMATION.							
Zones: 463,464							
DOCUMENT REFERENCES:							
Doc Typ		Reference					
AMM		05-24-50-200-002-A					
AMM		052450-200-002					
ACCESS PANELS:							
447AL, 448AR, 461AL, 462AR							
MATERIAL REQUIREMENTS:							
Part Number		Description				Qty.	
No parts assigned to this Task Item							
TOOLING REQUIREMENTS:							
Part Number		Description				Qty.	
No tools assigned to this Task Item							
TASK INSTRUCTIONS							
Job Description							
NOTE: THE INSPECTION MUST BE PERFORMED FROM WITHIN A TOUCHING DISTANCE (UNLESS OTHERWISE STATED), USING VISUAL INSPECTION AIDS I.E. INSPECTION MIRROR, SPOT LIGHT ETC., AS REQUIRED, WITH ALL IDENTIFIED ACCESS PANELS OPEN. THE PURPOSE OF THE INSPECTION IS TO DETERMINE THE GENERAL CONDITION AND SECURITY OF VISIBLE SYSTEM INSTALLATIONS / COMPONENTS / STRUCTURE CONTAINED IN THE ZONE INCLUDING CHECKING FOR EVIDENCE OF DEGRADATION, CHAFING OF TUBING, LOOSE DUCT SUPPORT, WIRING DAMAGE, CABLE AND PULLEY WEAR, FLUID LEAKS, INADEQUATE DRAINAGE AND OTHER CONDITIONS THAT COULD LEAD TO CORROSION / DAMAGE, AND GENERAL CONDITION OF THE ACCESS PANELS / FAIRINGS REMOVED. A. PERFORM A ZONAL GENERAL VISUAL INSPECTION OF NO.2 ENGINE HOT SECTION PER AMM TASK 05-24-50-200-002-A.							
STEP COMPLETION SIGN OFF:							
		Qualification / Skill	Number of employees	Duration	Number./Signature	Date	
						Day	Month
Mechanic/s				HRS			
Insp.		II/INSP		HRS			



MET.32721878

Task Card Title:

NO.2 ENGINE HOT SECTION ZONAL INSP

Task Card NO:

ZL-453-01-1-002

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

-Aircraft Maintenance Manual used: Revision No. _____ Dated. _____.

Task card finding (Tick Applicable Box) [] Yes [] No. If yes update the system and list Task card finding WO below

Work order No: _____

Note: Make sure to create the finding Work Order on task card level.

Remark's: _____

(1) If Task card interrupted or performed by different persons updates the system and update the following accordingly (Tick Applicable Box)

- Interruption No. 1 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

- Interruption No. 2 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

- Interruption No. 3 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

- Interruption No. 4 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

- Interruption No. 5 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

(2) Record any dimension or torque through the performed steps and sign-off as applicable:

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

**Task Completion Close Up And
System Update****Station****Date****Signature**

 MET.32721968		Task Card Title: NO.1 ENG PYLON L/E AND LOWER FAIRING					
Task Card NO: ZL-471-01-4-001		Work Package: ASP/H-26 C7-CHK		A/C Registration: HZ-ASP			
A/C Type: 321		Block Taskcard		Main Skill: INSP,II		PROD Final Acceptance:	
Project No: 01BASPC72608		Related Task Card:		A/C Area: 01			
Internal Check:		Check Type:		Work Order NO: 31956352		Tally Sequence NO: 338	
ENCLOSURE: ☐ CMR: ☐ CPCP: ☐ ETOPS: ☐ CDCCL: ☐ AD: ☐ ALI: ☐							
Type Code: GVI		Special Code: INSP		MSG Code: MRB		Request:	
						Phase: INSPECTION	
I HEREBY CERTIFY THAT ALL WARNINGS AND CAUTIONS HAVE BEEN READ AND THE WORK HAS BEEN CARRIED OUT IN ACCORDING WITH ALL LAID DOWN PROCEDURES, ATTACHED NOTES AND INFORMATION.							
Zones: 471,472,473,475,476,477							
DOCUMENT REFERENCES:							
Doc Typ		Reference					
AMM		05-24-70-200-001-A					
AMM		052470-200-001					
ACCESS PANELS:							
471BL, 471BR, 471CL, 471CR, 471DL, 473AL, 473AR, 475AL, 475AR, 475BL, 475BR, 477AL							
MATERIAL REQUIREMENTS:							
Part Number		Description				Qty.	
No parts assigned to this Task Item							
TOOLING REQUIREMENTS:							
Part Number		Description				Qty.	
No tools assigned to this Task Item							
TASK INSTRUCTIONS							
Job Description							
NOTE: THE INSPECTION MUST BE PERFORMED FROM WITHIN A TOUCHING DISTANCE (UNLESS OTHERWISE STATED), USING VISUAL INSPECTION AIDS I.E. INSPECTION MIRROR, SPOT LIGHT ETC., AS REQUIRED, WITH ALL IDENTIFIED ACCESS PANELS OPEN. THE PURPOSE OF THE INSPECTION IS TO DETERMINE THE GENERAL CONDITION AND SECURITY OF VISIBLE SYSTEM INSTALLATIONS / COMPONENTS / STRUCTURE CONTAINED IN THE ZONE INCLUDING CHECKING FOR EVIDENCE OF DEGRADATION, CHAFING OF TUBING, LOOSE DUCT SUPPORT, WIRING DAMAGE, CABLE AND PULLEY WEAR, FLUID LEAKS, INADEQUATE DRAINAGE AND OTHER CONDITIONS THAT COULD LEAD TO CORROSION / DAMAGE AND GENERAL CONDITION OF THE ACCESS PANELS / FAIRINGS REMOVED. A. PERFORM ZONAL GENERAL VISUAL INSPECTION OF THE LEADING EDGE OF THE PYLON AND THE LOWER FAIRING (ZONES 471, 472, 473, 475, 476, 477) PER AMM TASK 05-24-70-200-001-A.							
STEP COMPLETION SIGN OFF:							
	Qualification / Skill	Number of employees	Duration		Number./Signature	Date	
				HRS		Day	Month
Mechanic/s							

Copyright of Saudia Technic - Regeneration is not allowed without prior approval by Saudia Technic.

 MET.32721920		Task Card Title: NO.2 ENG PYLON L/E AND LOWER FAIRING					
Task Card NO: ZL-471-01-4-002		Work Package: ASP/H-26 C7-CHK		A/C Registration: HZ-ASP			
A/C Type: 321		Block Taskcard		Main Skill: INSP,II		PROD Final Acceptance:	
Project No: 01BASPC72608		Related Task Card:		A/C Area: 02			
Internal Check:		Check Type:		Work Order NO: 31956352		Tally Sequence NO: 339	
ENCLOSURE: ☐ CMR: ☐ CPCP: ☐ ETOPS: ☐ CDCCL: ☐ AD: ☐ ALI: ☐							
Type Code: GVI		Special Code: INSP		MSG Code: MRB		Request: 	
						Phase: INSPECTION	
I HEREBY CERTIFY THAT ALL WARNINGS AND CAUTIONS HAVE BEEN READ AND THE WORK HAS BEEN CARRIED OUT IN ACCORDING WITH ALL LAID DOWN PROCEDURES, ATTACHED NOTES AND INFORMATION.							
Zones: 481,482,483,485,486,487							
DOCUMENT REFERENCES:							
Doc Typ		Reference					
AMM		05-24-70-200-001-A					
AMM		052470-200-001					
ACCESS PANELS:							
481BL, 481BR, 481CL, 481CR, 483AL, 483AR, 485AL, 485AR, 485BL, 485BR							
MATERIAL REQUIREMENTS:							
Part Number		Description				Qty.	
No parts assigned to this Task Item							
TOOLING REQUIREMENTS:							
Part Number		Description				Qty.	
No tools assigned to this Task Item							
TASK INSTRUCTIONS							
Job Description							
NOTE: THE INSPECTION MUST BE PERFORMED FROM WITHIN A TOUCHING DISTANCE (UNLESS OTHERWISE STATED), USING VISUAL INSPECTION AIDS I.E. INSPECTION MIRROR, SPOT LIGHT ETC., AS REQUIRED, WITH ALL IDENTIFIED ACCESS PANELS OPEN. THE PURPOSE OF THE INSPECTION IS TO DETERMINE THE GENERAL CONDITION AND SECURITY OF VISIBLE SYSTEM INSTALLATIONS / COMPONENTS / STRUCTURE CONTAINED IN THE ZONE INCLUDING CHECKING FOR EVIDENCE OF DEGRADATION, CHAFING OF TUBING, LOOSE DUCT SUPPORT, WIRING DAMAGE, CABLE AND PULLEY WEAR, FLUID LEAKS, INADEQUATE DRAINAGE AND OTHER CONDITIONS THAT COULD LEAD TO CORROSION / DAMAGE AND GENERAL CONDITION OF THE ACCESS PANELS / FAIRINGS REMOVED. A. PERFORM ZONAL GENERAL VISUAL INSPECTION OF THE LEADING EDGE OF THE PYLON AND THE LOWER FAIRING (ZONES 481, 482, 483, 485, 486, 487) PER AMM TASK 05-24-70-200-001-A.							
STEP COMPLETION SIGN OFF:							
Qualification / Skill		Number of employees		Duration		Number./Signature	
						Date Day Month Year	
Mechanic/s				HRS			



Task Card Title:

NO.2 ENG PYLON L/E AND LOWER FAIRING

Task Card NO:

ZL-471-01-4-002

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

Insp.

INSP/II

HRS

-Aircraft Maintenance Manual used: Revision No. _____ Dated. _____.

Task card finding (Tick Applicable Box) [] Yes [] No. If yes update the system and list Task card finding WO below

Work order No: _____

_____, _____, _____, _____, _____, _____, _____, _____

Note: Make sure to creat the finding Work Order on task card level.

Remark's: _____

(1) If Task card interrupted or performed by different personals updates the system and update the following accord (Tick Applicable Box)

- Interruption No. 1 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

- Interruption No. 2 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

- Interruption No. 3 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

- Interruption No. 4 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

- Interruption No. 5 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

(2) Record any dimension or torque through the performed steps and sign-off as applicable:

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

**Task Completion Close Up And
System Update****Station****Date****Signature**

 MET.32721883		Task Card Title: L/H WING LOWER SURFACE ZONAL INSP							
Task Card NO: ZL-500-02-1-001		Work Package: ASP/H-26 C7-CHK		A/C Registration: HZ-ASP					
A/C Type: 321		Block Taskcard		Main Skill: II,INSP		PROD Final Acceptance:			
Project No: 01BASPC72608		Related Task Card:		A/C Area: 07					
Internal Check:		Check Type:		Work Order NO: 31956352		Tally Sequence NO: 340			
ENCLOSURE: ☐ CMR: ☐ CPCP: ☐ ETOPS: ☐ CDCCL: ☐ AD: ☐ ALI: ☐									
Type Code: GVI		Special Code: INSP		MSG Code: MRB, EWIS		Request: Phase: INSPECTION			
I HEREBY CERTIFY THAT ALL WARNINGS AND CAUTIONS HAVE BEEN READ AND THE WORK HAS BEEN CARRID OUT IN ACCORDING WITH ALL LAID DOWN PROCEDURES, ATTACHED NOTES AND INFORMATION.									
Zones: 500									
DOCUMENT REFERENCES:									
Doc Typ		Reference							
AMM		05-25-00-200-002-A							
AMM		052500-200-002							
ACCESS PANELS:									
MATERIAL REQUIREMENTS:									
Part Number		Description				Qty.			
No parts assigned to this Task Item									
TOOLING REQUIREMENTS:									
Part Number		Description				Qty.			
No tools assigned to this Task Item									
Job Description									
NOTE: The inspection must be performed from within a touching distance (unless otherwise stated), using visual inspection aids i.e. inspection mirror, spot light etc., as required, with all identified access panels open. The purpose of the inspection is to determine the general condition and security of visible system installations / components / structure contained in the zone including checking for evidence of degradation, chafing of tubing, loose duct support, wiring damage, cable and pulley wear, fluid leaks, inadequate drainage and other conditions that could lead to corrosion / damage and general condition of the access panels / fairings removed. A. Perform Zonal General Visual Inspection of the wing lower surface including upper and lower surfaces of slats and flaps per AMM TASK 05-25-00-200-002-A.									
STEP COMPLETION SIGN OFF:									
		Qualification / Skill	Number of employees	Duration		Number./Signature	Date		
							Day	Month	Year
Mechanic/s				HRS					



Task Card Title:

L/H WING LOWER SURFACE ZONAL INSP

Task Card NO:

ZL-500-02-1-001

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

Insp.

II/INSP

HRS

-Aircraft Maintenance Manual used: Revision No. _____ Dated. _____.

Task card finding (Tick Applicable Box) [] Yes [] No. If yes update the system and list Task card finding WO below

Work order No: _____, _____, _____, _____, _____, _____, _____, _____, _____, _____

_____, _____, _____, _____, _____, _____, _____, _____, _____, _____

Note: Make sure to creat the finding Work Order on task card level.

Remark's: _____

(1) If Task card interrupted or performed by different personals updates the system and update the following accord (Tick Applicable Box)

- Interruption No. 1 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

- Interruption No. 2 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

- Interruption No. 3 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

- Interruption No. 4 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

- Interruption No. 5 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

(2) Record any dimension or torque through the performed steps and sign-off as applicable:

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

**Task Completion Close Up And
System Update****Station****Date****Signature**

 MET.32721874		Task Card Title: R/H WING LOWER SURFACE ZONAL INSP					
Task Card NO: ZL-500-02-1-002		Work Package: ASP/H-26 C7-CHK		A/C Registration: HZ-ASP			
A/C Type: 321		Block Taskcard		Main Skill: II,INSP		PROD Final Acceptance:	
Project No: 01BASPC72608		Related Task Card:		A/C Area: 08			
Internal Check:		Check Type:		Work Order NO: 31956352		Tally Sequence NO: 341	
ENCLOSURE: ☐ CMR: ☐ CPCP: ☐ ETOPS: ☐ CDCCL: ☐ AD: ☐ ALI: ☐							
Type Code: GVI		Special Code: INSP		MSG Code: MRB, EWIS		Request: Phase: INSPECTION	
I HEREBY CERTIFY THAT ALL WARNINGS AND CAUTIONS HAVE BEEN READ AND THE WORK HAS BEEN CARRIED OUT IN ACCORDING WITH ALL LAID DOWN PROCEDURES, ATTACHED NOTES AND INFORMATION.							
Zones: 600							
DOCUMENT REFERENCES:							
Doc Typ		Reference					
AMM		05-25-00-200-002-A					
AMM		052500-200-002					
ACCESS PANELS:							
MATERIAL REQUIREMENTS:							
Part Number		Description					Qty.
No parts assigned to this Task Item							
TOOLING REQUIREMENTS:							
Part Number		Description					Qty.
No tools assigned to this Task Item							
Job Description							
NOTE: The inspection must be performed from within a touching distance (unless otherwise stated), using visual inspection aids i.e. inspection mirror, spot light etc., as required, with all identified access panels open. The purpose of the inspection is to determine the general condition and security of visible system installations / components / structure contained in the zone including checking for evidence of degradation, chafing of tubing, loose duct support, wiring damage, cable and pulley wear, fluid leaks, inadequate drainage and other conditions that could lead to corrosion / damage and general condition of the access panels / fairings removed. A. Perform Zonal General Visual Inspection of the wing lower surface including upper and lower surfaces of slats and flaps per AMM TASK 05-25-00-200-002-A.							
STEP COMPLETION SIGN OFF:							
Qualification / Skill		Number of employees		Duration		Number./Signature	
						Date Day Month Year	
Mechanic/s				HRS			



Task Card Title:

R/H WING LOWER SURFACE ZONAL INSP

Task Card NO:

ZL-500-02-1-002

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

Insp.

II/INSP

HRS

-Aircraft Maintenance Manual used: Revision No. _____ Dated. _____.

Task card finding (Tick Applicable Box) [] Yes [] No. If yes update the system and list Task card finding WO below

Work order No: _____

Note: Make sure to creat the finding Work Order on task card level.

Remark's: _____

(1) If Task card interrupted or performed by different personals updates the system and update the following accord (Tick Applicable Box)

- Interruption No. 1 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 2 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 3 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 4 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 5 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____

(2) Record any dimension or torque through the performed steps and sign-off as applicable:

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____

**Task Completion Close Up And
System Update**

Station

Date

Signature

 MET.32721843		Task Card Title: L/H FLAP TAB HINGE AND FAIRING NO.3A					
Task Card NO: ZL-537-01-2-001		Work Package: ASP/H-26 C7-CHK		A/C Registration: HZ-ASP			
A/C Type: 321		Block Taskcard		Main Skill: II,INSP		PROD Final Acceptance:	
Project No: 01BASPC72608		Related Task Card:		A/C Area: 07			
Internal Check:		Check Type:		Work Order NO: 31956352		Tally Sequence NO: 342	
ENCLOSURE: ☐ CMR: ☐ CPCP: ☐ ETOPS: ☐ CDCCL: ☐ AD: ☐ ALI: ☐							
Type Code: GVI		Special Code: INSP		MSG Code: MRB		Request: Phase: PRE INSP	
I HEREBY CERTIFY THAT ALL WARNINGS AND CAUTIONS HAVE BEEN READ AND THE WORK HAS BEEN CARRIED OUT IN ACCORDING WITH ALL LAID DOWN PROCEDURES, ATTACHED NOTES AND INFORMATION.							
Zones: 537							
DOCUMENT REFERENCES:							
Doc Typ		Reference					
AMM		05-25-30-200-010-A					
AMM		052530-200-010					
ACCESS PANELS:							
537AB, 537CB							
MATERIAL REQUIREMENTS:							
Part Number		Description				Qty.	
NO PARTS ASSIGNED TO THIS TASK							
TOOLING REQUIREMENTS:							
Part Number		Description				Qty.	
98L12003001000		HARNESS, SAFETY (TOOL/HZ-HMS)				1.0	
TASK INSTRUCTION							
Job Description							
NOTE: The inspection must be performed from within a touching distance (unless otherwise stated), using visual inspection aids i.e. inspection mirror, spot light etc., as required, with all identified access panels open. The purpose of the inspection is to determine the general condition and security of visible system installations / components / structure contained in the zone including checking for evidence of degradation, chafing of tubing, loose duct support, wiring damage, cable and pulley wear, fluid leaks, inadequate drainage and other conditions that could lead to corrosion / damage and general condition of the access panels / fairings removed. A. Perform Zonal General Visual Inspection of the flap tab hinge and the fairing NO. 3A per AMM TASK 05-25-30-200-010-A.							
STEP COMPLETION SIGN OFF:							
Qualification / Skill		Number of employees		Duration		Number./Signature	
Date							
Day Month Year							
Mechanic/s				HRS			



MET.32721843

Task Card Title:

L/H FLAP TAB HINGE AND FAIRING NO.3A

Task Card NO:

ZL-537-01-2-001

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

Insp.

II/INSP

HRS

- Aircraft Maintenance Manual used: Revision No. _____ Dated. _____.

Task card finding (Tick Applicable Box) [] Yes [] No. If yes update the system and list Task card finding WO below

Work order No: _____

Note: Make sure to create the finding Work Order on task card level.

Remark's: _____

(1) If Task card interrupted or performed by different persons updates the system and update the following accordingly (Tick Applicable Box)

- Interruption No. 1 [] Task card [] AMM [] Other specify. _____
- Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 2 [] Task card [] AMM [] Other specify. _____
- Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 3 [] Task card [] AMM [] Other specify. _____
- Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 4 [] Task card [] AMM [] Other specify. _____
- Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 5 [] Task card [] AMM [] Other specify. _____
- Performed by: _____ Page No. _____ Step From _____ To _____

(2) Record any dimension or torque through the performed steps and sign-off as applicable:

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
- Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
- Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
- Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
- Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
- Remark's: _____

**Task Completion Close Up And
System Update**

Station

Date

Signature

 MET.32721911		Task Card Title: R/H FLAP TAB HINGE AND FAIRING NO.3A					
Task Card NO: ZL-537-01-2-002		Work Package: ASP/H-26 C7-CHK		A/C Registration: HZ-ASP			
A/C Type: 321		Block Taskcard		Main Skill: INSP,II		PROD Final Acceptance:	
Project No: 01BASPC72608		Related Task Card:		A/C Area: 08			
Internal Check:		Check Type:		Work Order NO: 31956352		Tally Sequence NO: 343	
ENCLOSURE: ☐ CMR: ☐ CPCP: ☐ ETOPS: ☐ CDCCL: ☐ AD: ☐ ALI: ☐							
Type Code: GVI		Special Code: INSP		MSG Code: MRB		Request: Phase: PRE INSP	
I HEREBY CERTIFY THAT ALL WARNINGS AND CAUTIONS HAVE BEEN READ AND THE WORK HAS BEEN CARRIED OUT IN ACCORDING WITH ALL LAID DOWN PROCEDURES, ATTACHED NOTES AND INFORMATION.							
Zones: 637							
DOCUMENT REFERENCES:							
Doc Typ		Reference					
AMM		05-25-30-200-010-A					
AMM		052530-200-010					
ACCESS PANELS:							
637AB, 637CB							
MATERIAL REQUIREMENTS:							
Part Number		Description				Qty.	
NO PARTS ASSIGNED TO THIS TASK							
TOOLING REQUIREMENTS:							
Part Number		Description				Qty.	
98L12003001000		HARNESS, SAFETY (TOOL/HZ-HMS)				1.0	
TASK INSTRUCTION							
Job Description							
NOTE: The inspection must be performed from within a touching distance (unless otherwise stated), using visual inspection aids i.e. inspection mirror, spot light etc., as required, with all identified access panels open. The purpose of the inspection is to determine the general condition and security of visible system installations / components / structure contained in the zone including checking for evidence of degradation, chafing of tubing, loose duct support, wiring damage, cable and pulley wear, fluid leaks, inadequate drainage and other conditions that could lead to corrosion / damage and general condition of the access panels / fairings removed. A. Perform Zonal General Visual Inspection of the flap tab hinge and the fairing NO. 3A per AMM TASK 05-25-30-200-010-A.							
STEP COMPLETION SIGN OFF:							
Qualification / Skill		Number of employees		Duration		Number./Signature	
Date							
Day Month Year							
Mechanic/s				HRS			



MET.32721911

Task Card Title:

R/H FLAP TAB HINGE AND FAIRING NO.3A

Task Card NO:

ZL-537-01-2-002

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

Insp.

INSP/II

HRS

-Aircraft Maintenance Manual used: Revision No. _____ Dated. _____.

Task card finding (Tick Applicable Box) [] Yes [] No. If yes update the system and list Task card finding WO below

Work order No: _____

Note: Make sure to creat the finding Work Order on task card level.

Remark's: _____

(1) If Task card interrupted or performed by different personals updates the system and update the following accord (Tick Applicable Box)

- Interruption No. 1 [] Task card [] AMM [] Other specify. _____
- Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 2 [] Task card [] AMM [] Other specify. _____
- Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 3 [] Task card [] AMM [] Other specify. _____
- Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 4 [] Task card [] AMM [] Other specify. _____
- Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 5 [] Task card [] AMM [] Other specify. _____
- Performed by: _____ Page No. _____ Step From _____ To _____

(2) Record any dimension or torque through the performed steps and sign-off as applicable:

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
- Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
- Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
- Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
- Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
- Remark's: _____

**Task Completion Close Up And
System Update**

Station

Date

Signature

Copyright of Saudia Technic - Regeneration is not allowed without prior approval by Saudia Technic.



Task Card Title:

L/H FLAP TAB HINGE AND FAIRING

Task Card NO:

ZL-539-01-2-001

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

Insp.

II/INSP

HRS

- Aircraft Maintenance Manual used: Revision No. _____ Dated. _____.

Task card finding (Tick Applicable Box) [] Yes [] No. If yes update the system and list Task card finding WO below

Work order No: _____

Note: Make sure to create the finding Work Order on task card level.

Remark's: _____

(1) If Task card interrupted or performed by different persons updates the system and update the following accordingly (Tick Applicable Box)

- Interruption No. 1 [] Task card [] AMM [] Other specify. _____
Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 2 [] Task card [] AMM [] Other specify. _____
Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 3 [] Task card [] AMM [] Other specify. _____
Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 4 [] Task card [] AMM [] Other specify. _____
Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 5 [] Task card [] AMM [] Other specify. _____
Performed by: _____ Page No. _____ Step From _____ To _____

(2) Record any dimension or torque through the performed steps and sign-off as applicable:

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
Remark's: _____

**Task Completion Close Up And
System Update**

Station

Date

Signature

 MET.32721912		Task Card Title: R/H FLAP TAB HINGE AND FAIRING					
Task Card NO: ZL-539-01-2-002		Work Package: ASP/H-26 C7-CHK		A/C Registration: HZ-ASP			
A/C Type: 321		Block Taskcard		Main Skill: INSP,II		PROD Final Acceptance:	
Project No: 01BASPC72608		Related Task Card:		A/C Area: 08			
Internal Check:		Check Type:		Work Order NO: 31956352		Tally Sequence NO: 345	
ENCLOSURE: ☐ CMR: ☐ CPCP: ☐ ETOPS: ☐ CDCCL: ☐ AD: ☐ ALI: ☐							
Type Code: GVI		Special Code: INSP		MSG Code: MRB		Request: Phase: PRE INSP	
I HEREBY CERTIFY THAT ALL WARNINGS AND CAUTIONS HAVE BEEN READ AND THE WORK HAS BEEN CARRIED OUT IN ACCORDING WITH ALL LAID DOWN PROCEDURES, ATTACHED NOTES AND INFORMATION.							
Zones: 639							
DOCUMENT REFERENCES:							
Doc Typ		Reference					
AMM		05-25-30-200-012-A					
AMM		052530-200-012					
ACCESS PANELS:							
639AB, 639CB							
MATERIAL REQUIREMENTS:							
Part Number		Description				Qty.	
NO PARTS ASSIGNED TO THIS TASK							
TOOLING REQUIREMENTS:							
Part Number		Description				Qty.	
98L12003001000		HARNESS, SAFETY (TOOL/HZ-HMS)				1.0	
Job Description							
NOTE: The inspection must be performed from within a touching distance (unless otherwise stated), using visual inspection aids i.e. inspection mirror, spot light etc., as required, with all identified access panels open. The purpose of the inspection is to determine the general condition and security of visible system installations / components / structure contained in the zone including checking for evidence of degradation, chafing of tubing, loose duct support, wiring damage, cable and pulley wear, fluid leaks, inadequate drainage and other conditions that could lead to corrosion / damage and general condition of the access panels / fairings removed. A. Perform Zonal General Visual Inspection of the flap tab hinge and the fairing NO. 3C per AMM TASK 05-25-30-200-012-A. Note: This task is an EWIS (Electrical Wiring Interconnection System) procedure. EWIS is defined in ESPM 20-33-11.							
STEP COMPLETION SIGN OFF:							
Qualification / Skill		Number of employees		Duration		Number./Signature	
Date							
Day Month Year							
Mechanic/s				HRS			



Task Card Title:

R/H FLAP TAB HINGE AND FAIRING

Task Card NO:

ZL-539-01-2-002

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

Insp.

INSP/II

HRS

- Aircraft Maintenance Manual used: Revision No. _____ Dated. _____.

Task card finding (Tick Applicable Box) [] Yes [] No. If yes update the system and list Task card finding WO below

Work order No: _____

Note: Make sure to create the finding Work Order on task card level.

Remark's: _____

(1) If Task card interrupted or performed by different persons updates the system and update the following accordingly (Tick Applicable Box)

- Interruption No. 1 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 2 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 3 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 4 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 5 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____

(2) Record any dimension or torque through the performed steps and sign-off as applicable:

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____

**Task Completion Close Up And
System Update**

Station

Date

Signature

 MET.32721919		Task Card Title: L/H OUTB FIXED TRAILING EDGE INSP					
Task Card NO: ZL-575-01-1-001		Work Package: ASP/H-26 C7-CHK		A/C Registration: HZ-ASP			
A/C Type: 321		Block Taskcard		Main Skill: INSP,II		PROD Final Acceptance:	
Project No: 01BASPC72608		Related Task Card:		A/C Area: 07			
Internal Check:		Check Type:		Work Order NO: 31956352		Tally Sequence NO: 346	
ENCLOSURE: ☐ CMR: ☐ CPCP: ☐ ETOPS: ☐ CDCCL: ☐ AD: ☐ ALI: ☐							
Type Code: GVI		Special Code: INSP		MSG Code: MRB, EWIS		Request: Phase: INSPECTION	
I HEREBY CERTIFY THAT ALL WARNINGS AND CAUTIONS HAVE BEEN READ AND THE WORK HAS BEEN CARRIED OUT IN ACCORDING WITH ALL LAID DOWN PROCEDURES, ATTACHED NOTES AND INFORMATION.							
Zones: 575							
DOCUMENT REFERENCES:							
Doc Typ		Reference					
AMM		05-25-70-200-005-A					
AMM		052570-200-005					
ACCESS PANELS:							
575AT, 575KB, 575LB, 575MB							
MATERIAL REQUIREMENTS:							
Part Number		Description				Qty.	
No parts assigned to this Task Item							
TOOLING REQUIREMENTS:							
Part Number		Description				Qty.	
No tools assigned to this Task Item							
TASK INSTRUCTIONS							
Job Description							
NOTE: The inspection must be performed from within a touching distance (unless otherwise stated), using visual inspection aids i.e. inspection mirror, spot light etc., as required, with all identified access panels open. The purpose of the inspection is to determine the general condition and security of visible system installations / components / structure contained in the zone including checking for evidence of degradation, chafing of tubing, loose duct support, wiring damage, cable and pulley wear, fluid leaks, inadequate drainage and other conditions that could lead to corrosion / damage and general condition of the access panels / fairings removed. A. Perform Zonal General Visual Inspection of the outboard fixed trailing edge structure (from RIB 9 to RIB 27) per AMM TASK 05-25-70-200-005-A.							
STEP COMPLETION SIGN OFF:							
Qualification / Skill		Number of employees		Duration		Number./Signature	
						Date Day Month Year	
Mechanic/s				HRS			



MET.32721919

Task Card Title:

L/H OUTB FIXED TRAILING EDGE INSP

Task Card NO:

ZL-575-01-1-001

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP**Insp.**

INSP/II

HRS

-Aircraft Maintenance Manual used: Revision No. _____ Dated. _____.

Task card finding (Tick Applicable Box) [] Yes [] No. If yes update the system and list Task card finding WO below

Work order No: _____

_____, _____, _____, _____, _____, _____, _____, _____

Note: Make sure to creat the finding Work Order on task card level.

Remark's: _____

(1) If Task card interrupted or performed by different personals updates the system and update the following accord (Tick Applicable Box)

- Interruption No. 1 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

- Interruption No. 2 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

- Interruption No. 3 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

- Interruption No. 4 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

- Interruption No. 5 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

(2) Record any dimension or torque through the performed steps and sign-off as applicable:

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

**Task Completion Close Up And
System Update****Station****Date****Signature**

 MET.32721933	Task Card Title: R/H OUTB FIXED TRAILING EDGE INSP														
Task Card NO: ZL-575-01-1-002		Work Package: ASP/H-26 C7-CHK		A/C Registration: HZ-ASP											
A/C Type: 321		Block Taskcard		Main Skill: II,INSP		PROD Final Acceptance:									
Project No: 01BASPC72608		Related Task Card:		A/C Area: 08											
Internal Check:		Check Type:		Work Order NO: 31956352		Tally Sequence NO: 347									
ENCLOSURE: ☐ CMR: ☐ CPCP: ☐ ETOPS: ☐ CDCCL: ☐ AD: ☐ ALI: ☐															
Type Code: GVI		Special Code: INSP		MSG Code: EWIS, MRB		Request: Phase: INSPECTION									
I HEREBY CERTIFY THAT ALL WARNINGS AND CAUTIONS HAVE BEEN READ AND THE WORK HAS BEEN CARRID OUT IN ACCORDING WITH ALL LAID DOWN PROCEDURES, ATTACHED NOTES AND INFORMATION.															
Zones: 675															
DOCUMENT REFERENCES:															
Doc Typ		Reference													
AMM		05-25-70-200-005-A													
AMM		052570-200-005													
ACCESS PANELS:															
675AT, 675KB, 675LB, 675MB															
MATERIAL REQUIREMENTS:															
Part Number		Description				Qty.									
No parts assigned to this Task Item															
TOOLING REQUIREMENTS:															
Part Number		Description				Qty.									
No tools assigned to this Task Item															
TASK INSTRUCTIONS															
Job Description															
NOTE: The inspection must be performed from within a touching distance (unless otherwise stated), using visual inspection aids i.e. inspection mirror, spot light etc., as required, with all identified access panels open. The purpose of the inspection is to determine the general condition and security of visible system installations / components / structure contained in the zone including checking for evidence of degradation, chafing of tubing, loose duct support, wiring damage, cable and pulley wear, fluid leaks, inadequate drainage and other conditions that could lead to corrosion / damage and general condition of the access panels / fairings removed. A. Perform Zonal General Visual Inspection of the outboard fixed trailing edge structure (from RIB 9 to RIB 27) per AMM TASK 05-25-70-200-005-A.															
STEP COMPLETION SIGN OFF:															
		Qualification / Skill		Number of employees		Duration		Number./Signature		Date					
										Day		Month		Year	
Mechanic/s						HRS									



MET.32721933

Task Card Title:

R/H OUTB FIXED TRAILING EDGE INSP

Task Card NO:

ZL-575-01-1-002

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

Insp.

II/INSP

HRS

-Aircraft Maintenance Manual used: Revision No. _____ Dated. _____.

Task card finding (Tick Applicable Box) [] Yes [] No. If yes update the system and list Task card finding WO below

Work order No: _____

Note: Make sure to creat the finding Work Order on task card level.

Remark's: _____

(1) If Task card interrupted or performed by different personals updates the system and update the following accord (Tick Applicable Box)

- Interruption No. 1 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 2 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 3 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 4 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 5 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____

(2) Record any dimension or torque through the performed steps and sign-off as applicable:

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____

**Task Completion Close Up And
System Update**

Station

Date

Signature

 MET.32721848		Task Card Title: MLG MAIN DOOR ZONAL INSPECTION				
Task Card NO: ZL-734-01-1		Work Package: ASP/H-26 C7-CHK		A/C Registration: HZ-ASP		
A/C Type: 321		Block Taskcard		Main Skill: II,INSP		
Project No: 01BASPC72608		Related Task Card:		A/C Area: 09		
Internal Check:		Check Type:		Work Order NO: 31956352		
				Tally Sequence NO: 348		
ENCLOSURE: ☐ CMR: ☐ CPCP: ☐ ETOPS: ☐ CDCCL: ☐ AD: ☐ ALI: ☐						
Type Code: GVI		Special Code: INSP		MSG Code: MRB		
Request:		Phase: PRE INSP,PRE INSP				
I HEREBY CERTIFY THAT ALL WARNINGS AND CAUTIONS HAVE BEEN READ AND THE WORK HAS BEEN CARRID OUT IN ACCORDING WITH ALL LAID DOWN PROCEDURES, ATTACHED NOTES AND INFORMATION.						
Zones: 734,744						
DOCUMENT REFERENCES:						
Doc Typ		Reference				
AMM		05-27-30-200-004-A				
AMM		052730-200-004				
ACCESS PANELS:						
MATERIAL REQUIREMENTS:						
Part Number		Description			Qty.	
No parts assigned to this Task Item						
TOOLING REQUIREMENTS:						
Part Number		Description			Qty.	
No tools assigned to this Task Item						
TASK INSTRUCTIONS						
Job Description						
NOTE: THE INSPECTION MUST BE PERFORMED FROM WITHIN A TOUCHING DISTANCE (UNLESS OTHERWISE STATED), USING VISUAL INSPECTION AIDS I.E. INSPECTION MIRROR, SPOT LIGHT ETC., AS REQUIRED WITH ALL IDENTIFIED ACCESS PANELS OPEN. THE PURPOSE OF THE INSPECTION IS TO DETERMINE THE GENERAL CONDITION AND SECURITY OF VISIBLE SYSTEM INSTALLATIONS / COMPONENTS / STRUCTURE CONTAINED IN THE ZONE INCLUDING CHECKING FOR EVIDENCE OF DEGRADATION, CHAFING OF TUBING, LOOSE DUCT SUPPORT, WIRING DAMAGE, CABLE AND PULLEY WEAR, FLUID LEAKS, INADEQUATE DRAINAGE AND OTHER CONDITIONS THAT COULD LEAD TO CORROSION / DAMAGE AND GENERAL CONDITION OF THE ACCESS PANELS / FAIRINGS REMOVED. A. PERFORM ZONAL GENERAL VISUAL INSPECTION OF THE LEFT MAIN LANDING GEAR MAIN DOORS AS PER AMM TASK 05-27-30-200-004-A.						
STEP COMPLETION SIGN OFF:						



MET.32721848

Task Card Title:

MLG MAIN DOOR ZONAL INSPECTION

Task Card NO:

ZL-734-01-1

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

	Qualification / Skill	Number of employees	Duration		Number./Signature	Date		
						Day	Month	Year
Mechanic/s				HRS				
Insp.	II/INSP			HRS				

TASK INSTRUCTIONS**Job Description**

NOTE:

THE INSPECTION MUST BE PERFORMED FROM WITHIN A TOUCHING DISTANCE (UNLESS OTHERWISE STATED), USING VISUAL INSPECTION AIDS I.E. INSPECTION MIRROR, SPOT LIGHT ETC., AS REQUIRED WITH ALL IDENTIFIED ACCESS PANELS OPEN.

THE PURPOSE OF THE INSPECTION IS TO DETERMINE THE GENERAL CONDITION AND SECURITY OF VISIBLE SYSTEM INSTALLATIONS / COMPONENTS / STRUCTURE CONTAINED IN THE ZONE INCLUDING CHECKING FOR EVIDENCE OF DEGRADATION, CHAFING OF TUBING, LOOSE DUCT SUPPORT, WIRING DAMAGE, CABLE AND PULLEY WEAR, FLUID LEAKS, INADEQUATE DRAINAGE AND OTHER CONDITIONS THAT COULD LEAD TO CORROSION / DAMAGE AND GENERAL CONDITION OF THE ACCESS PANELS / FAIRINGS REMOVED.

B. PERFORM ZONAL GENERAL VISUAL INSPECTION OF THE RIGHT MAIN LANDING GEAR MAIN DOORS
AS PER AMM TASK 05-27-30-200-004-A.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration		Number./Signature	Date		
						Day	Month	Year
Mechanic/s				HRS				
Insp.	II/INSP			HRS				

-Aircraft Maintenance Manual used: Revision No. _____ Dated. _____.

Task card finding (Tick Applicable Box) [] Yes [] No. If yes update the system and list Task card finding WO below

Work order No: _____

Note: Make sure to create the finding Work Order on task card level.

Remark's: _____



Task Card Title:

MLG MAIN DOOR ZONAL INSPECTION

Task Card NO:

ZL-734-01-1

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

(1) If Task card interrupted or performed by different personals updates the system and update the following according (Tick Applicable Box)

- Interruption No. 1 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 2 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 3 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 4 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 5 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____

(2) Record any dimension or torque through the performed steps and sign-off as applicable:

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____

**Task Completion Close Up And
System Update**

Station**Date****Signature**

 MET.32721896		Task Card Title: FORWARD CARGO COMP. DOOR ZONAL INSP				
Task Card NO: ZL-825-01-1		Work Package: ASP/H-26 C7-CHK		A/C Registration: HZ-ASP		
A/C Type: 321		Block Taskcard		Main Skill: II,INSP		PROD Final Acceptance:
Project No: 01BASPC72608		Related Task Card:		A/C Area: 09		
Internal Check:		Check Type:		Work Order NO: 31956352		Tally Sequence NO: 349
ENCLOSURE: ☐ CMR: ☐ CPCP: ☐ ETOPS: ☐ CDCCL: ☐ AD: ☐ ALI: ☐						
Type Code: GVI		Special Code: INSP		MSG Code: MRB, EWIS		Request: Phase: PRE INSP
I HEREBY CERTIFY THAT ALL WARNINGS AND CAUTIONS HAVE BEEN READ AND THE WORK HAS BEEN CARRIED OUT IN ACCORDING WITH ALL LAID DOWN PROCEDURES, ATTACHED NOTES AND INFORMATION.						
Zones: 825						
DOCUMENT REFERENCES:						
Doc Typ		Reference				
AMM		05-28-20-200-001-A				
AMM		052820-200-001				
ACCESS PANELS:						
MATERIAL REQUIREMENTS:						
Part Number		Description				Qty.
No parts assigned to this Task Item						
TOOLING REQUIREMENTS:						
Part Number		Description				Qty.
No tools assigned to this Task Item						
TASK INSTRUCTIONS						
Job Description						
NOTE: THE INSPECTION MUST BE PERFORMED FROM WITHIN A TOUCHING DISTANCE (UNLESS OTHERWISE STATED), USING VISUAL INSPECTION AIDS I.E. INSPECTION MIRROR, SPOT LIGHT ETC., AS REQUIRED, WITH ALL IDENTIFIED ACCESS PANELS OPEN. THE PURPOSE OF THE INSPECTION IS TO DETERMINE THE GENERAL CONDITION AND SECURITY OF VISIBLE SYSTEM INSTALLATIONS / COMPONENTS / STRUCTURE CONTAINED IN THE ZONE INCLUDING CHECKING FOR EVIDENCE OF DEGRADATION, CHAFING OF TUBING, LOOSE DUCT SUPPORT, WIRING DAMAGE, CABLE AND PULLEY WEAR, FLUID LEAKS, INADEQUATE DRAINAGE AND OTHER CONDITIONS THAT COULD LEAD TO CORROSION / DAMAGE AND GENERAL CONDITION OF THE ACCESS PANELS / FAIRINGS REMOVED. A. PERFORM ZONAL GENERAL VISUAL INSPECTION OF THE FORWARD CARGO-COMPARTMENT DOOR INCLUDING THE FUSELAGE DOOR SILL, DOOR SEAL, LOCK FITTINGS AND THE EXTERNAL SURFACE OF THE DOOR AS PER AMM TASK 05-28-20-200-001-A.						
STEP COMPLETION SIGN OFF:						



Task Card Title:

FORWARD CARGO COMP. DOOR ZONAL INSP

Task Card NO:

ZL-825-01-1

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

	Qualification / Skill	Number of employees	Duration		Number./Signature	Date		
				HRS		Day	Month	Year
Mechanic/s				HRS				
Insp.	II/INSP			HRS				

-Aircraft Maintenance Manual used: Revision No. _____ Dated. _____.

Task card finding (Tick Applicable Box) [] Yes [] No. If yes update the system and list Task card finding WO below
Work order No: _____

Note: Make sure to creat the finding Work Order on task card level.

Remark's: _____

(1) If Task card interrupted or performed by different personals updates the system and update the following accord (Tick Applicable Box)

- Interruption No. 1 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

- Interruption No. 2 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

- Interruption No. 3 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

- Interruption No. 4 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

- Interruption No. 5 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

(2) Record any dimension or torque through the performed steps and sign-off as applicable:

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

**Task Completion Close Up And
System Update****Station****Date****Signature**

 MET.32721910		Task Card Title: AFT CARGO COMP. DOOR ZONAL INSP				
Task Card NO: ZL-826-01-1		Work Package: ASP/H-26 C7-CHK		A/C Registration: HZ-ASP		
A/C Type: 321		Block Taskcard		Main Skill: INSP,II		
Project No: 01BASPC72608		Related Task Card:		A/C Area: 09		
Internal Check:		Check Type:		Work Order NO: 31956352		
				Tally Sequence NO: 350		
ENCLOSURE: ☐ CMR: ☐ CPCP: ☐ ETOPS: ☐ CDCCL: ☐ AD: ☐ ALI: ☐						
Type Code: GVI		Special Code: INSP		MSG Code: MRB, EWIS		
				Request: 		
				Phase: PRE INSP		
I HEREBY CERTIFY THAT ALL WARNINGS AND CAUTIONS HAVE BEEN READ AND THE WORK HAS BEEN CARRIED OUT IN ACCORDING WITH ALL LAID DOWN PROCEDURES, ATTACHED NOTES AND INFORMATION.						
Zones: 826						
DOCUMENT REFERENCES:						
Doc Typ		Reference				
AMM		05-28-20-200-002-A				
AMM		052820-200-002				
ACCESS PANELS:						
MATERIAL REQUIREMENTS:						
Part Number		Description			Qty.	
No parts assigned to this Task Item						
TOOLING REQUIREMENTS:						
Part Number		Description			Qty.	
No tools assigned to this Task Item						
TASK INSTRUCTIONS						
Job Description						
NOTE: THE INSPECTION MUST BE PERFORMED FROM WITHIN A TOUCHING DISTANCE (UNLESS OTHERWISE STATED), USING VISUAL INSPECTION AIDS I.E. INSPECTION MIRROR, SPOT LIGHT ETC., AS REQUIRED, WITH ALL IDENTIFIED ACCESS PANELS OPEN. THE PURPOSE OF THE INSPECTION IS TO DETERMINE THE GENERAL CONDITION AND SECURITY OF VISIBLE SYSTEM INSTALLATIONS / COMPONENTS / STRUCTURE CONTAINED IN THE ZONE INCLUDING CHECKING FOR EVIDENCE OF DEGRADATION, CHAFING OF TUBING, LOOSE DUCT SUPPORT, WIRING DAMAGE, CABLE AND PULLEY WEAR, FLUID LEAKS, INADEQUATE DRAINAGE AND OTHER CONDITIONS THAT COULD LEAD TO CORROSION / DAMAGE AND GENERAL CONDITION OF THE ACCESS PANELS / FAIRINGS REMOVED. A. PERFORM ZONAL GENERAL VISUAL INSPECTION OF THE AFT CARGO-COMPARTMENT DOOR INCLUDING THE FUSELAGE DOOR SILL, DOOR SEAL AND LOCK FITTINGS PER AMM TASK 05-28-20-200-002-A.						
STEP COMPLETION SIGN OFF:						



Task Card Title:

AFT CARGO COMP. DOOR ZONAL INSP

Task Card NO:

ZL-826-01-1

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

	Qualification / Skill	Number of employees	Duration		Number./Signature	Date		
				HRS		Day	Month	Year
Mechanic/s				HRS				
Insp.	INSP/II			HRS				

-Aircraft Maintenance Manual used: Revision No. _____ Dated. _____.

Task card finding (Tick Applicable Box) [] Yes [] No. If yes update the system and list Task card finding WO below
Work order No: _____

Note: Make sure to creat the finding Work Order on task card level.

Remark's: _____

(1) If Task card interrupted or performed by different personals updates the system and update the following accord (Tick Applicable Box)

- Interruption No. 1 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

- Interruption No. 2 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

- Interruption No. 3 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

- Interruption No. 4 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

- Interruption No. 5 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

(2) Record any dimension or torque through the performed steps and sign-off as applicable:

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

**Task Completion Close Up And
System Update****Station****Date****Signature**

 MET.32721967		Task Card Title: BULK CARGO COMP. DOOR ZONAL INSP			
Task Card NO: ZL-827-01-1		Work Package: ASP/H-26 C7-CHK		A/C Registration: HZ-ASP	
A/C Type: 321		Block Taskcard		Main Skill: INSP,II	
Project No: 01BASPC72608		Related Task Card:		A/C Area: 09	
Internal Check:		Check Type:		Work Order NO: 31956352	
Tally Sequence NO: 351					
ENCLOSURE: ☐ CMR: ☐ CPCP: ☐ ETOPS: ☐ CDCCL: ☐ AD: ☐ ALI: ☐					
Type Code: GVI		Special Code: INSP		MSG Code: SOEL, MRB, EWIS, GAC A	
Request:		Phase: PRE INSP			
I HEREBY CERTIFY THAT ALL WARNINGS AND CAUTIONS HAVE BEEN READ AND THE WORK HAS BEEN CARRIED OUT IN ACCORDING WITH ALL LAID DOWN PROCEDURES, ATTACHED NOTES AND INFORMATION.					
Zones: 827					
DOCUMENT REFERENCES:					
Doc Typ		Reference			
AMM		05-28-20-200-003-A			
AMM		052820-200-003			
DO		SOEE TR SA00ME2302736			
GACA		121.473			
ACCESS PANELS:					
MATERIAL REQUIREMENTS:					
Part Number		Description			Qty.
No parts assigned to this Task Item					
TOOLING REQUIREMENTS:					
Part Number		Description			Qty.
No tools assigned to this Task Item					
TASK INSTRUCTIONS					
Job Description					
NOTE: THE INSPECTION MUST BE PERFORMED FROM WITHIN A TOUCHING DISTANCE (UNLESS OTHERWISE STATED), USING VISUAL INSPECTION AIDS I.E. INSPECTION MIRROR, SPOT LIGHT ETC., AS REQUIRED, WITH ALL IDENTIFIED ACCESS PANELS OPEN. THE PURPOSE OF THE INSPECTION IS TO DETERMINE THE GENERAL CONDITION AND SECURITY OF VISIBLE SYSTEM INSTALLATIONS / COMPONENTS / STRUCTURE CONTAINED IN THE ZONE INCLUDING CHECKING FOR EVIDENCE OF DEGRADATION, CHAFING OF TUBING, LOOSE DUCT SUPPORT, WIRING DAMAGE, CABLE AND PULLEY WEAR, FLUID LEAKS, INADEQUATE DRAINAGE AND OTHER CONDITIONS THAT COULD LEAD TO CORROSION / DAMAGE AND GENERAL CONDITION OF THE ACCESS PANELS / FAIRINGS REMOVED. A. PERFORM ZONAL GENERAL VISUAL INSPECTION OF BULK CARGO COMPARTMENT DOOR INCLUDING DOOR STOPS ON FUSELAGE DOOR FRAME AS PER AMM TASK 05-28-20-200-003-A.					



Task Card Title:

BULK CARGO COMP. DOOR ZONAL INSP

Task Card NO:

ZL-827-01-1

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP**STEP COMPLETION SIGN OFF:**

	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year
Mechanic/s				HRS			
Insp.	INSP/II			HRS			

-Aircraft Maintenance Manual used: Revision No. _____ Dated. _____.

Task card finding (Tick Applicable Box) [] Yes [] No. If yes update the system and list Task card finding WO below

Work order No: _____

Note: Make sure to create the finding Work Order on task card level.

Remark's: _____

(1) If Task card interrupted or performed by different persons updates the system and update the following accordingly (Tick Applicable Box)

- Interruption No. 1 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

- Interruption No. 2 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

- Interruption No. 3 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

- Interruption No. 4 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

- Interruption No. 5 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

(2) Record any dimension or torque through the performed steps and sign-off as applicable:

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

**Task Completion Close Up And
System Update****Station****Date****Signature**

 MET.32721865		Task Card Title: FWD AND AFT EMERGENCY EXITS INSP				
Task Card NO: ZL-833-04-1		Work Package: ASP/H-26 C7-CHK		A/C Registration: HZ-ASP		
A/C Type: 321		Block Taskcard		Main Skill: II,INSP		
Project No: 01BASPC72608		Related Task Card:		A/C Area: 09		
Internal Check:		Check Type:		Work Order NO: 31956352		
				Tally Sequence NO: 352		
ENCLOSURE: ☐ CMR: ☐ CPCP: ☐ ETOPS: ☐ CDCCL: ☐ AD: ☐ ALI: ☐						
Type Code: GVI		Special Code: INSP		MSG Code: MRB, SOEE		
				Request: Phase: PRE INSP		
I HEREBY CERTIFY THAT ALL WARNINGS AND CAUTIONS HAVE BEEN READ AND THE WORK HAS BEEN CARRID OUT IN ACCORDING WITH ALL LAID DOWN PROCEDURES, ATTACHED NOTES AND INFORMATION.						
Zones: 833,834,843,844						
DOCUMENT REFERENCES:						
Doc Typ		Reference				
AMM		05-28-30-200-807-A				
AMM		052830-200-011				
DO		SOEE TR SA00ME2302736				
ACCESS PANELS:						
833, 834, 843, 844						
MATERIAL REQUIREMENTS:						
Part Number		Description			Qty.	
No parts assigned to this Task Item						
TOOLING REQUIREMENTS:						
Part Number		Description			Qty.	
No tools assigned to this Task Item						
Job Description						
NOTE: THE INSPECTION MUST BE PERFORMED FROM WITHIN A TOUCHING DISTANCE (UNLESS OTHERWISE STATED), USING VISUAL INSPECTION AIDS I.E. INSPECTION MIRROR, SPOT LIGHT ETC., AS REQUIRED, WITH ALL IDENTIFIED ACCESS PANELS OPEN. THE PURPOSE OF THE INSPECTION IS TO DETERMINE THE GENERAL CONDITION AND SECURITY OF VISIBLE SYSTEM INSTALLATIONS / COMPONENTS / STRUCTURE CONTAINED IN THE ZONE INCLUDING CHECKING FOR EVIDENCE OF DEGRADATION, CHAFING OF TUBING, LOOSE DUCT SUPPORT, WIRING DAMAGE, CABLE AND PULLEY WEAR, FLUID LEAKS, INADEQUATE DRAINAGE AND OTHER CONDITIONS THAT COULD LEAD TO CORROSION / DAMAGE AND GENERAL CONDITION OF THE ACCESS PANELS / FAIRINGS REMOVED. A. PERFORM ZONAL GENERAL VISUAL INSPECTION OF L&R FWD PASSENGER/CREW DOORS INCLUDING DOOR STOPS ON FUSELAGE DOOR FRAME AND DOOR SEALS, EXTERNAL SURFACE PER AMM TASK 05-28-30-200-011-A. NOTE: THIS TASK IS AN EWIS (ELECTRICAL WIRING INTERCONNECTION SYSTEM) PROCEDURE. EWIS IS DEFINED IN ESPM 20-33-11.						
STEP COMPLETION SIGN OFF:						



Task Card Title:

FWD AND AFT EMERGENCY EXITS INSP

Task Card NO:

ZL-833-04-1

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

	Qualification / Skill	Number of employees	Duration		Number./Signature	Date		
						Day	Month	Year
Mechanic/s				HRS				
Insp.	II/INSP			HRS				

-Aircraft Maintenance Manual used: Revision No. _____ Dated. _____.

Task card finding (Tick Applicable Box) [] Yes [] No. If yes update the system and list Task card finding WO below
Work order No: _____

Note: Make sure to creat the finding Work Order on task card level.

Remark's: _____

(1) If Task card interrupted or performed by different personals updates the system and update the following accord (Tick Applicable Box)

- Interruption No. 1 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

- Interruption No. 2 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

- Interruption No. 3 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

- Interruption No. 4 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

- Interruption No. 5 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

(2) Record any dimension or torque through the performed steps and sign-off as applicable:

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

**Task Completion Close Up And
System Update****Station****Date****Signature**

 MET.32722075		Task Card Title: B/C SEAT REFRESH			
Task Card NO: 25-SVA-03		Work Package: ASP/H-26 C7-CHK		A/C Registration: HZ-ASP	
A/C Type: 321		Block Taskcard		Main Skill: CAB,ACFT_TECH	
Project No: 01BASPC72608		Related Task Card:		A/C Area: 05	
Internal Check:		Check Type:		Work Order NO: Tally Sequence NO: 354	
ENCLOSURE: ☐ CMR: ☐ CPCP: ☐ ETOPS: ☐ CDCCL: ☐ AD: ☐ ALI: ☐					
Type Code: DVI		Special Code:		MSG Code: 4	
Request:		Phase:			
I HEREBY CERTIFY THAT ALL WARNINGS AND CAUTIONS HAVE BEEN READ AND THE WORK HAS BEEN CARRIED OUT IN ACCORDING WITH ALL LAID DOWN PROCEDURES, ATTACHED NOTES AND INFORMATION.					
Zones:					
DOCUMENT REFERENCES:					
Doc Typ		Reference			
CAP		S25-C10028			
ACCESS PANELS:					
MATERIAL REQUIREMENTS:					
Part Number		Description			Qty.
No parts assigned to this Task Item					
TOOLING REQUIREMENTS:					
Part Number		Description			Qty.
No tools assigned to this Task Item					
B/C SEAT REFRESHMENT:					
Job Description					
B/C SEAT DEEP REFRESH:					
REFERENCES					
1. - FOR REPAIRS AND CLEANING PROCEDURE FOLLOW THE APPLICABLE CMM:					
1. CMM 25-26-83 (APPLICABILITY: A321, HZ-ASH - HZ-ASW).					
2. - SAUDIA GMM.					
<u>AISLE ENDBAY</u>					
(IF ANY PARTS ARE IN UNACCEPTABLE CONDITION, PLEASE REFER TO STEP 5):					



Task Card Title:

B/C SEAT REFRESH

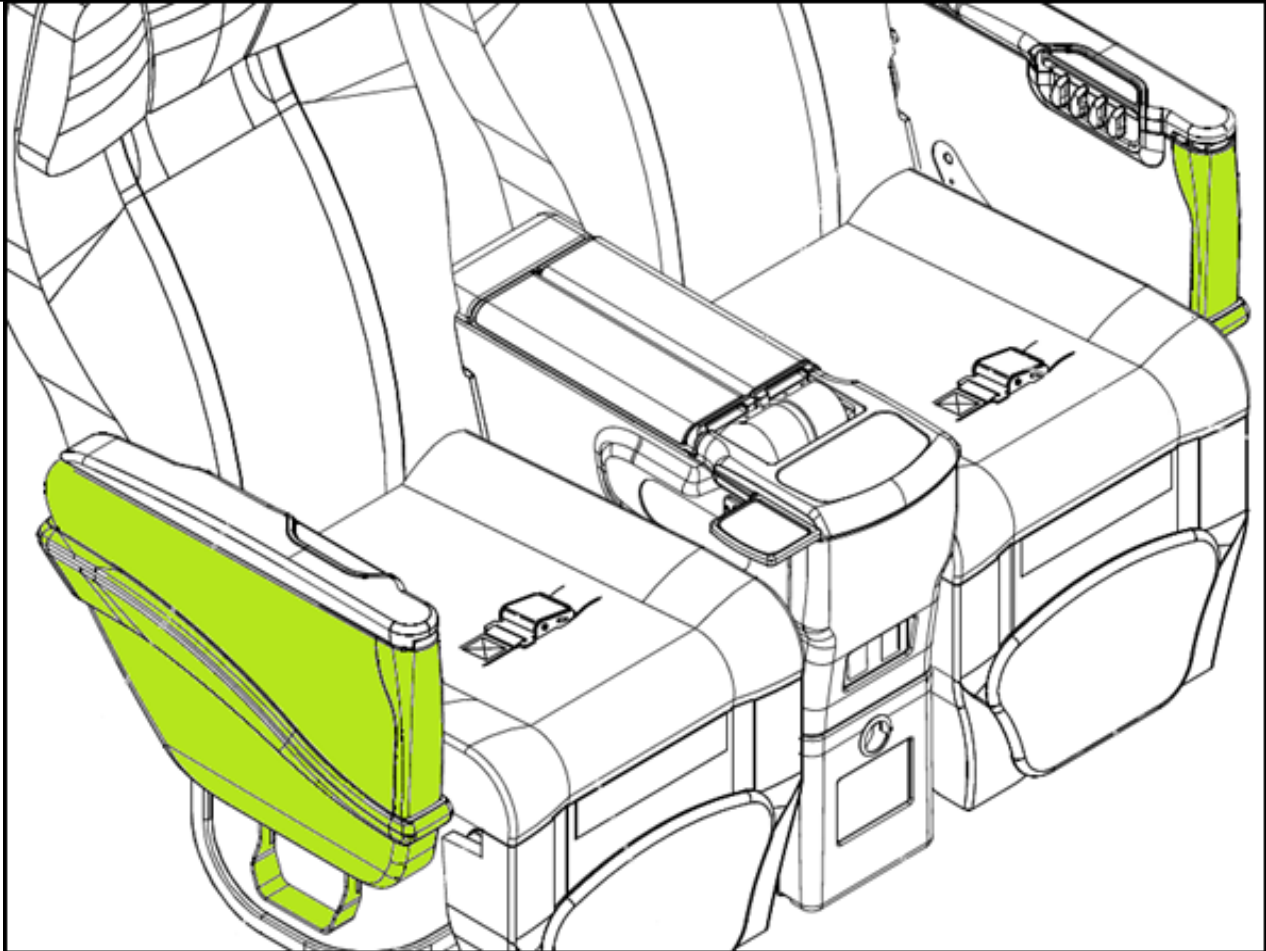
Task Card NO:

25-SVA-03

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

1. - DEEP CLEAN, POLISH, REAPPLY SURFACE FINISH, OR PAINT PARTS AS APPLICABLE.
2. - PERFORM DET VISUAL CHECK OF OUTBOARD SHELL FOR CLEANLINESS AND CONDITION (USING HAND-HELD FLASH LIGHT):

A.

- A. CRACK, DENT, OR DAMAGE ARE NOT ACCEPTABLE.
- B. SURFACE SCRATCHES ARE ACCEPTABLE, BUT DEEP SCRATCHES THAT EXPOSE THE BASE MATERIAL ARE UNACCEPTABLE.
- C. SURFACES ARE CLEAN AND FREE OF ANY STAINS OR MARKS.
- D. MISSING, BROKEN, DAMAGED, DISBANDED, OR LOOSE PARTS ARE UNACCEPTABLE.
- E. SHARP EDGES OR BURRS ARE NOT ACCEPTABLE.
- F. WORN OR CHIPPED PAINT AND FINISH NOT ACCEPTABLE.
- G. MISALIGNED PARTS AND GAPS ARE NOT ACCEPTABLE.
- H. MISSING OR LOOSE FASTENERS ARE NOT ACCEPTABLE.
- I. ENSURE ALL VELCROS ARE PROPERLY INSTALLED.
- J. SEALS MUST BE CLEAN AND INSTALLED CORRECTLY. MISALIGNMENT, CUTS, OR DAMAGES ARE NOT ACCEPTABLE.
- K. ORIENTATION OF PARTS, LAMINATES, DÉCOR, DECALS, AND PLACARDS SHOULD BE CORRECT.

3. - PERFORM DET VISUAL CHECK BUMPER STRIPS AND KICKSTRIP FOR CONDITION (USING HAND-HELD FLASH LIGHT).



Task Card Title:

B/C SEAT REFRESH

Task Card NO:

25-SVA-03

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

A.

A. BUMPER STRIPS AND KICKSTRIP MUST BE PRESENT AND SECURE.

B. SURFACE SCRATCHES ARE PERMISSIBLE. CRACK, DENT, SCRATCHES, OR DAMAGE ARE NOT ACCEPTABLE.

4. - CHECK THE CONDITION AND SERVICEABILITY OF THE IN-USE LIGHT/TTL LIGHT REPLACE ANY DEFECTIVE PART WITH A NEW ONE.

5. - IF A PART CANNOT BE REPAIRED, POLISHED, PAINTED, OR REFRESHED, REPLACE THE DEFECTIVE PART WITH A NEW ONE.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year
Mechanic/s	CAB/ACFT_TECH		HRS				
Insp.			HRS				

Job Description**INNER SHROUDS AND PLASTIC PARTS****(IF ANY PARTS ARE IN UNACCEPTABLE CONDITION, PLEASE REFER TO STEP 3 AND 4):**

1. - PERFORM DET VISUAL CHECK OF INTERNAL BOARD SHELL AND PLASTIC PARTS FOR CLEANLINESS AND CONDITION (USING HAND-HELD FLASH LIGHT):



Task Card Title:

B/C SEAT REFRESH

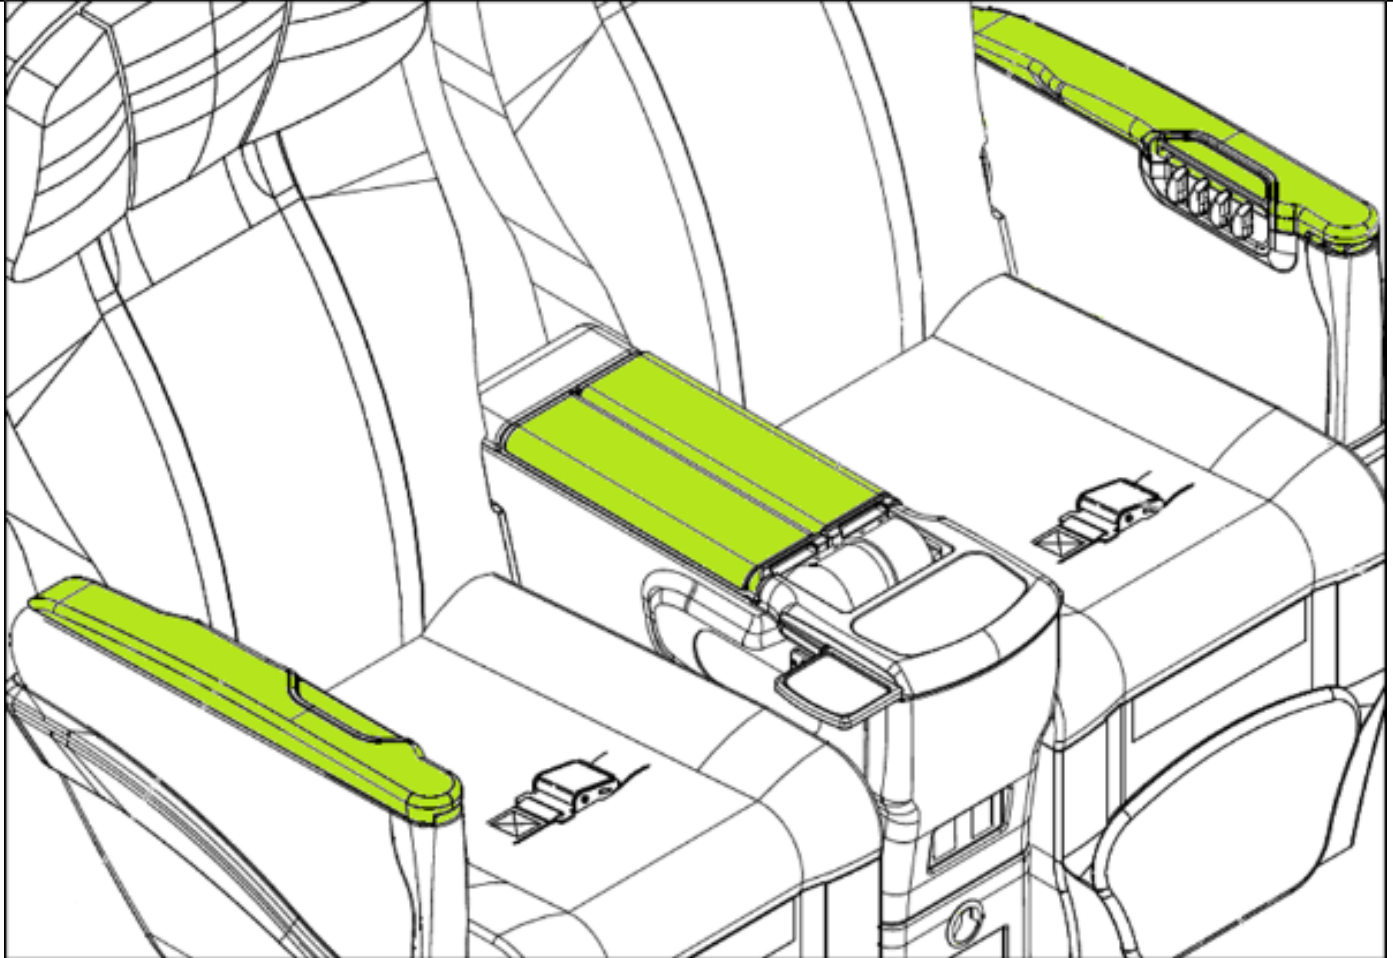
Task Card NO:

25-SVA-03

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

- A. CRACKS, DENTS, OR DAMAGE NOT ALLOWED.
- B. SURFACE SCRATCHES ARE ALLOWED, BUT DEEP SCRATCHES ARE NOT.
- C. SURFACES MUST BE CLEAN AND FREE OF STAINS OR MARKS.
- D. MISSING, BROKEN, DAMAGED, DIS-BONDED, OR LOOSE PARTS ARE NOT ACCEPTABLE.
- E. SHARP EDGES OR BURRS ARE NOT ALLOWED.
- F. NO WORN OR CHIPPED PAINT OR FINISH ALLOWED.
- G. PARTS MUST BE ALIGNED WITH NO GAPS.
- H. NO MISSING OR LOOSE FASTENERS ALLOWED.
- I. ALL VELCRO MUST BE PROPERLY INSTALLED.
- J. SEALS MUST BE CLEAN AND PROPERLY INSTALLED, WITH NO MISALIGNMENT, CUTS, OR DAMAGES.
- K. PLACARDS SHOULD BE CLEAN AND IN GOOD CONDITION, WITH NO MISALIGNMENT, CUTS, OR DAMAGES
- L. ORIENTATION OF PARTS, LAMINATES, DECOR, DECALS, AND PLACARDS SHOULD BE CORRECT.

2. - GVI LIFE VEST COMPARTMENT FOR CLEANLINESS, CONDITION AND SECURITY.



Task Card Title:

B/C SEAT REFRESH

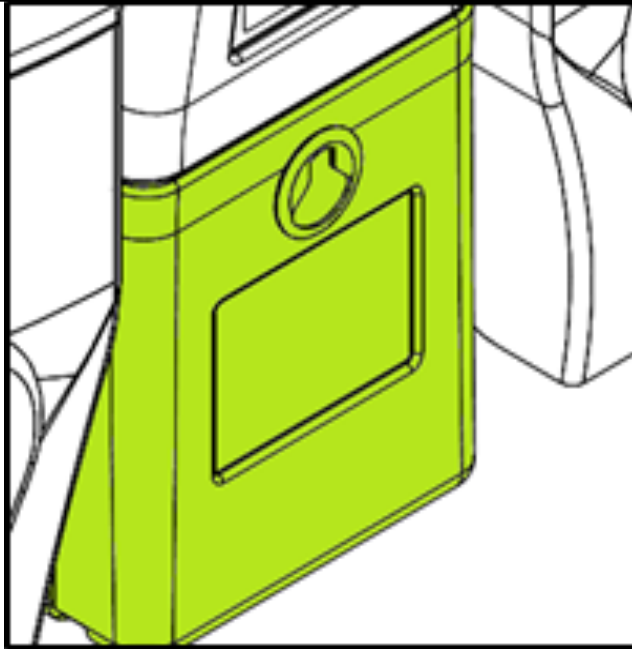
Task Card NO:

25-SVA-03

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

- A. PULL STRAP PROPERLY INSTALLED.
 - B. PARTS MUST BE ALIGNED WITH NO GAPS.
 - C. VELCROS PROPERLY INSTALLED.
 - D. LOOSE OR DAMAGED DOOR HINGES/RAIL ARE NOT ACCEPTABLE.
3. - CLEAN, POLISH, REAPPLY SURFACE FINISH, OR PAINT DEFECTIVE PARTS AS APPLICABLE.
4. - IN CASE OF ANY FINDING IN STEP (1 & 2) AND IF THE PART CANNOT BE POLISHED, PAINTED, OR REFRESHED, REPLACE THE DEFECTIVE PART WITH A NEW ONE.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration		Number./Signature	Date		
						Day	Month	Year
Mechanic/s	CAB/ACFT_TECH			HRS				
Insp.				HRS				

Job Description**SEAT ARM ASSEMBLY**

(IF ANY PARTS ARE IN UNACCEPTABLE CONDITION, PLEASE REFER TO STEP 3 FOR ARM CAPS FOR OTHER PARTS REFER TO STEP 3 AND 4):



Task Card Title:

B/C SEAT REFRESH

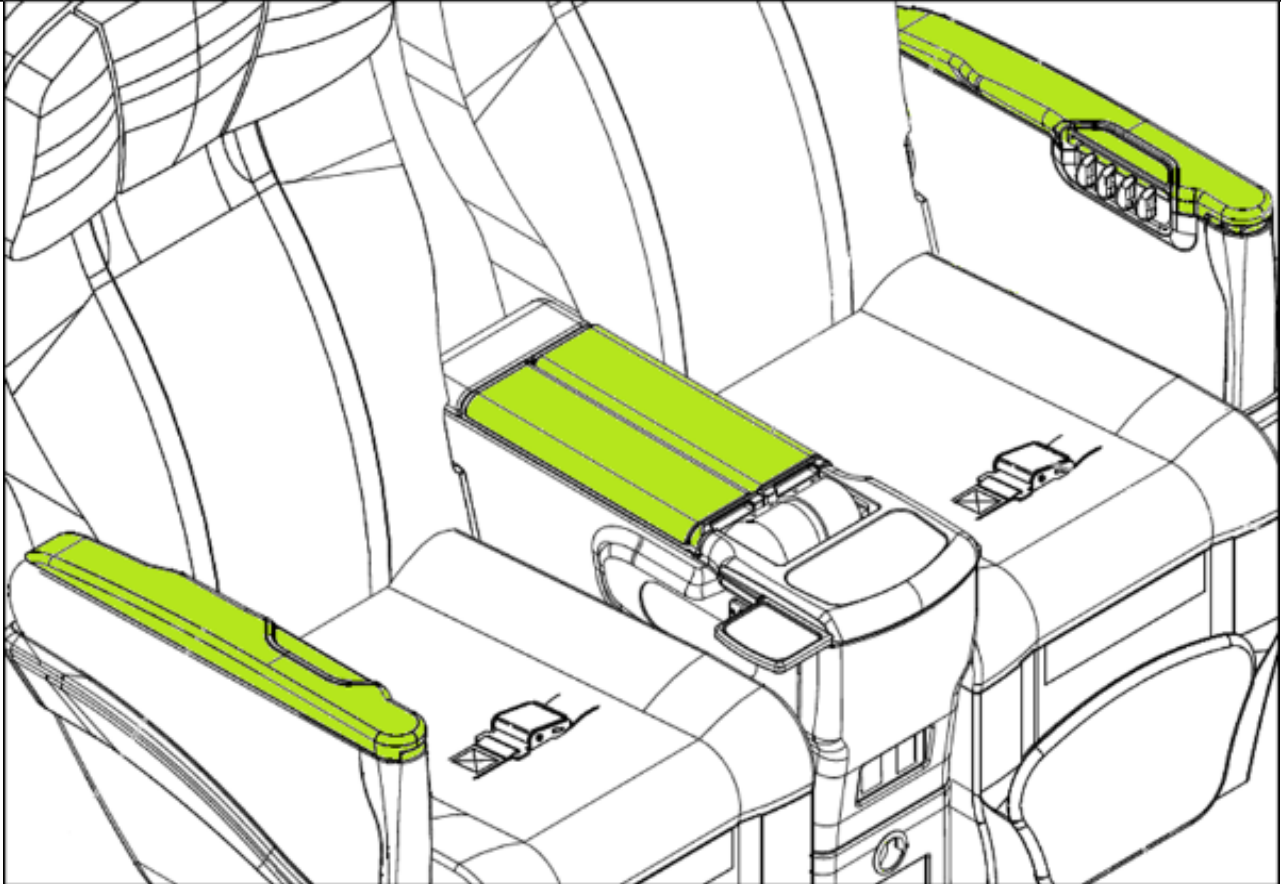
Task Card NO:

25-SVA-03

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

1. - PERFORM DET VISUAL CHECK OF SEAT ARM ASSEMBLY FOR CLEANLINESS AND CONDITION (USING HAND-HELD FLASH LIGHT):
 - A. CRACK, DENT, OR DAMAGE ARE NOT ACCEPTABLE.
 - B. SURFACE SCRATCHES ARE ACCEPTABLE. DEEP SCRATCHES THAT EXPOSE THE BASE MATERIAL, ARE NOT ACCEPTABLE.
 - C. SURFACES ARE CLEAN AND FREE OF ANY STAINS OR MARKS.
 - D. MISSING, BROKEN, DAMAGED, DISBONDED, OR LOOSE PARTS ARE NOT ACCEPTABLE.
 - E. SHARP EDGES OR BURRS ARE NOT ACCEPTABLE.
 - F. WORN OR CHIPPED PAINT AND FINISH NOT ACCEPTABLE.
 - G. MISALIGNED PARTS AND GAPS ARE NOT ACCEPTABLE.
 - H. SEALS ARE CLEAN AND INSTALLED PROPERLY. MISALIGNMENT, CUTS, OR DAMAGES ARE NOT ACCEPTABLE.
 - I. ARM CAPS STAINS, DAMAGE OR DISCOLORATION ARE UNACCEPTABLE.
2. - IF ANY ARM CAP ARE IN UNACCEPTABLE CONDITION SEND THEM TO THE SHOP FOR REPAIR AS APPLICABLE.
3. - CLEAN, POLISH, REAPPLY SURFACE FINISH, OR PAINT DEFECTIVE PARTS AS APPLICABLE.
4. IN CASE ANY FINDING IN STEP (1 & 2) AND IF THE PART CANNOT BE POLISHED, PAINTED, OR REFRESHED, REPLACE THE DEFECTIVE PART WITH A NEW ONE.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year



Task Card Title:

B/C SEAT REFRESH

Task Card NO:

25-SVA-03

Work Package:

ASP/H-26 C7-CHK

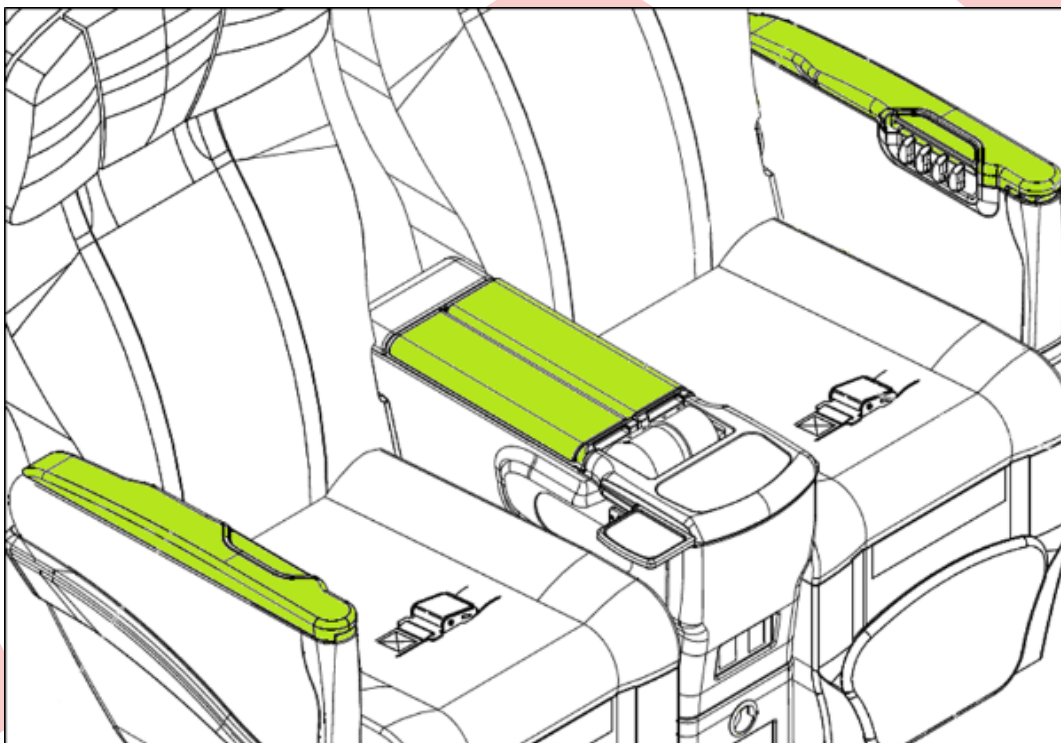
A/C Registration:

HZ-ASP

Mechanic/s	CAB/ACFT_TECH			HRS				
Insp.				HRS				

GENERAL VISUAL OF ALL CLOSETS/STOWAGE FOR CLEANLINESS AND CONDITION.**Job Description****SEAT ARM ASSEMBLY**

(IF ANY PARTS ARE IN UNACCEPTABLE CONDITION. PLEASE REFER TO STEP 3 FOR ARM CAPS FOR OTHER PARTS REFER TO STEP 3 AND 4):



1. - DVI OF SEAT ARM ASSEMBLY FOR CLEANLINESS AND CONDITION (USING HAND-HELD FLASH LIGHT):
 - A. CRACK, DENT, OR DAMAGE ARE NOT ACCEPTABLE.
 - B. SURFACE SCRATCHES ARE ACCEPTABLE. DEEP SCRATCHES THAT EXPOSE THE BASE MATERIAL, ARE NOT ACCEPTABLE.
 - C. SURFACES ARE CLEAN AND FREE OF ANY STAINS OR MARKS.
 - D. MISSING, BROKEN, DAMAGED, DISBONDED, OR LOOSE PARTS ARE NOT ACCEPTABLE.
 - E. SHARP EDGES OR BURRS ARE NOT ACCEPTABLE.
 - F. WORN OR CHIPPED PAINT AND FINISH NOT ACCEPTABLE.
 - G. MISALIGNED PARTS AND GAPS ARE NOT ACCEPTABLE.
 - H. SEALS ARE CLEAN AND INSTALLED PROPERLY. MISALIGNMENT, CUTS, OR DAMAGES ARE NOT ACCEPTABLE.
 - I. ARM CAPS STAINS, DAMAGE OR DISCOLORATION ARE UNACCEPTABLE.
2. - IF ANY ARM CAP ARE IN UNACCEPTABLE CONDITION SEND THEM TO THE SHOP FOR REPAIR AS APPLICABLE.
3. - CLEAN, POLISH, REAPPLY SURFACE FINISH, OR PAINT DEFECTIVE PARTS AS APPLICABLE.
4. - IN CASE ANY FINDING IN STEP (1 & 2) AND IF THE PART CANNOT BE POLISHED, PAINTED, OR REFRESHED,

 MET.32722075	Task Card Title: B/C SEAT REFRESH						
Task Card NO: 25-SVA-03	Work Package: ASP/H-26 C7-CHK	A/C Registration: HZ-ASP					
REPLACE THE DEFECTIVE PART WITH A NEW ONE.							
STEP COMPLETION SIGN OFF:							
	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year
Mechanic/s	CAB/ACFT_TECH		HRS				
Insp.			HRS				
Job Description							
<u>SEAT ACTUATION</u> <u>(IF ANY PARTS ARE IN UNACCEPTABLE CONDITION, PLEASE REFER TO STEP 4):</u> 1. FUNCTION TEST THE SEAT MECHANICAL ACTUATION SYSTEM (<u>LEGREST, BACKREST, AND FOOT REST</u>) (PERSON TO BE SEATED DURING THE TEST): A. NOISY OR JERKY MOVEMENTS NOT ACCEPTABLE. B. INTERFERENCE OF PARTS, SHROUDS, OR OTHER ITEMS IS NOT ACCEPTABLE. 2. PERFORM DET VISUAL CHECK THE SEAT CONTROL UNIT FOR CLEANLINESS AND CONDITION.							



Task Card Title:

B/C SEAT REFRESH

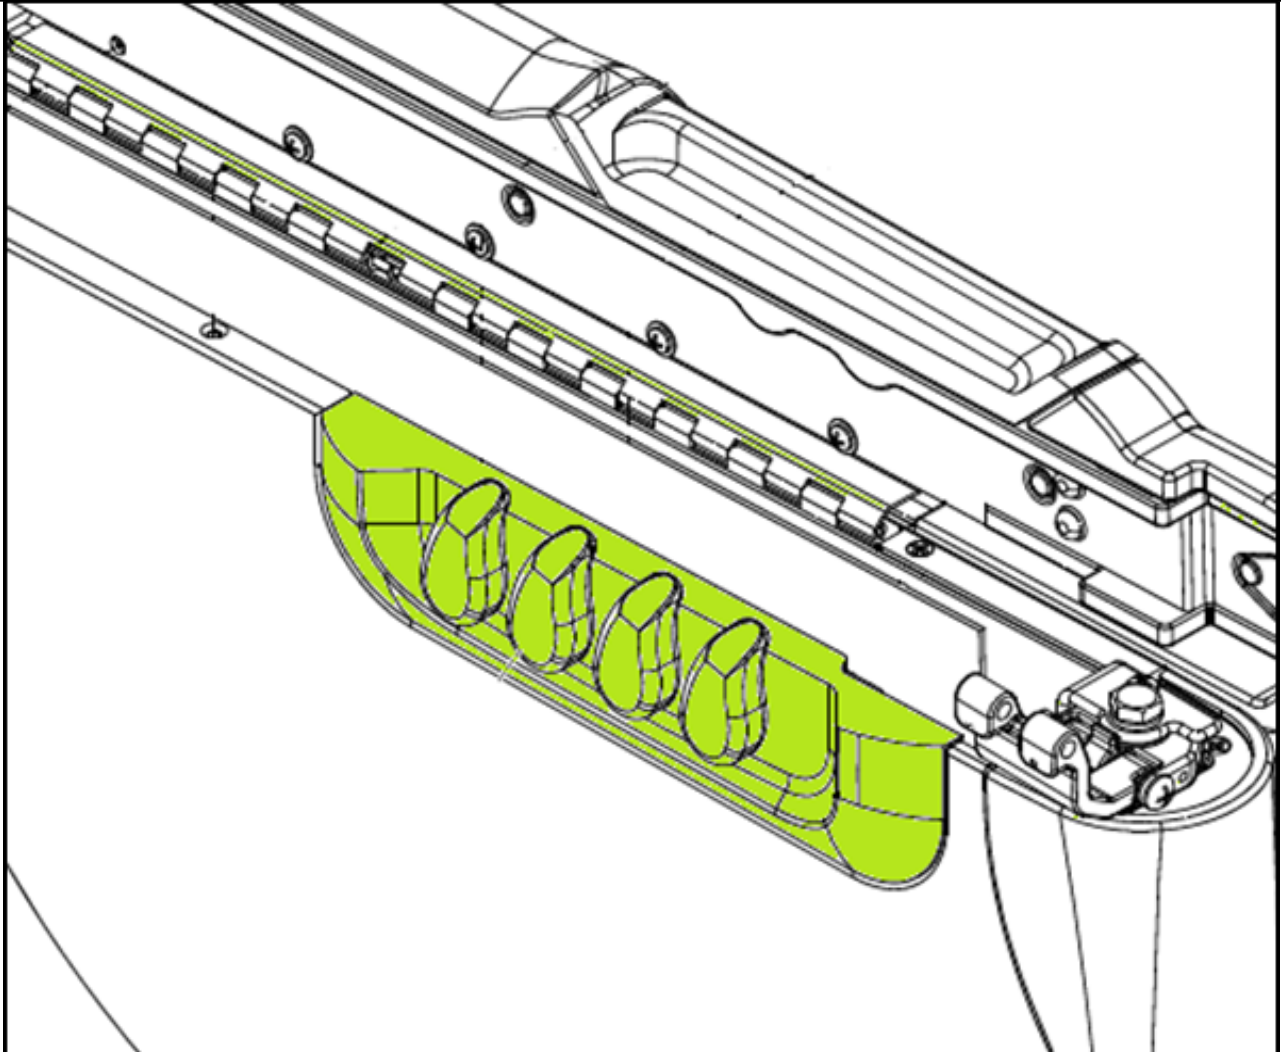
Task Card NO:

25-SVA-03

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

- A. DAMAGED OR LOOSE BUTTONS OR PANELS OR MEMBRANES ARE NOT ACCEPTABLE.
- B. CRACK, DENT, OR DAMAGE ARE NOT ACCEPTABLE.
- C. SURFACE SCRATCHES ARE ACCEPTABLE.
- D. SURFACES ARE CLEAN AND FREE OF ANY STAINS OR MARKS.
- E. MISSING, BROKEN, DAMAGED, DIS-BONDED, OR LOOSE PARTS ARE NOT ACCEPTABLE.
- F. SHARP EDGES OR BURRS ARE NOT ACCEPTABLE.
- G. WORN OR CHIPPED PAINT AND FINISH NOT ACCEPTABLE.
- H. MISALIGNED PARTS AND GAPS ARE NOT ACCEPTABLE.

3. CHECK HEADREST FOR PROPER FUNCTION AND MOVEMENT.

4. IF ANY PARTS ARE IN UNACCEPTABLE CONDITION, REPAIR OR REPLACE THE DEFECTIVE PART WITH A NEW ONE AS APPLICABLE.



Task Card Title:

B/C SEAT REFRESH

Task Card NO:

25-SVA-03

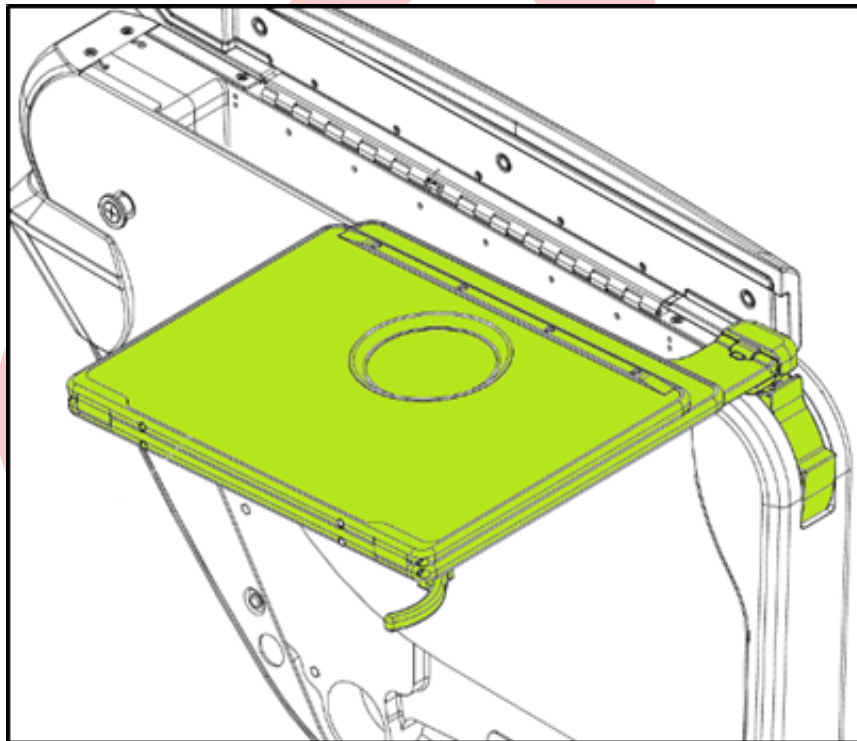
Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP**STEP COMPLETION SIGN OFF:**

	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year
Mechanic/s	CAB/ACFT_TECH		HRS				
Insp.			HRS				

Job Description**MEAL TABLE & COCKTAIL TABLE****(IF ANY PARTS ARE IN UNACCEPTABLE CONDITION, PLEASE REFER TO STEP 3 AND 4):****1. DEPLOY & STOW MEAL TABLE**



Task Card Title:

B/C SEAT REFRESH

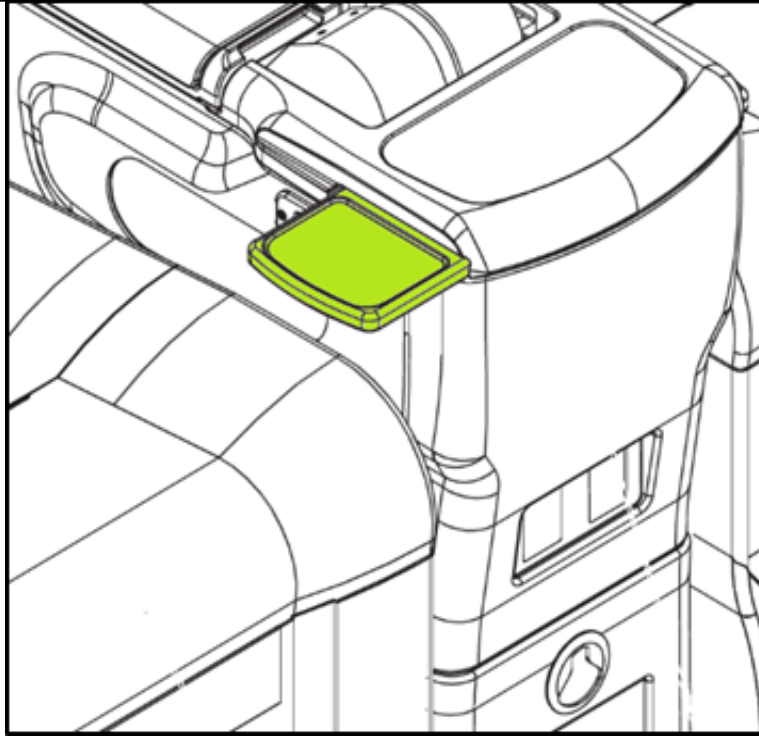
Task Card NO:

25-SVA-03

Work Package:

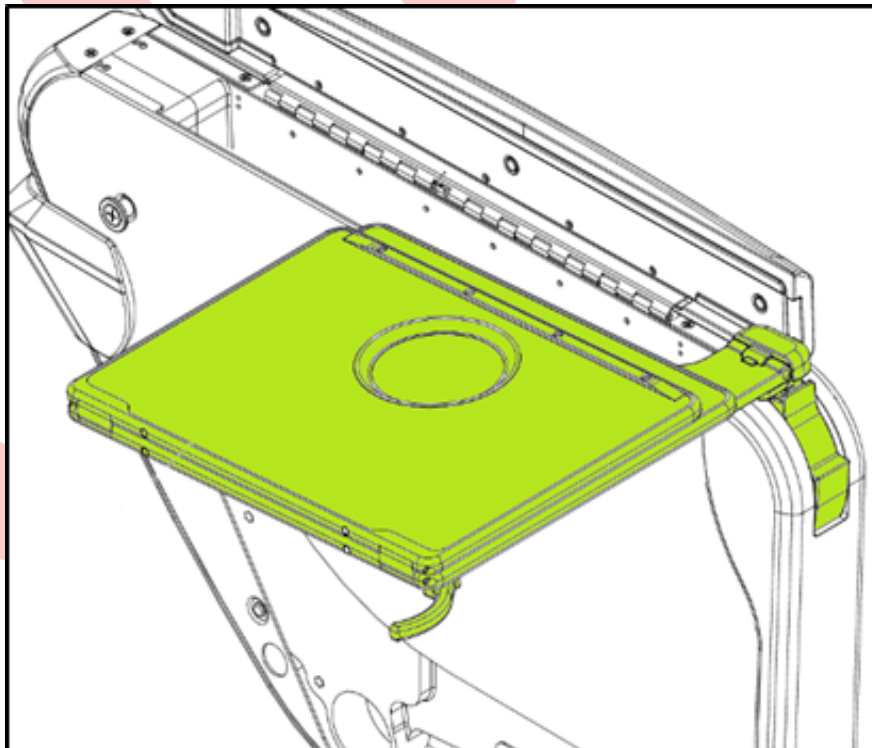
ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

- A. NOISY OR JERKY MOVEMENTS NOT ACCEPTABLE.
- B. INTERFERENCE OF PARTS, SHROUDS, OR OTHER ITEMS IS NOT ACCEPTABLE.
- C. CHECK FOR RIGIDITY OR ARM AND TILT MECHANISM. LOOSE INSTALLATION NOT ACCEPTABLE.
- D. MISALIGNMENT OF MEAL TABLE IN STOW POSITION IS NOT ACCEPTABLE.

2. PERFORM DET VISUAL CHECK OF MEAL TABLE & COCKTAIL TABLE FOR CONDITION AND CLEANLINESS.





Task Card Title:

B/C SEAT REFRESH

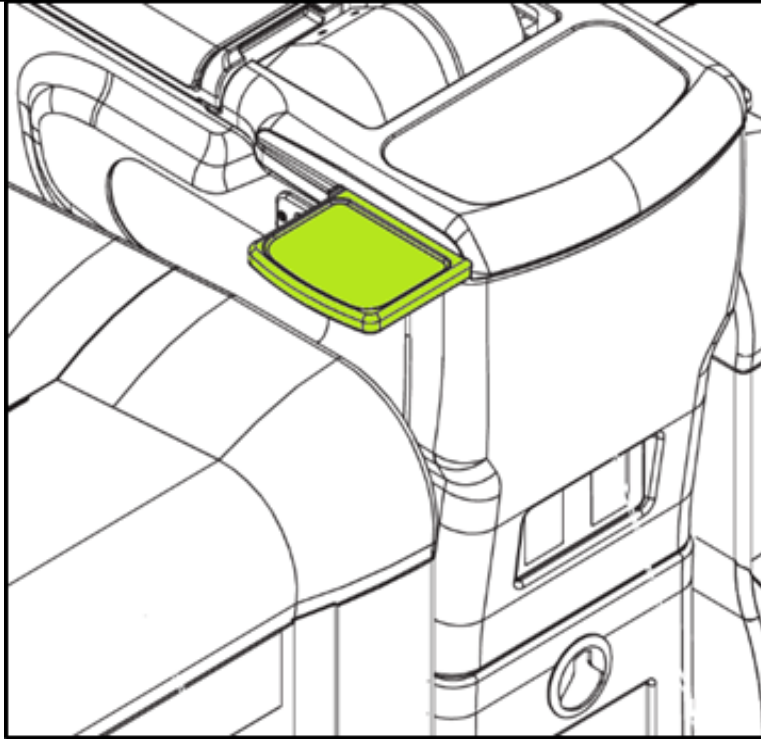
Task Card NO:

25-SVA-03

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

- A. CRACK, DENT, OR DAMAGE ARE NOT ACCEPTABLE.
 - B. SURFACE SCRATCHES ARE ACCEPTABLE. DEEP SCRATCHES THAT EXPOSE THE BASE MATERIAL, ARE NOT ACCEPTABLE.
 - C. SURFACES ARE CLEAN AND FREE OF ANY STAINS OR MARKS.
 - D. MISSING, BROKEN, DAMAGED, DIS-BONDED, OR LOOSE PARTS ARE NOT ACCEPTABLE.
 - E. SHARP EDGES OR BURRS ARE NOT ACCEPTABLE.
 - F. WORN OR CHIPPED OR PEELED PAINT AND FINISH NOT ACCEPTABLE.
3. PEELING OF LAMINATES OR BUBBLES IN LAMINATES ARE NOT ACCEPTABLE. CLEAN, POLISH, REAPPLY SURFACE FINISH, OR PAINT DEFECTIVE PARTS AS APPLICABLE.
 4. IN CASE ANY FINDING IN STEP (1 & 2) AND IF THE PART CANNOT BE POLISHED, PAINTED, OR REFRESHED, REPLACE THE DEFECTIVE PART WITH A NEW ONE.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year
Mechanic/s	CAB/ACFT_TECH		HRS				
Insp.			HRS				

Job Description**SEAT ARM ASSEMBLY/FOODTRAY STOWAGE****(IF ANY PARTS ARE IN UNACCEPTABLE CONDITION, PLEASE REFER TO STEP 3 AND 4):**



Task Card Title:

B/C SEAT REFRESH

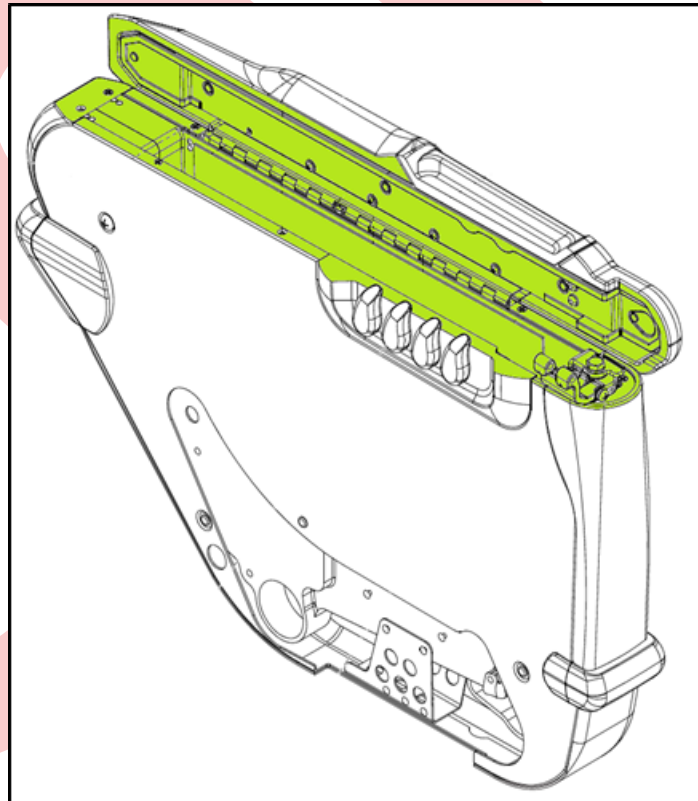
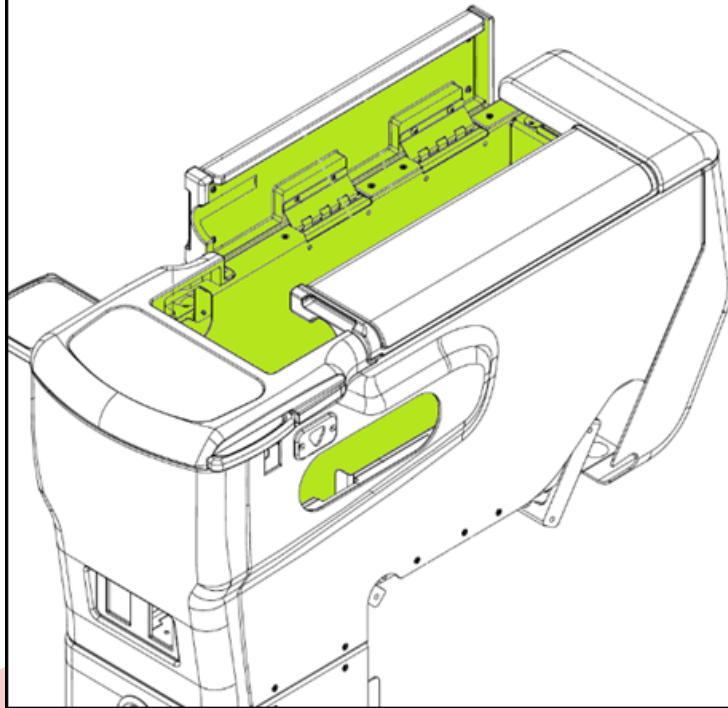
Task Card NO:

25-SVA-03

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

1. OPEN THE ARMREST AND FOODTRAY STOWAGE AND GVI FOR CLEANLINESS AND CONDITION:

- A. CRACKS, DENTS, OR DAMAGE NOT ALLOWED.
- B. SURFACE SCRATCHES ARE ALLOWED, BUT DEEP SCRATCHES ARE NOT.



MET.32722075

Task Card Title:

B/C SEAT REFRESH

Task Card NO:

25-SVA-03

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

- C. SURFACES MUST BE CLEAN AND FREE OF STAINS OR MARKS.
 D. MISSING, BROKEN, DAMAGED, DIS-BONDED, OR LOOSE PARTS ARE NOT ACCEPTABLE.
 E. SHARP EDGES OR BURRS ARE NOT ALLOWED.
 F. PARTS MUST BE ALIGNED WITH NO GAPS.
 G. NO MISSING OR LOOSE FASTENERS ALLOWED.
 H. SEALS MUST BE CLEAN AND PROPERLY INSTALLED, WITH NO MISALIGNMENT, CUTS, OR DAMAGES.
 I. ORIENTATION OF PARTS, LAMINATES, AND DÉCOR SHOULD BE CORRECT.
2. DEPLOY & STOW STOWAGE COMPARTMENT DOOR:
- A. NOISY OR JERKY MOVEMENTS NOT ACCEPTABLE.
 B. NO PLAY OR RATTLING ALLOWED.
 C. INTERFERENCE OF PARTS, ITEMS IS NOT ACCEPTABLE.
 D. CHECK FOR RIGIDITY LOOSE INSTALLATION NOT ACCEPTABLE.
 E. MISALIGNMENT OF STOWAGE COMPARTMENT DOOR IN STOW POSITION IS NOT ACCEPTABLE.
 F. SHOULD BE EASILY DEPLOYABLE AND STOWED WITHOUT THE NEED OF EXCESSIVE FORCE.
3. CLEAN, POLISH, REAPPLY SURFACE FINISH, OR PAINT DEFECTIVE PARTS AS APPLICABLE.
 4. IN CASE ANY FINDING IN STEP (1 & 2) AND IF THE PART CANNOT BE POLISHED, PAINTED, OR REFRESHED, REPLACE THE DEFECTIVE PART WITH A NEW ONE.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year
Mechanic/s	CAB/ACFT_TECH		HRS				
Insp.			HRS				

Job Description**LEGREST ASSEMBLY****(IF ANY PARTS ARE IN UNACCEPTABLE CONDITION, PLEASE REFER TO STEP 3 AND 4):**



Task Card Title:

B/C SEAT REFRESH

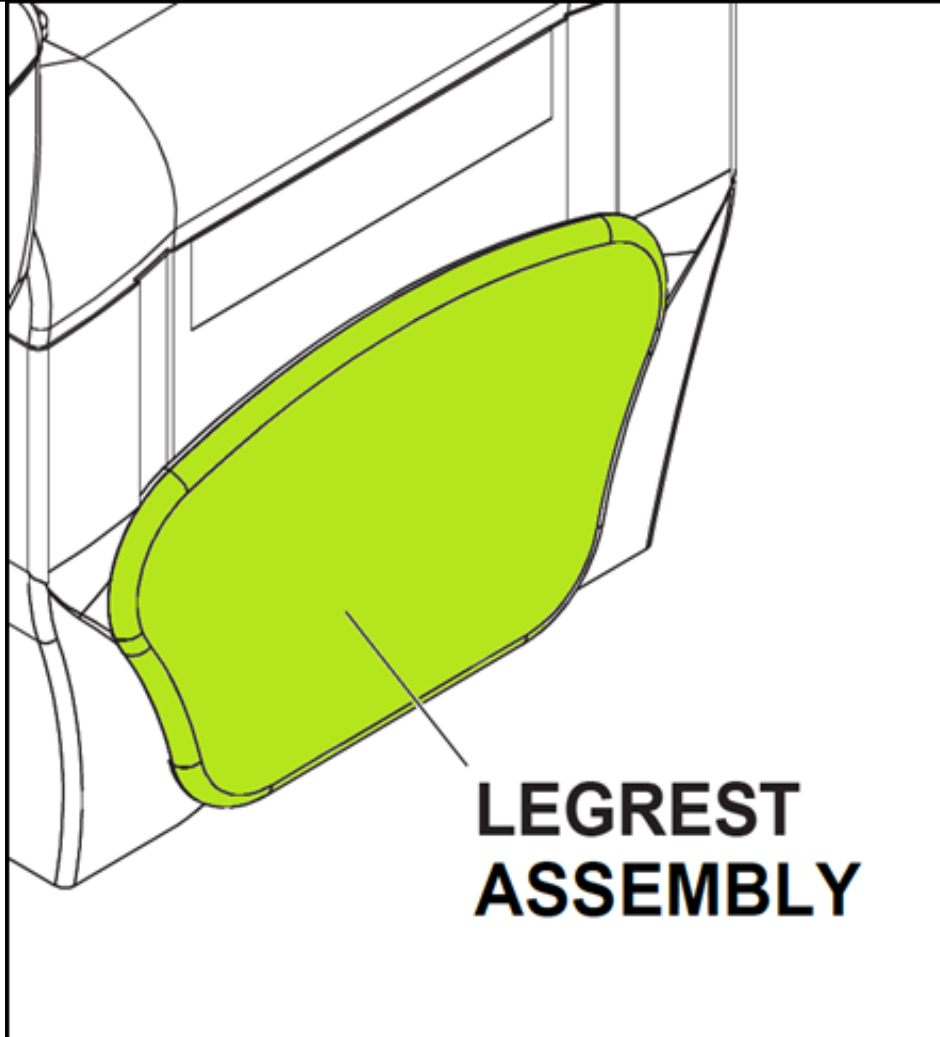
Task Card NO:

25-SVA-03

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

1. - DVI OF LEGREST ASSEMBLY FOR CLEANLINESS AND CONDITION (USING HAND-HELD FLASH LIGHT):

- A. SURFACES MUST BE CLEAN AND FREE OF STAINS OR MARKS.
- B. MISSING, BROKEN, DAMAGED, DIS-BONDED, OR LOOSE PARTS ARE NOT ACCEPTABLE.
- C. SHARP EDGES OR BURRS ARE NOT ALLOWED.
- D. ALL VELCRO MUST BE PROPERLY INSTALLED.
- E. ORIENTATION OF PARTS, LAMINATES, DECOR, DECALS, AND PLACARDS SHOULD BE CORRECT.

2.- IN CASE OF ANY FINDING IN STEP 1 IF THE PART CANNOT REPAIRED, OR REFRESHED, REPLACE THE DEFECTIVE PART WITH A NEW ONE.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration		Number./Signature	Date		
						Day	Month	Year
Mechanic/s	CAB/ACFT_TECH			HRS				
Insp.				HRS				



MET.32722075

Task Card Title:

B/C SEAT REFRESH

Task Card NO:

25-SVA-03

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP**Job Description****SEAT STRUCTURE****(IF ANY PARTS ARE IN UNACCEPTABLE CONDITION, PLEASE REFER TO STEP 4):**

1. REMOVE SEAT CUSHIONS AND USE A VACUUM CLEANER OR LIGHT BRUSH TO CLEAN THE AREA HIDDEN UNDER THE CUSHION AND AROUND THE SEAT STRUCTURE.
2. PERFORM DET VISUAL CHECK THE CONDITION FOR SERVICEABILITY OF SEATPAN, DIAPHRAGM, AND SURROUNDING STRUCTURE FOR DAMAGE, CRACKS, ETC.:
 - A. CHECK FOR PROPER TENSION. THE DIAPHRAGM SHOULD NOT HAVE SAGS OR APPEAR LOOSE.
 - B. TEARS OR OTHER DAMAGE TO THE FABRIC ARE UNACCEPTABLE. MISSING PARTS, BROKEN PARTS, AND PARTS NOT SECURELY ATTACHED OR FASTENED ARE UNACCEPTABLE.
 - C. HARDWARE AND METAL PARTS FOR MUST BE IN A CORRECT ORIENTATION, TIGHT, AND FREE OF BURRS, DAMAGE, SHARP EDGES AND, CRACKS
3. CHECK FOR PROPER INSTALLATION OF THE ACTUATION HARDWARE AND LEGREST.
4. IF ANY PARTS ARE IN UNACCEPTABLE CONDITION, REPAIR OR REPLACE THE DEFECTIVE PART WITH A NEW ONE AS APPLICABLE.

ALL SEAT PLACARDS/MARKER

1. PERFORM DET VISUAL CHECK ALL SEAT PLACARDS/MARKER CONDITION AND CLEANLINESS.
 - A. PLACARDS MUST BE CLEAN AND IN GOOD CONDITION, CORRECT ORIENTATION, WITH NO MISALIGNMENT, CUTS, OR DAMAGES.
 - B. MISSING OR DIS-BONDED PARTS ARE NOT ACCEPTABLE.
2. IF ANY PARTS ARE IN UNACCEPTABLE CONDITION, REPAIR OR REPLACE THE DEFECTIVE PART WITH A NEW ONE AS APPLICABLE.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year
Mechanic/s	CAB/ACFT_TECH		HRS				
Insp.			HRS				

10. GENERAL VISUAL OF PAX WINDOW SHADES FOR CONDITION AND CLEANLINESS.**Job Description**

10. PERFORM GENERAL VISUAL OF PAX WINDOW SHADES FOR CONDITION AND CLEANLINESS.

- A. NO CRACKS, DENTS, OR DAMAGE ARE ACCEPTABLE.
- B. MISSING, BROKEN, DAMAGED, DIS-BONDED, OR LOOSE PARTS ARE NOT ACCEPTABLE.
- C. SHARP EDGES OR BURRS ARE NOT ALLOWED

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year

 MET.32722075	Task Card Title: B/C SEAT REFRESH						
Task Card NO: 25-SVA-03		Work Package: ASP/H-26 C7-CHK		A/C Registration: HZ-ASP			
Mechanic/s	CAB/ACFT_TECH			HRS			
Insp.				HRS			
GV ALL PASSENGER SEAT TRACK COVERS							
Job Description							
11. PERFORM GENERAL VISUAL CHECK OF ALL PASSENGER SEAT TRACK COVERS FOR CORRECT INSTALLATION, CONDITION, DAMAGE, AND CLEANNESS. MISSING SEAT TRACK COVERS ARE NOT ACCEPTABLE.							
STEP COMPLETION SIGN OFF:							
	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year
Mechanic/s			HRS				
Insp.			HRS				
Job Description							
12. PERFORM GV CHECK ALL CORNER BUMPERS/KICKSTRIPS OF LAVATORIES, GALLEYS, CLOSETS, PARTITIONS AND CLASS DIVIDERS. CHECK ALL SEALS, BUMPERS AND KICK STRIPS FOR PROPER INSTALLATION AND CONDITION.							
A. BUMPER STRIPS AND KICKSTRIP MUST BE PRESENT AND SECURE.							
B. SURFACE SCRATCHES ARE PERMISSIBLE. CRACK, DENT, DEEP SCRATCHES, OR DAMAGE ARE NOT ACCEPTABLE.							
STEP COMPLETION SIGN OFF:							
	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year
Mechanic/s	CAB/ACFT_TECH		HRS				
Insp.			HRS				
Job Description							
13. CHECK AVAILABILITY OF AUGMENTED CREW CURTAINS AND POUCH.							
STEP COMPLETION SIGN OFF:							
	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year
Mechanic/s	CAB/ACFT_TECH		HRS				
Insp.			HRS				
Job Description							
14. PERFORM GV CHECK DOOR ASSIST HANDLE NEAR L1, R1, L2, R2, L3, R3, L4, R4, L5 AND R5 DOORS FOR PROPER INSTALLATION AND CONDITION.							
STEP COMPLETION SIGN OFF:							
	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year
Mechanic/s	CAB/ACFT_TECH		HRS				

 MET.32722075	Task Card Title: B/C SEAT REFRESH							
Task Card NO: 25-SVA-03	Work Package: ASP/H-26 C7-CHK	A/C Registration: HZ-ASP						
Insp.				HRS				
Job Description								
15. PERFORM GENERAL VISUAL CHECK THE CONDITION OF NTF FOR ANY DAMAGE, CLEANNESS, OR STAINS IN ALL GALLEYS, LAVATORIES, AND ENTRYWAYS.								
STEP COMPLETION SIGN OFF:								
	Qualification / Skill	Number of employees	Duration		Number./Signature	Date		
						Day	Month	Year
Mechanic/s	CAB/ACFT_TECH			HRS				
Insp.				HRS				
Job Description								
16. PERFORM GENERAL VISUAL CHECK ALL AIRCRAFT CARPET AND FLOOR MAT (JOINTS) AT ALL PASSENGER ENTRY DOORS AREA AND FIX IT, IF IT NOT INSTALLED PROPERLY USE DOUBLE FACE TAPE P/N: SABA99D AS REQUIRED.								
STEP COMPLETION SIGN OFF:								
	Qualification / Skill	Number of employees	Duration		Number./Signature	Date		
						Day	Month	Year
Mechanic/s	CAB/ACFT_TECH			HRS				
Insp.				HRS				
Job Description								
17. PERFORM CHECK AVAILABILITY OF ADAPTER PLATE FOR BABY BASSINET PN: 5WM003CK501/-502. REFER CMM 25-32-065-4148 PAGES 10405-10408.								
STEP COMPLETION SIGN OFF:								
	Qualification / Skill	Number of employees	Duration		Number./Signature	Date		
						Day	Month	Year
Mechanic/s	CAB/ACFT_TECH			HRS				
Insp.				HRS				
Job Description								
18.PERFORM GENERAL VISUAL CHECK OF ALL CABIN PLACARDS FOR PRESENCES, CONDITION AND CLEANLINESS. A. PLACARDS MUST BE CLEAN AND IN GOOD CONDITION, CORRECT ORIENTATION, WITH NO MISALIGNMENT, CUTS, OR DAMAGES.								
STEP COMPLETION SIGN OFF:								
	Qualification / Skill	Number of employees	Duration		Number./Signature	Date		
						Day	Month	Year
Mechanic/s	CAB/ACFT_TECH			HRS				
Insp.				HRS				



Task Card Title:

B/C SEAT REFRESH

Task Card NO:

25-SVA-03

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP**Job Description**

19. PERFORM GENERAL VISUAL CHECK OF ALL CABIN SEALS (GALLEY, LAVATORY, OVERHEAD/CLOSET, PARTITION AND PAX DOOR).

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year
Mechanic/s	CAB/ACFT_TECH			HRS			
Insp.				HRS			

-Aircraft Maintenance Manual used: Revision No. _____ Dated. _____.

Task card finding (Tick Applicable Box) [] Yes [] No. If yes update the system and list Task card finding WO below

Work order No: _____

Note: Make sure to create the finding Work Order on task card level.

Remark's: _____

(1) If Task card interrupted or performed by different personals updates the system and update the following accordingly (Tick Applicable Box)

- Interruption No. 1 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

- Interruption No. 2 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

- Interruption No. 3 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

- Interruption No. 4 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

- Interruption No. 5 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

(2) Record any dimension or torque through the performed steps and sign-off as applicable:

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

 MET.32722075	Task Card Title: B/C SEAT REFRESH			
Task Card NO: 25-SVA-03	Work Package: ASP/H-26 C7-CHK	A/C Registration: HZ-ASP		
Task Completion Close Up And System Update	Station	Date	Signature	

Copyright of Saudia Technic - Regeneration is not allowed without prior approval by Saudia Technic.

DISPROVED

 MET.25382789		Task Card Title: RUDDER MECHANICAL CONTROL CHK					
Task Card NO: 272100-04-1		Work Package: ASP/H-26 C7-CHK		A/C Registration: HZ-ASP			
A/C Type: 321		Block Taskcard		Main Skill: IL,INSP,AF,ACFT_TECH		PROD Final Acceptance:	
Project No: 01BASPC72608		Related Task Card:		A/C Area: 10			
Internal Check:		Check Type:		Work Order NO:		Tally Sequence NO: 355	
ENCLOSURE: ☐ CMR: ☐ CPCP: ☐ ETOPS: ☐ CDCCL: ☐ AD: ☐ ALI: ☐							
Type Code: OPC		Special Code:		MSG Code: LUR, 9, MRB		Request: Phase:	
I HEREBY CERTIFY THAT ALL WARNINGS AND CAUTIONS HAVE BEEN READ AND THE WORK HAS BEEN CARRIED OUT IN ACCORDING WITH ALL LAID DOWN PROCEDURES, ATTACHED NOTES AND INFORMATION.							
Zones: 325							
DOCUMENT REFERENCES:							
Doc Typ		Reference					
AMM		27-26-41-280-001-A					
AMM		27-26-41-000-001-A					
AMM		27-26-41-400-001-A					
MRB		27.21.00/04					
ACCESS PANELS:							
325BL							
MATERIAL REQUIREMENTS:							
Part Number		Description				Qty.	
D2727000700600		ROD-SPRING				1.0	
TOOLING REQUIREMENTS:							
Part Number		Description				Qty.	
98D27207549000		PIN RIGGING-YAW DAMPER				1.0	
TASK INSTRUCTIONS							
Job Description							
A. REMOVE THE CENTERING SPRING ROD OF THE YAW DAMPER AS PER AMM TASK 27-26-41-000-001-A.							
STEP COMPLETION SIGN OFF:							
Qualification / Skill		Number of employees		Duration		Number./Signature	
Date							
Day Month Year							
Mechanic/s		AF/ACFT_TECH		HRS			
Insp.				HRS			
TASK INSTRUCTIONS							
Job Description							
B. SEND THE YAW DAMPER CENTERING SPRING ROD TO SHOP FOR OPERATIONAL CHECK.							



Task Card Title:

RUDDER MECHANICAL CONTROL CHK

Task Card NO:

272100-04-1

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP**STEP COMPLETION SIGN OFF:**

	Qualification / Skill	Number of employees	Duration		Number./Signature	Date		
						Day	Month	Year
Mechanic/s	AF/ACFT_TECH			HRS				
Insp.				HRS				

TASK INSTRUCTIONS**Job Description**

C. OK TO INSTALL RUDDER YAW DAMPER CENTERING SPRING ROD.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration		Number./Signature	Date		
						Day	Month	Year
Mechanic/s				HRS				
Insp.	II/INSP			HRS				

TASK INSTRUCTIONS**Job Description**

D. INSTALL RUDDER YAW DAMPER MECHANICAL SPRING ROD AS PER AMM TASK 27-26-41-400-001-A.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration		Number./Signature	Date		
						Day	Month	Year
Mechanic/s	AF/ACFT_TECH			HRS				
Insp.	INSP/II			HRS				

-Aircraft Maintenance Manual used: Revision No. _____ Dated. _____.

Task card finding (Tick Applicable Box) [] Yes [] No. If yes update the system and list Task card finding WO below

Work order No: _____

Note: Make sure to create the finding Work Order on task card level.

Remark's: _____



Task Card Title:

RUDDER MECHANICAL CONTROL CHK

Task Card NO:

272100-04-1

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

(1) If Task card interrupted or performed by different personals updates the system and update the following according (Tick Applicable Box)

- Interruption No. 1 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 2 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 3 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 4 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 5 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____

(2) Record any dimension or torque through the performed steps and sign-off as applicable:

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____

**Task Completion Close Up And
System Update**

Station**Date****Signature**

Copyright of Saudia Technic - Regeneration is not allowed without prior approval by Saudia Technic.



Task Card Title:

RUDDER MECHANICAL CNTROL LUBRICATION

Task Card NO:

272100-08-1

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

(1) If Task card interrupted or performed by different personals updates the system and update the following accord (Tick Applicable Box)

- Interruption No. 1 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 2 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 3 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 4 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 5 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____

(2) Record any dimension or torque through the performed steps and sign-off as applicable:

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____

**Task Completion Close Up And
System Update**

Station**Date****Signature**

 MET.32721986		Task Card Title: THS MECHANICAL CONTROL LUBRICATION					
Task Card NO: 274100-03-1		Work Package: ASP/H-26 C7-CHK		A/C Registration: HZ-ASP			
A/C Type: 321		Block Taskcard		Main Skill: AF,ACFT_TECH		PROD Final Acceptance:	
Project No: 01BASPC72608		Related Task Card:		A/C Area: 10			
Internal Check:		Check Type:		Work Order NO:		Tally Sequence NO: 357	
ENCLOSURE: ☐ CMR: ☐ CPCP: ☐ ETOPS: ☐ CDCCL: ☐ AD: ☐ ALI: ☐							
Type Code: LUB		Special Code: AF		MSG Code: MRB, 6		Request: Phase:	
JOB SETUP, TC/P, JOB-C LOSEUP							
I HEREBY CERTIFY THAT ALL WARNINGS AND CAUTIONS HAVE BEEN READ AND THE WORK HAS BEEN CARRIED OUT IN ACCORDING WITH ALL LAID DOWN PROCEDURES, ATTACHED NOTES AND INFORMATION.							
Zones: 120,310							
DOCUMENT REFERENCES:							
Doc Typ		Reference					
AMM		12-22-27-640-007-A					
ACCESS PANELS:							
312AR, 811							
MATERIAL REQUIREMENTS:							
Part Number		Description				Qty.	
MIL-PRF-23827		GRASE ROYCO27 S/L2Y (IF SD USE ASG7P)				0.0	
TOOLING REQUIREMENTS:							
Part Number		Description				Qty.	
98D27403500000		PITCH TRIM CONTROL LOCKING (7616 99)				0.0	
PREPARATION							
Job Description							
A. PREPARE FOR THS MECHANICAL CONTROL CHAINS LUBRICATION AS PER AMM TASK 12-22-27-640-007-A.							
STEP COMPLETION SIGN OFF:							
Qualification / Skill		Number of employees		Duration		Number./Signature	
Date		Day		Month		Year	
Mechanic/s		AF/ACFT_TECH		HRS			
Insp.				HRS			
HST LUBRICATION							
Job Description							
B. LUBRICATE THE THS MECHANICAL CONTROL CHAINS CORRECT TENSION AS PER AMM TASK 12-22-27-640-007-A.							
STEP COMPLETION SIGN OFF:							
Qualification / Skill		Number of employees		Duration		Number./Signature	
Date		Day		Month		Year	
Mechanic/s		AF/ACFT_TECH		HRS			

 MET.32721986	Task Card Title: THS MECHANICAL CONTROL LUBRICATION						
Task Card NO: 274100-03-1		Work Package: ASP/H-26 C7-CHK		A/C Registration: HZ-ASP			
Insp.				HRS			
CLOSE UP							
Job Description							
C. RETURN AIRCRAFT BACK TO NORMAL CONFIGURATION AS PER AMM TASK 12-22-27-640-007-A.							
STEP COMPLETION SIGN OFF:							
	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year
Mechanic/s	AF/ACFT_TECH			HRS			
Insp.				HRS			
-Aircraft Maintenance Manual used: Revision No. _____ Dated. _____. Task card finding (Tick Applicable Box) [☐] Yes [☐] No. If yes update the system and list Task card finding WO below Work order No: _____ _____ _____ Note: Make sure to creat the finding Work Order on task card level. Remark's: _____ _____ _____							



MET.32721986

Task Card Title:

THS MECHANICAL CONTROL LUBRICATION

Task Card NO:

274100-03-1

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

(1) If Task card interrupted or performed by different personals updates the system and update the following accordingly (Tick Applicable Box)

- Interruption No. 1 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 2 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 3 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 4 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 5 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____

(2) Record any dimension or torque through the performed steps and sign-off as applicable:

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____

**Task Completion Close Up And
System Update**

Station**Date****Signature**

 MET.32722069		Task Card Title: APU FUEL PUMP SYSTEM AND FUEL FEED LINE					
Task Card NO: 282200-04-1		Work Package: ASP/H-26 C7-CHK		A/C Registration: HZ-ASP			
A/C Type: 321		Block Taskcard		Main Skill: II,INSP,ACFT_TECH,AP		PROD Final Acceptance:	
Project No: 01BASPC72608		Related Task Card:		A/C Area:			
Internal Check:		Check Type:		Work Order NO:		Tally Sequence NO: 358	
ENCLOSURE: ☐ CMR: ☐ CPCP: ☐ ETOPS: ☐ CDCCL: ☐ AD: ☐ ALI: ☐							
Type Code: FNC		Special Code: AP		MSG Code: 8		Request: Phase: JOB SETUP,INSPECTIO N,JOB-CLOSEUP	
I HEREBY CERTIFY THAT ALL WARNINGS AND CAUTIONS HAVE BEEN READ AND THE WORK HAS BEEN CARRID OUT IN ACCORDING WITH ALL LAID DOWN PROCEDURES, ATTACHED NOTES AND INFORMATION.							
Zones: 140,210,734,744							
DOCUMENT REFERENCES:							
Doc Typ		Reference					
AMM		28-22-00-720-801-00					
AMTOSS		282200-720-801					
MSI		28.22.00/04					
ACCESS PANELS:							
192MB, 522KB, 622KB							
MATERIAL REQUIREMENTS:							
Part Number		Description				Qty.	
No parts assigned to this Task Item							
TOOLING REQUIREMENTS:							
Part Number		Description				Qty.	
No tools assigned to this Task Item							
TASK PREPARATION							
Job Description							
A. PERFORM JOB SETUP FOR FUNCTIONAL CHECK (LEAK CHECK) OF THE APU FUEL FEED PIPE SHROUD(S) AS PER AMM TASK 28-22-00-720-801-A.							
STEP COMPLETION SIGN OFF:							
	Qualification / Skill	Number of employees	Duration		Number./Signature	Date	
						Day	Month
Mechanic/s	ACFT_TECH/AP		HRS				Year
Insp.			HRS				
TASK INSTRUCTIONS							
Job Description							
B. PERFORM A FUNCTIONAL CHECK (LEAK CHECK) OF THE APU FUEL FEED PIPE SHROUD(S) AS PER AMM 28-22-00-720-801-A.							
STEP COMPLETION SIGN OFF:							



Task Card Title:

APU FUEL PUMP SYSTEM AND FUEL FEED LINE



Task Card NO:

282200-04-1

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year
Mechanic/s	ACFT_TECH/AP		HRS				
Insp.	II/INSP		HRS				

TASK CLOSE UP

Job Description

C. PERFORM JOB CLOSE UP AND RETURN THE AIRCRAFT BACK TO NORMAL CONFIGURATION AS PER AMM TASK 28-22-00-720-801-A.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year
Mechanic/s	ACFT_TECH/AP		HRS				
Insp.			HRS				

-Aircraft Maintenance Manual used: Revision No. _____ Dated. _____.

Task card finding (Tick Applicable Box) [] Yes [] No. If yes update the system and list Task card finding WO below
Work order No: _____

Note: Make sure to creat the finding Work Order on task card level.

Remark's: _____



Task Card Title:

APU FUEL PUMP SYSTEM AND FUEL FEED LINE

Task Card NO:

282200-04-1

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

(1) If Task card interrupted or performed by different personals updates the system and update the following accordingly (Tick Applicable Box)

- Interruption No. 1 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 2 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 3 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 4 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 5 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____

(2) Record any dimension or torque through the performed steps and sign-off as applicable:

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____

**Task Completion Close Up And
System Update**

Station**Date****Signature**

 MET.32721973		Task Card Title: NO. 1 ENG LOW PRESS SHUT OFF VALVE OPC					
Task Card NO: 282400-01-1-001		Work Package: ASP/H-26 C7-CHK		A/C Registration: HZ-ASP			
A/C Type: 321		Block Taskcard		Main Skill: INSP,RII,ACFT_TECH,AP		PROD Final Acceptance:	
Project No: 01BASPC72608		Related Task Card:		A/C Area: 01			
Internal Check:		Check Type:		Work Order NO:		Tally Sequence NO: 359	
ENCLOSURE: ☐ CMR: ☐ CPCP: ☐ ETOPS: ☐ CDCCL: ☐ AD: ☐ ALI: ☐							
Type Code: OPC		Special Code: PP		MSG Code: 8, MRB, LUR		Request: JOB-SETUP,OPS/LK,TC/P,OPS/LK,OPS/LK,JOB-C Phase: LOSEUP	
I HEREBY CERTIFY THAT ALL WARNINGS AND CAUTIONS HAVE BEEN READ AND THE WORK HAS BEEN CARRID OUT IN ACCORDING WITH ALL LAID DOWN PROCEDURES, ATTACHED NOTES AND INFORMATION.							
Zones: 210,520							
DOCUMENT REFERENCES:							
Doc Typ		Reference					
AMM		28-24-00-790-003-A					
CAP		S28-C10001					
MRB		28.24.00/01					
ACCESS PANELS:							
522AT							
MATERIAL REQUIREMENTS:							
Part Number		Description				Qty.	
MS27196-24		GASKET *MRP-M123*				0.0	
TOOLING REQUIREMENTS:							
Part Number		Description				Qty.	
98D27803000000		LOCKING TOOL-FLAP SLAT LEVER, IN (HM				1.0	
TASK PREPARATION							
Job Description							
1. A. PREPARE FOR ENGINE LOW PRESSURE SHUT OFF VALVE AND ITS CONTROL OPERATIONAL CHECK AS PER AMM TASK 28-24-00-790-003-A.							
STEP COMPLETION SIGN OFF:							
	Qualification / Skill	Number of employees	Duration		Number./Signature	Date	
				HRS		Day Month Year	
Mechanic/s	ACFT_TECH/AP			HRS			
Insp.				HRS			
TASK INSTRUCTIONS							
Job Description							
2. A. PERFORM AN OPERATIONAL TEST OF ENGINE LP VALVE (12QM) AS PER AMM TASK 28-24-00-790-003-A.							
STEP COMPLETION SIGN OFF:							



Task Card Title:

NO. 1 ENG LOW PRESS SHUT OFF VALVE OPC

Task Card NO:

282400-01-1-001

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year
Mechanic/s	ACFT_TECH/AP		HRS				
Insp.			HRS				

TASK INSTRUCTIONS**Job Description**

2.
B. PERFORM ENGINE LP VALVE (12QM) LEAK CHECK WITH THE VALVE SELECTED CLOSE AND THE BOOST PUMP RUNNING AS AMM TASK 28-24-00-790-003-A.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year
Mechanic/s	ACFT_TECH/AP		HRS				
Insp.			HRS				

JOB-CLOSEUP**Job Description**

3.
A. CONNECT THE FUEL FEED LINE (REF. AMM TASK 73-11-46-400-802-A).
(AS PER AMM 28-24-00-790-003-A).

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year
Mechanic/s	ACFT_TECH/AP		HRS				
Insp.			HRS				

TASK CLOSE UP**Job Description**

3.
B. PERFORM FUEL FEED LINE LEAK CHECK AS PER AMM TASK 28-24-00-790-003-A.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year
Mechanic/s	ACFT_TECH/AP		HRS				
Insp.	INSP/RII		HRS				

TASK CLOSE UP**Job Description**

4.
A. RETURN THE AIRCRAFT TO ITS NORMAL CONFIGURATION AS PER AMM TASK 28-24-00-790-003-A.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year



Task Card Title:

NO. 1 ENG LOW PRESS SHUT OFF VALVE OPC

Task Card NO:

282400-01-1-001

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

Mechanic/s	ACFT_TECH/AP			HRS				
Insp.				HRS				

-Aircraft Maintenance Manual used: Revision No. _____ Dated. _____.

Task card finding (Tick Applicable Box) [] Yes [] No. If yes update the system and list Task card finding WO below

Work order No: _____

Note: Make sure to creat the finding Work Order on task card level.

Remark's: _____

(1) If Task card interrupted or performed by different personals updates the system and update the following accord (Tick Applicable Box)

- Interruption No. 1 [] Task card [] AMM [] Other specify. _____
Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 2 [] Task card [] AMM [] Other specify. _____
Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 3 [] Task card [] AMM [] Other specify. _____
Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 4 [] Task card [] AMM [] Other specify. _____
Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 5 [] Task card [] AMM [] Other specify. _____
Performed by: _____ Page No. _____ Step From _____ To _____

(2) Record any dimension or torque through the performed steps and sign-off as applicable:

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
Remark's: _____

Task Completion Close Up And System Update	Station	Date	Signature

 MET.32721989		Task Card Title: NO.2 ENG LOW PRESS SHUT OFF VALVE OPC					
Task Card NO: 282400-01-1-002		Work Package: ASP/H-26 C7-CHK		A/C Registration: HZ-ASP			
A/C Type: 321		Block Taskcard		Main Skill: INSP,RII,ACFT_TECH,AP		PROD Final Acceptance:	
Project No: 01BASPC72608		Related Task Card:		A/C Area: 02			
Internal Check:		Check Type:		Work Order NO:		Tally Sequence NO: 360	
ENCLOSURE: ☐ CMR: ☐ CPCP: ☐ ETOPS: ☐ CDCCL: ☐ AD: ☐ ALI: ☐							
Type Code: OPC		Special Code: PP		MSG Code: LUR, 8, MRB		Request: PRE HGR, PRE HGR, PRE HGR, OPS/LK, JOB-CLOS EUP	
I HEREBY CERTIFY THAT ALL WARNINGS AND CAUTIONS HAVE BEEN READ AND THE WORK HAS BEEN CARRID OUT IN ACCORDING WITH ALL LAID DOWN PROCEDURES, ATTACHED NOTES AND INFORMATION.							
Zones: 210,620							
DOCUMENT REFERENCES:							
Doc Typ		Reference					
AMM		28-24-00-790-003-A					
CAP		S28-C10001					
MRB		28.24.00/01					
ACCESS PANELS:							
622AT							
MATERIAL REQUIREMENTS:							
Part Number		Description				Qty.	
MS27196-24		GASKET *MRP-M123*				0.0	
TOOLING REQUIREMENTS:							
Part Number		Description				Qty.	
98D27803000000		LOCKING TOOL-FLAP SLAT LEVER, IN (HM				1.0	
TASK PREPARATION							
Job Description							
1. A. PREPARE FOR ENGINE LOW PRESSURE SHUT OFF VALVE AND ITS CONTROL OPERATIONAL CHECK AS PER AMM TASK 28-24-00-790-003-A.							
STEP COMPLETION SIGN OFF:							
		Qualification / Skill		Number of employees		Duration	
						Number./Signature	
						Date	
Mechanic/s		ACFT_TECH/AP					
Insp.							
TASK INSTRUCTIONS							
Job Description							
2. A. PERFORM AN OPERATIONAL TEST OF ENGINE LP VALVE (13QM) AS PER AMM TASK 28-24-00-790-003-A.							
STEP COMPLETION SIGN OFF:							



Task Card Title:

NO.2 ENG LOW PRESS SHUT OFF VALVE OPC



Task Card NO:

282400-01-1-002

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year
Mechanic/s	ACFT_TECH/AP		HRS				
Insp.			HRS				

TASK INSTRUCTIONS

Job Description

2.

B. PERFORM ENGINE LP VALVE (13QM) LEAK CHECK WITH THE VALVE SELECTED CLOSE AND THE BOOST PUMP RUNNING AS AMM TASK 28-24-00-790-003-A.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year
Mechanic/s	ACFT_TECH/AP		HRS				
Insp.			HRS				

TASK CLOSE UP

Job Description

3.

A. PERFORM FUEL FEED LINE LEAK CHECK AS PER AMM TASK 28-24-00-790-003-A.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year
Mechanic/s	ACFT_TECH/AP		HRS				
Insp.	INSP/RII		HRS				

TASK CLOSE UP

Job Description

3.

B. RETURN THE AIRCRAFT TO ITS NORMAL CONFIGURATION AS PER AMM TASK 28-24-00-790-003-A.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year
Mechanic/s	ACFT_TECH/AP		HRS				
Insp.			HRS				

-Aircraft Maintenance Manual used: Revision No. _____ Dated. _____.

Task card finding (Tick Applicable Box) [] Yes [] No. If yes update the system and list Task card finding WO below

Work order No: _____

Note: Make sure to create the finding Work Order on task card level.

Remark's: _____



Task Card Title:

NO.2 ENG LOW PRESS SHUT OFF VALVE OPC

Task Card NO:

282400-01-1-002

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

(1) If Task card interrupted or performed by different personals updates the system and update the following according (Tick Applicable Box)

- Interruption No. 1 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 2 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 3 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 4 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 5 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____

(2) Record any dimension or torque through the performed steps and sign-off as applicable:

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____

**Task Completion Close Up And
System Update**

Station**Date****Signature**

 MET.32721982		Task Card Title: NO. 1 ENG LOW PRESS SHUT OFF VALVE OPC BY INDIVIDU										
AL MOTORS												
Task Card NO: 282400-02-1-001		Work Package: ASP/H-26 C7-CHK		A/C Registration: HZ-ASP								
A/C Type: 321		Block Taskcard		Main Skill: PP,ACFT_TECH		PROD Final Acceptance:						
Project No: 01BASPC72608		Related Task Card:		A/C Area: 01								
Internal Check:		Check Type:		Work Order NO:		Tally Sequence NO: 361						
ENCLOSURE: ☐ CMR: ☐ CPCP: ☐ ETOPS: ☐ CDCCL: ☐ AD: ☐ ALI: ☐												
Type Code: OPC		Special Code: PP		MSG Code: 9, MRB, LUR		Request: Phase: PRE HGR, PRE HGR, JOB -CLOSEUP						
I HEREBY CERTIFY THAT ALL WARNINGS AND CAUTIONS HAVE BEEN READ AND THE WORK HAS BEEN CARRID OUT IN ACCORDING WITH ALL LAID DOWN PROCEDURES, ATTACHED NOTES AND INFORMATION.												
Zones: 210												
DOCUMENT REFERENCES:												
Doc Typ		Reference										
AMM		28-24-00-710-803-A										
AMTOSS		AMT 282400-710-803										
CAP		S28-C10002										
MRB		28.24.00/02										
ACCESS PANELS:												
522AT												
MATERIAL REQUIREMENTS:												
Part Number		Description				Qty.						
No parts assigned to this task												
TOOLING REQUIREMENTS:												
Part Number		Description				Qty.						
98D27803000000		LOCKING TOOL-FLAP SLAT LEVER, IN (HM				1.0						
TASK PREPARATION												
Job Description												
A. PERFOME JOB SET-UP AND OBEY THE FUEL SAFETY PROCEDURES WHEN DO WORK ON THE FUEL SYSTEM AS PER AMM TASK 28-24-00-710-803-A.												
STEP COMPLETION SIGN OFF:												
		Qualification / Skill		Number of employees		Duration		Number./Signature		Date		
										Day Month Year		

 MET.32721982	Task Card Title: NO. 1 ENG LOW PRESS SHUT OFF VALVE OPC BY INDIVIDU AL MOTORS								
Task Card NO: 282400-02-1-001		Work Package: ASP/H-26 C7-CHK			A/C Registration: HZ-ASP				
Mechanic/s	PP/ACFT_TECH			HRS					
Insp.				HRS					
TASK INSTRUCTIONS									
Job Description									
A. PERFORM AN OPERATIONAL CHECK OF LP SHUT OFF VALVES INCLUDING OPERATION BY INDIVIDUAL MOTORS AS PER AMM TASK 28-24-00-710-803-A.									
STEP COMPLETION SIGN OFF:									
	Qualification / Skill	Number of employees	Duration		Number./Signature		Date		
							Day	Month	
Mechanic/s	PP/ACFT_TECH			HRS					
Insp.				HRS					
TASK CLOSE UP									
Job Description									
C. PERFORM THE AIRCRAFT CLOSE UP AS PER AMM TASK 28-24-00-710-803-A.									
STEP COMPLETION SIGN OFF:									
	Qualification / Skill	Number of employees	Duration		Number./Signature		Date		
							Day	Month	
Mechanic/s	PP/ACFT_TECH			HRS					
Insp.				HRS					
-Aircraft Maintenance Manual used: Revision No. _____ Dated._____. Task card finding (Tick Applicable Box) [] Yes [] No. If yes update the system and list Task card finding WO below Work order No: _____ _____ Note: Make sure to creat the finding Work Order on task card level. Remark's: _____ _____									



Task Card Title:

NO. 1 ENG LOW PRESS SHUT OFF VALVE OPC BY INDIVIDU**AL MOTORS**

Task Card NO:

282400-02-1-001

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

(1) If Task card interrupted or performed by different personals updates the system and update the following according (Tick Applicable Box)

- Interruption No. 1 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 2 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 3 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 4 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 5 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____

(2) Record any dimension or torque through the performed steps and sign-off as applicable:

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____

**Task Completion Close Up And
System Update**

Station**Date****Signature**

 MET.32721983		Task Card Title: NO. 2 ENG LOW PRESS SHUT OFF VALVE OPC BY INDIVIDU										
AL MOTORS												
Task Card NO: 282400-02-1-002		Work Package: ASP/H-26 C7-CHK		A/C Registration: HZ-ASP								
A/C Type: 321		Block Taskcard		Main Skill: PP,ACFT_TECH		PROD Final Acceptance:						
Project No: 01BASPC72608		Related Task Card:		A/C Area: 02								
Internal Check:		Check Type:		Work Order NO:		Tally Sequence NO: 362						
ENCLOSURE: ☐ CMR: ☐ CPCP: ☐ ETOPS: ☐ CDCCL: ☐ AD: ☐ ALI: ☐												
Type Code: OPC		Special Code: PP		MSG Code: LUR, 9, MRB		Request: Phase: PRE HGR, PRE HGR, JOB -CLOSEUP						
I HEREBY CERTIFY THAT ALL WARNINGS AND CAUTIONS HAVE BEEN READ AND THE WORK HAS BEEN CARRID OUT IN ACCORDING WITH ALL LAID DOWN PROCEDURES, ATTACHED NOTES AND INFORMATION.												
Zones: 210												
DOCUMENT REFERENCES:												
Doc Typ		Reference										
AMM		28-24-00-710-803-A										
AMTOSS		AMT 282400-710-803										
CAP		S28-C10002										
MRB		28.24.00/02										
ACCESS PANELS:												
622AT												
MATERIAL REQUIREMENTS:												
Part Number		Description				Qty.						
No parts assigned to this task												
TOOLING REQUIREMENTS:												
Part Number		Description				Qty.						
98D27803000000		LOCKING TOOL-FLAP SLAT LEVER, IN (HM				1.0						
TASK PREPARATION												
Job Description												
A. PERFOME JOB SET-UP AND OBEY THE FUEL SAFETY PROCEDURES WHEN DO WORK ON THE FUEL SYSTEM AS PER AMM TASK 28-24-00-710-803-A.												
STEP COMPLETION SIGN OFF:												
		Qualification / Skill		Number of employees		Duration		Number./Signature		Date		
										Day	Month	Year

 MET.32721983	Task Card Title: NO. 2 ENG LOW PRESS SHUT OFF VALVE OPC BY INDIVIDU AL MOTORS						
Task Card NO: 282400-02-1-002		Work Package: ASP/H-26 C7-CHK		A/C Registration: HZ-ASP			
Mechanic/s	PP/ACFT_TECH			HRS			
Insp.				HRS			
TASK INSTRUCTIONS							
Job Description							
A. PERFORM AN OPERATIONAL CHECK OF LP SHUT OFF VALVES INCLUDING OPERATION BY INDIVIDUAL MOTORS AS PER AMM TASK 28-24-00-710-803-A.							
STEP COMPLETION SIGN OFF:							
	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year
Mechanic/s	PP/ACFT_TECH		HRS				
Insp.			HRS				
TASK CLOSE UP							
Job Description							
C. PERFORM THE AIRCRAFT CLOSE UP AS PER AMM TASK 28-24-00-710-803-A.							
STEP COMPLETION SIGN OFF:							
	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year
Mechanic/s	PP/ACFT_TECH		HRS				
Insp.			HRS				
-Aircraft Maintenance Manual used: Revision No. _____ Dated._____. Task card finding (Tick Applicable Box) [] Yes [] No. If yes update the system and list Task card finding WO below Work order No: _____ _____ Note: Make sure to creat the finding Work Order on task card level. Remark's: _____ _____							



Task Card Title:

NO. 2 ENG LOW PRESS SHUT OFF VALVE OPC BY INDIVIDU**AL MOTORS**

Task Card NO:

282400-02-1-002

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

(1) If Task card interrupted or performed by different personals updates the system and update the following according (Tick Applicable Box)

- Interruption No. 1 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 2 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 3 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 4 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 5 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____

(2) Record any dimension or torque through the performed steps and sign-off as applicable:

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____

**Task Completion Close Up And
System Update**

Station**Date****Signature**

 MET.32721984		Task Card Title: ANALYZE HYD FLUID FOR PARTICLE, WATER & ACIDITY C					
Task Card NO:		Work Package:		A/C Registration:			
291000-15-1		ASP/H-26 C7-CHK		HZ-ASP			
A/C Type:		Block Taskcard		Main Skill:		PROD Final Acceptance:	
321				ACFT_TECH,AP			
Project No:		Related Task Card:		A/C Area:			
01BASPC72608				09			
Internal Check:		Check Type:		Work Order NO:		Tally Sequence NO:	
						363	
ENCLOSURE: ☐ CMR: ☐ CPCP: ☐ ETOPS: ☐ CDCCL: ☐ AD: ☐ ALI: ☐							
Type Code:		Special Code:		MSG Code:		Request:	
DET		AF		9, MRB		Phase:	
I HEREBY CERTIFY THAT ALL WARNINGS AND CAUTIONS HAVE BEEN READ AND THE WORK HAS BEEN CARRIED OUT IN ACCORDING WITH ALL LAID DOWN PROCEDURES, ATTACHED NOTES AND INFORMATION.							
Zones: 100							
DOCUMENT REFERENCES:							
Doc Typ		Reference					
AMM		12-32-29-281-001-A					
ACCESS PANELS:							
195BB, 196BB, 734, 744							
MATERIAL REQUIREMENTS:							
Part Number		Description				Qty.	
No parts assigned to this Task Item							
TOOLING REQUIREMENTS:							
Part Number		Description				Qty.	
No tools assigned to this Task Item							
1.JOB-SETUP							
Job Description							
1.PERFORM JOB-SETUP FOR ANALYZE HYDRAULIC FLUID FOR PARTICLE, WATER AND ACIDITY CONTAMINATION AS PER AMM 12-32-29-281-001-A.							
STEP COMPLETION SIGN OFF:							
	Qualification / Skill	Number of employees	Duration		Number./Signature	Date	
						Day	Month
Mechanic/s	ACFT_TECH/AP		HRS				Year
Insp.			HRS				
2.TASK INSTRUCTION							
Job Description							
2.							
A. TAKE GREEN, BLUE AND YELLOW HYDRAULIC SYSTEMS FLUID SAMPLE FOR ANALYSIS AS PER AMM TASK 12-32-29-281-001-A.							



Task Card Title:

ANALYZE HYD FLUID FOR PARTICLE, WATER & ACIDITY C**CONTAMINATION**

Task Card NO:

291000-15-1

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

Please make sure the quantity of the HYD sample is more than 100ml and the following data is reflected on the HYD samples bag:

1. WORK ORDER NUMBER
2. QUERY NUMBER
3. AIRCRAFT TAIL NUMBER
4. BLUE/GREEN /YELLOW HYD SYS TAPE
5. DATE OF SAMPLES.
6. **FOR JED STATION ONLY**, DROP AREA LOCATION (707) OF THE LABORATORY
(PLEASE MAKE SURE THE SAMPLES ARE DELIVERED AND RECEIVED BY THE LAB
HAND TO HAND).

NOTE:

1. **AIRCRAFT OUT KINGDOM STATION**,SEND HYD FLUID SAMPLES TO LOCAL FLUID LAB FOR ANALYSIS.
2. **AIRCRAFT IN KINGDOM STATION**,SEND HYD FLUID SAMPLES TO JED FLUID LAB FOR ANALYSIS.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year
Mechanic/s	ACFT_TECH/AP		HRS				
Insp.			HRS				

3.OPEN WORK ORDER**Job Description**

3.

A . ISSUE A WORK ORDER TO PERFORM THE REQUIRED ACTION BASED ON THE HYD SAMPLE RESULTS AS PER THE AMM 12-32-29-281-001-A. IF SUFFICIENT GROUND TIME IS AVAILABLE FOR COMPLIANCE.

B . DEFER THE TASK CARD FOR 25 DAYS TO ALLOW ADEQUATE TIME FOR THE NECESSARY ACTIONS BASED ON THE HYD SAMPLE RESULTS, IF GROUND TIME IS INSUFFICIENT.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year
Mechanic/s	ACFT_TECH/AP		HRS				
Insp.			HRS				



Task Card Title:

ANALYZE HYD FLUID FOR PARTICLE, WATER & ACIDITY C**CONTAMINATION**

Task Card NO:

291000-15-1

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP**Job Description**

3.

C. PROCEED WITH THE REQUIRED ACTION AS SPECIFIED IN AMM TASK 12-32-29-281-001-A, IF THE RESULTS EXCEED THE LIMITS AMM TASK 12-32-29-281-001-A.

D. NO FURTHER ACTION IS REQUIRED. (IF THE RESULTS ARE WITHIN DEFINED LIMITS OF AMM TASK 12-32-29-281-001-A).

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year
Mechanic/s	ACFT_TECH/AP		HRS				
Insp.			HRS				

JOB-CLOSEUP**Job Description**

4.

A. PERFORM JOB-CLOSEUP AND RETURN AIRCRAFT BACK TO NORMAL AS PER AMM 12-32-29-281-001-A.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year
Mechanic/s	ACFT_TECH/AP		HRS				
Insp.			HRS				

-Aircraft Maintenance Manual used: Revision No. _____ Dated. _____.

Task card finding (Tick Applicable Box) [] Yes [] No. If yes update the system and list Task card finding WO below

Work order No: _____

Note: Make sure to create the finding Work Order on task card level.

Remark's: _____



Task Card Title:

ANALYZE HYD FLUID FOR PARTICLE, WATER & ACIDITY C**CONTAMINATION**

Task Card NO:

291000-15-1

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

(1) If Task card interrupted or performed by different personals updates the system and update the following accordingly (Tick Applicable Box)

- Interruption No. 1 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 2 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 3 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 4 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 5 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____

(2) Record any dimension or torque through the performed steps and sign-off as applicable:

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____

**Task Completion Close Up And
System Update**

Station**Date****Signature**

 MET.32721992		Task Card Title: MAIN AND AUXILIARY HYDRAULIC POWER							
Task Card NO: 291000-26-1		Work Package: ASP/H-26 C7-CHK			A/C Registration: HZ-ASP				
A/C Type: 321		Block Taskcard		Main Skill: ACFT_TECH,AP		PROD Final Acceptance:			
Project No: 01BASPC72608		Related Task Card:		A/C Area:					
Internal Check:		Check Type:		Work Order NO:		Tally Sequence NO: 364			
ENCLOSURE: ☐ CMR: ☐ CPCP: ☐ ETOPS: ☐ CDCCL: ☐ AD: ☐ ALI: ☐									
Type Code: DET		Special Code: AP		MSG Code: 9		Request: JOB SETUP, JOB-CLOSE UP			
I HEREBY CERTIFY THAT ALL WARNINGS AND CAUTIONS HAVE BEEN READ AND THE WORK HAS BEEN CARRID OUT IN ACCORDING WITH ALL LAID DOWN PROCEDURES, ATTACHED NOTES AND INFORMATION.									
Zones: 195,196									
DOCUMENT REFERENCES:									
Doc Typ		Reference							
AMTOSS		123229-281-804							
MSI		29.10.00/42							
ACCESS PANELS:									
195BB, 196BB									
MATERIAL REQUIREMENTS:									
Part Number		Description				Qty.			
No parts assigned to this Task Item									
TOOLING REQUIREMENTS:									
Part Number		Description				Qty.			
No tools assigned to this Task Item									
JOB-SETUP									
Job Description									
1. A. PERFORM JOB SET UP FOR ANALYZE HYDRAULIC FLUID FOR CHLORINE, DENSITY, VISCOSITY AND CONDUCTIVITY CONTAMINATIOND AS PER AMM 12-32-29-281-804-A.									
STEP COMPLETION SIGN OFF:									
		Qualification / Skill	Number of employees	Duration		Number./Signature	Date		
							Day	Month	Year
Mechanic/s		ACFT_TECH/AP			HRS				
Insp.					HRS				
PROCEDURE									
Job Description									
2. A. PERFORM PROCEDURE OF ANALYZE HYDRAULIC FLUID FOR CHLORINE, DENSITY, VISCOSITY AND CONDUCTIVITY									

 MET.32721992	Task Card Title: MAIN AND AUXILIARY HYDRAULIC POWER						
Task Card NO: 291000-26-1	Work Package: ASP/H-26 C7-CHK	A/C Registration: HZ-ASP					
CONTAMINATION AS PER AMM 12-32-29-281-804-A.							
STEP COMPLETION SIGN OFF:							
	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year
Mechanic/s	ACFT_TECH/AP		HRS				
Insp.			HRS				
CLOSE-UP							
Job Description							
3. A. JOB-CLOSEUP AND RETURN AIRCRAFT BACK TO NORMAL AS PER AMM 12-32-29-281-804-A.							
STEP COMPLETION SIGN OFF:							
	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year
Mechanic/s	ACFT_TECH/AP		HRS				
Insp.			HRS				
-Aircraft Maintenance Manual used: Revision No. _____ Dated. _____. Task card finding (Tick Applicable Box) [] Yes [] No. If yes update the system and list Task card finding WO below Work order No: _____ _____ Note: Make sure to creat the finding Work Order on task card level. Remark's: _____ _____							



Task Card Title:

MAIN AND AUXILIARY HYDRAULIC POWER

Task Card NO:

291000-26-1

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

(1) If Task card interrupted or performed by different personals updates the system and update the following according (Tick Applicable Box)

- Interruption No. 1 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 2 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 3 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 4 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 5 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____

(2) Record any dimension or torque through the performed steps and sign-off as applicable:

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____

**Task Completion Close Up And
System Update**

Station**Date****Signature**

 MET.32721985		Task Card Title: ALTITUDE REPORTING FUNCTIONAL TEST					
Task Card NO: 345200-01-1-A		Work Package: ASP/H-26 C7-CHK		A/C Registration: HZ-ASP			
A/C Type: 321		Block Taskcard		Main Skill: AV,ACFT_TECH		PROD Final Acceptance:	
Project No: 01BASPC72608		Related Task Card:		A/C Area: 06			
Internal Check:		Check Type:		Work Order NO:		Tally Sequence NO: 365	
ENCLOSURE: ☐ CMR: ☐ CPCP: ☐ ETOPS: ☐ CDCCL: ☐ AD: ☐ ALI: ☐							
Type Code: OPC		Special Code: AV		MSG Code: RVSM, GACA*		Request: Phase: OPS/LK	
I HEREBY CERTIFY THAT ALL WARNINGS AND CAUTIONS HAVE BEEN READ AND THE WORK HAS BEEN CARRID OUT IN ACCORDING WITH ALL LAID DOWN PROCEDURES, ATTACHED NOTES AND INFORMATION.							
Zones: 210							
DOCUMENT REFERENCES:							
Doc Typ		Reference					
AMM		34-52-00-720-004-A					
GACA		GACAR 91.409-Item V.5.i					
GACA		GACAR 91.453					
ACCESS PANELS:							
MATERIAL REQUIREMENTS:							
Part Number		Description				Qty.	
No parts assigned to this Task Item							
TOOLING REQUIREMENTS:							
Part Number		Description				Qty.	
No tools assigned to this Task Item							
INSTRUCTION							
Job Description							
A. PERFORM A FUNCTIONAL TEST OF THE ALTITUDE REPORTING FUNCTION AS PER AMM TASK 34-52-00-720-004-A.							
STEP COMPLETION SIGN OFF:							
	Qualification / Skill	Number of employees	Duration		Number./Signature	Date	
						Day	Month
						Year	
Mechanic/s	AV/ACFT_TECH		HRS				
Insp.			HRS				
-Aircraft Maintenance Manual used: Revision No. _____ Dated. _____.							
Task card finding (Tick Applicable Box) [] Yes [] No. If yes update the system and list Task card finding WO below							
Work order No: _____							
Note: Make sure to creat the finding Work Order on task card level.							
Remark's: _____							



MET.32721985

Task Card Title:

ALTITUDE REPORTING FUNCTIONAL TEST

Task Card NO:

345200-01-1-A

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

(1) If Task card interrupted or performed by different personals updates the system and update the following according (Tick Applicable Box)

- Interruption No. 1 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 2 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 3 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 4 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 5 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____

(2) Record any dimension or torque through the performed steps and sign-off as applicable:

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____

**Task Completion Close Up And
System Update**

Station**Date****Signature**

 MET.32721981		Task Card Title: ATC MODE "S" TRANSP FUC CHK					
Task Card NO: 345200-03-1-A		Work Package: ASP/H-26 C7-CHK		A/C Registration: HZ-ASP			
A/C Type: 321		Block Taskcard		Main Skill: INSP,II,AV,ACFT_TECH		PROD Final Acceptance:	
Project No: 01BASPC72608		Related Task Card:		A/C Area: 06			
Internal Check:		Check Type:		Work Order NO:		Tally Sequence NO: 366	
ENCLOSURE: ☐ CMR: ☐ CPCP: ☐ ETOPS: ☐ CDCCL: ☐ AD: ☐ ALI: ☐							
Type Code: FNC		Special Code: AV		MSG Code: RVSM, GACA		Request: 	
						Phase: OPS/LK	
I HEREBY CERTIFY THAT ALL WARNINGS AND CAUTIONS HAVE BEEN READ AND THE WORK HAS BEEN CARRIED OUT IN ACCORDING WITH ALL LAID DOWN PROCEDURES, ATTACHED NOTES AND INFORMATION.							
Zones: 210							
DOCUMENT REFERENCES:							
Doc Typ		Reference					
AMM		34-52-00-720-005-A02					
GACA		GACAR 91.409-Item V.5.i					
GACA		GACAR 91.453					
ACCESS PANELS:							
MATERIAL REQUIREMENTS:							
Part Number		Description					Qty.
No parts assigned to this Task Item							
TOOLING REQUIREMENTS:							
Part Number		Description					Qty.
No tools assigned to this Task Item							
FUNCTIONAL TEST							
Job Description							
(RVSM REQUIREMENT)							
A. PERFORM A FUNCTIONAL TEST OF THE ATC / MODE "S" TRANSPONDER AS PER AMM TASK 34-52-00-720-005-A.							
STEP COMPLETION SIGN OFF:							
	Qualification / Skill	Number of employees	Duration		Number./Signature	Date	
						Day	Month
Mechanic/s	AV/ACFT_TECH			HRS			
Insp.	INSP/II			HRS			



MET.32721981

Task Card Title:

ATC MODE "S" TRANSP FUC CHK



Task Card NO:

345200-03-1-A

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

-Aircraft Maintenance Manual used: Revision No. _____ Dated. _____.

Task card finding (Tick Applicable Box) [] Yes [] No. If yes update the system and list Task card finding WO below

Work order No: _____

Note: Make sure to create the finding Work Order on task card level.

Remark's: _____

(1) If Task card interrupted or performed by different persons updates the system and update the following accordingly (Tick Applicable Box)

- Interruption No. 1 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

- Interruption No. 2 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

- Interruption No. 3 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

- Interruption No. 4 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

- Interruption No. 5 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

(2) Record any dimension or torque through the performed steps and sign-off as applicable:

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

Task Completion Close Up And
System Update

Station

Date

Signature

 MET.32721979		Task Card Title: INSPECT WATER SEPARATOR AND ASSOCIATED FILTER ELEMENT, AND CLEAN AS NECESSARY					
Task Card NO: 383100-02-1		Work Package: ASP/H-26 C7-CHK		A/C Registration: HZ-ASP			
A/C Type: 321		Block Taskcard		Main Skill: AF,ACFT_TECH		PROD Final Acceptance:	
Project No: 01BASPC72608		Related Task Card:		A/C Area: 09			
Internal Check:		Check Type:		Work Order NO:		Tally Sequence NO: 367	
ENCLOSURE: ☐ CMR: ☐ CPCP: ☐ ETOPS: ☐ CDCCL: ☐ AD: ☐ ALI: ☐							
Type Code: DET		Special Code: AF		MSG Code: MRB, 9		Request: JOB SETUP, TC/P, CLOSE-UP	
I HEREBY CERTIFY THAT ALL WARNINGS AND CAUTIONS HAVE BEEN READ AND THE WORK HAS BEEN CARRIED OUT IN ACCORDING WITH ALL LAID DOWN PROCEDURES, ATTACHED NOTES AND INFORMATION.							
Zones: 170							
DOCUMENT REFERENCES:							
Doc Typ		Reference					
AMM		38-31-67					
AMM		38-31-67-610-001-A					
ACCESS PANELS:							
162DW							
MATERIAL REQUIREMENTS:							
Part Number		Description				Qty.	
14401-065		HOUSING ASSY-FILTER				1.0	
2-175N497-70		PACKING-USE PN 2-175N602-70				1.0	
AMS1550		AIRCRAFT CLEANER				1.0	
AMS-1476B		NO VIRUS A/C GEL				1.0	
TOOLING REQUIREMENTS:							
Part Number		Description				Qty.	
No tools assigned to this Task Item							
1. JOB SET-UP:							
Job Description							
A. PERFORM A JOB SET UP FOR WATER SEPARATOR AND ASSOCIATED FILTER ELEMENT AS PER AMM 38-31-67-610-001 -A.							
STEP COMPLETION SIGN OFF:							
	Qualification / Skill	Number of employees	Duration		Number./Signature	Date	
				HRS		Day	Month
Mechanic/s	AF/ACFT_TECH			HRS			
Insp.				HRS			
TASK INSTRUCTIONS							
Job Description							
A. REMOVE AND INSTALL SERVICEABLE WATER SEPARATOR FROM THE WASTE HOLDING TANK AS PER AMM TASK							



Task Card Title:

INSPECT WATER SEPARATOR AND ASSOCIATED FILTER E**LEMENT, AND CLEAN AS NECESSARY**

Task Card NO:

383100-02-1

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

38-31-67-610-001-A,

NOTE: IF THE WATER SEPARATOR IS NOT AVAILABLE, CLEAN THE WATER SEPARATOR ON THE AIRCRAFT AS PER AMM TASK 38-31-67-610-001-A.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year
Mechanic/s	AF/ACFT_TECH		HRS				
Insp.			HRS				

3. CLOSE UP:**Job Description**

A. PERFORM AIRCRAFT CLOSE UP PER AMM TASK 38-31-67-610-001 -A.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year
Mechanic/s	AF/ACFT_TECH		HRS				
Insp.			HRS				

-Aircraft Maintenance Manual used: Revision No. _____ Dated. _____.

Task card finding (Tick Applicable Box) [] Yes [] No. If yes update the system and list Task card finding WO below

Work order No: _____

Note: Make sure to create the finding Work Order on task card level.

Remark's: _____



Task Card Title:

INSPECT WATER SEPARATOR AND ASSOCIATED FILTER E**LEMENT, AND CLEAN AS NECESSARY**

Task Card NO:

383100-02-1

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

(1) If Task card interrupted or performed by different personals updates the system and update the following according (Tick Applicable Box)

- Interruption No. 1 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 2 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 3 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 4 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 5 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____

(2) Record any dimension or torque through the performed steps and sign-off as applicable:

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____

**Task Completion Close Up And
System Update**

Station**Date****Signature**

 MET.32721816		Task Card Title: VACUUM TOILET SYSTEM INSPECTION					
Task Card NO: 383100-05-1		Work Package: ASP/H-26 C7-CHK		A/C Registration: HZ-ASP			
A/C Type: 321		Block Taskcard		Main Skill: INSP,IL,ACFT_TECH,AP		PROD Final Acceptance:	
Project No: 01BASPC72608		Related Task Card:		A/C Area: 09			
Internal Check:		Check Type:		Work Order NO:		Tally Sequence NO: 368	
ENCLOSURE: ☐ CMR: ☐ CPCP: ☐ ETOPS: ☐ CDCCL: ☐ AD: ☐ ALI: ☐							
Type Code: DET		Special Code: AF		MSG Code: 6, MRB		Request: Phase: JOB-SETUP,INSPECTION, JOB-CLOSEUP	
I HEREBY CERTIFY THAT ALL WARNINGS AND CAUTIONS HAVE BEEN READ AND THE WORK HAS BEEN CARRIED OUT IN ACCORDING WITH ALL LAID DOWN PROCEDURES, ATTACHED NOTES AND INFORMATION.							
Zones: 172							
DOCUMENT REFERENCES:							
Doc Typ		Reference					
AMM		38-31-61-210-001-A					
AMM		38-31-61-210-001-A					
ACCESS PANELS:							
161DW, 162DW							
MATERIAL REQUIREMENTS:							
Part Number		Description				Qty.	
05983		PACKING-USE PN 2-162N602-70				2.0	
2-029N497-70		USE PN 2-029N602-70				2.0	
4812-107		WASHER				4.0	
5105-37H		RING RETAINING				2.0	
AMS1550		AIRCRAFT CLEANER				1.0	
MIL-R-46082		COMPOUND HIGH TEMP (BUY ON RQST).S				1.0	
AMS-1476B		NO VIRUS A/C GEL				1.0	
TOOLING REQUIREMENTS:							
Part Number		Description				Qty.	
No tools assigned to this Task Item							
JOB-SETUP							
Job Description							
PERFORM JOB-SETUP FOR DETAILED VISUAL INSPECTION OF THE RINSE NOZZLES AND THE INNER SIDE OF THE WASTE HOLDING TANK FOR WASTE BUILD-UP AND DAMAGE PER AMM TASK 38-31-61-210-001-A.							
STEP COMPLETION SIGN OFF:							
	Qualification / Skill	Number of employees	Duration		Number./Signature	Date	
				HRS		Day	Month
Mechanic/s	ACFT_TECH/AP			HRS			
Insp.				HRS			



MET.32721816

Task Card Title:

VACUUM TOILET SYSTEM INSPECTION

Task Card NO:

383100-05-1

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP**TASK INSTRUCTION****Job Description**

A. PERFORM DETAILED VISUAL INSPECTION OF THE RINSE NOZZLES AND THE INNER SIDE OF THE WASTE HOLDING TANK FOR WASTE BUILD-UP AND DAMAGE PER AMM TASK 38-31-61-210-001-A.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration		Number./Signature	Date		
						Day	Month	Year
Mechanic/s				HRS				
Insp.	INSP/II			HRS				

JOB-CLOSEUP**Job Description**

PERFORM JOB-CLOSEUP AND RETURN ACFT BACK TO NORMAL AS PER AMM 38-31-61-210-001-A.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration		Number./Signature	Date		
						Day	Month	Year
Mechanic/s	ACFT_TECH/AP			HRS				
Insp.				HRS				

-Aircraft Maintenance Manual used: Revision No. _____ Dated. _____.

Task card finding (Tick Applicable Box) [] Yes [] No. If yes update the system and list Task card finding WO below

Work order No: _____

Note: Make sure to creat the finding Work Order on task card level.

Remark's: _____



MET.32721816

Task Card Title:

VACUUM TOILET SYSTEM INSPECTION

Task Card NO:

383100-05-1

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

(1) If Task card interrupted or performed by different personals updates the system and update the following according (Tick Applicable Box)

- Interruption No. 1 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 2 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 3 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 4 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 5 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____

(2) Record any dimension or torque through the performed steps and sign-off as applicable:

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____

**Task Completion Close Up And
System Update**

Station**Date****Signature**

 MET.25416078		Task Card Title: D-ULPA FILTER ELEMENT REPLACEMENT					
Task Card NO: 470000-01-1		Work Package: ASP/H-26 C7-CHK		A/C Registration: HZ-ASP			
A/C Type: 321		Block Taskcard		Main Skill: INSP,RII,AF,ACFT_TECH		PROD Final Acceptance:	
Project No: 01BASPC72608		Related Task Card:		A/C Area: 09			
Internal Check:		Check Type:		Work Order NO:		Tally Sequence NO: 369	
ENCLOSURE: ☐ CMR: ☐ CPCP: ☐ ETOPS: ☐ CDCCL: ☐ AD: ☐ ALI: ☐							
Type Code: DIS		Special Code: AF		MSG Code: LUR, 9, MRB		Request: JOB-SETUP,OPS/LK,OPS/LK,OPS/LK,JOB-CLOS Phase: EUP	
I HEREBY CERTIFY THAT ALL WARNINGS AND CAUTIONS HAVE BEEN READ AND THE WORK HAS BEEN CARRID OUT IN ACCORDING WITH ALL LAID DOWN PROCEDURES, ATTACHED NOTES AND INFORMATION.							
Zones: 191							
DOCUMENT REFERENCES:							
Doc Typ		Reference					
AMM		47-10-41-920-001-A					
ACCESS PANELS:							
191BB							
MATERIAL REQUIREMENTS:							
Part Number		Description				Qty.	
2050118-102		FILTER ASSY				1.0	
2050118-201		FILTER ELEMENT USE PN KIT2050118-301				1.0	
M25988-1-127		PACKING ... FOR MRS NO 4700001				1.0	
M25988-1-153		PACKING EC 3 MBTR 400				1.0	
MILPRF27617		LUBRICANT-OXYGEN S/L INDEF**HAZ.MAT.				1.0	
CA-1000		JOINTING COMPOUND SEALANT				1.0	
TOOLING REQUIREMENTS:							
Part Number		Description				Qty.	
No tools assigned to this Task Item							
TASK PREPARATION							
Job Description							
A. PREPARE FOR D-ULPA FILTER ELEMENT REPLACEMENT AS PER AMM TASK 47-10-41-920-001-A.							
STEP COMPLETION SIGN OFF:							
		Qualification / Skill	Number of employees	Duration	Number./Signature	Date	
						Day	Month
Mechanic/s		AF/ACFT_TECH		HRS			
Insp.				HRS			
TASK PREPARATION							
Job Description							
B. REMOVE THE D-ULPA FILTER ELEMENT AS PER AMM TASK 47-10-41-920-001-A.							
STEP COMPLETION SIGN OFF:							



Task Card Title:

D-ULPA FILTER ELEMENT REPLACEMENT

Task Card NO:

470000-01-1

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

	Qualification / Skill	Number of employees	Duration		Number./Signature	Date		
						Day	Month	Year
Mechanic/s	AF/ACFT_TECH			HRS				
Insp.				HRS				

TASK INSTRUCTIONS**Job Description**

C. INSTALL THE D-ULPA FILTER ELEMENT AS AMM TASK 47-10-41-920-001-A.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration		Number./Signature	Date		
						Day	Month	Year
Mechanic/s	AF/ACFT_TECH			HRS				
Insp.	INSP/RII			HRS				

TASK INSTRUCTIONS**Job Description**

D. PERFORM A LEAK CHECK OF THE D-ULPA FILTER ASSEMBLY AS PER AMM TASK 47-10-41-920-001-A.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration		Number./Signature	Date		
						Day	Month	Year
Mechanic/s	AF/ACFT_TECH			HRS				
Insp.	INSP/RII			HRS				

TASK INSTRUCTIONS**Job Description**

E. RETURN THE AIRCRAFT TO ITS NORMAL CONFIGURATION AS PER AMM TASK 47-10-41-920-001-A.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration		Number./Signature	Date		
						Day	Month	Year
Mechanic/s	AF/ACFT_TECH			HRS				
Insp.				HRS				

-Aircraft Maintenance Manual used: Revision No. _____ Dated. _____.

Task card finding (Tick Applicable Box) [] Yes [] No. If yes update the system and list Task card finding WO below

Work order No: _____

Note: Make sure to creat the finding Work Order on task card level.

Remark's: _____



MET.25416078

Task Card Title:

D-ULPA FILTER ELEMENT REPLACEMENT

Task Card NO:

470000-01-1

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

(1) If Task card interrupted or performed by different personals updates the system and update the following accordingly (Tick Applicable Box)

- Interruption No. 1 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 2 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 3 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 4 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 5 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____

(2) Record any dimension or torque through the performed steps and sign-off as applicable:

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____

**Task Completion Close Up And
System Update**

Station**Date****Signature**

 MET.32721977		Task Card Title: DISCARD FUEL INLET FILTER ELEMENT					
Task Card NO: 493000-B1-1		Work Package: ASP/H-26 C7-CHK		A/C Registration: HZ-ASP			
A/C Type: 321		Block Taskcard		Main Skill: INSP,RII,ACFT_TECH,AP		PROD Final Acceptance:	
Project No: 01BASPC72608		Related Task Card:		A/C Area:			
Internal Check:		Check Type:		Work Order NO:		Tally Sequence NO: 370	
ENCLOSURE: ☐ CMR: ☐ CPCP: ☐ ETOPS: ☐ CDCCL: ☐ AD: ☐ ALI: ☐							
Type Code: DIS		Special Code: INSP		MSG Code: LUR, 9, MRB		Request: Phase:	
I HEREBY CERTIFY THAT ALL WARNINGS AND CAUTIONS HAVE BEEN READ AND THE WORK HAS BEEN CARRID OUT IN ACCORDING WITH ALL LAID DOWN PROCEDURES, ATTACHED NOTES AND INFORMATION.							
Zones: 315							
DOCUMENT REFERENCES:							
Doc Typ		Reference					
AMM		49-32-41-920-001-A					
AMM		493241-920-001					
ACCESS PANELS:							
315AL, 316AR							
MATERIAL REQUIREMENTS:							
Part Number		Description				Qty.	
MIL-PRF-23699		SYNTHETIC BASE LUBRICATING OIL ENG				1.0	
MIL-PRF-7808		SYNTHETIC BASE LUBRICATING OIL ENG				1.0	
MIL-PRF-7808		SYNTHETIC BASE LUBRICATING OIL ENG				1.0	
2685336		FUEL-FILTER				1.0	
TOOLING REQUIREMENTS:							
Part Number		Description				Qty.	
98L12003001000		HARNESS, SAFETY (TOOL/HZ-HMS)				1.0	
Job Description							
1. JOB SET-UP:							
A. PERFORM A JOB SET UP FOR REPLACEMENT OF THE FUEL FILTER (131-9(A)) PER AMM TASK 49-32-41-920-001-A.							
STEP COMPLETION SIGN OFF:							
Qualification / Skill		Number of employees		Duration		Number./Signature	
Date							
Day Month Year							
Mechanic/s		ACFT_TECH/AP		HRS			
Insp.				HRS			
Job Description							
2. INSPECTION:							

 MET.32721977	Task Card Title: DISCARD FUEL INLET FILTER ELEMENT						
Task Card NO: 493000-B1-1	Work Package: ASP/H-26 C7-CHK	A/C Registration: HZ-ASP					
A. PERFORM REPLACEMENT OF THE FUEL FILTER (131-9(A)) PER AMM TASK 49-32-41-920-001-A.							
STEP COMPLETION SIGN OFF:							
	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year
Mechanic/s	ACFT_TECH			HRS			
Insp.	INSP/RII/AP			HRS			
Job Description							
3. CLOSE UP:							
A. PERFORM AIRCRAFT CLOSE UP AND PUT THE AIRCRAFT BACK TO ITS INITIAL CONFIGURATION PER AMM TASK 49-32-41-920-001-A.							
STEP COMPLETION SIGN OFF:							
	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year
Mechanic/s	ACFT_TECH/AP			HRS			
Insp.				HRS			
-Aircraft Maintenance Manual used: Revision No. _____ Dated. _____.							
Task card finding (Tick Applicable Box) [] Yes [] No. If yes update the system and list Task card finding WO below							
Work order No: _____							
Note: Make sure to create the finding Work Order on task card level.							
Remark's: _____							



MET.32721977

Task Card Title:

DISCARD FUEL INLET FILTER ELEMENT

Task Card NO:

493000-B1-1

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

(1) If Task card interrupted or performed by different personals updates the system and update the following accord (Tick Applicable Box)

- Interruption No. 1 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 2 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 3 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 4 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 5 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____

(2) Record any dimension or torque through the performed steps and sign-off as applicable:

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____

**Task Completion Close Up And
System Update**

Station**Date****Signature**

 MET.32721988		Task Card Title: FWD AND AFT PASS/CREW DOOR HINGE LUB					
Task Card NO: 521000-14-1		Work Package: ASP/H-26 C7-CHK		A/C Registration: HZ-ASP			
A/C Type: 321		Block Taskcard		Main Skill: CAB,ACFT_TECH		PROD Final Acceptance:	
Project No: 01BASPC72608		Related Task Card:		A/C Area: 05			
Internal Check:		Check Type:		Work Order NO:		Tally Sequence NO: 371	
ENCLOSURE: ☐ CMR: ☐ CPCP: ☐ ETOPS: ☐ CDCCL: ☐ AD: ☐ ALI: ☐							
Type Code: LUB		Special Code: CAB		MSG Code: MRB, 9		Request: 	
Phase: TC/P							
I HEREBY CERTIFY THAT ALL WARNINGS AND CAUTIONS HAVE BEEN READ AND THE WORK HAS BEEN CARRIED OUT IN ACCORDING WITH ALL LAID DOWN PROCEDURES, ATTACHED NOTES AND INFORMATION.							
Zones: 831,832,841,842							
DOCUMENT REFERENCES:							
Doc Typ		Reference					
AMM		12-22-52-640-016-A					
ACCESS PANELS:							
MATERIAL REQUIREMENTS:							
Part Number		Description				Qty.	
A-A-59173		MEDIUM GREASE MOLYKOTE33M				0.0	
MIL-PRF-23827		GRASE ROYCO27 S/L2Y (IF SD USE ASG7P				0.0	
TOOLING REQUIREMENTS:							
Part Number		Description				Qty.	
No tools assigned to this Task Item							
TASK INSTRUCTION							
Job Description							
A. LUBRICATE THE HINGE ARM SUPPORT FITTING BEARINGS AT THE FOLLOWING DOORS PER AMM TASK 12-22-52-640-016-A: (1) FWD L/H PASSENGER/CREW DOOR. (2) FWD R/H PASSENGER/CREW DOOR. (3) AFT L/H PASSENGER/CREW DOOR. (4) AFT R/H PASSENGER/CREW DOOR.							
STEP COMPLETION SIGN OFF:							
		Qualification / Skill		Number of employees		Duration	
						Number./Signature	
Mechanic/s		CAB/ACFT_TECH					
Insp.							



Task Card Title:

FWD AND AFT PASS/CREW DOOR HINGE LUB

Task Card NO:

521000-14-1

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

-Aircraft Maintenance Manual used: Revision No. _____ Dated. _____.

Task card finding (Tick Applicable Box) [] Yes [] No. If yes update the system and list Task card finding WO below

Work order No: _____

Note: Make sure to creat the finding Work Order on task card level.

Remark's: _____

(1) If Task card interrupted or performed by different personals updates the system and update the following accord (Tick Applicable Box)

- Interruption No. 1 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

- Interruption No. 2 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

- Interruption No. 3 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

- Interruption No. 4 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

- Interruption No. 5 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

(2) Record any dimension or torque through the performed steps and sign-off as applicable:

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

**Task Completion Close Up And
System Update****Station****Date****Signature**

 MET.32721980		Task Card Title: FWD AND AFT PASS/CREW DOOR EXT LUB					
Task Card NO: 521121-01-1		Work Package: ASP/H-26 C7-CHK		A/C Registration: HZ-ASP			
A/C Type: 321		Block Taskcard		Main Skill: CAB,ACFT_TECH		PROD Final Acceptance:	
Project No: 01BASPC72608		Related Task Card:		A/C Area: 09			
Internal Check:		Check Type:		Work Order NO:		Tally Sequence NO: 372	
ENCLOSURE: ☐ CMR: ☐ CPCP: ☐ ETOPS: ☐ CDCCL: ☐ AD: ☐ ALI: ☐							
Type Code: LUB		Special Code: CAB		MSG Code: 6, MRB		Request: 	
Phase: TC/P							
I HEREBY CERTIFY THAT ALL WARNINGS AND CAUTIONS HAVE BEEN READ AND THE WORK HAS BEEN CARRIED OUT IN ACCORDING WITH ALL LAID DOWN PROCEDURES, ATTACHED NOTES AND INFORMATION.							
Zones: 831,832,841,842							
DOCUMENT REFERENCES:							
Doc Typ		Reference					
AMM		12-22-52-640-006-A					
ACCESS PANELS:							
MATERIAL REQUIREMENTS:							
Part Number		Description				Qty.	
A-A-59173		MEDIUM GREASE MOLYKOTE33M				1.0	
MIL-PRF-23827		GRASE ROYCO27 S/L2Y (IF SD USE ASG7P				1.0	
TOOLING REQUIREMENTS:							
Part Number		Description				Qty.	
No tools assigned to this Task Item							
TASK INSTRUCTION							
Job Description							
A. LUBRICATE THE EXTERIOR CONTROL HANDLE AND TELESCOPIC ARM AT THE FOLLOWING DOORS PER AMM TASK 12-22-52-640-006-A: (1) FWD L/H PASSENGER/CREW DOOR. (2) FWD R/H PASSENGER/CREW DOOR. (3) AFT L/H PASSENGER/CREW DOOR. (4) AFT R/H PASSENGER/CREW DOOR.							
STEP COMPLETION SIGN OFF:							
		Qualification / Skill		Number of employees		Duration	
						Number./Signature	
						Date	
						Day Month Year	
Mechanic/s		CAB/ACFT_TECH				HRS	
Insp.						HRS	



Task Card Title:

FWD AND AFT PASS/CREW DOOR EXT LUB

Task Card NO:

521121-01-1

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

-Aircraft Maintenance Manual used: Revision No. _____ Dated. _____.

Task card finding (Tick Applicable Box) [] Yes [] No. If yes update the system and list Task card finding WO below

Work order No: _____

Note: Make sure to create the finding Work Order on task card level.

Remark's: _____

(1) If Task card interrupted or performed by different persons updates the system and update the following accordingly (Tick Applicable Box)

- Interruption No. 1 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

- Interruption No. 2 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

- Interruption No. 3 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

- Interruption No. 4 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

- Interruption No. 5 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

(2) Record any dimension or torque through the performed steps and sign-off as applicable:

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

**Task Completion Close Up And
System Update****Station****Date****Signature**

 MET.28377189		Task Card Title: EMERG EXIT DOOR EXT CNTRL HNDL LUBR					
Task Card NO: 522200-03-1		Work Package: ASP/H-26 C7-CHK		A/C Registration: HZ-ASP			
A/C Type: 321		Block Taskcard		Main Skill: CAB,ACFT_TECH		PROD Final Acceptance:	
Project No: 01BASPC72608		Related Task Card:		A/C Area: 09			
Internal Check:		Check Type:		Work Order NO:		Tally Sequence NO: 373	
ENCLOSURE: ☐ CMR: ☐ CPCP: ☐ ETOPS: ☐ CDCCL: ☐ AD: ☐ ALI: ☐							
Type Code: LUB		Special Code: CAB		MSG Code: MRB, 8		Request: Phase: TC/P	
I HEREBY CERTIFY THAT ALL WARNINGS AND CAUTIONS HAVE BEEN READ AND THE WORK HAS BEEN CARRIED OUT IN ACCORDING WITH ALL LAID DOWN PROCEDURES, ATTACHED NOTES AND INFORMATION.							
Zones: 833,834,843,844							
DOCUMENT REFERENCES:							
Doc Typ		Reference					
AMM		12-22-52-640-013-A					
AMM		122252-640-013					
MRB		52.22.00/03					
ACCESS PANELS:							
MATERIAL REQUIREMENTS:							
Part Number		Description				Qty.	
A-A-59173		MEDIUM GREASE MOLYKOTE33M				0.0	
MIL-PRF-23827		GRASE ROYCO27 S/L2Y (IF SD USE ASG7P				0.0	
WD40		SPRAY				1.0	
TOOLING REQUIREMENTS:							
Part Number		Description				Qty.	
No tools assigned to this Task Item							
TASK INSTRUCTION							
Job Description							
A. LUBRICATE THE EXTERNAL CONTROL HANDLE AND THE TELESCOPIC ARM FOR THE FOLLOWING DOORS AS PER AMM TASK 12-22-52-640-013-A: (1) FWD L/H EMERGENCY EXIT DOOR. (2) FWD R/H EMERGENCY EXIT DOOR. (3) AFT L/H EMERGENCY EXIT DOOR. (4) AFT R/H EMERGENCY EXIT DOOR.							
STEP COMPLETION SIGN OFF:							
Qualification / Skill		Number of employees		Duration		Number./Signature	
Date		Day		Month		Year	
Mechanic/s		CAB/ACFT_TECH		HRS			



Task Card Title:

EMERG EXIT DOOR EXT CNTRL HNDL LUBR

Task Card NO:

522200-03-1

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

Insp.

HRS

- Aircraft Maintenance Manual used: Revision No. _____ Dated. _____.

Task card finding (Tick Applicable Box) [] Yes [] No. If yes update the system and list Task card finding WO below

Work order No: _____

Note: Make sure to creat the finding Work Order on task card level.

Remark's: _____

(1) If Task card interrupted or performed by different personals updates the system and update the following accord (Tick Applicable Box)

- Interruption No. 1 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 2 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 3 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 4 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 5 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____

(2) Record any dimension or torque through the performed steps and sign-off as applicable:

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____

**Task Completion Close Up And
System Update**

Station

Date

Signature

 MET.32721975		Task Card Title: BULK CARGO DOOR HANDLE AND HINGE LUB					
Task Card NO: 523300-01-1		Work Package: ASP/H-26 C7-CHK			A/C Registration: HZ-ASP		
A/C Type: 321		Block Taskcard		Main Skill: AF,ACFT_TECH		PROD Final Acceptance:	
Project No: 01BASPC72608		Related Task Card:		A/C Area: 09			
Internal Check:		Check Type:		Work Order NO:		Tally Sequence NO: 374	
ENCLOSURE: ☐ CMR: ☐ CPCP: ☐ ETOPS: ☐ CDCCL: ☐ AD: ☐ ALI: ☐							
Type Code: LUB		Special Code: AF		MSG Code: MRB, 6, 9		Request: 	
Phase: TC/P							
I HEREBY CERTIFY THAT ALL WARNINGS AND CAUTIONS HAVE BEEN READ AND THE WORK HAS BEEN CARRID OUT IN ACCORDING WITH ALL LAID DOWN PROCEDURES, ATTACHED NOTES AND INFORMATION.							
Zones: 827							
DOCUMENT REFERENCES:							
Doc Typ		Reference					
AMM		12-22-52-640-007-A					
AMM		122252-640-007					
MRB		52.33.00/01					
ACCESS PANELS:							
MATERIAL REQUIREMENTS:							
Part Number		Description					Qty.
MIL-PRF-23827		GRASE ROYCO27 S/L2Y (IF SD USE ASG7P					1.0
VVL800		LUBRICATING OIL **HAZ.MAT.** S/L 2YR					1.0
TOOLING REQUIREMENTS:							
Part Number		Description					Qty.
No tools assigned to this Task Item							
TASK INSTRUCTION							
Job Description							
A. LUBRICATE THE CARGO DOOR HANDLE AND HINGE BEARING PER AMM TASK 12-22-52-640-007-A.							
STEP COMPLETION SIGN OFF:							
	Qualification / Skill	Number of employees	Duration		Number./Signature	Date	
				HRS		Day	Month
Mechanic/s	AF/ACFT_TECH			HRS			
Insp.				HRS			



Task Card Title:

BULK CARGO DOOR HANDLE AND HINGE LUB

Task Card NO:

523300-01-1

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

-Aircraft Maintenance Manual used: Revision No. _____ Dated. _____.

Task card finding (Tick Applicable Box) [] Yes [] No. If yes update the system and list Task card finding WO below

Work order No: _____

Note: Make sure to create the finding Work Order on task card level.

Remark's: _____

(1) If Task card interrupted or performed by different persons updates the system and update the following accordingly (Tick Applicable Box)

- Interruption No. 1 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

- Interruption No. 2 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

- Interruption No. 3 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

- Interruption No. 4 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

- Interruption No. 5 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

(2) Record any dimension or torque through the performed steps and sign-off as applicable:

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

**Task Completion Close Up And
System Update****Station****Date****Signature**

 MET.32722072		Task Card Title: SKIN AROUND ADF1 ANTENNA CUTOUT INSP						
Task Card NO: 533131-01-1		Work Package: ASP/H-26 C7-CHK		A/C Registration: HZ-ASP				
A/C Type: 321		Block Taskcard		Main Skill: INSP,II,RIL,AV,ACFT_TECH		PROD Final Acceptance:		
Project No: 01BASPC72608		Related Task Card:		A/C Area: 09				
Internal Check:		Check Type:		Work Order NO:		Tally Sequence NO: 375		
ENCLOSURE: ☒ CMR: ☐ CPCP: ☒ ETOPS: ☐ CDCCL: ☐ AD: ☐ ALI: ☐								
Type Code: GVI		Special Code: INSP		MSG Code: MRB, CPCP		Request: ON, JOB-CLOSEUP, JOB-CLOSEUP, JOB-CLOSEUP Phase: P		
I HEREBY CERTIFY THAT ALL WARNINGS AND CAUTIONS HAVE BEEN READ AND THE WORK HAS BEEN CARRIED OUT IN ACCORDING WITH ALL LAID DOWN PROCEDURES, ATTACHED NOTES AND INFORMATION.								
Zones: 200								
DOCUMENT REFERENCES:								
Doc Typ		Reference						
AMM		34-53-11-000-001-A						
AMM		53-31-00-210-011-A						
AMM		34-53-11-400-001-A						
ACCESS PANELS:								
MATERIAL REQUIREMENTS:								
Part Number		Description				Qty.		
14SBA1		TEXTILE - LINT FREE COTTON AMS3819				1.0		
08BAA9		NON AQUEOUS CLEANER - GENERAL				1.0		
12ABB1		CORROSION PREVENTIVE, USE PN: AV 8				1.0		
12ABB1		CORROSION PREVENTIVE, USE PN: AV 8				1.0		
12ACB1		CORROSION PREVENTIVE DUTY HARD FILM				1.0		
12ACC1		CORROSION PREVENTIVE DUTY SOFT FILM				1.0		
TOOLING REQUIREMENTS:								
Part Number		Description				Qty.		
98L12003001000		HARNESS, SAFETY (TOOL/HZ-HMS)				1.0		
PREPARATION								
Job Description								
A. PERFORM JOB SET UP FOR GENERAL VISUAL INSPECTION OF SKIN AROUND ADF 1 ANTENNA CUTOUT, BETWEEN FR 44 AND FR 45 AND BETWEEN STRINGER 1, LH/RH, EXTERNAL SURFACE AS PER AMM TASK 53-31-00-210-011-A AND REMOVE THE ADF1 ANTENNA 3RP1 (REF. AMM TASK 34-53-11-000-001-A).								
STEP COMPLETION SIGN OFF:								
	Qualification / Skill	Number of employees	Duration		Number./Signature	Date		
						Day	Month	Year
Mechanic/s	AV/ACFT_TECH		HRS					



Task Card Title:

SKIN AROUND ADF1 ANTENNA CUTOUT INSP

Task Card NO:

533131-01-1

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

Insp.

HRS

PREPARATION**Job Description**

B. CLEAN THE INSPECTION AREA AS REQUIREDAS PER AMM 53-31-00-210-011-A.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year
Mechanic/s	AV/ACFT_TECH		HRS				
Insp.			HRS				

TASK INSTRUCTION**Job Description**

A. PERFORM A GENERAL VISUAL INSPECTION OF SKIN AROUND ADF 1 ANTENNA CUTOUT, BETWEEN FR 44 AND FR 45 AND BETWEEN STRINGER 1, LH/RH, EXTERNAL SURFACE AS PER AMM TASK 53-31-00-210-011-A.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year
Mechanic/s			HRS				
Insp.	INSP/II		HRS				

TASK INSTRUCTION**Job Description**

B. CHECK AND APPLY THE TPS LAYER AS PER AMM 53-31-00-210-011-A.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year
Mechanic/s	AV/ACFT_TECH		HRS				
Insp.			HRS				

CLOSE UP**Job Description**

A. OK TO INSTALL THE ADF-1 ANTENNA 3RP1 AS PER AMM 53-31-00-210-011-A.

STEP COMPLETION SIGN OFF:



Task Card Title:

SKIN AROUND ADF1 ANTENNA CUTOUT INSP

Task Card NO:

533131-01-1

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

	Qualification / Skill	Number of employees	Duration		Number./Signature	Date		
						Day	Month	Year
Mechanic/s				HRS				
Insp.	INSP/II			HRS				

CLOSE UP**Job Description**

B. INSTALL THE ADF-1 ANTENNA 3RP1 (REF. AMM TASK 34-53-11-400-001-A).

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration		Number./Signature	Date		
						Day	Month	Year
Mechanic/s	AV/ACFT_TECH			HRS				
Insp.	INSP/RII			HRS				

CLOSE UP**Job Description**

C. PERFORM JOB-CLOSEUP AND RETURN AIRCRAFT BACK TO NORMAL AS PER AMM 53-31-00-210-011-A.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration		Number./Signature	Date		
						Day	Month	Year
Mechanic/s	AV/ACFT_TECH			HRS				
Insp.				HRS				

-Aircraft Maintenance Manual used: Revision No. _____ Dated. _____.

Task card finding (Tick Applicable Box) [] Yes [] No. If yes update the system and list Task card finding WO below

Work order No: _____

Note: Make sure to create the finding Work Order on task card level.

Remark's: _____



Task Card Title:

SKIN AROUND ADF1 ANTENNA CUTOUT INSP

Task Card NO:

533131-01-1

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

(1) If Task card interrupted or performed by different personals updates the system and update the following according (Tick Applicable Box)

- Interruption No. 1 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 2 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 3 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 4 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 5 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____

(2) Record any dimension or torque through the performed steps and sign-off as applicable:

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____

**Task Completion Close Up And
System Update**

Station**Date****Signature**

 MET.25383779		Task Card Title: WATER SERVICE PANEL CUTOUT INSP							
Task Card NO: 534141-01-5		Work Package: ASP/H-26 C7-CHK		A/C Registration: HZ-ASP					
A/C Type: 321		Block Taskcard		Main Skill: INSP,IL,AF,ACFT_TECH		PROD Final Acceptance:			
Project No: 01BASPC72608		Related Task Card:		A/C Area: 09					
Internal Check:		Check Type:		Work Order NO:		Tally Sequence NO: 376			
ENCLOSURE: ☒ CMR: ☐ CPCP: ☐ ETOPS: ☐ CDCCL: ☐ AD: ☐ ALI: ☒									
Type Code: DET		Special Code: INSP		MSG Code: ALI		Request: CLEAN UP, INSPECTION			
I HEREBY CERTIFY THAT ALL WARNINGS AND CAUTIONS HAVE BEEN READ AND THE WORK HAS BEEN CARRIED OUT IN ACCORDING WITH ALL LAID DOWN PROCEDURES, ATTACHED NOTES AND INFORMATION.									
Zones: 100									
DOCUMENT REFERENCES:									
Doc Typ		Reference							
ALI		534141-01-5							
AMM		53-41-00-210-816-A							
AMM		534100-210-816							
ACCESS PANELS:									
MATERIAL REQUIREMENTS:									
Part Number		Description				Qty.			
MILT81533		SOLVENT DEGREASER.				1.0			
TOOLING REQUIREMENTS:									
Part Number		Description				Qty.			
No tools assigned to this Task Item									
PREPARATION									
Job Description									
A. CLEAN THE INSPECTION AREA AS REQUIRED.									
STEP COMPLETION SIGN OFF:									
		Qualification / Skill	Number of employees	Duration		Number./Signature	Date		
							Day	Month	Year
Mechanic/s		AF/ACFT_TECH		HRS					
Insp.				HRS					
TASK INSTRUCTION									
Job Description									
A. PERFORM A DETAILED INSPECTION OF FUSELAGE SKIN AROUND WATER SERVICE PANEL CUTOUT BETWEEN FR 65									



Task Card Title:

WATER SERVICE PANEL CUTOUT INSP



Task Card NO:

534141-01-5

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

AND FR 66 AND FROM STGR 37 TO STGR 43, EXTERNAL SURFACE AS PER AMM TASK 53-41-00-210-816-A.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration	HRS	Number./Signature	Date		
						Day	Month	Year
Mechanic/s				HRS				
Insp.	INSP/II			HRS				

-Aircraft Maintenance Manual used: Revision No. _____ Dated. _____.

Task card finding (Tick Applicable Box) [] Yes [] No. If yes update the system and list Task card finding WO below

Work order No: _____

Note: Make sure to creat the finding Work Order on task card level.

Remark's: _____

(1) If Task card interrupted or performed by different personals updates the system and update the following accord (Tick Applicable Box)

- Interruption No. 1 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

- Interruption No. 2 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

- Interruption No. 3 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

- Interruption No. 4 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

- Interruption No. 5 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

(2) Record any dimension or torque through the performed steps and sign-off as applicable:

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

Task Completion Close Up And
System Update

Station

Date

Signature

 MET.28342346		Task Card Title: BULK CARGO COMPARTMENT							
Task Card NO: ZL-161-02-3		Work Package: ASP/H-26 C7-CHK		A/C Registration: HZ-ASP					
A/C Type: 321		Block Taskcard		Main Skill: IL,INSP,ACFT_TECH,AP		PROD Final Acceptance:			
Project No: 01BASPC72608		Related Task Card:		A/C Area:					
Internal Check:		Check Type:		Work Order NO:		Tally Sequence NO: 377			
ENCLOSURE: ☐ CMR: ☐ CPCP: ☐ ETOPS: ☐ CDCCL: ☐ AD: ☐ ALI: ☐									
Type Code: GVI		Special Code:		MSG Code: EWIS		Request: JOB-SETUP,CLEAN-UP,INSPECTION,JOB-CLOSURE EUP			
I HEREBY CERTIFY THAT ALL WARNINGS AND CAUTIONS HAVE BEEN READ AND THE WORK HAS BEEN CARRIED OUT IN ACCORDING WITH ALL LAID DOWN PROCEDURES, ATTACHED NOTES AND INFORMATION.									
Zones: 161,162									
DOCUMENT REFERENCES:									
Doc Typ		Reference							
AMM		05-21-60-200-003-A							
AMTOSS		052160-200-003							
ZIP		ZL-161-02-3							
ACCESS PANELS:									
161AC, 161AW, 161BC, 161BW, 161CW, 162BW, 162CW, 162EW, 826, 827									
MATERIAL REQUIREMENTS:									
Part Number		Description				Qty.			
14SBA1		TEXTILE - LINT FREE COTTON AMS3819				1.0			
08BAA9		NON AQUEOUS CLEANER - GENERAL				1.0			
TOOLING REQUIREMENTS:									
Part Number		Description				Qty.			
No tools assigned to this Task Item									
TASK PREPARATION									
Job Description									
A. PERFORM JOB SETUP FOR GENERAL VISUAL INSPECTION OF BULK CARGO COMPARTMENT (EWIS). AS PER AMM TASK 05-21-60-200-003-A.									
STEP COMPLETION SIGN OFF:									
		Qualification / Skill	Number of employees	Duration		Number./Signature	Date		
							Day	Month	Year
Mechanic/s		ACFT_TECH/AP		HRS					
Insp.				HRS					
TASK PREPARATION									
Job Description									



MET.28342346

Task Card Title:

BULK CARGO COMPARTMENT

Task Card NO:

ZL-161-02-3

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

B. CLEAN THE INSPECTION AREA AS REQUIRED AS PER AMM 05-21-60-200-003-A.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year
Mechanic/s	ACFT_TECH/AP		HRS				
Insp.			HRS				

TASK INSTRUCTIONS**Job Description**

C. PERFORM A GENERAL VISUAL INSPECTION OF BULK CARGO COMPARTMENT (EWIS). AS PER AMM TASK 05-21-60-200-003-A.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year
Mechanic/s			HRS				
Insp.	II/INSP		HRS				

TASK CLOSE UP**Job Description**

D. PERFORM CLOSE-UP AND RETURN THE AIRCRAFT BACK TO NORMAL CONFIGURATION AS PER AMM TASK 05-21-60-200-003-A .

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year
Mechanic/s	ACFT_TECH/AP		HRS				
Insp.			HRS				

-Aircraft Maintenance Manual used: Revision No. _____ Dated._____.

Task card finding (Tick Applicable Box) [] Yes [] No. If yes update the system and list Task card finding WO below

Work order No: _____

Note: Make sure to create the finding Work Order on task card level.

Remark's: _____



Task Card Title:

BULK CARGO COMPARTMENT

Task Card NO:

ZL-161-02-3

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

(1) If Task card interrupted or performed by different personals updates the system and update the following according (Tick Applicable Box)

- Interruption No. 1 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 2 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 3 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 4 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 5 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____

(2) Record any dimension or torque through the performed steps and sign-off as applicable:

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____

**Task Completion Close Up And
System Update**

Station**Date****Signature**

 MET.32721976		Task Card Title: AIR CONDITION COMPARTMENT ZONAL INSP				
Task Card NO: ZL-191-01-2		Work Package: ASP/H-26 C7-CHK		A/C Registration: HZ-ASP		
A/C Type: 321		Block Taskcard		Main Skill: INSP,II		
Project No: 01BASPC72608		Related Task Card:		A/C Area: 09		
Internal Check:		Check Type:		Work Order NO:		
				Tally Sequence NO: 378		
ENCLOSURE: ☐ CMR: ☐ CPCP: ☐ ETOPS: ☐ CDCCL: ☐ AD: ☐ ALI: ☐						
Type Code: GVI		Special Code: INSP		MSG Code: MRB		
				Request:		
				Phase: PRE INSP		
I HEREBY CERTIFY THAT ALL WARNINGS AND CAUTIONS HAVE BEEN READ AND THE WORK HAS BEEN CARRIED OUT IN ACCORDING WITH ALL LAID DOWN PROCEDURES, ATTACHED NOTES AND INFORMATION.						
Zones: 191,192						
DOCUMENT REFERENCES:						
Doc Typ		Reference				
AMM		05-21-90-200-001-A				
AMM		05-21-90-200-001-A (Rev. 55)				
AMM		052190-200-001				
ACCESS PANELS:						
191AB, 191BB, 191KB, 192KB						
MATERIAL REQUIREMENTS:						
Part Number		Description			Qty.	
No parts assigned to this Task Item						
TOOLING REQUIREMENTS:						
Part Number		Description			Qty.	
No tools assigned to this Task Item						
Job Description						
NOTE: THE INSPECTION MUST BE PERFORMED FROM WITHIN A TOUCHING DISTANCE (UNLESS OTHERWISE STATED), USING VISUAL INSPECTION AIDS I.E. INSPECTION MIRROR, SPOT LIGHT ETC., AS REQUIRED, WITH ALL IDENTIFIED ACCESS PANELS OPEN. THE PURPOSE OF THE INSPECTION IS TO DETERMINE THE GENERAL CONDITION AND SECURITY OF VISIBLE SYSTEM INSTALLATIONS/COMPONENTS/STRUCTURE CONTAINED IN THE ZONE INCLUDING CHECKING FOR EVIDENCE OF DEGRADATION, CHAFING OF TUBING, LOOSE DUCT SUPPORT, WIRING DAMAGE, CABLE AND PULLEY WEAR, FLUID LEAKS, INADEQUATE DRAINAGE AND OTHER CONDITIONS THAT COULD LEAD TO CORROSION / DAMAGE AND GENERAL CONDITION OF THE ACCESS PANELS/FAIRINGS REMOVED. A. PERFORM ZONAL GENERAL VISUAL INSPECTION OF THE AIR CONDITIONING COMPARTMENT AND FAIRINGS PER AMM TASK 05-21-90-200-001-A.						
STEP COMPLETION SIGN OFF:						



Task Card Title:

AIR CONDITION COMPARTMENT ZONAL INSP

Task Card NO:

ZL-191-01-2

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

	Qualification / Skill	Number of employees	Duration		Number./Signature	Date		
						Day	Month	Year
Mechanic/s				HRS				
Insp.	INSP/II			HRS				

-Aircraft Maintenance Manual used: Revision No. _____ Dated. _____.

Task card finding (Tick Applicable Box) [] Yes [] No. If yes update the system and list Task card finding WO below

Work order No: _____

Note: Make sure to creat the finding Work Order on task card level.

Remark's: _____

(1) If Task card interrupted or performed by different personals updates the system and update the following accord (Tick Applicable Box)

- Interruption No. 1 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

- Interruption No. 2 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

- Interruption No. 3 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

- Interruption No. 4 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

- Interruption No. 5 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

(2) Record any dimension or torque through the performed steps and sign-off as applicable:

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

**Task Completion Close Up And
System Update****Station****Date****Signature**

 MET.28342345		Task Card Title: UPPER WING FAIRING SLIDE STOWAGE					
Task Card NO: ZL-193-02-1		Work Package: ASP/H-26 C7-CHK		A/C Registration: HZ-ASP			
A/C Type: 321		Block Taskcard		Main Skill: IL,INSP,ACFT_TECH,AP		PROD Final Acceptance:	
Project No: 01BASPC72608		Related Task Card:		A/C Area:			
Internal Check:		Check Type:		Work Order NO:		Tally Sequence NO: 379	
ENCLOSURE: ☐ CMR: ☐ CPCP: ☐ ETOPS: ☐ CDCCL: ☐ AD: ☐ ALI: ☐							
Type Code: GVI		Special Code:		MSG Code: EWIS		Request: INSPECTION, INSPECTION, JOB-CLOSEUP, JOB-CLOSEUP	
I HEREBY CERTIFY THAT ALL WARNINGS AND CAUTIONS HAVE BEEN READ AND THE WORK HAS BEEN CARRIED OUT IN ACCORDING WITH ALL LAID DOWN PROCEDURES, ATTACHED NOTES AND INFORMATION.							
Zones: 193,194							
DOCUMENT REFERENCES:							
Doc Typ		Reference					
AMM		05-21-90-200-010-A					
AMTOSS		052190-200-010					
ZIP		ZL-193-02-1					
ACCESS PANELS:							
193AT, 194AT							
MATERIAL REQUIREMENTS:							
Part Number		Description				Qty.	
14SBA1		TEXTILE - LINT FREE COTTON AMS3819				1.0	
08BAA9		NON AQUEOUS CLEANER - GENERAL				1.0	
12ABC1		CORROSION PREVENTIVE SOFT FILM				1.0	
TOOLING REQUIREMENTS:							
Part Number		Description				Qty.	
No tools assigned to this Task Item							
TASK PREPARATION							
Job Description							
A. PERFORM JOB SETUP FOR A GENERAL VISUAL INSPECTION OF UPPER WING FAIRING (EWIS) AS PER AMM TASK 05-21-90-200-010-A.							
STEP COMPLETION SIGN OFF:							
Qualification / Skill		Number of employees		Duration		Number./Signature	
Date							
Day Month Year							
Mechanic/s		ACFT_TECH/AP		HRS			
Insp.				HRS			
TASK PREPARATION							
Job Description							



MET.28342345

Task Card Title:

UPPER WING FAIRING SLIDE STOWAGE



Task Card NO:

ZL-193-02-1

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

B. CLEAN THE INSPECTION AREA AS REQUIRED AS PER AMM 05-21-90-200-010-A.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year
Mechanic/s	ACFT_TECH/AP		HRS				
Insp.			HRS				

TASK INSTRUCTIONS

Job Description

C. PERFORM A GENERAL VISUAL INSPECTION OF UPPER WING FAIRING (EWIS) AS PER AMM TASK 05-21-90-200-010-A.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year
Mechanic/s			HRS				
Insp.	II/INSP		HRS				

TASK CLOSE UP

Job Description

D. OK TO INSTALL THE WING-TO-FUSELAGE FAIRINGS (REF. AMM TASK 05-21-90-200-010-A).

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year
Mechanic/s			HRS				
Insp.	II/INSP		HRS				

TASK CLOSE UP

Job Description

E. INSTALL THE WING-TO-FUSELAGE FAIRINGS (REF. AMM TASK 05-21-90-200-010-A).

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year
Mechanic/s	ACFT_TECH/AP		HRS				
Insp.	INSP/II		HRS				

TASK CLOSE UP

Job Description

F. PERFORM CLOSE-UP AND RETURN THE AIRCRAFT BACK TO NORMAL CONFIGURATION AS PER AMM TASK 05-21-90-200-010-A.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year
Mechanic/s	ACFT_TECH/AP		HRS				
Insp.			HRS				



MET.28342345

Task Card Title:

UPPER WING FAIRING SLIDE STOWAGE

Task Card NO:

ZL-193-02-1

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

-Aircraft Maintenance Manual used: Revision No. _____ Dated. _____.

Task card finding (Tick Applicable Box) [] Yes [] No. If yes update the system and list Task card finding WO below

Work order No: _____

Note: Make sure to create the finding Work Order on task card level.

Remark's: _____

(1) If Task card interrupted or performed by different persons updates the system and update the following accordingly (Tick Applicable Box)

- Interruption No. 1 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

- Interruption No. 2 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

- Interruption No. 3 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

- Interruption No. 4 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

- Interruption No. 5 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

(2) Record any dimension or torque through the performed steps and sign-off as applicable:

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

**Task Completion Close Up And
System Update****Station****Date****Signature**

 MET.32721978		Task Card Title: AFT PASSENGER/CREW DOOR				
Task Card NO: ZL-831-01-1		Work Package: ASP/H-26 C7-CHK		A/C Registration: HZ-ASP		
A/C Type: 321		Block Taskcard		Main Skill: INSP,II		PROD Final Acceptance:
Project No: 01BASPC72608		Related Task Card:		A/C Area: 09		
Internal Check:		Check Type:		Work Order NO:		Tally Sequence NO: 380
ENCLOSURE: ☐ CMR: ☐ CPCP: ☐ ETOPS: ☐ CDCCL: ☐ AD: ☐ ALI: ☐						
Type Code: GVI		Special Code: INSP		MSG Code: MRB		Request: Phase: PRE INSP,PRE INSP
I HEREBY CERTIFY THAT ALL WARNINGS AND CAUTIONS HAVE BEEN READ AND THE WORK HAS BEEN CARRIED OUT IN ACCORDING WITH ALL LAID DOWN PROCEDURES, ATTACHED NOTES AND INFORMATION.						
Zones: 832,842						
DOCUMENT REFERENCES:						
Doc Typ		Reference				
AMM		05-28-30-200-001-A				
AMM		052830-200-001				
ACCESS PANELS:						
MATERIAL REQUIREMENTS:						
Part Number		Description				Qty.
No parts assigned to this Task Item						
TOOLING REQUIREMENTS:						
Part Number		Description				Qty.
No tools assigned to this Task Item						
TASK INSTRUCTIONS						
Job Description						
NOTE: THE INSPECTION MUST BE PERFORMED FROM WITHIN A TOUCHING DISTANCE (UNLESS OTHERWISE STATED), USING VISUAL INSPECTION AIDS I.E. INSPECTION MIRROR, SPOT LIGHT ETC., AS REQUIRED, WITH ALL IDENTIFIED ACCESS PANELS OPEN. THE PURPOSE OF THE INSPECTION IS TO DETERMINE THE GENERAL CONDITION AND SECURITY OF VISIBLE SYSTEM INSTALLATIONS / COMPONENTS / STRUCTURE CONTAINED IN THE ZONE INCLUDING CHECKING FOR EVIDENCE OF DEGRADATION, CHAFING OF TUBING, LOOSE DUCT SUPPORT, WIRING DAMAGE, CABLE AND PULLEY WEAR, FLUID LEAKS, INADEQUATE DRAINAGE AND OTHER CONDITIONS THAT COULD LEAD TO CORROSION / DAMAGE AND GENERAL CONDITION OF THE ACCESS PANELS / FAIRINGS REMOVED. A. PERFORM ZONAL GENERAL VISUAL INSPECTION OF THE AFT L/H PASSENGER/CREW DOORS INCLUDING THE DOOR STOPS ON THE FUSELAGE DOOR FRAMES, THE DOOR SEALS AND THE EXTERNAL SURFACE OF THE DOOR PER AMM TASK 05-28-30-200-001-A.						
STEP COMPLETION SIGN OFF:						
		Qualification / Skill	Number of employees	Duration	Number./Signature	Date Day Month Year

 MET.32721978	Task Card Title: AFT PASSENGER/CREW DOOR						
Task Card NO: ZL-831-01-1		Work Package: ASP/H-26 C7-CHK		A/C Registration: HZ-ASP			
Mechanic/s				HRS			
Insp.	INSP/II			HRS			
TASK INSTRUCTIONS							
Job Description							
D. PERFORM ZONAL GENERAL VISUAL INSPECTION OF THE AFT R/H PASSENGER/CREW DOORS INCLUDING THE DOOR STOPS ON THE FUSELAGE DOOR FRAMES, THE DOOR SEALS AND THE EXTERNAL SURFACE OF THE DOOR PER AMM TASK 05-28-30-200-001-A.							
STEP COMPLETION SIGN OFF:							
	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year
Mechanic/s			HRS				
Insp.	II/INSP		HRS				
-Aircraft Maintenance Manual used: Revision No. _____ Dated. _____. Task card finding (Tick Applicable Box) [☐] Yes [☐] No. If yes update the system and list Task card finding WO below Work order No: _____ _____ Note: Make sure to creat the finding Work Order on task card level. Remark's: _____ _____							



Task Card Title:

AFT PASSENGER/CREW DOOR

Task Card NO:

ZL-831-01-1

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

(1) If Task card interrupted or performed by different personals updates the system and update the following according (Tick Applicable Box)

- Interruption No. 1 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 2 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 3 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 4 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 5 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____

(2) Record any dimension or torque through the performed steps and sign-off as applicable:

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____

**Task Completion Close Up And
System Update**

Station**Date****Signature**

Copyright of Saudia Technic - Regeneration is not allowed without prior approval by Saudia Technic.



Task Card Title:

AIRCRAFT EXTERIOR APPEARANCE WASH

Task Card NO:

12-21-11-01-0-SVA

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

Insp.

HRS

Job Description

B. COVER PITOT PROBES AND STATIC PORTS.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year
Mechanic/s	AV/ACFT_TECH		HRS				
Insp.			HRS				

Job Description

C. PERFORM A WALK AROUND CHECK BEFORE WASH TO VERIFY INTEGRITY OF AIRCRAFT.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year
Mechanic/s	ACFT_TECH/AP		HRS				
Insp.			HRS				

Job Description

D. PERFORM AIRCRAFT EXTERIOR APPEARANCE WASH ON THE FOLLOWING AREAS (REF. AMM TASK 12-21-11-615-002-A):

NOTE: MATERIAL P/N CB-210 USED AS PRIMARY EXTERIOR DETERGENT AND P/N CB-250 USED AS SOLVENT DEGREASER.

- (1) UPPER AND LOWER HALF OF THE FUSELAGE.
- (2) NO.1 AND NO.2 ENGINES NACELLES AND THRUST REVERSER.
- (3) LEFT AND RIGHT WING UPPER AND LOWER SURFACES.
- (4) EMPENNAGE INCLUDING HORIZONTAL AND VERTICAL STABILIZERS.
- (5) LH AND RH MAIN LANDING GEARS AND DOORS (WITH DOORS CLOSED).
- (6) NOSE LANDING GEAR AND DOORS (WITH DOORS CLOSED).

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year
Mechanic/s	AF/ACFT_TECH		HRS				
Insp.			HRS				

Job Description

E. PERFORM ALL LANDING GEARS AND DOORS LUBRICATION AS PER AMM TASK 12-22-32-640-001 / -002.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year



Task Card Title:

AIRCRAFT EXTERIOR APPEARANCE WASH

Task Card NO:

12-21-11-01-0-SVA

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

Mechanic/s	AF/ACFT_TECH			HRS			
Insp.				HRS			

Job Description

F. REMOVE ALL COVERS INSTALLED ON PITOT STATIC PROBES / PORTS.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year
Mechanic/s	AV/ACFT_TECH		HRS				
Insp.	INSP/II		HRS				

Job Description

G. REMOVE COVERS INSTALLED ON THE SKIN AIR INLET AND OUTLET VALVES.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year
Mechanic/s	ACFT_TECH/AP		HRS				
Insp.			HRS				

Job Description

H. OPEN OUTFLOW VALVES OR REMOVE COVERS, (IF INSTALLED).

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year
Mechanic/s	AF/ACFT_TECH		HRS				
Insp.			HRS				

Job Description

I. REMOVE UNNECESSARY EQUIPMENT FROM AROUND THE AIRPLANE.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year
Mechanic/s	ACFT_TECH/AP		HRS				
Insp.			HRS				

Job Description

J. PERFORM A WALK AROUND CHECK AFTER COMPLETION OF WASH TO VERIFY INTEGRITY OF AIRCRAFT.

STEP COMPLETION SIGN OFF:

 MET.19281391	Task Card Title: AIRCRAFT EXTERIOR APPEARANCE WASH							
Task Card NO: 12-21-11-01-0-SVA		Work Package: ASP/H-26 C7-CHK		A/C Registration: HZ-ASP				
Mechanic/s	Qualification / Skill	Number of employees	Duration		Number./Signature		Date	
	ACFT_TECH/AP			HRS			Day	Month
				HRS				Year
-Aircraft Maintenance Manual used: Revision No. _____ Dated. _____. Task card finding (Tick Applicable Box) [] Yes [] No. If yes update the system and list Task card finding WO below Work order No: _____ _____ Note: Make sure to creat the finding Work Order on task card level. Remark's: _____ _____								
(1) If Task card interrupted or performed by different personals updates the system and update the following accord (Tick Applicable Box) - Interruption No. 1 [] Task card [] AMM [] Other specify. _____ Performed by: _____ Page No. _____ Step From _____ To _____ - Interruption No. 2 [] Task card [] AMM [] Other specify. _____ Performed by: _____ Page No. _____ Step From _____ To _____ - Interruption No. 3 [] Task card [] AMM [] Other specify. _____ Performed by: _____ Page No. _____ Step From _____ To _____ - Interruption No. 4 [] Task card [] AMM [] Other specify. _____ Performed by: _____ Page No. _____ Step From _____ To _____ - Interruption No. 5 [] Task card [] AMM [] Other specify. _____ Performed by: _____ Page No. _____ Step From _____ To _____								
(2) Record any dimension or torque through the performed steps and sign-off as applicable: - Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____ Remark's: _____ - Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____ Remark's: _____ - Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____ Remark's: _____ - Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____ Remark's: _____ - Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____ Remark's: _____								
Task Completion Close Up And System Update			Station		Date		Signature	

 MET.23571006		Task Card Title: AIRCRAFT HEAVY WASH				
Task Card NO: 12-21-11-03-0-SVA		Work Package: ASP/H-26 C7-CHK		A/C Registration: HZ-ASP		
A/C Type: 321		On Demand Task Card		Main Skill: PP,INSP,RIL,AF,AV,CAB,ACFT_T ECH		PROD Final Acceptance:
Project No: 01BASPC72608		Related Task Card:		A/C Area: 00		
Internal Check:		Check Type:		Work Order NO:		Tally Sequence NO: 382
ENCLOSURE: ☐ CMR: ☐ CPCP: ☐ ETOPS: ☐ CDCCL: ☐ AD: ☐ ALI: ☐						
Type Code: CLN		Special Code: AF		MSG Code: 4, 7		Request: WASH,WASH,WASH, WASH,WASH,WASH, WASH
I HEREBY CERTIFY THAT ALL WARNINGS AND CAUTIONS HAVE BEEN READ AND THE WORK HAS BEEN CARRIED OUT IN ACCORDING WITH ALL LAID DOWN PROCEDURES, ATTACHED NOTES AND INFORMATION.						
Zones: 100						
DOCUMENT REFERENCES:						
Doc Typ		Reference				
AMM		12-21-11-615-002-A				
ACCESS PANELS:						
MATERIAL REQUIREMENTS:						
Part Number		Description				Qty.
CB-210		CLEANER EXTERIOR S/L 2 YRS				1.0
CB-250		CLEANER EXTERIOR S/L 2/YRS.				1.0
LOTOXANE		NON-AQUEOUS CLEANER				1.0
MIL-C-16173		BRAYCOTE 194*IF SD USE: BRAYCOTE194*				1.0
MIL-PRF-5606		OIL HYDROLIC S/L 2 YRS USE MILH5606				1.0
MIL-PRF-680		NON AQUEOUS CLEANER- PETROLEUM BASED				1.0
STODDARDSOLVENT		SOLVENT, USE PN: ARDROX 5503				1.0
SV7290017		LUBRICANT , USE PN: LPS 2				1.0
TN10138		COMPOUND CORROSION INHIB*HAZ MATS/L				1.0
TT-I-735		ISOPROPYL ALCOHOL				1.0
A952		DINITROL REMOVER **HAZ MAT**. S/L 2				1.0
TOOLING REQUIREMENTS:						
Part Number		Description				Qty.
98A10001005000		COVER-SLIPON PITOT PROBE				0.0
98A10001013000		COVER-TOTAL TEMP SENSOR (TOOL/HZ-HMS				2.0
98A10001500000		COVER-SLIP ON,ANGLE OF ATTACK SENSOR				3.0
98D10103500001		COVER-STATIC PROBE				6.0
98D10103501000		COVER-ICE DETECTION PROBE (TOOL/HZ-H				2.0
PREPARATION (A/F)						
Job Description						
A. PERFORM JOB SET-UP (A/F) SIDE AS PER AMMM TASK 12-21-11-615-002-A.						



Task Card Title:

AIRCRAFT HEAVY WASH

Task Card NO:

12-21-11-03-0-SVA

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP**STEP COMPLETION SIGN OFF:**

	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year
Mechanic/s	AF/ACFT_TECH		HRS				
Insp.			HRS				

PREPARATION (P/P)**Job Description**

B. PERFORM JOB SET-UP (P/P) SIDE AS PER AMMM TASK 12-21-11-615-002-A.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year
Mechanic/s	PP/ACFT_TECH		HRS				
Insp.			HRS				

PREPARATION (AVN)**Job Description**

C. PERFORM JOB SET-UP (AVN) SIDE AS PER AMMM TASK 12-21-11-615-002-A.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year
Mechanic/s	AV/ACFT_TECH		HRS				
Insp.			HRS				

PREPARATION (OSS)**Job Description**

D. PERFORM JOB SET-UP (OSS) SIDE AS PER AMMM TASK 12-21-11-615-002-A.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year
Mechanic/s	AF/ACFT_TECH		HRS				
Insp.			HRS				

TASK INSTRUCTION**Job Description**

A. PERFORM CLEANING OF FUSELAGE, WINGS, NACELLES, PYLONS, HORIZONTAL AND VERTICAL STABILIZERS AS PER AMMM TASK 12-21-11-615-002-A.

NOTE: USE MATERIAL AS FOLLOWS:

*P/N CB-210: USED AS PRIMARY EXTERIOR DETERGENT.

*P/N CB-250: USED AS SOLVENT DEGREASER.

*P/N A-952: USED TO REMOVE HEAVY STAINED FROM THE FOLLOWING AIRCRAFT EXTERIOR SURFACES:

- LOWER EMPENNAGE AREA, BEHIND THE MAIN LANDING GEAR WHERE EXHAUST STAINS ARE COMMONLY DEPOSITED.
- THE AREAS COMING FROM THE APU SUCH AS GANG DRAINS.
- LOWER SURFACES OF THE FLAPS BOTH INBOARD AND OUTBOARD.



Task Card Title:

AIRCRAFT HEAVY WASH

Task Card NO:

12-21-11-03-0-SVA

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

MIXING RATIOS: CEE BEE A952 CAN BE MIXED WITH (SUPER BEE 210 (DILUTED 10:1 OR 20:1)) DEPENDING UPON DEGREE OF CONTAMINATION. THE DILUTION OF CEE BEE A952 IS RECOMMENDED AT A (10% TO 25%) RATIO WITH A952 DEPENDING UPON SOIL AND CARBON DEPOSITS.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year
Mechanic/s	AF/ACFT_TECH		HRS				
Insp.			HRS				

TASK INSTRUCTION**Job Description**

B. RINSE EXTERNAL AREAS AS PER AMMM TASK 12-21-11-615-002-A.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year
Mechanic/s	AF/ACFT_TECH		HRS				
Insp.			HRS				

TASK INSTRUCTION**Job Description**

C. PERFORM A CLEANING OF THE OUTER AND INNER SURFACES OF THE WINDSHIELDS AS PER AMMM TASK 12-21-11-615-002-A.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year
Mechanic/s	AF/ACFT_TECH		HRS				
Insp.			HRS				

TASK INSTRUCTION**Job Description**

D. PERFORM A CLEANING OF THE INNER SURFACES OF THE WINDSHIELDS AS PER AMMM TASK 12-21-11-615-002-A.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year
Mechanic/s	CAB/ACFT_TECH		HRS				
Insp.			HRS				

TASK INSTRUCTION**Job Description**

E. REMOVE THE REMAINING RAIN REPELLENT FLUID FROM THE WINDSHIELD.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year



Task Card Title:

AIRCRAFT HEAVY WASH



Task Card NO:

12-21-11-03-0-SVA

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

Mechanic/s	AF/ACFT_TECH			HRS				
Insp.				HRS				
TASK INSTRUCTION								
Job Description								
F. EXAMINE THE WIPERS CONDITION, REPLACE IF NECESSARY.								
STEP COMPLETION SIGN OFF:								
	Qualification / Skill	Number of employees	Duration	Number./Signature	Date			
					Day	Month	Year	
Mechanic/s	AF/ACFT_TECH			HRS				
Insp.				HRS				
TASK INSTRUCTION								
Job Description								
G. PERFORM A CLEANING OF THE LH AND RH ACRYLIC AND GLASS FIXED AND SLIDING WINDOWS AS PER AMMM TASK 12-21-11-615-002-A.								
STEP COMPLETION SIGN OFF:								
	Qualification / Skill	Number of employees	Duration	Number./Signature	Date			
					Day	Month	Year	
Mechanic/s	AF/ACFT_TECH			HRS				
Insp.				HRS				
TASK INSTRUCTION								
Job Description								
H. PERFORM A CLEANING OF THE OUTER SURFACE OF THE OUTER WINDOWS' PANES AS PER AMMM TASK 12-21-11-615-002-A.								
STEP COMPLETION SIGN OFF:								
	Qualification / Skill	Number of employees	Duration	Number./Signature	Date			
					Day	Month	Year	
Mechanic/s	AF/ACFT_TECH			HRS				
Insp.				HRS				
TASK INSTRUCTION								
Job Description								
I. OPENING OF THE LANDING GEAR DOORS AS PER AMMM TASK 12-21-11-615-002-A AND MAKE SURE THAT THE ACCESS DOOR OPENINGS IN THE LANDING GEAR BAYS ARE CORRECTLY CLOSED.								
STEP COMPLETION SIGN OFF:								
	Qualification / Skill	Number of employees	Duration	Number./Signature	Date			
					Day	Month	Year	
Mechanic/s	AF/ACFT_TECH			HRS				
Insp.				HRS				



Task Card Title:

AIRCRAFT HEAVY WASH

Task Card NO:

12-21-11-03-0-SVA

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP**TASK INSTRUCTION****Job Description**

J. PERFORM LDG'S BAYS CLEANING AS PER AMMM TASK 12-21-11-615-002-A.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration		Number./Signature	Date		
						Day	Month	Year
Mechanic/s	AF/ACFT_TECH			HRS				
Insp.				HRS				

TASK INSTRUCTION**Job Description**

K. PERFORM MAIN AND NOSE LANDING GEARS CLEANING AS PER AMMM TASK 12-21-11-615-002-A.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration		Number./Signature	Date		
						Day	Month	Year
Mechanic/s	AF/ACFT_TECH			HRS				
Insp.				HRS				

CLOSE UP**Job Description**

A. PERFORM MAIN AND NOSE LANDING GEARS' CHROMIUM SURFACES CLEANING AS PER AMMM TASK 12-21-11-615-002-A.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration		Number./Signature	Date		
						Day	Month	Year
Mechanic/s	AF/ACFT_TECH			HRS				
Insp.				HRS				

CLOSE UP**Job Description**

B. APPLY CORROSION PREVENTION ON THE LANDING GEARS AND IN THE LANDING GEARS' BAYS AS PER AMMM TASK 12-21-11-615-002-A.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration		Number./Signature	Date		
						Day	Month	Year
Mechanic/s	AF/ACFT_TECH			HRS				
Insp.				HRS				

CLOSE UP**Job Description**

C. LUBRICATE NOSE AND MAIN LANDING GEARS (REF. AMMM TASK 12-22-32-640-001-A AND AMMM TASK 12-22-32-640-002-A).

STEP COMPLETION SIGN OFF:



Task Card Title:

AIRCRAFT HEAVY WASH



Task Card NO:

12-21-11-03-0-SVA

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

	Qualification / Skill	Number of employees	Duration		Number./Signature	Date		
						Day	Month	Year
Mechanic/s	AF/ACFT_TECH			HRS				
Insp.				HRS				

CLOSE UP

Job Description

D. PERFORM A GENERAL VISUAL INSPECTION OF NOSE AND MAIN LANDING GEARS AS PER AMMM TASK 12-21-11-615-002-A.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration		Number./Signature	Date		
						Day	Month	Year
Mechanic/s	AF/ACFT_TECH			HRS				
Insp.				HRS				

CLOSE UP

Job Description

E. PERFORM A FINAL CHECK AND CLEANING TOUCH-UP AS PER AMM TASK 12-21-11-615-002-A.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration		Number./Signature	Date		
						Day	Month	Year
Mechanic/s	AF/ACFT_TECH			HRS				
Insp.				HRS				

CLOSE UP

Job Description

F. REMOVE ALL CLEANING EQUIPMENTS.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration		Number./Signature	Date		
						Day	Month	Year
Mechanic/s	AF/ACFT_TECH			HRS				
Insp.				HRS				

CLOSE UP

Job Description

G. REMOVE ALL PROTECTIVE EQUIPMENTS (REF. AMM TASK 10-11-00-555-014).

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration		Number./Signature	Date		
						Day	Month	Year
Mechanic/s	AV/ACFT_TECH			HRS				
Insp.	INSP/RII			HRS				



Task Card Title:

AIRCRAFT HEAVY WASH

Task Card NO:

12-21-11-03-0-SVA

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP**CLOSE UP****Job Description**

H. PERFORM JOB CLOSE UP (OSS) SIDE AS PER AMM TASK 12-21-11-615-002-A.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration		Number./Signature	Date		
						Day	Month	Year
Mechanic/s	AF/ACFT_TECH			HRS				
Insp.				HRS				

CLOSE UP**Job Description**

I. PERFORM JOB CLOSE UP (AVN) SIDE AS PER AMM TASK 12-21-11-615-002-A.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration		Number./Signature	Date		
						Day	Month	Year
Mechanic/s	AV/ACFT_TECH			HRS				
Insp.				HRS				

CLOSE UP**Job Description**

J. PERFORM JOB CLOSE UP (A/F) SIDE AS PER AMM TASK 12-21-11-615-002-A.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration		Number./Signature	Date		
						Day	Month	Year
Mechanic/s	AF/ACFT_TECH			HRS				
Insp.				HRS				

-Aircraft Maintenance Manual used: Revision No. _____ Dated. _____.

Task card finding (Tick Applicable Box) [] Yes [] No. If yes update the system and list Task card finding WO below

Work order No: _____

Note: Make sure to creat the finding Work Order on task card level.

Remark's: _____



Task Card Title:

AIRCRAFT HEAVY WASH

Task Card NO:

12-21-11-03-0-SVA

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

(1) If Task card interrupted or performed by different personals updates the system and update the following according (Tick Applicable Box)

- Interruption No. 1 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 2 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 3 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 4 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 5 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____

(2) Record any dimension or torque through the performed steps and sign-off as applicable:

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____

**Task Completion Close Up And
System Update**

Station**Date****Signature**

 MET.31375689		Task Card Title: MLG DR ACTUATOR EYE END BEARING LUB					
Task Card NO: 32-10-00-01-0-SVA		Work Package: ASP/H-26 C7-CHK		A/C Registration: HZ-ASP			
A/C Type: 321		Single Running Taskcard		Main Skill: IL,INSP,AF,ACFT_TECH		PROD Final Acceptance:	
Project No: 01BASPC72608		Related Task Card:		A/C Area: 09			
Internal Check:		Check Type:		Work Order NO:		Tally Sequence NO: 383	
ENCLOSURE: ☐ CMR: ☐ CPCP: ☐ ETOPS: ☐ CDCCL: ☐ AD: ☒ ALI: ☐							
Type Code: LUB		Special Code: AF		MSG Code: 4		Request: JOB-SETUP,TC/P,TC/P	
I HEREBY CERTIFY THAT ALL WARNINGS AND CAUTIONS HAVE BEEN READ AND THE WORK HAS BEEN CARRIED OUT IN ACCORDING WITH ALL LAID DOWN PROCEDURES, ATTACHED NOTES AND INFORMATION.							
Zones: 700,734,744							
DOCUMENT REFERENCES:							
Doc Typ		Reference					
AMM		32-12-00-010-001-A					
AMM		12-22-32-640-001-A					
AMM		12-22-32-640-001-A Lubrication of Main Landing Gear and Doors					
ACCESS PANELS:							
MATERIAL REQUIREMENTS:							
Part Number		Description				Qty.	
HYJET-IV-A-PLUS		HYDRAULIC FLUID				1.0	
MIL-PRF-81322		ASG22 IF SD USE P/N SV7291638 S/L 3				1.0	
AEROSHELLGREASE33*		GREASE REQUIRE FOR E.O. 27-1495				1.0	
MIL-PRF-23827TYPEI		GREASE, PLEASE USE PN: ASG33				1.0	
LOTOXANE		NON-AQUEOUS CLEANER				1.0	
MIL-PRF-680		NON AQUEOUS CLEANER- PETROLEUM BASED				1.0	
TOOLING REQUIREMENTS:							
Part Number		Description				Qty.	
460005835		GROUND LOCK SLEEVE ALT PN DAH602734				1.0	
PREPARATION							
Job Description							
A. OPEN THE MAIN LANDING GEAR DOORS FOR ACCESS AS PER AMM TASK 32-12-00-010-001-A.							
STEP COMPLETION SIGN OFF:							
Qualification / Skill		Number of employees		Duration		Number./Signature	
Date		Day		Month		Year	
Mechanic/s		AF/ACFT_TECH		HRS			

 MET.31375689	Task Card Title: MLG DR ACTUATOR EYE END BEARING LUB						
Task Card NO: 32-10-00-01-0-SVA		Work Package: ASP/H-26 C7-CHK		A/C Registration: HZ-ASP			
Insp.				HRS			
TASK INSTRUCTION							
Job Description							
A. PERFORM LH MLG DOOR ACTUATOR PN 114122014 LUBRICATION AS PER AMM TASK 12-22-32-640-001-A.							
STEP COMPLETION SIGN OFF:							
	Qualification / Skill	Number of employees	Duration		Number./Signature	Date	
				HRS		Day	Month
Mechanic/s	AF/ACFT_TECH			HRS			
Insp.	II/INSP			HRS			
TASK INSTRUCTION							
Job Description							
B. PERFORM RH MLG DOOR ACTUATOR PN 114122014 LUBRICATION AS PER AMM TASK 12-22-32-640-001-A.							
STEP COMPLETION SIGN OFF:							
	Qualification / Skill	Number of employees	Duration		Number./Signature	Date	
				HRS		Day	Month
Mechanic/s	AF/ACFT_TECH			HRS			
Insp.	II/INSP			HRS			
-Aircraft Maintenance Manual used: Revision No. _____ Dated. _____. Task card finding (Tick Applicable Box) [☐] Yes [☐] No. If yes update the system and list Task card finding WO below Work order No: _____ _____ Note: Make sure to creat the finding Work Order on task card level. Remark's: _____ _____ _____							



Task Card Title:

MLG DR ACTUATOR EYE END BEARING LUB

Task Card NO:

32-10-00-01-0-SVA

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

(1) If Task card interrupted or performed by different personals updates the system and update the following according (Tick Applicable Box)

- Interruption No. 1 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 2 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 3 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 4 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 5 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____

(2) Record any dimension or torque through the performed steps and sign-off as applicable:

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____

**Task Completion Close Up And
System Update**

Station**Date****Signature**

 MET.32722073		Task Card Title: DISCARD CHEMICAL OXYGEN GENERATORS					
Task Card NO: 352142-01-1		Work Package: ASP/H-26 C7-CHK			A/C Registration: HZ-ASP		
A/C Type: 321		Single Running Taskcard		Main Skill: INSP,RII,CAB,ACFT_TECH		PROD Final Acceptance:	
Project No: 01BASPC72608		Related Task Card:		A/C Area: 05			
Internal Check:		Check Type:		Work Order NO:		Tally Sequence NO: 384	
ENCLOSURE: ☐ CMR: ☐ CPCP: ☐ ETOPS: ☐ CDCCL: ☐ AD: ☐ ALI: ☐							
Type Code: DIS		Special Code: CAB		MSG Code: 8, MRB		Request: Phase: JOB SETUP, JOB-CLOSE UP	
I HEREBY CERTIFY THAT ALL WARNINGS AND CAUTIONS HAVE BEEN READ AND THE WORK HAS BEEN CARRIED OUT IN ACCORDING WITH ALL LAID DOWN PROCEDURES, ATTACHED NOTES AND INFORMATION.							
Zones: 200							
DOCUMENT REFERENCES:							
Doc Typ		Reference					
AMM		35-21-00-920-001-A					
AMM		35-21-42-000-001-A					
AMM		35-21-42-400-001-A					
AMM		352100-920-001					
ACCESS PANELS:							
MATERIAL REQUIREMENTS:							
Part Number		Description				Qty.	
E63420-00		OXYGEN GENERATOR IN 14C22L215460009				5.0	
E63440-00		GENERATOR ASSY-OXYGEN , HAZMAT				61.0	
TOOLING REQUIREMENTS:							
Part Number		Description				Qty.	
No tools assigned to this Task Item							
PREPERATION							
Job Description							
A. PERFORM JOB SET UP AND GET ACCESS FOR ALL PASSENGER/ATTENDANT SERVICE UNIT (PSU/ASU) INCLUDING PASSENGER, SUPERNUMERARY, ATTENDANT, GALLEY, CREW AND/OR ATTENDANT REST MODULE SERVICE UNITS (PSU'S/ASU'S) - AS CONFIGURED AS PER AMM 35-21-00-920-001.							
STEP COMPLETION SIGN OFF:							
	Qualification / Skill	Number of employees	Duration		Number./Signature	Date	
						Day Month Year	
Mechanic/s	CAB/ACFT_TECH		HRS				
Insp.			HRS				
INSPECTION:							
Job Description							



Task Card Title:

DISCARD CHEMICAL OXYGEN GENERATORS

Task Card NO:

352142-01-1

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

B. CHECK THE EXPIRY DATE OF ALL OXYGEN GENERATORS:.

A32S NOTE:

Oxygen generator P/N E63420-00 & P/N E63440-00 Life is 15 Years.

Oxygen generator P/N 117042-22 & P/N 117042-24 Life is 10 Years.

(1) IF EXPIRY DATE IS BEFORE (6 MONTHS), ITEM MUST BE REPLACED.

(2) IF PART IS S/D OR EXPIRY IS AFTER (6 MONTHS) AND BEFORE (3 YEARS) DO THE FOLLOWING:

(A) REGISTER P/N, S/N, LOCATION, EXPIRY DATE OF THE EFFECTED AIRCRAFT PART IN THE SCHEDULE BELOW.

(B) INSPECTOR MUST ISSUE A WORK ORDER (W/O) WITH ABOVE INFORMATION.

(C) PRODUCTION CONTROL PLANNING MUST GENERATE E-MAIL WITH ABOVE INFORMATION AND SEND TO THE FOLLOWING DEPARTMENTS:

- SV AMP	SVAMP@ SAUDIA.COM
- MCC LINE MAINTENANCE PLANNING	SVMCCLMP@SAUDIA.COM
- MCC DUTY MANAGER	SVMCCDUTYMGR@SAUDIA.COM
- SV MATERIAL PLANNING & CONTROL	SVMATPC@SAUDIA.COM
- SVT AIRCRAFT MAINTENANCE OVERSIGHT	SVTOVERSIGHT@SAUDIA.COM

(PROD PLNR PRN: _____ SIGNATURE: _____ .)

NOTE: OVER RIDE PROCESS MUST BE ACCOMPLISHED BY INSPECTION SUPERVISOR WHEN E-MAIL IS ISSUED.

(3) IF EXPIRY DATE MORE THAN (3 YEARS) NO ACTION REQUIRED.

SEQ	LIFE LIMIT PART	PART NO.	SERIAL NO.	LOCATION	EXPIRY DATE
1					
2					
3					
4					
5					

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration		Number./Signature	Date		
						Day	Month	Year
Mechanic/s	CAB/ACFT_TECH			HRS				

 MET.32722073	Task Card Title: DISCARD CHEMICAL OXYGEN GENERATORS												
Task Card NO: 352142-01-1		Work Package: ASP/H-26 C7-CHK		A/C Registration: HZ-ASP									
Insp.	INSP/RII			HRS									
CLOSE UP													
Job Description													
C. PERFORM JOB CLOSE UP AND RETURN THE AIRCRAFT BACK TO ITS NORMAL CONDITION AS PER AMM TASK 35-21-00-920-001.													
STEP COMPLETION SIGN OFF:													
	Qualification / Skill	Number of employees	Duration		Number./Signature		Date						
				HRS			<table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td style="text-align: center;">Day</td> <td style="text-align: center;">Month</td> <td style="text-align: center;">Year</td> </tr> <tr> <td></td> <td></td> <td></td> </tr> </table>	Day	Month	Year			
Day	Month	Year											
Mechanic/s	CAB/ACFT_TECH			HRS									
Insp.	INSP/RII			HRS									
-Aircraft Maintenance Manual used: Revision No. _____ Dated. _____. Task card finding (Tick Applicable Box) [☐] Yes [☐] No. If yes update the system and list Task card finding WO below Work order No: _____ _____ Note: Make sure to creat the finding Work Order on task card level. Remark's: _____ _____													



Task Card Title:

DISCARD CHEMICAL OXYGEN GENERATORS

Task Card NO:

352142-01-1

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

(1) If Task card interrupted or performed by different personals updates the system and update the following according (Tick Applicable Box)

- Interruption No. 1 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 2 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 3 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 4 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 5 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____

(2) Record any dimension or torque through the performed steps and sign-off as applicable:

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____

**Task Completion Close Up And
System Update**

Station**Date****Signature**

 MET.32626072		Task Card Title: WATER TANK DISINFECTION			
Task Card NO: 381000-01-1		Work Package: ASP/H-26 C7-CHK		A/C Registration: HZ-ASP	
A/C Type: 321		Single Running Taskcard		Main Skill: CAB,ACFT_TECH	
Project No: 01BASPC72608		Related Task Card:		A/C Area: 00	
Internal Check:		Check Type:		Work Order NO: Tally Sequence NO: 385	
ENCLOSURE: ☐ CMR: ☐ CPCP: ☐ ETOPS: ☐ CDCCL: ☐ AD: ☐ ALI: ☐					
Type Code: RST		Special Code: CAB		MSG Code: 6, 8, MRB	
Request:		Phase: OPS/LK			
I HEREBY CERTIFY THAT ALL WARNINGS AND CAUTIONS HAVE BEEN READ AND THE WORK HAS BEEN CARRIED OUT IN ACCORDING WITH ALL LAID DOWN PROCEDURES, ATTACHED NOTES AND INFORMATION.					
Zones: 171					
DOCUMENT REFERENCES:					
Doc Typ		Reference			
AMM		38-10-00-670-002-A			
AMM		38-10-00-170-001-A			
AMM		38-10-00-281-001-A			
AMM		38-10-00-670-003-A			
AMM		38-10-00-670-003-A01			
AMM		38-10-00-670-004-A			
AMM		38-10-00-670-005-A			
AMM		38-10-00-670-006-A			
AMM		38-10-00-670-803-A			
AMM		38-10-00-670-804-A			
ACCESS PANELS:					
171AL					
MATERIAL REQUIREMENTS:					
Part Number		Description			Qty.
150G		WTR FLTR CAR-USE PN EV949000			4.0
770440		CANISTER-FILTER,WATER			1.0
778000		CARTRIDGE-FILTER-USE PN 778000PY			3.0
CALCIUM-HYPOCHLORITE		CALCIUM HYPOCHLORITE**HAZ MAT** MRP#			1.0
H2O2		PEROXIDE,HYDROGEN - (MSDS#19)			1.0
SODIUM HYPOCHLORITE		CONCENTRATED CHLORINE BLEACH			1.0
TOOLING REQUIREMENTS:					
Part Number		Description			Qty.
98F38108656000		DOSER WATER DISINFECTION			1.0
WATER TANK AND DISTRIBUTION SYSTEM DISINFECTION					
Job Description					
A. PERFORM DISINFECTION OF POTABLE WATER SYSTEM AND DISCARD OF WATER FILTER ELEMENTS. (PER AMM TASK					

 MET.32626072	Task Card Title: WATER TANK DISINFECTION							
Task Card NO: 381000-01-1		Work Package: ASP/H-26 C7-CHK			A/C Registration: HZ-ASP			
38-10-00-670-002-A). 								
STEP COMPLETION SIGN OFF:								
	Qualification / Skill	Number of employees	Duration		Number./Signature	Date		
						Day	Month	Year
Mechanic/s	CAB/ACFT_TECH			HRS				
Insp.				HRS				
-Aircraft Maintenance Manual used: Revision No. _____ Dated. _____. Task card finding (Tick Applicable Box) [☐] Yes [☐] No. If yes update the system and list Task card finding WO below Work order No: _____ _____ _____ Note: Make sure to creat the finding Work Order on task card level. Remark's: _____ _____ _____								



MET.32626072

Task Card Title:

WATER TANK DISINFECTION

Task Card NO:

381000-01-1

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

(1) If Task card interrupted or performed by different personals updates the system and update the following according (Tick Applicable Box)

- Interruption No. 1 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 2 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 3 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 4 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 5 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____

(2) Record any dimension or torque through the performed steps and sign-off as applicable:

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____

**Task Completion Close Up And
System Update**

Station**Date****Signature**

 MET.32722063		Task Card Title: FWD CGO DOOR FTNG EXTERNAL AREA INSP					
Task Card NO: 523108-01-1		Work Package: ASP/H-26 C7-CHK			A/C Registration: HZ-ASP		
A/C Type: 321		Single Running Taskcard		Main Skill: INSP,IL,AF,ACFT_TECH		PROD Final Acceptance:	
Project No: 01BASPC72608		Related Task Card:		A/C Area: 09			
Internal Check:		Check Type:		Work Order NO:		Tally Sequence NO: 386	
ENCLOSURE: ☒ CMR: ☐ CPCP: ☒ ETOPS: ☐ CDCCL: ☐ AD: ☐ ALI: ☒							
Type Code: DET		Special Code: INSP		MSG Code: ALI, CPCP, MRB		Request: JOB-SETUP,CLEAN-UP,INSPECTION,JOB-CLOSURE Phase: EUP	
I HEREBY CERTIFY THAT ALL WARNINGS AND CAUTIONS HAVE BEEN READ AND THE WORK HAS BEEN CARRID OUT IN ACCORDING WITH ALL LAID DOWN PROCEDURES, ATTACHED NOTES AND INFORMATION.							
Zones: 825							
DOCUMENT REFERENCES:							
Doc Typ		Reference					
ALI		523108-01-1					
AMM		52-31-11-200-004-A					
AMM		523111-200-004					
ACCESS PANELS:							
MATERIAL REQUIREMENTS:							
Part Number		Description				Qty.	
LOTOXANE		NON-AQUEOUS CLEANER				1.0	
AV 8		PREVENTIVE- WATER DISPLACE HARD FILM				1.0	
TOOLING REQUIREMENTS:							
Part Number		Description				Qty.	
No tools assigned to this Task Item							
PREPARATION							
Job Description							
A. PERFORM JOB SET UP AS PER AMM TASK 52-31-11-200-004-A.							
STEP COMPLETION SIGN OFF:							
	Qualification / Skill	Number of employees	Duration		Number./Signature	Date	
						Day Month Year	
Mechanic/s	AF/ACFT_TECH		HRS				
Insp.			HRS				
PREPARATION							
Job Description							
B. CLEAN THE INSPECTION AREA AS REQUIRED.							
STEP COMPLETION SIGN OFF:							



Task Card Title:

FWD CGO DOOR FTNG EXTERNAL AREA INSP

Task Card NO:

523108-01-1

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

	Qualification / Skill	Number of employees	Duration		Number./Signature	Date		
						Day	Month	Year
Mechanic/s	AF/ACFT_TECH			HRS				
Insp.				HRS				

TASK INSTRUCTION**Job Description****NOTE**

Ensure to fill the attached TSV# 92-634 along with this task.

A. PERFORM A DETAILED INSPECTION OF FORWARD CARGO COMPARTMENT DOOR, HINGE FITTINGS AND ATTACHMENT AREA, EXTERNAL AS PER AMM TASK 52-31-11-200-004-A.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration		Number./Signature	Date		
						Day	Month	Year
Mechanic/s				HRS				
Insp.	INSP/II			HRS				

CLOSE UP**Job Description**

A. APPLY AV8 OR AV25 AS PER AMM TASK 52-31-11-200-004-A.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration		Number./Signature	Date		
						Day	Month	Year
Mechanic/s	AF/ACFT_TECH			HRS				
Insp.	INSP/II			HRS				

-Aircraft Maintenance Manual used: Revision No. _____ Dated. _____.

Task card finding (Tick Applicable Box) [] Yes [] No. If yes update the system and list Task card finding WO below

Work order No: _____

Note: Make sure to create the finding Work Order on task card level.

Remark's: _____



Task Card Title:

FWD CGO DOOR FTNG EXTERNAL AREA INSP

Task Card NO:

523108-01-1

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

(1) If Task card interrupted or performed by different personals updates the system and update the following according (Tick Applicable Box)

- Interruption No. 1 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 2 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 3 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 4 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 5 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____

(2) Record any dimension or torque through the performed steps and sign-off as applicable:

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____

**Task Completion Close Up And
System Update**

Station**Date****Signature**

 MET.32722065		Task Card Title: AFT CGO DOOR FTNG EXTERNAL AREA INSP					
Task Card NO: 523118-01-2		Work Package: ASP/H-26 C7-CHK			A/C Registration: HZ-ASP		
A/C Type: 321		Single Running Taskcard		Main Skill: INSP,IL,AF,ACFT_TECH		PROD Final Acceptance:	
Project No: 01BASPC72608		Related Task Card:		A/C Area: 09			
Internal Check:		Check Type:		Work Order NO:		Tally Sequence NO: 387	
ENCLOSURE: ☒ CMR: ☐ CPCP: ☒ ETOPS: ☐ CDCCL: ☐ AD: ☐ ALI: ☒							
Type Code: DET		Special Code: INSP		MSG Code: CPCP, MRB, ALI		Request: JOB-SETUP,CLEAN-UP,INSPECTION,JOB-CLOSURE Phase: EUP	
I HEREBY CERTIFY THAT ALL WARNINGS AND CAUTIONS HAVE BEEN READ AND THE WORK HAS BEEN CARRIED OUT IN ACCORDING WITH ALL LAID DOWN PROCEDURES, ATTACHED NOTES AND INFORMATION.							
Zones: 826							
DOCUMENT REFERENCES:							
Doc Typ		Reference					
ALI		523118-01-2					
AMM		52-32-11-200-005-A					
AMM		523211-200-005					
ACCESS PANELS:							
MATERIAL REQUIREMENTS:							
Part Number		Description				Qty.	
LOTOXANE		NON-AQUEOUS CLEANER				1.0	
AV 8		PREVENTIVE- WATER DISPLACE HARD FILM				1.0	
TOOLING REQUIREMENTS:							
Part Number		Description				Qty.	
No tools assigned to this Task Item							
PREPARATION							
Job Description							
A. PERFORM JOB SET UP AS PER AMM TASK 52-32-11-200-005-A.							
STEP COMPLETION SIGN OFF:							
	Qualification / Skill	Number of employees	Duration		Number./Signature	Date	
						Day Month Year	
Mechanic/s	AF/ACFT_TECH		HRS				
Insp.			HRS				
PREPARATION							
Job Description							
B. CLEAN THE INSPECTION AREA AS REQUIRED.							
STEP COMPLETION SIGN OFF:							



Task Card Title:

AFT CGO DOOR FTNG EXTERNAL AREA INSP

Task Card NO:

523118-01-2

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

	Qualification / Skill	Number of employees	Duration		Number./Signature	Date		
						Day	Month	Year
Mechanic/s	AF/ACFT_TECH			HRS				
Insp.				HRS				

TASK INSTRUCTION**Job Description****NOTE**

Ensure to fill the attached TSV# 92-634 along with this task.

A. PERFORM A DETAILED INSPECTION OF AFT CARGO COMPARTMENT DOOR, HINGE FITTINGS AND ATTACHMENT AREA, EXTERNAL AS PER AMM TASK 52-32-11-200-005-A.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration		Number./Signature	Date		
						Day	Month	Year
Mechanic/s				HRS				
Insp.	INSP/II			HRS				

CLOSE UP**Job Description**

A. APPLY AV8 OR AV25 AS PER AMM TASK 52-32-11-200-005-A.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration		Number./Signature	Date		
						Day	Month	Year
Mechanic/s	AF/ACFT_TECH			HRS				
Insp.	II/INSP			HRS				

-Aircraft Maintenance Manual used: Revision No. _____ Dated. _____.

Task card finding (Tick Applicable Box) [] Yes [] No. If yes update the system and list Task card finding WO below

Work order No: _____

Note: Make sure to create the finding Work Order on task card level.

Remark's: _____



Task Card Title:

AFT CGO DOOR FTNG EXTERNAL AREA INSP

Task Card NO:

523118-01-2

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

(1) If Task card interrupted or performed by different personals updates the system and update the following according (Tick Applicable Box)

- Interruption No. 1 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 2 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 3 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 4 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 5 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____

(2) Record any dimension or torque through the performed steps and sign-off as applicable:

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____

**Task Completion Close Up And
System Update**

Station**Date****Signature**

 MET.32722070		Task Card Title: NLG AFT DOOR AFT FITTINGS INSPECTION						
Task Card NO: 528223-01-1		Work Package: ASP/H-26 C7-CHK		A/C Registration: HZ-ASP				
A/C Type: 321		Single Running Taskcard		Main Skill: INSP,II		PROD Final Acceptance:		
Project No: 01BASPC72608		Related Task Card:		A/C Area: 09				
Internal Check:		Check Type:		Work Order NO:		Tally Sequence NO: 388		
ENCLOSURE: ☒ CMR: ☐ CPCP: ☐ ETOPS: ☐ CDCCL: ☐ AD: ☐ ALI: ☐								
Type Code: DET		Special Code: INSP		MSG Code: MRB		Request: INSPECTION		
I HEREBY CERTIFY THAT ALL WARNINGS AND CAUTIONS HAVE BEEN READ AND THE WORK HAS BEEN CARRIED OUT IN ACCORDING WITH ALL LAID DOWN PROCEDURES, ATTACHED NOTES AND INFORMATION.								
Zones: 715,716								
DOCUMENT REFERENCES:								
Doc Typ		Reference						
AMM		52-82-00-220-801-A						
AMM		528200-220-801						
ACCESS PANELS:								
MATERIAL REQUIREMENTS:								
Part Number		Description				Qty.		
No parts assigned to this Task Item								
TOOLING REQUIREMENTS:								
Part Number		Description				Qty.		
No tools assigned to this Task Item								
TASK INSTRUCTION								
Job Description								
A. PERFORM A DETAILED INSPECTION OF THE AFT NOSE LANDING GEAR DOORS AFT FITTINGS AS PER AMM TASK 52-82-00-220-801-A.								
STEP COMPLETION SIGN OFF:								
	Qualification / Skill	Number of employees	Duration		Number./Signature	Date		
						Day	Month	Year
Mechanic/s				HRS				
Insp.	INSP/II			HRS				
-Aircraft Maintenance Manual used: Revision No. _____ Dated._____. Task card finding (Tick Applicable Box) [] Yes [] No. If yes update the system and list Task card finding WO below Work order No: _____ _____ Note: Make sure to create the finding Work Order on task card level. Remark's: _____ _____								



Task Card Title:

NLG AFT DOOR AFT FITTINGS INSPECTION

Task Card NO:

528223-01-1

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

(1) If Task card interrupted or performed by different personals updates the system and update the following accordingly (Tick Applicable Box)

- Interruption No. 1 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 2 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 3 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 4 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 5 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____

(2) Record any dimension or torque through the performed steps and sign-off as applicable:

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____

**Task Completion Close Up And
System Update**

Station**Date****Signature**

 MET.31575944		Task Card Title: SDI (ENDOSCOPE) OF FWD PAX/CREW DOOR CUTOUT, INT ERCOSTALS FITTINGS N°7 BETWEEN FR15-16 & FR20-21, LH					
Task Card NO: 531101-02-1		Work Package: /RH ASP/H-26 C7-CHK		A/C Registration: HZ-ASP			
A/C Type: 321		Single Running Taskcard		Main Skill: IL,INSP,CAB,ACFT_TECH		PROD Final Acceptance:	
Project No: 01BASPC72608		Related Task Card:		A/C Area: 05			
Internal Check:		Check Type:		Work Order NO:		Tally Sequence NO: 389	
ENCLOSURE: ☒ CMR: ☐ CPCP: ☐ ETOPS: ☐ CDCCL: ☐ AD: ☐ ALI: ☒							
Type Code: SDI		Special Code: CAB		MSG Code: ALI		Request: Phase: LOSEUP, JOB-CLOSEUP, JOB-CLOSEUP, JOB-CLOSEUP, SEUP, JOB-CLOSEUP	
I HEREBY CERTIFY THAT ALL WARNINGS AND CAUTIONS HAVE BEEN READ AND THE WORK HAS BEEN CARRIED OUT IN ACCORDING WITH ALL LAID DOWN PROCEDURES, ATTACHED NOTES AND INFORMATION.							
Zones: 221,222							
DOCUMENT REFERENCES:							
Doc Typ		Reference					
AMM		53-11-00-200-804-A					
AMM		531100-200-804					
ACCESS PANELS:							
MATERIAL REQUIREMENTS:							
Part Number		Description				Qty.	
LOTOXANE		NON-AQUEOUS CLEANER				1.0	
TOOLING REQUIREMENTS:							
Part Number		Description				Qty.	
No tools assigned to this Task Item							
PREPARATION							
Job Description							
A. PERFORM JOB SET UP AS PER AMM TASK 53-11-00-200-804-A.							
STEP COMPLETION SIGN OFF:							
	Qualification / Skill	Number of employees	Duration		Number./Signature	Date	
				HRS		Day	Month
Mechanic/s	CAB/ACFT_TECH			HRS			
Insp.				HRS			
PREPARATION							
Job Description							
B. CLEAN THE INSPECTION AREA AS REQUIRED.							
STEP COMPLETION SIGN OFF:							
	Qualification / Skill	Number of employees	Duration		Number./Signature	Date	
						Day	Month



Task Card Title:

SDI (ENDOSCOPE) OF FWD PAX/CREW DOOR CUTOUT, INTERCOSTALS FITTINGS N°7 BETWEEN FR15-16 & FR20-21, LH


Task Card NO:

531101-02-1

Work Package: /RH

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

Mechanic/s	CAB/ACFT_TECH			HRS			
Insp.				HRS			

TASK INSTRUCTION**Job Description**

A. PERFORM A SPECIAL DETAILED INSPECTION OF THE LH FORWARD PASSENGER/CREW DOOR CUTOUT, INTERCOSTALS FITTINGS N°7 BETWEEN FR 15-16 AND FR 20-21 (REF. NTM 519000) AS PER AMM TASK 53-11-00-200-804-A.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year
Mechanic/s			HRS				
Insp.	II/INSP		HRS				

TASK INSTRUCTION**Job Description**

B. PERFORM A SPECIAL DETAILED INSPECTION OF THE RH FORWARD PASSENGER/CREW DOOR CUTOUT, INTERCOSTALS FITTINGS N°7 BETWEEN FR 15-16 AND FR 20-21 (REF. NTM 519000) AS PER AMM TASK 53-11-00-200-804-A.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year
Mechanic/s			HRS				
Insp.	II/INSP		HRS				

CLOSE UP**Job Description**

A. OK TO INSTALL THE INSULATION BLANKETS.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year
Mechanic/s			HRS				
Insp.	II/INSP		HRS				

CLOSE UP**Job Description**

B. INSTALL THE INSULATION BLANKETS AROUND THE FRAME OF THE PASSENGER/CREW DOOR (REF. AMM TASK 25-80-00-400-001-A).

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year
Mechanic/s	CAB/ACFT_TECH		HRS				
Insp.	II/INSP		HRS				

CLOSE UP**Job Description**



Task Card Title:

**SDI (ENDOSCOPE) OF FWD PAX/CREW DOOR CUTOUT, INT
ERCOSTALS FITTINGS N°7 BETWEEN FR15-16 & FR20-21, LH**


Task Card NO:

531101-02-1

Work Package: /RH

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

C. OK TO INSTALL THE LINING PANELS.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration		Number./Signature	Date		
						Day	Month	Year
Mechanic/s				HRS				
Insp.	II/INSP			HRS				

CLOSE UP**Job Description**

D. INSTALL THE LINING PANELS AROUND THE FRAME OF THE PASSENGER/CREW DOOR BETWEEN FR16 AND FR20 (REF. AMM TASK 25-23-45-400-006-A AND AMM TASK 25-23-45-400-007-A).

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration		Number./Signature	Date		
						Day	Month	Year
Mechanic/s	CAB/ACFT_TECH			HRS				
Insp.	INSP/II			HRS				

CLOSE UP**Job Description**

E. OK TO INSTALL THE CEILING PANEL.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration		Number./Signature	Date		
						Day	Month	Year
Mechanic/s				HRS				
Insp.	II/INSP			HRS				

CLOSE UP**Job Description**

F. INSTALL THE CEILING PANEL ON FR 15 AND FR 21 (REF. AMM TASK 25-23-41-400-001-A).

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration		Number./Signature	Date		
						Day	Month	Year
Mechanic/s	CAB/ACFT_TECH			HRS				
Insp.	INSP/II			HRS				

-Aircraft Maintenance Manual used: Revision No. _____ Dated. _____.

Task card finding (Tick Applicable Box) [] Yes [] No. If yes update the system and list Task card finding WO below

Work order No: _____

Note: Make sure to creat the finding Work Order on task card level.

Remark's: _____



Task Card Title:

**SDI (ENDOSCOPE) OF FWD PAX/CREW DOOR CUTOUT, INT
ERCOSTALS FITTINGS N°7 BETWEEN FR15-16 & FR20-21, LH**


Task Card NO:

531101-02-1

Work Package: /RH

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

(1) If Task card interrupted or performed by different personals updates the system and update the following according (Tick Applicable Box)

- Interruption No. 1 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 2 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 3 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 4 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 5 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____

(2) Record any dimension or torque through the performed steps and sign-off as applicable:

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____

**Task Completion Close Up And
System Update**

Station**Date****Signature**

 MET.31575943		Task Card Title: SDI (ENDOSCOPE) OF FWD PAX/CREW DOOR CUTOUT,INTE RCOSTALS FITTINGS NO.1 BETWEEN FR15-16 & FR20-21,LH/				
Task Card NO: 531101-04-1		Work Package: RH ASP/H-26 C7-CHK		A/C Registration: HZ-ASP		
A/C Type: 321		Single Running Taskcard		Main Skill: INSP,II,CAB,ACFT_TECH		PROD Final Acceptance:
Project No: 01BASPC72608		Related Task Card:		A/C Area: 05		
Internal Check:		Check Type:		Work Order NO:		
				Tally Sequence NO: 390		
ENCLOSURE: ☒ CMR: ☐ CPCP: ☐ ETOPS: ☐ CDCCL: ☐ AD: ☐ ALI: ☒						
Type Code: SDI		Special Code: CAB, INSP, NDT		MSG Code: ALI		Request:
Phase:						
I HEREBY CERTIFY THAT ALL WARNINGS AND CAUTIONS HAVE BEEN READ AND THE WORK HAS BEEN CARRID OUT IN ACCORDING WITH ALL LAID DOWN PROCEDURES, ATTACHED NOTES AND INFORMATION.						
Zones: 211,221,222						
DOCUMENT REFERENCES:						
Doc Typ		Reference				
ALI		531101-04-1				
AMM		53-11-00-290-801-A				
AMM		531100-290-801				
ACCESS PANELS:						
831, 841						
MATERIAL REQUIREMENTS:						
Part Number		Description				Qty.
LOTOXANE		NON-AQUEOUS CLEANER				1.0
AV 30		PREVENTIVE - HEAVY DUTY HARD FILM				1.0
TOOLING REQUIREMENTS:						
Part Number		Description				Qty.
No tools assigned to this Task Item						
TASK PREPARATION						
Job Description						
A. PERFORM JOB SET UP AND PERFORM THE FOLLOWING AS PER AMM TASK 53-11-00-290-801-A: (1) REMOVE THE APPLICABLE CEILING PANELS BETWEEN FR15 AND FR21 TO GET ACCESS TO THE INSPECTION AREA (REF. AMM TASK 25-23-41-000-001-A). (2) REMOVE THE APPLICABLE DOOR FRAME LININGS AT FR16 AND FR20 TO GET ACCESS TO THE INSPECTION AREA (REF. AMM TASK 25-23-45-000-002-A AND AMM TASK 25-23-45-000-005-A). (3) REMOVE THE APPLICABLE INSULATION BLANKETS AT FR16 AND FR20 TO GET ACCESS TO THE INSPECTION AREA (REF. AMM TASK 25-80-00-000-001-A).						
STEP COMPLETION SIGN OFF:						
Qualification / Skill		Number of employees	Duration	Number./Signature	Date	
					Day	Month
					Year	



Task Card Title:

SDI (ENDOSCOPE) OF FWD PAX/CREW DOOR CUTOUT,INTE**RCOSTALS FITTINGS NO.1 BETWEEN FR15-16 & FR20-21,LH/**

Task Card NO:

531101-04-1

Work Package: RH

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

Mechanic/s	CAB/ACFT_TECH			HRS			
------------	---------------	--	--	-----	--	--	--

Insp.				HRS			
-------	--	--	--	-----	--	--	--

TASK PREPARATION**Job Description**

B. CLEAN THE INSPECTION AREA AS REQUIRED AND REMOVE THE TPS LAYER (REF. AMM TASK 51-78-00-916-001-A).

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year
Mechanic/s	CAB/ACFT_TECH			HRS			
Insp.				HRS			

TASK INSTRUCTIONS**Job Description**

A. PERFORM A SPECIAL DETAILED INSPECTION OF LEFT AND RIGHT INTERCOSTAL FITTINGS 1 OF THE FORWARD PASSENGER/CREW-DOOR CUTOUT (REF. NTM 531101) AS PER AMM TASK 53-11-00-290-801-A. PERFORM THIS INSPECTION BETWEEN FR15 AND FR16 AND BETWEEN FR20 AND FR21.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year
Mechanic/s				HRS			
Insp.	INSP/II			HRS			

TASK CLOSE UP**Job Description**

A. APPLY A NEW LAYER OF CORROSION PREVENTIVE COMPOUND-WATER DISPLACING & HEAVY DUTY HARD FILM (REF. AMM TASK 51-78-00-916-001-A).

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year
Mechanic/s	CAB/ACFT_TECH			HRS			
Insp.	II/INSP			HRS			

TASK CLOSE UP**Job Description**

B. OK TO INSTALL THE REMOVED INSULATION BLANKETS AT FR16 AND FR20.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year
Mechanic/s				HRS			
Insp.	INSP/II			HRS			

TASK CLOSE UP**Job Description**



Task Card Title:

SDI (ENDOSCOPE) OF FWD PAX/CREW DOOR CUTOUT,INTE**RCOSTALS FITTINGS NO.1 BETWEEN FR15-16 & FR20-21,LH/**

Task Card NO:

531101-04-1

Work Package: RH

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

C. INSTALL THE REMOVED INSULATION BLANKETS AT FR16 AND FR20 (REF.AMM TASK 25-80-00-400-001-A).

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration		Number./Signature	Date		
						Day	Month	Year
Mechanic/s	CAB/ACFT_TECH			HRS				
Insp.	INSP/II			HRS				

TASK CLOSE UP**Job Description**

F. OK TO INSTALL THE REMOVED DOOR FRAME LININGS AT FR16 AND FR20.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration		Number./Signature	Date		
						Day	Month	Year
Mechanic/s				HRS				
Insp.	INSP/II			HRS				

TASK CLOSE UP**Job Description**

G. INSTALL THE REMOVED DOOR FRAME LININGS AT FR16 AND FR20 (REF. AMM TASK 25-23-45-400-006-A AND AMM TASK 25-23-45-400-007-A).

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration		Number./Signature	Date		
						Day	Month	Year
Mechanic/s	CAB/ACFT_TECH			HRS				
Insp.	INSP/II			HRS				

TASK CLOSE UP**Job Description**

H. OK TO INSTALL THE REMOVED CEILING PANELS BETWEEN FR15 AND FR21.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration		Number./Signature	Date		
						Day	Month	Year
Mechanic/s				HRS				
Insp.	INSP/II			HRS				

TASK CLOSE UP**Job Description**

I. INSTALL THE REMOVED CEILING PANELS BETWEEN FR15 AND FR21 (REF. AMM TASK 25-23-41-400-001-A).

STEP COMPLETION SIGN OFF:



Task Card Title:

SDI (ENDOSCOPE) OF FWD PAX/CREW DOOR CUTOUT,INTE**RCOSTALS FITTINGS NO.1 BETWEEN FR15-16 & FR20-21,LH/**

Task Card NO:

531101-04-1

Work Package: RH

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year
Mechanic/s	CAB/ACFT_TECH		HRS				
Insp.	INSP/II		HRS				

-Aircraft Maintenance Manual used: Revision No. _____ Dated. _____.

Task card finding (Tick Applicable Box) [] Yes [] No. If yes update the system and list Task card finding WO below

Work order No: _____

_____, _____, _____, _____, _____, _____, _____, _____

Note: Make sure to creat the finding Work Order on task card level.

Remark's: _____

_____, _____, _____, _____, _____, _____, _____, _____

(1) If Task card interrupted or performed by different personals updates the system and update the following accord (Tick Applicable Box)

- Interruption No. 1 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

- Interruption No. 2 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

- Interruption No. 3 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

- Interruption No. 4 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

- Interruption No. 5 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

(2) Record any dimension or torque through the performed steps and sign-off as applicable:

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

Task Completion Close Up And System Update	Station	Date	Signature

 MET.32721819		Task Card Title: AVIONICS DOORS SURROUND INSPECTION					
Task Card NO: 531111-02-1		Work Package: ASP/H-26 C7-CHK		A/C Registration: HZ-ASP			
A/C Type: 321		Single Running Taskcard		Main Skill: INSP,IL,AV,ACFT_TECH		PROD Final Acceptance:	
Project No: 01BASPC72608		Related Task Card:		A/C Area:			
Internal Check:		Check Type:		Work Order NO:		Tally Sequence NO: 391	
ENCLOSURE: ☐ CMR: ☐ CPCP: ☐ ETOPS: ☐ CDCCL: ☐ AD: ☐ ALI: ☒							
Type Code: DET		Special Code: INSP		MSG Code: ALI		Request: Phase:	
I HEREBY CERTIFY THAT ALL WARNINGS AND CAUTIONS HAVE BEEN READ AND THE WORK HAS BEEN CARRIED OUT IN ACCORDING WITH ALL LAID DOWN PROCEDURES, ATTACHED NOTES AND INFORMATION.							
Zones: 100							
DOCUMENT REFERENCES:							
Doc Typ		Reference					
ALI		531111-02-1					
AMM		53-11-00-220-813-A					
AMTOSS		AMT 531100-220-813					
ACCESS PANELS:							
MATERIAL REQUIREMENTS:							
Part Number		Description				Qty.	
No parts assigned to this Task Item							
TOOLING REQUIREMENTS:							
Part Number		Description				Qty.	
No tools assigned to this Task Item							
TASK PREPARATION							
Job Description							
A. PERFORM JOB SETUP AND CLEAN THE INSPECTION AREAS WITH CLEANING AGENTS AND A CLEAN LINT-FREE COTTONCLOTH, IF NECESSARY AS PER AMM TASK 53-11-00-220-813-A. NOTE: DO NOT OPEN THE AVIONICS COMPARTMENT DOORS.							
STEP COMPLETION SIGN OFF:							
Qualification / Skill		Number of employees		Duration		Number./Signature	
Date							
Day Month Year							
Mechanic/s		AV/ACFT_TECH		HRS			
Insp.				HRS			
TASK INSTRUCTION							
Job Description							
A. PERFORM A DETAILED VISUAL INSPECTION OF THE EXTERNAL SURFACE (4 DOORS) OF THE SURROUND CORNERS OF THE AVIONICS COMPARTMENT DOORS FOR DAMAGE OR DISCONTINUITIES AS PER							



MET.32721819

Task Card Title:

AVIONICS DOORS SURROUND INSPECTION



Task Card NO:

531111-02-1

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

AMM TASK 53-11-00-220-813-A.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration	HRS	Number./Signature	Date		
						Day	Month	Year
Mechanic/s				HRS				
Insp.	INSP/II			HRS				

-Aircraft Maintenance Manual used: Revision No. _____ Dated. _____.

Task card finding (Tick Applicable Box) [] Yes [] No. If yes update the system and list Task card finding WO below

Work order No: _____

Note: Make sure to create the finding Work Order on task card level.

Remark's: _____

(1) If Task card interrupted or performed by different persons updates the system and update the following accordingly (Tick Applicable Box)

- Interruption No. 1 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 2 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 3 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 4 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 5 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____

(2) Record any dimension or torque through the performed steps and sign-off as applicable:

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____Task Completion Close Up And
System Update

Station

Date

Signature

 MET.31486316		Task Card Title: FUSELAGE SKIN ATTACHMENT					
Task Card NO: 531113-03-1		Work Package: ASP/H-26 C7-CHK		A/C Registration: HZ-ASP			
A/C Type: 321		Single Running Taskcard		Main Skill: II,INSP,ACFT_TECH,AP		PROD Final Acceptance:	
Project No: 01BASPC72608		Related Task Card:		A/C Area:			
Internal Check:		Check Type:		Work Order NO:			
						Tally Sequence NO: 392	
ENCLOSURE: ☐ CMR: ☐ CPCP: ☐ ETOPS: ☐ CDCCL: ☐ AD: ☐ ALI: ☒							
Type Code: GVI		Special Code: AP		MSG Code: ALI		Request: Phase: JOB-SETUP,INSPECTION,JOB-CLOSEUP	
I HEREBY CERTIFY THAT ALL WARNINGS AND CAUTIONS HAVE BEEN READ AND THE WORK HAS BEEN CARRIED OUT IN ACCORDING WITH ALL LAID DOWN PROCEDURES, ATTACHED NOTES AND INFORMATION.							
Zones: 195,196							
DOCUMENT REFERENCES:							
Doc Typ		Reference					
ALI		531113-03-1					
AMM		53-11-00-210-825-A					
AMM		531100-210-825					
ACCESS PANELS:							
195BB, 196BB							
MATERIAL REQUIREMENTS:							
Part Number		Description				Qty.	
No parts assigned to this Task Item							
TOOLING REQUIREMENTS:							
Part Number		Description				Qty.	
No tools assigned to this Task Item							
JOB-SETUP							
Job Description							
1. A. PERFORM JOB SET UP FOR GENERAL VISUAL INSPECTION OF ATTACHMENT TO SKIN PANEL, FR16, FROM STRINGER 3 LH TO STRINGER 3 RH, EXTERNAL SURFACE AS PER AMM 53-11-00-210-825-A.							
STEP COMPLETION SIGN OFF:							
	Qualification / Skill	Number of employees	Duration		Number./Signature	Date	
				HRS		Day	Month
Mechanic/s	ACFT_TECH/AP			HRS			
Insp.				HRS			
PROCEDURE							
Job Description							



MET.31486316

Task Card Title:

FUSELAGE SKIN ATTACHMENT



Task Card NO:

531113-03-1

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

2.

A. PERFORM GENERAL VISUAL INSPECTION OF ATTACHMENT TO SKIN PANEL, FR16, FROM STRINGER 3 LH TO STRINGER 3 RH, EXTERNAL SURFACE AS PER AMM 53-11-00-210-825-A.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year
Mechanic/s			HRS				
Insp.	II/INSP		HRS				

CLOSE-UP

Job Description

3.

A. JOB-CLOSEUP AND RETURN AIRCRAFT BACK TO NORMAL AS PER AMM 53-11-00-210-825-A.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year
Mechanic/s	ACFT_TECH/AP		HRS				
Insp.			HRS				

-Aircraft Maintenance Manual used: Revision No. _____ Dated. _____.

Task card finding (Tick Applicable Box) [] Yes [] No. If yes update the system and list Task card finding WO below

Work order No: _____

Note: Make sure to create the finding Work Order on task card level.

Remark's: _____



Task Card Title:

FUSELAGE SKIN ATTACHMENT

Task Card NO:

531113-03-1

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

(1) If Task card interrupted or performed by different personals updates the system and update the following according (Tick Applicable Box)

- Interruption No. 1 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 2 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 3 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 4 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 5 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____

(2) Record any dimension or torque through the performed steps and sign-off as applicable:

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____

**Task Completion Close Up And
System Update**

Station**Date****Signature**

 MET.25471528		Task Card Title: FR20 SPLICE STRUCTURE LWR STGR INSP					
Task Card NO: 531124-01-1		Work Package: ASP/H-26 C7-CHK			A/C Registration: HZ-ASP		
A/C Type: 321		Single Running Taskcard		Main Skill: IL,INSP,AF,ACFT_TECH		PROD Final Acceptance:	
Project No: 01BASPC72608		Related Task Card:		A/C Area: 09			
Internal Check:		Check Type:		Work Order NO:		Tally Sequence NO: 393	
ENCLOSURE: ☒ CMR: ☐ CPCP: ☐ ETOPS: ☐ CDCCL: ☐ AD: ☐ ALI: ☒							
Type Code: DET		Special Code: AF		MSG Code: ALI		Request: CLEAN-UP,INSPECTION	
I HEREBY CERTIFY THAT ALL WARNINGS AND CAUTIONS HAVE BEEN READ AND THE WORK HAS BEEN CARRIED OUT IN ACCORDING WITH ALL LAID DOWN PROCEDURES, ATTACHED NOTES AND INFORMATION.							
Zones: 100,127,128							
DOCUMENT REFERENCES:							
Doc Typ		Reference					
ALI		531124-01-1					
AMM		53-11-00-210-011-A					
AMM		531100-210-011					
ACCESS PANELS:							
MATERIAL REQUIREMENTS:							
Part Number		Description				Qty.	
LOTOXANE		NON-AQUEOUS CLEANER				1.0	
TOOLING REQUIREMENTS:							
Part Number		Description				Qty.	
No tools assigned to this Task Item							
PREPARATION							
Job Description							
A. CLEAN THE INSPECTION AREA AS REQUIRED.							
STEP COMPLETION SIGN OFF:							
		Qualification / Skill		Number of employees		Duration	
						Number./Signature	
						Date	
						Day Month Year	
Mechanic/s		AF/ACFT_TECH				HRS	
Insp.						HRS	
TASK INSTRUCTION							
Job Description							
A. PERFORM A DETAILED INSPECTION OF LH AND RH STRUCTURE OF THE SPLICES OF FR20 AT THE LOWER STRINGERS STGR30 AND STGR32 AS PER AMM 53-11-00-210-011-A.							
STEP COMPLETION SIGN OFF:							



Task Card Title:

FR20 SPLICE STRUCTURE LWR STGR INSP

Task Card NO:

531124-01-1

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

	Qualification / Skill	Number of employees	Duration		Number./Signature	Date		
				HRS		Day	Month	Year
Mechanic/s				HRS				
Insp.	II/INSP			HRS				

-Aircraft Maintenance Manual used: Revision No. _____ Dated. _____.

Task card finding (Tick Applicable Box) [] Yes [] No. If yes update the system and list Task card finding WO below

Work order No: _____

_____, _____, _____, _____, _____, _____, _____, _____, _____, _____

Note: Make sure to creat the finding Work Order on task card level.

Remark's: _____

(1) If Task card interrupted or performed by different personals updates the system and update the following accord (Tick Applicable Box)

- Interruption No. 1 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

- Interruption No. 2 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

- Interruption No. 3 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

- Interruption No. 4 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

- Interruption No. 5 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

(2) Record any dimension or torque through the performed steps and sign-off as applicable:

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

**Task Completion Close Up And
System Update****Station****Date****Signature**

 MET.32722079	Task Card Title: WINDSHIELD CTR POST UPPER ATTACHMENT INSP						
Task Card NO: 531131-02-1		Work Package: ASP/H-26 C7-CHK		A/C Registration: HZ-ASP			
A/C Type: 321		Single Running Taskcard		Main Skill: STR,II,INSP,RII,NDT_INSP,CAB, ACFT_TECH,NDT		PROD Final Acceptance:	
Project No: 01BASPC72608							
Internal Check:		Check Type:		Work Order NO:			
ENCLOSURE: ☒ CMR: ☐ CPCP: ☐ ETOPS: ☐ CDCCL: ☐ AD: ☐ ALI: ☒							
Type Code: SDI		Special Code: CAB		MSG Code: ALI		Request: Phase:	
I HEREBY CERTIFY THAT ALL WARNINGS AND CAUTIONS HAVE BEEN READ AND THE WORK HAS BEEN CARRIED OUT IN ACCORDING WITH ALL LAID DOWN PROCEDURES, ATTACHED NOTES AND INFORMATION.							
Zones: 211,212							
DOCUMENT REFERENCES:							
Doc Typ		Reference					
ALI		531131-02-1					
AMM		53-11-00-200-803-A					
AMM		531100-200-803					
ACCESS PANELS:							
211LC, 211MC, 211MW, 212LC							
MATERIAL REQUIREMENTS:							
Part Number		Description				Qty.	
LOTOXANE		NON-AQUEOUS CLEANER				1.0	
TOOLING REQUIREMENTS:							
Part Number		Description				Qty.	
No tools assigned to this Task Item							
PREPARATION							
Job Description							
A. PERFORM JOB SET UP AS PER AMM TASK 53-11-00-200-803-A.							
STEP COMPLETION SIGN OFF:							
	Qualification / Skill	Number of employees	Duration		Number./Signature	Date	
				HRS		Day	Month
Mechanic/s	CAB/ACFT_TECH			HRS			
Insp.				HRS			
PREPARATION							
Job Description							
B. REMOVE THE FASTENERS FROM THE HOLES TO BE INSPECTED (REF. SRM 514000) AS PER AMM TASK 53-11-00-200-803-A.							
STEP COMPLETION SIGN OFF:							



Task Card Title:

WINDSHIELD CTR POST UPPER ATTACHMENT INSP

Task Card NO:

531131-02-1

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

	Qualification / Skill	Number of employees	Duration		Number./Signature	Date		
						Day	Month	Year
Mechanic/s	STR/ACFT_TECH			HRS				
Insp.				HRS				

PREPARATION**Job Description**

C. CLEAN THE INSPECTION AREA AS REQUIRED.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration		Number./Signature	Date		
						Day	Month	Year
Mechanic/s	STR/ACFT_TECH			HRS				
Insp.				HRS				

TASK INSTRUCTION**Job Description**

A. PERFORM A GENERAL VISUAL CHECK OF THE INSPECTION AREA FOR DAMAGE OR DISCONTINUITIES AS PER AMM TASK 53-11-00-200-803-A.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration		Number./Signature	Date		
						Day	Month	Year
Mechanic/s				HRS				
Insp.	II/INSP			HRS				

TASK INSTRUCTION**Job Description**

B. PERFORM A SPECIAL DETAILED INSPECTION (ROTO) OF LEFT AND RIGHT WINDSHIELD CENTER POST INTERNAL SURFACE, 2 FASTENER HOLES, UPPER ATTACHMENT AREA, (REF. NTM 531131) AS PER AMM TASK 53-11-00-200-803-A.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration		Number./Signature	Date		
						Day	Month	Year
Mechanic/s				HRS				
Insp.	NDT_INSP/NDT			HRS				

CLOSE UP**Job Description**

A. INSTALL THE FASTENERS OF THE INSPECTED HOLES (REF. SRM 514200).

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration		Number./Signature	Date		
						Day	Month	Year
Mechanic/s	STR/ACFT_TECH			HRS				

 MET.32722079	Task Card Title: WINDSHIELD CTR POST UPPER ATTACHMENT INSP							
Task Card NO: 531131-02-1		Work Package: ASP/H-26 C7-CHK		A/C Registration: HZ-ASP				
Insp.	INSP/RII			HRS				
CLOSE UP								
Job Description								
B. OK TO INSTALL THE WINDSHIELDS.								
STEP COMPLETION SIGN OFF:								
	Qualification / Skill	Number of employees	Duration		Number./Signature	Date		
						Day	Month	Year
Mechanic/s				HRS				
Insp.	II/INSP			HRS				
CLOSE UP								
Job Description								
C. INSTALL THE WINDSHIELDS (REF. AMM TASK 56-11-11-400-001-A AND AMM TASK 56-11-11-400-001-A-01).								
STEP COMPLETION SIGN OFF:								
	Qualification / Skill	Number of employees	Duration		Number./Signature	Date		
						Day	Month	Year
Mechanic/s	CAB/ACFT_TECH			HRS				
Insp.	INSP/RII			HRS				
-Aircraft Maintenance Manual used: Revision No. _____ Dated. _____. Task card finding (Tick Applicable Box) [☐] Yes [☐] No. If yes update the system and list Task card finding WO below Work order No: _____ _____ Note: Make sure to creat the finding Work Order on task card level. Remark's: _____ _____								



Task Card Title:

WINDSHIELD CTR POST UPPER ATTACHMENT INSP

Task Card NO:

531131-02-1

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

(1) If Task card interrupted or performed by different personals updates the system and update the following accordingly (Tick Applicable Box)

- Interruption No. 1 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 2 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 3 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 4 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 5 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____

(2) Record any dimension or torque through the performed steps and sign-off as applicable:

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____

**Task Completion Close Up And
System Update**

Station**Date****Signature**

 MET.32722081		Task Card Title: SPECIAL DETAILED INSPECTION (ROTO) OF WINDSHIELD SIDE POST AT FR 4, UPPER ATTACHMENT, INTERNAL SIDE,					
Task Card NO: 531135-03-1		Work Package: LH/RH ASP/H-26 C7-CHK		A/C Registration: HZ-ASP			
A/C Type: 321		Single Running Taskcard		Main Skill: STR, INSP, II, CAB, LB, A-PAINT, AC FT_TECH, CLEANER, NDT		PROD Final Acceptance:	
Project No: 01BASPC72608		Related Task Card:		A/C Area: 06			
Internal Check:		Check Type:		Work Order NO:		Tally Sequence NO: 395	
ENCLOSURE: ☐ CMR: ☐ CPCP: ☐ ETOPS: ☐ CDCCL: ☐ AD: ☐ ALI: ☒							
Type Code: SDI		Special Code:		MSG Code: ALI		Request:	
						Phase:	
I HEREBY CERTIFY THAT ALL WARNINGS AND CAUTIONS HAVE BEEN READ AND THE WORK HAS BEEN CARRIED OUT IN ACCORDING WITH ALL LAID DOWN PROCEDURES, ATTACHED NOTES AND INFORMATION.							
Zones: 210,211,212							
DOCUMENT REFERENCES:							
Doc Typ		Reference					
ALI		531135-03-1					
AMM		53-11-00-280-803-A					
AMM		531100-280-803					
ACCESS PANELS:							
211BC, 211KC, 211LC, 211NW, 212BC, 212KC, 212LC, 212NW							
MATERIAL REQUIREMENTS:							
Part Number		Description				Qty.	
LOTOXANE		NON-AQUEOUS CLEANER				1.0	
08BAA9		NON AQUEOUS CLEANER - GENERAL				1.0	
14SBA1		TEXTILE - LINT FREE COTTON AMS3819				1.0	
TOOLING REQUIREMENTS:							
Part Number		Description				Qty.	
No tools assigned to this Task Item							
TASK PREPARATION							
Job Description							
A. PERFORM JOB SET-UP AS PER AMM TASK 53-11-00-280-803-A AND PERFORM THE FOLLOWINGS: (1) OPEN THE SLIDING WINDOW (REF. AMM TASK 56-12-11-010-001-A) . (2) REMOVE THE WINDSHIELD SUNVISOR (REF. AMM TASK 25-13-11-000-001-A) . (3) REMOVE LINING PANELS 211NW (212NW), 211BC (212BC) AND 211KC (212KC) TO GET ACCESS TO THE INSPECTION AREA. (4) REMOVE THE SUPPORTS (1) AND (5), IF INSTALLED AND NECESSARY.							
STEP COMPLETION SIGN OFF:							
	Qualification / Skill	Number of employees	Duration		Number./Signature	Date	
						Day	Month
Mechanic/s	CAB/ACFT_TECH			HRS			Year
Insp.				HRS			



Task Card Title:

SPECIAL DETAILED INSPECTION (ROTO) OF WINDSHIELD**SIDE POST AT FR 4, UPPER ATTACHMENT, INTERNAL SIDE,**

Task Card NO:

531135-03-1

Work Package: LH/RH

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP**TASK PREPARATION****Job Description**

B. REMOVE THE FASTENERS TO DO AN INSPECTION OF THE HOLES (REF. SRM 51-42-00).
(REF AMM 53-11-00-280-803-A)

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration		Number./Signature	Date		
						Day	Month	Year
Mechanic/s	STR/ACFT_TECH			HRS				
Insp.				HRS				

TASK PREPARATION**Job Description**

C. CLEAN THE INSPECTION AREA AND REMOVE THE SEALANT AND/OR PAINT IF NECESSARY.
(REF AMM 53-11-00-280-803-A)

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration		Number./Signature	Date		
						Day	Month	Year
Mechanic/s	LB/CLEANER			HRS				
Insp.				HRS				

TASK INSTRUCTIONS**Job Description**

A. PERFORM A SPECIAL DETAILED INSPECTION OF THE WINDSHIELD SIDE POST AT FR4, UPPER ATTACHMENT ON THE INTERNAL SIDE (LEFT AND RIGHT SIDES) AS PER AMM TASK 53-11-00-280-803-A, FOR DAMAGE AND DISCONTINUITIES (REF. NTM 531135).

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration		Number./Signature	Date		
						Day	Month	Year
Mechanic/s				HRS				
Insp.	INSP/NDT			HRS				

TASK CLOSE-UP**Job Description**

A. OK TO INSTALL THE FASTENERS IN THE EXAMINED HOLES PER AMM53-11-00-280-803-A.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration		Number./Signature	Date		
						Day	Month	Year
Mechanic/s				HRS				
Insp.	INSP/II			HRS				

TASK CLOSE-UP**Job Description**



Task Card Title:

SPECIAL DETAILED INSPECTION (ROTO) OF WINDSHIELD**SIDE POST AT FR 4, UPPER ATTACHMENT, INTERNAL SIDE,**

Task Card NO:

531135-03-1

Work Package: LH/RH

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

B. INSTALL NEW FASTENERS IN THE EXAMINED HOLES (REF. SRM 514200).

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year
Mechanic/s	STR/ACFT_TECH		HRS				
Insp.	INSP/II		HRS				

TASK CLOSE-UP**Job Description**

C. IF THE SEALANT AND/OR PAINT REMOVED FROM THE INSPECTION AREA, APPLY SEALANT (REF. SRM 51-24-00 OR PAINT REF. SRM 51-23-00).
(REF. 53-11-00-280-803-A)

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year
Mechanic/s	A-PAINT/ACFT_TECH H		HRS				
Insp.	II/INSP		HRS				

TASK CLOSE-UP**Job Description**

D. OK TO INSTALL THE SUPPORTS (1) AND (5), IF REMOVED PER AMM 53-11-00-280-803-A.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year
Mechanic/s			HRS				
Insp.	INSP/II		HRS				

TASK CLOSE-UP**Job Description**

E. INSTALL THE SUPPORTS (1) AND (5) AS PER AMM TASK 53-11-00-280-803-A.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year
Mechanic/s	CAB/ACFT_TECH		HRS				
Insp.	INSP/II		HRS				

TASK CLOSE-UP**Job Description**

F. OK TO INSTALL LINING PANELS AND THE WINDSHIELD SUNVISOR PER REF 53-11-00-280-803-A,

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year

 MET.32722081	Task Card Title: SPECIAL DETAILED INSPECTION (ROTO) OF WINDSHIELD SIDE POST AT FR 4, UPPER ATTACHMENT, INTERNAL SIDE,						
Task Card NO: 531135-03-1		Work Package: LH/RH ASP/H-26 C7-CHK		A/C Registration: HZ-ASP			
Mechanic/s 				HRS			
Insp. 		INSP/II		HRS			
TASK CLOSE-UP							
Job Description							
G. INSTALL LINING PANELS 211BC (212BC), 211KC (212KC), 211NW (212NW) AND INSTALL THE WINDSHIELD SUNVISOR (REF. AMM TASK 25-13-11-400-001-A). (REF 53-11-00-280-803-A)							
STEP COMPLETION SIGN OFF:							
	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year
Mechanic/s 		CAB/ACFT_TECH		HRS			
Insp. 		INSP/II		HRS			
-Aircraft Maintenance Manual used: Revision No. _____ Dated. _____. Task card finding (Tick Applicable Box) [☐] Yes [☐] No. If yes update the system and list Task card finding WO below Work order No: _____ _____ Note: Make sure to creat the finding Work Order on task card level. Remark's: _____ _____							



Task Card Title:

SPECIAL DETAILED INSPECTION (ROTO) OF WINDSHIELD**SIDE POST AT FR 4, UPPER ATTACHMENT, INTERNAL SIDE,**

Task Card NO:

531135-03-1Work Package **LH/RH****ASP/H-26 C7-CHK**

A/C Registration:

HZ-ASP

(1) If Task card interrupted or performed by different personals updates the system and update the following according (Tick Applicable Box)

- Interruption No. 1 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 2 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 3 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 4 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 5 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____

(2) Record any dimension or torque through the performed steps and sign-off as applicable:

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____

**Task Completion Close Up And
System Update**

Station**Date****Signature**

Copyright of Saudia Technic - Regeneration is not allowed without prior approval by Saudia Technic.



Task Card Title:
SPECIAL DETAILED INSPECTION (HFEC) OF DOOR FR 16, L



H/RH

Task Card NO:

531153-04-1

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

53-11-00-280-811-A.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year
Mechanic/s	ACFT_TECH/CLEANER			HRS			
Insp.				HRS			

TASK INSTRUCTION

Job Description

A. PERFORM A SPECIAL DETAILED INSPECTION OF THE AREA BETWEEN THE LINTEL AND INTERCOSTAL 6, ON DOOR FRAME 16, FOR DAMAGE OR DISCONTINUITIES REF. NTM 53-11-53 (AS PER AMM TASK 53-11-00-280-811-A).

NOTE: PERFORM THIS INSPECTION FROM THE INSIDE OF THE AIRCRAFT, ON THE LEFT AND RIGHT SIDESS (REF. NTM 53-11-53).

THIS INSPECTION DOES NOT INCLUDE THE AREA WITH THE TWO JOGGLES.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year
Mechanic/s				HRS			
Insp.	NDT_INSP/NDT			HRS			

TASK INSTRUCTION CONT:-

Job Description

TASK INSTRUCTION CONT:-

B. IF REMOVED, APPLY SEALANT AS PER AMM TASK 53-11-00-280-811-A.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year
Mechanic/s	CAB/ACFT_TECH			HRS			
Insp.	II/INSP			HRS			

TASK INSTRUCTION CONT:-

Job Description

TASK INSTRUCTION CONT:-

A. APPLY CORROSION PREVENTATION AS PER AMM TASK 53-11-00-280-811-A.
(AMM 51-78-00-916-001-A)

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year
Mechanic/s	CAB/ACFT_TECH			HRS			
Insp.	II/INSP			HRS			



Task Card Title:

SPECIAL DETAILED INSPECTION (HFEC) OF DOOR FR 16, L**H/RH**

Task Card NO:

531153-04-1

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP**JOB-CLOSEUP****Job Description**

A. OK TO INSTALL THE INSULATION BLANKETS AS PER 53-11-00-280-811-A.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year
Mechanic/s			HRS				
Insp.	II/INSP		HRS				

THE INSULATION BLANKETS & LINING PANELS INSTALLTION**Job Description**

A. INSTALL THE INSULATION BLANKETS AS PER (REF. AMM TASK 25-80-00-400-001-A).

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year
Mechanic/s	CAB/ACFT_TECH		HRS				
Insp.	II/INSP		HRS				

THE FWD GALLEYS AND LAVATORIES INSTALLTION**Job Description**

A. OK TO INSTALL LINING PANELS AS PER 53-11-00-280-811-A.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year
Mechanic/s			HRS				
Insp.	II/INSP		HRS				

JOB-CLOSEUP**Job Description**

A. INSTALL LINING PANELS AS PER (REF. AMM TASKS 25-23-45-400-006-A AND 25-23-45-400-007-A) AS PER AMM TASK 53-11-00-280-811-A.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year
Mechanic/s	CAB/ACFT_TECH		HRS				
Insp.			HRS				

Job Description

A. INSTALL THE FWD GALLEYS BETWEEN FR15 AND FR16, IF REMOVED AS PER 53-11-00-280-811-A.



MET.25434854

Task Card Title:

SPECIAL DETAILED INSPECTION (HFEC) OF DOOR FR 16, L**H/RH**

Task Card NO:

531153-04-1

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP**STEP COMPLETION SIGN OFF:**

	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year
Mechanic/s	CAB/ACFT_TECH		HRS				
Insp.			HRS				

LAVATORIES INSTALLTION**Job Description**

A. INSTALL THE LAVATORIES BETWEEN FR15 AND FR16, IF REMOVED AS PER 53-11-00-280-811-A.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year
Mechanic/s	CAB/ACFT_TECH		HRS				
Insp.			HRS				

Job Description

JOB-CLOSEUP CONT:-

A. PERFORM JOB CLOSE UP AS PER AMM 53-11-00-280-811-A.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year
Mechanic/s	CAB/ACFT_TECH		HRS				
Insp.			HRS				

-Aircraft Maintenance Manual used: Revision No. _____ Dated. _____.

Task card finding (Tick Applicable Box) [] Yes [] No. If yes update the system and list Task card finding WO below

Work order No: _____

_____, _____, _____, _____, _____, _____, _____, _____

Note: Make sure to creat the finding Work Order on task card level.

Remark's: _____

_____, _____, _____, _____, _____, _____, _____, _____



Task Card Title:

SPECIAL DETAILED INSPECTION (HFEC) OF DOOR FR 16, L**H/RH**

Task Card NO:

531153-04-1

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

(1) If Task card interrupted or performed by different personals updates the system and update the following accord (Tick Applicable Box)

- Interruption No. 1 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 2 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 3 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 4 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 5 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____

(2) Record any dimension or torque through the performed steps and sign-off as applicable:

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____

**Task Completion Close Up And
System Update**

Station**Date****Signature**

 MET.25524033		Task Card Title: SDI (HFEC) OF DOOR FR 20, BETWEEN LINTEL & INTERCO STAL 6, EXCEPT DOUBLE JOGGLE AREA, LH/RH					
Task Card NO: 531155-04-1		Work Package: ASP/H-26 C7-CHK		A/C Registration: HZ-ASP			
A/C Type: 321		Single Running Taskcard		Main Skill: II, INSP, NDT, INSP, CAB, ACFT_TECH, CLEANER, NDT		PROD Final Acceptance:	
Project No: 01BASPC72608		Related Task Card:		A/C Area:			
Internal Check:		Check Type:		Work Order NO:		Tally Sequence NO: 397	
ENCLOSURE: ☐ CMR: ☐ CPCP: ☐ ETOPS: ☐ CDCCL: ☐ AD: ☐ ALI: ☐							
Type Code: SDI		Special Code: CAB, INSP, NDT		MSG Code: ALI		Request: Phase: P, CLOSE-UP, JOB-CLOSEUP, JOB-CLOSEUP, JOB-CLOSEUP	
I HEREBY CERTIFY THAT ALL WARNINGS AND CAUTIONS HAVE BEEN READ AND THE WORK HAS BEEN CARRID OUT IN ACCORDING WITH ALL LAID DOWN PROCEDURES, ATTACHED NOTES AND INFORMATION.							
Zones: 221,222							
DOCUMENT REFERENCES:							
Doc Typ		Reference					
AMM		53-11-00-280-809-A					
AMM		531100-280-809					
ACCESS PANELS:							
831, 841							
MATERIAL REQUIREMENTS:							
Part Number		Description				Qty.	
LOTOXANE		NON-AQUEOUS CLEANER				1.0	
14SBA1		TEXTILE - LINT FREE COTTON AMS3819				1.0	
LPS 3		CPC- WATER DISPLACING SOFT FILM				1.0	
TOOLING REQUIREMENTS:							
Part Number		Description				Qty.	
No tools assigned to this Task Item							
TASK PREPARATION							
Job Description							
JOB-SETUP 1. A. PERFORM JOB SET UP AS PER AMM TASK 53-11-00-280-809-A, REMOVE THE FWD GALLEYS BETWEEN FR20 AND FR21, IF INSTALLED, THE NECESSARY LINING PANELS AT FR20 AND THE NECESSARY INSULATION BLANKETS.							
STEP COMPLETION SIGN OFF:							
	Qualification / Skill	Number of employees	Duration		Number./Signature	Date	
				HRS		Day	Month
Mechanic/s	CAB/ACFT_TECH			HRS			
Insp.				HRS			
TASK PREPARATION							
Job Description							
JOB-SETUP CONT:-							



Task Card Title:

SDI (HFEC) OF DOOR FR 20, BETWEEN LINTEL & INTERCO**STAL 6, EXCEPT DOUBLE JOGGLE AREA, LH/RH**

Task Card NO:

531155-04-1

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

1.

B. CLEAN THE INSPECTION AREA AS REQUIRED AND REMOVE THE SEALANT AND/OR PAINT IF NECESSARY PER AMM 53-11-00-280-809-A.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration		Number./Signature	Date		
						Day	Month	Year
Mechanic/s	ACFT_TECH/CLEANER			HRS				
Insp.				HRS				

TASK INSTRUCTION**Job Description**

2.

A. PERFORM A SPECIAL DETAILED INSPECTION OF THE AREA BETWEEN THE LINTEL AND INTERCOSTAL 6, ON DOOR FRAME 20, FOR DAMAGE OR DISCONTINUITIES REF. NTM 53-11-55 (AS PER AMM TASK 53-11-00-280-809-A).

NOTE: PERFORM THIS INSPECTION FROM THE INSIDE OF THE AIRCRAFT, ON THE LEFT AND RIGHT SIDESS (REF. NTM 53-11-55).

THIS INSPECTION DOES NOT INCLUDE THE AREA WITH THE TWO JOGGLES.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration		Number./Signature	Date		
						Day	Month	Year
Mechanic/s				HRS				
Insp.	NDT_INSP/NDT			HRS				

TASK INSTRUCTION CONT:-**Job Description**

TASK INSTRUCTION CONT:-

2.

B. IF REMOVED, APPLY SEALANT AS PER AMM TASK 53-11-00-280-809-A.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration		Number./Signature	Date		
						Day	Month	Year
Mechanic/s	CAB/ACFT_TECH			HRS				
Insp.	II/INSP			HRS				

TASK INSTRUCTION CONT:-**Job Description**

TASK INSTRUCTION CONT:-

2.

C. APPLY CORROSION PREVENTATION AS PER AMM TASK 53-11-00-280-809-A.
(AMM 51-78-00-916-001-A)

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration		Number./Signature	Date		
						Day	Month	Year



MET.25524033

Task Card Title:

SDI (HFEC) OF DOOR FR 20, BETWEEN LINTEL & INTERCO**STAL 6, EXCEPT DOUBLE JOGGLE AREA, LH/RH**

Task Card NO:

531155-04-1

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

Mechanic/s	CAB/ACFT_TECH			HRS				
Insp.	INSP/II			HRS				

Job Description

3.

A. OK TO INSTALL THE INSULATION BLANKETS AS PER 53-11-00-280-809-A.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year
Mechanic/s			HRS				
Insp.	II/INSP		HRS				

THE INSULATION BLANKETS**Job Description**

3.

B. INSTALL THE INSULATION BLANKETS AS PER 53-11-00-280-809-A.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year
Mechanic/s	CAB/ACFT_TECH		HRS				
Insp.	II/INSP		HRS				

Job Description

3.

C. OK TO INSTALL LINING PANELS AS PER 53-11-00-280-809-A.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year
Mechanic/s			HRS				
Insp.	INSP/II		HRS				

Job Description



Task Card Title:

SDI (HFEC) OF DOOR FR 20, BETWEEN LINTEL & INTERCO**STAL 6, EXCEPT DOUBLE JOGGLE AREA, LH/RH**

Task Card NO:

531155-04-1

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

3.

D. INSTALL LINING PANELS AT FRAME 20 AS PER 53-11-00-280-809-A.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year
Mechanic/s	CAB/ACFT_TECH		HRS				
Insp.	INSP/II		HRS				

THE FWD GALLEYS INSTALLTION**Job Description**

3.

E. OK TO INSTALL THE FWD GALLEY FR20 AND FR21, IF REMOVED PER 53-11-00-280-809-A.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year
Mechanic/s			HRS				
Insp.	II/INSP		HRS				

THE FWD GALLEYS INSTALLTION**Job Description**

3.

F. INSTALL THE FWD GALLEY BETWEEN FR20 AND FR21, IF REMOVED AS PER 53-11-00-280-809-A.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year
Mechanic/s	CAB/ACFT_TECH		HRS				
Insp.	II/INSP		HRS				

JOB-CLOSEUP CONT:-**Job Description**

JOB-CLOSEUP CONT:-

3.

G. PERFORM JOB CLOSE UP AS PER AMM 53-11-00-280-809-A.

STEP COMPLETION SIGN OFF:



Task Card Title:

SDI (HFEC) OF DOOR FR 20, BETWEEN LINTEL & INTERCO**STAL 6, EXCEPT DOUBLE JOGGLE AREA, LH/RH**

Task Card NO:

531155-04-1

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year
Mechanic/s	CAB/ACFT_TECH		HRS				
Insp.			HRS				

-Aircraft Maintenance Manual used: Revision No. _____ Dated. _____.

Task card finding (Tick Applicable Box) [] Yes [] No. If yes update the system and list Task card finding WO below

Work order No: _____

_____, _____, _____, _____, _____, _____, _____, _____

Note: Make sure to creat the finding Work Order on task card level.

Remark's: _____

(1) If Task card interrupted or performed by different personals updates the system and update the following accord (Tick Applicable Box)

- Interruption No. 1 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

- Interruption No. 2 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

- Interruption No. 3 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

- Interruption No. 4 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

- Interruption No. 5 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

(2) Record any dimension or torque through the performed steps and sign-off as applicable:

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

**Task Completion Close Up And
System Update****Station****Date****Signature**

 MET.32721997		Task Card Title: FWD PRESSURE BULKHEAD VERTICAL POSTS					
Task Card NO: 531184-04-1		Work Package: ASP/H-26 C7-CHK		A/C Registration: HZ-ASP			
A/C Type: 321		Single Running Taskcard		Main Skill: INSP,IL,ACFT_TECH,AP		PROD Final Acceptance:	
Project No: 01BASPC72608		Related Task Card:		A/C Area:			
Internal Check:		Check Type:		Work Order NO:		Tally Sequence NO: 398	
ENCLOSURE: ☐ CMR: ☐ CPCP: ☐ ETOPS: ☐ CDCCL: ☐ AD: ☐ ALI: ☒							
Type Code: DET		Special Code: AP, INSP		MSG Code: ALI		Request: Phase:	
I HEREBY CERTIFY THAT ALL WARNINGS AND CAUTIONS HAVE BEEN READ AND THE WORK HAS BEEN CARRIED OUT IN ACCORDING WITH ALL LAID DOWN PROCEDURES, ATTACHED NOTES AND INFORMATION.							
Zones: 211,212							
DOCUMENT REFERENCES:							
Doc Typ		Reference					
ALI		531184-04-1					
AMM		53-11-00-220-830-A					
AMTOSS		531100-220-830					
ACCESS PANELS:							
811							
MATERIAL REQUIREMENTS:							
Part Number		Description				Qty.	
08BAA9		NON AQUEOUS CLEANER - GENERAL				1.0	
12ABC1		CORROSION PREVENTIVE SOFT FILM				1.0	
14SBA1		TEXTILE - LINT FREE COTTON AMS3819				1.0	
TOOLING REQUIREMENTS:							
Part Number		Description				Qty.	
No tools assigned to this Task Item							
JOB-SETUP							
Job Description							
1. A. PERFORM JOB SET UP FOR DETAILED INSPECTION OF CENTRAL AND ADJACENT VERTICAL POSTS OF FORWARD PRESSURE BULKHEAD AND WEB ASSEMBLY, UPPER PORTION AS PER AMM 53-11-00-220-830-A.							
STEP COMPLETION SIGN OFF:							
Qualification / Skill		Number of employees		Duration		Number./Signature	
Date		Day		Month		Year	
Mechanic/s		ACFT_TECH/AP		HRS			
Insp.				HRS			
PROCEDURE							



Task Card Title:

FWD PRESSURE BULKHEAD VERTICAL POSTS

Task Card NO:

531184-04-1

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP**Job Description**

- 2.
- A. PERFORM DETAILED INSPECTION OF CENTRAL AND ADJACENT VERTICAL POSTS OF FORWARD PRESSURE BULKHEAD AND WEB ASSEMBLY, UPPER PORTION AS PER AMM 53-11-00-220-830-A.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration		Number./Signature	Date		
						Day	Month	Year
Mechanic/s				HRS				
Insp.	INSP/II			HRS				

INSTALLATION OF THE INSULATION BLANKETS**Job Description**

- 3.
- A. OK TO INSTALL THE REMOVED INSULATION BLANKETS REF. AMM TASK 25-80-00-400-001.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration		Number./Signature	Date		
						Day	Month	Year
Mechanic/s				HRS				
Insp.	II/INSP			HRS				

INSTALL THE REMOVED INSULATION BLANKETS**Job Description**

- 3.
- B. INSTALL THE REMOVED INSULATION BLANKETS REF. AMM TASK 25-80-00-400-001.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration		Number./Signature	Date		
						Day	Month	Year
Mechanic/s	ACFT_TECH/AP			HRS				
Insp.				HRS				

CLOSE-UP**Job Description**

- 3.
- C. PERFORM JOB CLOSE-UP AND RETURN THE AIRCRAFT TO ITS NORMAL CONFIGURATION IN ACCORDANCE WITH AMM 53-11-00-220-830-A.

STEP COMPLETION SIGN OFF:



Task Card Title:

FWD PRESSURE BULKHEAD VERTICAL POSTS

Task Card NO:

531184-04-1

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year
Mechanic/s	ACFT_TECH/AP		HRS				
Insp.			HRS				

-Aircraft Maintenance Manual used: Revision No. _____ Dated. _____.

Task card finding (Tick Applicable Box) [] Yes [] No. If yes update the system and list Task card finding WO below

Work order No: _____

Note: Make sure to creat the finding Work Order on task card level.

Remark's: _____

(1) If Task card interrupted or performed by different personals updates the system and update the following accord (Tick Applicable Box)

- Interruption No. 1 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

- Interruption No. 2 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

- Interruption No. 3 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

- Interruption No. 4 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

- Interruption No. 5 [] Task card [] AMM [] Other specify. _____

Performed by: _____ Page No. _____ Step From _____ To _____

(2) Record any dimension or torque through the performed steps and sign-off as applicable:

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____

Remark's: _____

**Task Completion Close Up And
System Update****Station****Date****Signature**

 MET.28342393		Task Card Title: CABIN FLOOR BEAMS, INTERNAL STRUCTURE					
Task Card NO: 532107-01-1		Work Package: ASP/H-26 C7-CHK		A/C Registration: HZ-ASP			
A/C Type: 321		Single Running Taskcard		Main Skill: II, INSP, NDT, INSP, ACFT_TECH, AP		PROD Final Acceptance:	
Project No: 01BASPC72608		Related Task Card:		A/C Area:			
Internal Check:		Check Type:		Work Order NO:		Tally Sequence NO: 399	
ENCLOSURE: ☒ CMR: ☐ CPCP: ☐ ETOPS: ☐ CDCCL: ☐ AD: ☐ ALI: ☒							
Type Code: SDI		Special Code: AP, INSP, NDT		MSG Code: ALI		Request:	
Phase:							
I HEREBY CERTIFY THAT ALL WARNINGS AND CAUTIONS HAVE BEEN READ AND THE WORK HAS BEEN CARRIED OUT IN ACCORDING WITH ALL LAID DOWN PROCEDURES, ATTACHED NOTES AND INFORMATION.							
Zones: 131,132,833,843							
DOCUMENT REFERENCES:							
Doc Typ		Reference					
ALI		532107-01-1					
AMM		53-21-00-280-801-A					
AMM		532100-280-801					
ACCESS PANELS:							
825							
MATERIAL REQUIREMENTS:							
Part Number		Description				Qty.	
08BAA9		NON AQUEOUS CLEANER - GENERAL				1.0	
14SBA1		TEXTILE - LINT FREE COTTON AMS3819				1.0	
TOOLING REQUIREMENTS:							
Part Number		Description				Qty.	
No tools assigned to this Task Item							
1. JOB SET-UP							
Job Description							
A. PERFORM JOB SET UP AS PER AMM TASK 53-21-00-280-801-A AND PERFORM THE FOLLOWING:							
(1) REMOVE THE APPLICABLE DOOR FRAME LININGS AT FR35.1 AND FR35.2A TO GET ACCESS TO THE INSPECTION AREA AS PER AMM TASK.							
(2) REMOVE THE APPLICABLE INSULATION BLANKETS AT FR35.1 AND FR35.2A TO GET ACCESS TO THE INSPECTION AREA AS PER AMM TASK.							
STEP COMPLETION SIGN OFF:							
Qualification / Skill		Number of employees		Duration		Number./Signature	
Date							
Day Month Year							
Mechanic/s		ACFT_TECH/AP					
Insp.							



Task Card Title:

CABIN FLOOR BEAMS, INTERNAL STRUCTURE

Task Card NO:

532107-01-1

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP**1. JOB SET-UP (CONT...):****Job Description**

B. MAKE SURE THAT THE SURFACE OF THE INSPECTION AREA IS CLEAN AND SMOOTH, USE A NON AQUEOUS GENERAL CLEANER

WITH A LINT FREE COTTON TEXTILE TO CLEAN THE SURFACE OF THE INSPECTION AREA.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year
Mechanic/s	ACFT_TECH/AP		HRS				
Insp.			HRS				

2. PROCEDURE**Job Description**

A. PERFORM A SPECIAL DETAILED INSPECTION OF THE FUSELAGE INTERNAL AND EXTERNAL PARTS OF THE STRUCTURE, FRAME AND SKIN AT FRAMES 35.1 AND 35.2A. DO THIS INSPECTION BETWEEN LEFT STRINGERS 9 AND 11 AND BETWEEN RIGHT STRINGERS 12 AND 14 AS PER AMM TASK 53-21-00-280-801.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year
Mechanic/s			HRS				
Insp.	II/NDT_INSP		HRS				

3. CLOSE UP**Job Description**

A. OK TO INSTALL THE INSULATION BLANKETS.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year
Mechanic/s			HRS				
Insp.	INSP/II		HRS				

3. CLOSE UP**Job Description**

B. INSTALL THE INSULATION BLANKETS.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year
Mechanic/s	ACFT_TECH/AP		HRS				
Insp.	INSP/II		HRS				

3. CLOSE UP



Task Card Title:

CABIN FLOOR BEAMS, INTERNAL STRUCTURE

Task Card NO:

532107-01-1

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP**Job Description**

C. PERFORM JOB CLOSE UP AND RETURN THE AIRCRAFT BACK TO NORMAL CONFIGURATION AS PER AMM TASK 53-21-00-280-801-A.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year
Mechanic/s	ACFT_TECH/AP			HRS			
Insp.				HRS			

-Aircraft Maintenance Manual used: Revision No. _____ Dated: _____.

Task card finding (Tick Applicable Box) [] Yes [] No. If yes update the system and list Task card finding WO below

Work order No: _____

Note: Make sure to create the finding Work Order on task card level.

Remark's: _____

(1) If Task card interrupted or performed by different personals updates the system and update the following accordingly (Tick Applicable Box)

- Interruption No. 1 [] Task card [] AMM [] Other specify. _____
Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 2 [] Task card [] AMM [] Other specify. _____
Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 3 [] Task card [] AMM [] Other specify. _____
Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 4 [] Task card [] AMM [] Other specify. _____
Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 5 [] Task card [] AMM [] Other specify. _____
Performed by: _____ Page No. _____ Step From _____ To _____

(2) Record any dimension or torque through the performed steps and sign-off as applicable:

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
Remark's: _____

 MET.28342393	Task Card Title: CABIN FLOOR BEAMS, INTERNAL STRUCTURE			
Task Card NO: 532107-01-1	Work Package: ASP/H-26 C7-CHK	A/C Registration: HZ-ASP		
Task Completion Close Up And System Update	Station	Date	Signature	

COPY

Copyright of Saudia Technic - Regeneration is not allowed without prior approval by Saudia Technic.



Task Card Title:

ANTI-CRASH ROD JUNCTION

Task Card NO:

532130-39-1

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP**Job Description**

1.
B. REMOVE THE APPLICABLE PASSENGER SEATS THAT ARE BETWEEN FRAME 29 AND FRAME 35.7 ON THE RIGHT SIDE AND BETWEEN FRAME 24 AND FRAME 35.7 ON THE LEFT SIDE AS PER AMM 53-21-00-220-827-A.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year
Mechanic/s	ACFT_TECH/AP		HRS				
Insp.			HRS				

REMOVE THE LOWER SIDEWALL PANELS**Job Description**

1.
C. REMOVE THE APPLICABLE LOWER SIDEWALL PANELS THAT ARE BETWEEN FRAME 29 AND FRAME 35.7 ON THE RIGHT SIDE AND BETWEEN FRAME 24 AND FRAME 35.7 ON THE LEFT SIDE AS PER AMM 53-21-00-220-827-A.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year
Mechanic/s	ACFT_TECH/AP		HRS				
Insp.			HRS				

PREPERATION**Job Description**

1.
D. REMOVE THE APPLICABLE INSULATION BLANKETS TO GET ACCESS TO THE INSPECTION AREA AS PER 53-21-00-220-827-A.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year
Mechanic/s	ACFT_TECH/AP		HRS				
Insp.			HRS				

PREPARATION**Job Description**

1.
E. CLEAN THE INSPECTION AREA WITH THE NON AQUEOUS CLEANER-GENERAL AND A CLEAN TEXTILE-LINT FREE COTTON AS PER AMM 53-21-00-220-827-A.



Task Card Title:

ANTI-CRASH ROD JUNCTION



Task Card NO:

532130-39-1

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration		Number./Signature	Date		
						Day	Month	Year
Mechanic/s	ACFT_TECH/AP			HRS				
Insp.				HRS				

TASK INSTRUCTION

Job Description

- 2.
- A. PERFORM A DETAILED INSPECTION OF STRINGER 23 AT ANTI-CRASH ROD JUNCTION FROM FR29 TO FR35.7 RH AND FROM FR24 TO FR35.7 LH, INTERNAL STRUCTURE (VISIBLE PART) AS PER AMM 53-21-00-220-827-A.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration		Number./Signature	Date		
						Day	Month	Year
Mechanic/s	ACFT_TECH/AP			HRS				
Insp.	INSP/II			HRS				

CLOSEUP

Job Description

- 3.
- A. OK TO INSTALL THE REMOVED INSULATION BLANKETS AMM 53-21-00-220-827-A.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration		Number./Signature	Date		
						Day	Month	Year
Mechanic/s	INSP/II			HRS				
Insp.				HRS				

CLOSE UP

Job Description

- 3.
- B. INSTALL THE REMOVED INSULATION BLANKETS AMM 53-21-00-220-827-A.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration		Number./Signature	Date		
						Day	Month	Year
Mechanic/s	ACFT_TECH/AP			HRS				



Task Card Title:

ANTI-CRASH ROD JUNCTION



Task Card NO:

532130-39-1

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

Insp.

HRS

CLOSE UP

Job Description

3.
C. OK TO INSTALL THE REMOVED LOWER SIDEWALL PANELS AS PER AMM 53-21-00-220-827-A.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year
Mechanic/s			HRS				
Insp.	INSP/II		HRS				

JOB-CLOSEUP

Job Description

3.
D. INSTALL THE REMOVED LOWER SIDEWALL PANELS AS PER AMM 53-21-00-220-827-A.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year
Mechanic/s	ACFT_TECH/AP		HRS				
Insp.			HRS				

CLOSE UP

Job Description

3.
E. OK TO INSTALL INSTALL THE REMOVED PASSENGER SEATS AS PER AMM 53-21-00-220-827-A.

STEP COMPLETION SIGN OFF:

	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year
Mechanic/s			HRS				
Insp.	II/INSP		HRS				

CLOSE UP

Job Description

3.
F. INSTALL THE REMOVED PASSENGER SEATS (REF AMM 53-21-00-220-827-A).

 MET.32721991	Task Card Title: ANTI-CRASH ROD JUNCTION						
Task Card NO: 532130-39-1	Work Package: ASP/H-26 C7-CHK	A/C Registration: HZ-ASP					
.							
STEP COMPLETION SIGN OFF:							
	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year
Mechanic/s	CAB/ACFT_TECH			HRS			
Insp.				HRS			
CLOSEUP							
Job Description							
3. G. PERFORM JOB-CLOSEUP AND RETURN AIRCRAFT BACK TO NORMAL AS PER AMM 53-21-00-220-827-A. .							
STEP COMPLETION SIGN OFF:							
	Qualification / Skill	Number of employees	Duration	Number./Signature	Date		
					Day	Month	Year
Mechanic/s	ACFT_TECH/AP			HRS			
Insp.				HRS			
-Aircraft Maintenance Manual used: Revision No. _____ Dated._____. Task card finding (Tick Applicable Box) [☐] Yes [☐] No. If yes update the system and list Task card finding WO below Work order No: _____ _____ Note: Make sure to creat the finding Work Order on task card level. Remark's: _____ _____							



MET.32721991

Task Card Title:

ANTI-CRASH ROD JUNCTION

Task Card NO:

532130-39-1

Work Package:

ASP/H-26 C7-CHK

A/C Registration:

HZ-ASP

(1) If Task card interrupted or performed by different personals updates the system and update the following according (Tick Applicable Box)

- Interruption No. 1 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 2 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 3 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 4 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____
- Interruption No. 5 [] Task card [] AMM [] Other specify. _____
 Performed by: _____ Page No. _____ Step From _____ To _____

(2) Record any dimension or torque through the performed steps and sign-off as applicable:

- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____
- Dimension/torque: _____ Mech _____ INSP _____ Page No. _____ Step _____
 Remark's: _____

**Task Completion Close Up And
System Update**

Station**Date****Signature**