



JDR Restoration & Remodeling

JDR Restoration & Remodeling
- Home Re-Imagined -
E: jdrrestoration.com

Insured: [Redacted]
Property: [Redacted]
[Redacted]

Home: [Redacted]

Contractor: [Redacted]
Company: JDR Restoration & Remodeling
Business: [Redacted]
[Redacted]

Business: (972) 584-7961
E-mail: info@jdrremodeling.com



Claim Number: Policy Number: Type of Loss: Water Damage

Date of Loss:
Date Inspected: 7/2/2024 12:00 PM

Date Received:
Date Entered: 7/5/2024 8:25 AM

Price List: TXDF8X_JUL24
Restoration/Service/Remodel
Estimate: [Redacted]




Main Level

Main Level

DESCRIPTION	QTY	RESET	REMOVE	REPLACE	TAX	O&P	TOTAL
Job setup, safety and administration							
1. Residential Supervision / Project Management - per hour	20.00 HR		0.00	72.29	0.00	289.16	1,734.96
Estimated 2 hrs/day, 5 days/wk, for 2 weeks. Supervisor is responsible for budget creating and management, trade scheduling, ordering materials, working with named insured to select finishes, ensuring timely completion of project, and overall job quality.							
From Xactimate: Includes: Hourly labor rate for residential supervision/project management. Note: This is for a Superintendent/Proj. Manager used to manage residential jobs where formal Supervision/Proj. Management is needed to coordinate the work of subcontractors, or to perform other project management duties. This item should not be used for a working crew leader. The GC, estimator and/or parties involved will determine whether or not the use of a formal Superintendent/Proj. Manager is warranted, as well as the number of hours required to perform these tasks. A Superintendent/Proj. Manager generally manages multiple jobs at once. Generally, a typical single-family detached rebuild or new build would have a minimal amount of hours per weekday. In some cases, such as large multi-family/multi-unit/multi-bldg projects a full-time formal supervisor may be warranted. A Superintendent/Proj. Manager may complete tasks such as, but not limited to, creating/maintaining project schedules, coordinating/meeting trades, ordering materials, inspecting job sites, obtaining permits, meeting with inspectors, etc.							
2. Megohmmeter check electrical circuits - average residence	1.00 EA		0.00	973.87	0.00	194.78	1,168.65
Necessary to check electrical system to insure it is safe for occupants							
3. Respirator - Half face purpose resp. (per day)	2.00 DA		0.00	1.67	0.00	0.66	4.00
2 concrete grinders for 2 days - one grinding concrete and one HEPA vacuuming							
4. Respirator cartridge - HEPA (per pair)	2.00 EA		0.00	16.92	2.79	7.32	43.95
2 concrete grinders for 2 days - one grinding concrete and one HEPA vacuuming							
5. Add for HEPA filter (canister/backpack vacuums)	1.00 EA		0.00	89.91	6.02	19.18	115.11
Total: Main Level					8.81	511.10	3,066.67

Bathroom

Height: 9'

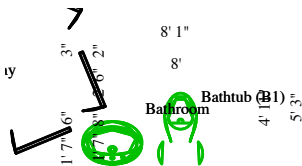

150.50 SF Walls
189.83 SF Walls & Ceiling
2.48 SY Flooring
25.83 LF Ceil. Perimeter

39.33 SF Ceiling
22.28 SF Floor
11.50 LF Floor Perimeter

DESCRIPTION	QTY	RESET	REMOVE	REPLACE	TAX	O&P	TOTAL
6. Batt insulation replacement per LF - 4" - up to 2' tall	5.42 LF		0.00	3.30	0.93	3.76	22.58
Allowance to replace insulation on exterior-facing walls							

CONTINUED - Bathroom

DESCRIPTION	QTY	RESET	REMOVE	REPLACE	TAX	O&P	TOTAL
7. 1/2" - drywall per LF - up to 2' tall	11.50 LF		0.00	12.79	1.40	29.70	178.19
8. R&R 1/2" drywall - hung, taped, floated, ready for paint	8.00 SF		0.46	3.14	0.44	5.84	35.08
Replace drywall that was damaged while tile tub surround was being removed during mitigation							
9. R&R Drywall window return - up to 6"	4.00 LF		0.46	11.18	0.42	9.38	56.36
Repair drywall return on both sides of window							
10. Texture drywall - light texture	38.75 SF		0.00	1.25	0.26	9.74	58.44
Additional SF needed to blend in with surrounding texture							
11. Seal/prime (1 coat) then paint (2 coats) the walls	150.50 SF		0.00	1.76	3.97	53.78	322.63
12. Vanity	2.58 LF		0.00	236.97	41.66	130.62	783.66
13. Seal & paint vanity - inside and out	4.58 LF		0.00	51.32	1.87	47.40	284.32
Includes exposed end of vanity							
14. Vanity top - one sink - polished marble	2.58 LF		0.00	95.21	13.13	51.74	310.51
15. Backsplash - solid surface Unattached	4.58 LF		0.00	14.97	4.03	14.52	87.11
16. Sink - single - Reset	1.00 EA		0.00	106.42	0.06	21.30	127.78
17. Sink faucet - Reset	1.00 EA		0.00	147.74	0.00	29.54	177.28
18. P-trap assembly - ABS (plastic)	1.00 EA		0.00	72.39	0.69	14.62	87.70
19. Plumbing fixture supply line	2.00 EA		0.00	24.01	1.19	9.84	59.05
20. Angle stop valve	2.00 EA		0.00	44.49	2.06	18.22	109.26
21. Detach & Reset Mirror - framed	8.59 SF	6.33	0.00	0.00	0.00	10.88	65.25
22. Concrete grinding	22.28 SF		0.00	3.80	0.00	16.94	101.60
Allowance to remove mortar residue and prep concrete substrate for new tile flooring installation							
23. HEPA Vacuuming - Light - (PER SF)	22.28 SF		0.00	0.49	1.08	2.18	14.18
HEPA vacuum as required by OSHA							
https://www.osha.gov/laws-regs/regulations/standardnumber/1926/1926.1153 (xiii) Walk-behind milling machines and floor grinders Use machine equipped with integrated water delivery system that continuously feeds water to the cutting surface Operate and maintain tool in accordance with manufacturer's instructions to minimize dust emissions OR Use machine equipped with dust collection system recommended by the manufacturer Operate and maintain tool in accordance with manufacturer's instructions to minimize dust emissions Dust collector must provide the air flow recommended by the manufacturer, or greater, and have a filter with 99% or greater efficiency and a filter-cleaning mechanism When used indoors or in an enclosed area, use a HEPA-filtered vacuum to remove loose dust in between passes							
24. Mortar bed for tile floors	22.28 SF		0.00	4.69	4.26	21.76	130.51

CONTINUED - Bathroom




DESCRIPTION	QTY	RESET	REMOVE	REPLACE	TAX	O&P	TOTAL
25. Tile floor covering	22.28 SF		0.00	10.98	9.82	50.88	305.33
26. Grout sealer	22.28 SF		0.00	1.21	0.35	5.48	32.79
27. Baseboard - 3 1/4"	11.50 LF		0.00	3.94	1.79	9.42	56.52
28. Seal (1 coat) & paint (1 coat) baseboard	11.50 LF		0.00	2.08	0.13	4.80	28.85
29. Door stop - wall or floor mounted	1.00 EA		0.00	14.52	0.52	3.00	18.04
30. Door opening (jamb & casing) - 32" to 36" wide - paint grade	1.00 EA		0.00	179.14	10.40	37.90	227.44
31. Seal & paint door/window trim & jamb - (per side)	2.00 EA		0.00	43.19	0.92	17.46	104.76
32. Door hinges (set of 3) - Detach & reset	1.00 EA		0.00	29.94	0.00	5.98	35.92
Door hinges will need to be detached and reset to allow replacement of jamb							
33. On site door prep. for full hinges - Labor only	1.00 EA		0.00	102.27	0.00	20.46	122.73
34. Interior door - Reset - slab only	1.00 EA		0.00	13.77	0.00	2.76	16.53
35. Paint door slab only - (per side)	1.00 EA		0.00	50.56	0.73	10.26	61.55
36. Mask wall - plastic, paper, tape (per LF)	25.83 LF		0.00	1.74	0.58	9.10	54.62
37. Floor protection - plastic and tape 10 mil	22.28 SF		0.00	0.38	0.22	1.74	10.43
38. Toilet - Reset	1.00 EA		0.00	176.33	0.72	35.40	212.45
39. Plumbing fixture supply line	1.00 EA		0.00	24.01	0.60	4.92	29.53
40. Angle stop valve	1.00 EA		0.00	44.49	1.03	9.10	54.62
BATHTUB							
41. Batt insulation - 4" - R15 - paper / foil faced	82.64 SF		0.00	1.54	6.41	26.74	160.42
42. 1/2" Cement board	82.64 SF		0.00	5.14	13.57	87.68	526.02
43. Waterproof membrane - poly - tile underlayment	69.44 SF		0.00	6.16	15.01	88.56	531.32
44. Bathtub - Reset	1.00 EA		0.00	438.52	0.00	87.70	526.22
45. Tile tub surround - 60 to 75 SF	1.00 EA		0.00	1,485.81	41.65	305.50	1,832.96
46. Tile - soap dish	1.00 EA		0.00	26.75	0.89	5.54	33.18
47. Seal grout on tile wall	69.44 SF		0.00	1.31	1.09	18.42	110.48
48. Tile - towel bar	1.00 EA		0.00	33.92	1.05	7.00	41.97
49. R&R Window sill - tile on wall	4.33 LF		2.34	10.38	1.41	11.30	67.79
50. Tub/shower faucet - Detach & reset	1.00 EA		0.00	249.06	0.00	49.82	298.88

MISCELLANEOUS

CONTINUED - Bathroom

DESCRIPTION	QTY	RESET	REMOVE	REPLACE	TAX	O&P	TOTAL
51. Detach & Reset Towel bar	1.00 EA	17.34	0.00	0.00	0.00	3.46	20.80
52. Towel ring - Detach & reset	1.00 EA		0.00	18.30	0.00	3.66	21.96
53. Toilet paper holder - Detach & reset	1.00 EA		0.00	18.30	0.00	3.66	21.96
54. Detach & Reset Light bar - 4 lights	1.00 EA	63.37	0.00	0.00	0.00	12.68	76.05
55. Content Manipulation charge - 1 hour	0.50 HR		0.00	57.21	0.00	5.72	34.33
56. Final cleaning - construction Residential	22.28 SF		0.00	0.37	0.82	1.64	10.70
Totals: Bathroom					187.16	1,449.50	8,698.64

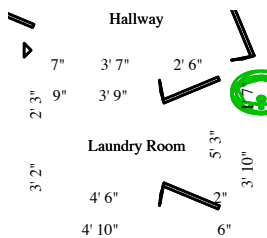

Laundry Room

223.50 SF Walls
261.13 SF Walls & Ceiling
4.18 SY Flooring
24.83 LF Ceil. Perimeter

37.63 SF Ceiling
37.63 SF Floor
24.83 LF Floor Perimeter

Height: 9'


DESCRIPTION	QTY	RESET	REMOVE	REPLACE	TAX	O&P	TOTAL
57. Batt insulation replacement per LF - 4" - up to 2' tall	7.75 LF		0.00	3.30	1.68	6.78	40.64
58. 1/2" - drywall per LF - up to 2' tall	24.83 LF		0.00	12.79	3.03	64.12	384.73
59. Texture drywall - light texture	62.08 SF		0.00	1.25	0.41	15.60	93.61
Additional SF needed to blend in with surrounding texture							
60. Seal/prime (1 coat) then paint (2 coats) the walls	223.50 SF		0.00	1.76	5.90	79.86	479.12
61. Concrete grinding	37.63 SF		0.00	3.80	0.00	28.60	171.59
Allowance to remove mortar residue and prep concrete substrate for new tile flooring installation							
62. HEPA Vacuuming - Light - (PER SF)	37.63 SF		0.00	0.49	1.82	3.68	23.94

JDR Restoration & Remodeling
- Home Re-Imagined -
E: jdrrestoration.com

CONTINUED - Laundry Room

DESCRIPTION	QTY	RESET	REMOVE	REPLACE	TAX	O&P	TOTAL
HEPA vacuum as required by OSHA							
https://www.osha.gov/laws-regs/regulations/standardnumber/1926/1926.1153 (xiii) Walk-behind milling machines and floor grinders Use machine equipped with integrated water delivery system that continuously feeds water to the cutting surface Operate and maintain tool in accordance with manufacturer's instructions to minimize dust emissions OR Use machine equipped with dust collection system recommended by the manufacturer Operate and maintain tool in accordance with manufacturer's instructions to minimize dust emissions Dust collector must provide the air flow recommended by the manufacturer, or greater, and have a filter with 99% or greater efficiency and a filter-cleaning mechanism When used indoors or in an enclosed area, use a HEPA-filtered vacuum to remove loose dust in between passes							
63. Mortar bed for tile floors	37.63 SF		0.00	4.69	7.20	36.74	220.42
64. Tile floor covering	37.63 SF		0.00	10.98	16.58	85.96	515.72
65. Grout sealer	37.63 SF		0.00	1.21	0.59	9.22	55.34
66. Baseboard - 3 1/4"	24.83 LF		0.00	3.94	3.87	20.34	122.04
67. Seal (1 coat) & paint (1 coat) baseboard	24.83 LF		0.00	2.08	0.29	10.40	62.34
68. Door stop - wall or floor mounted	1.00 EA		0.00	14.52	0.52	3.00	18.04
69. Door opening (jamb & casing) - 32"to36"wide - paint grade	1.00 EA		0.00	179.14	10.40	37.90	227.44
70. Seal & paint door/window trim & jamb - (per side)	2.00 EA		0.00	43.19	0.92	17.46	104.76
71. Door hinges (set of 1) slab - Detach & reset	1.00 EA		0.00	29.94	0.00	5.98	35.92
Door hinges will need to be detached and reset to allow replacement of jamb							
72. On site door prep. for full hinges - Labor only	1.00 EA		0.00	102.27	0.00	20.46	122.73
73. Interior door - Reset - slab only	1.00 EA		0.00	13.77	0.00	2.76	16.53
74. Paint door slab only - 2 coats (per side)	2.00 EA		0.00	50.56	1.45	20.52	123.09
75. Mask wall - plastic, paper, tape (per LF)	24.83 LF		0.00	1.74	0.55	8.76	52.51
76. Floor protection - plastic and tape 10 mil	37.63 SF		0.00	0.38	0.37	2.94	17.61
77. Washer/Washing machine - Remove & reset	1.00 EA		0.00	59.71	0.00	11.94	71.65
78. Dryer - Remove & reset	1.00 EA		0.00	46.04	0.00	9.20	55.24
79. Content Manipulation charge - 1 hour	1.00 HR		0.00	57.21	0.00	11.44	68.65
80. Final cleaning - construction Residential	37.63 SF		0.00	0.37	1.38	2.78	18.08
Totals: Laundry Room					56.96	516.44	3,101.74

JDR Restoration & Remodeling
- Home Re-Imagined -
E: jdrrestoration.com

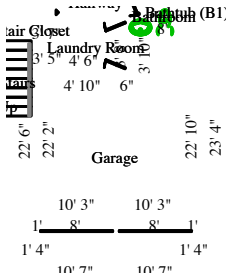


Garage

Height: 9'

814.50 SF Walls
1,221.74 SF Walls & Ceiling
45.25 SY Flooring
90.50 LF Ceil. Perimeter

407.24 SF Ceiling
407.24 SF Floor
90.50 LF Floor Perimeter

DESCRIPTION	QTY	RESET	REMOVE	REPLACE	TAX	O&P	TOTAL
81. Batt insulation replacement per LF - 4" - up to 2' tall	14.25 LF		0.00	3.30	2.46	9.90	59.39
82. 1/2" - drywall per LF - up to 2' tall	14.25 LF		0.00	12.79	1.74	36.80	220.80
83. Texture drywall - light texture	35.63 SF		0.00	1.25	0.24	8.94	53.72
Additional SF needed to blend in with surrounding texture							
84. Seal/prime (1 coat) then paint (2 coats) the walls	814.50 SF		0.00	1.76	21.50	291.00	1,746.02
85. Baseboard - 3 1/4"	14.25 LF		0.00	3.94	2.22	11.68	70.05
86. Seal (1 coat) & paint (1 coat) baseboard	90.50 LF		0.00	2.08	1.05	37.86	227.15
87. Door opening (jamb & casing) - 32" to 36" wide - paint grade	1.00 EA		0.00	179.14	10.40	37.90	227.44
88. Seal & paint door/window trim & jamb - (per side)	2.00 EA		0.00	43.19	0.92	17.46	104.76
89. Door hinges (set of 3) - Detach & reset	1.00 EA		0.00	29.94	0.00	5.98	35.92
Door hinges will need to be detached and reset to allow replacement of jamb							
90. On site door prep. for full hinges - Labor only	1.00 EA		0.00	102.27	0.00	20.46	122.73
91. Interior door - Reset - slab only	1.00 EA		0.00	13.77	0.00	2.76	16.53
92. Paint door slab only - (per side)	2.00 EA		0.00	50.56	1.45	20.52	123.09
93. Mask wall - plastic, paper, tape (per LF)	90.50 LF		0.00	1.74	2.02	31.90	191.39
94. Floor protection - plastic and tape 10 mil	407.24 SF		0.00	0.38	4.03	31.76	190.54
95. Content Manipulation charge - hour	2.00 HR		0.00	57.21	0.00	22.88	137.30
96. Final cleaning - construction Residential	407.24 SF		0.00	0.37	14.92	30.14	195.74
Totals: Garage					62.95	617.94	3,722.57

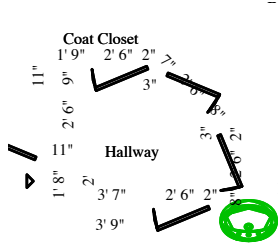

Hallway

205.17 SF Walls
242.23 SF Walls & Ceiling
4.12 SY Flooring
24.61 LF Ceil. Perimeter

37.05 SF Ceiling
37.05 SF Floor
22.11 LF Floor Perimeter


Height: 9'

Missing Wall - Goes to Floor

2' 6" X 6' 8"

Opens into LIVING_ROOM2

DESCRIPTION	QTY	RESET	REMOVE	REPLACE	TAX	O&P	TOTAL
97. 1/2" - drywall per LF - up to 2' tall	17.28 LF		0.00	12.79	2.11	44.62	267.74
98. Texture drywall - light texture	43.20 SF		0.00	1.25	0.29	10.86	65.15
Additional SF needed to blend in with surrounding texture							
99. Seal/prime (1 coat) then paint (2 coats) the walls	205.17 SF		0.00	1.76	5.42	73.30	439.82
100. Cold air return cover - Detach & reset	1.00 EA		0.00	21.10	0.00	4.22	25.32
101. Baseboard - 3 1/4"	7.28 LF		0.00	3.94	1.14	5.96	35.78
102. Seal (1 coat) & paint (1 coat) baseboard	22.11 LF		0.00	2.08	0.26	9.26	55.51
103. Paint door/window trim & jamb - 2 coats (per side)	1.00 EA		0.00	43.15	0.46	8.74	52.35
Paint door trim for Coat Closet in order to achieve a uniform repair with baseboard							
104. Carpet pad	37.05 SF		0.00	0.67	1.65	5.30	31.77
105. Carpet	42.61 SF		0.00	3.88	10.48	35.16	210.97
15 % waste added for Carpet.							
106. Final cleaning - construction Residential	37.05 SF		0.00	0.37	1.36	2.74	17.81
Totals: Hallway					23.17	200.16	1,202.22

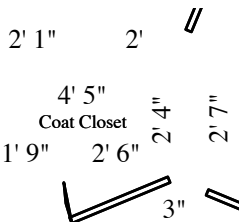

Coat Closet

121.50 SF Walls
131.81 SF Walls & Ceiling
1.15 SY Flooring
13.50 LF Ceil. Perimeter

10.31 SF Ceiling
10.31 SF Floor
13.50 LF Floor Perimeter


Height: 9'

DESCRIPTION	QTY	RESET	REMOVE	REPLACE	TAX	O&P	TOTAL
107. R&R Carpet pad	10.31 SF		0.13	0.67	0.46	1.74	10.45

JDR Restoration & Remodeling
- Home Re-Imagined -
E: jdrrestoration.com

CONTINUED - Coat Closet

DESCRIPTION	QTY	RESET	REMOVE	REPLACE	TAX	O&P	TOTAL
108. Remove Carpet 	10.31 SF		0.30	0.00	0.00	0.62	3.71
109. Carpet	11.85 SF		0.00	3.88	2.91	9.78	58.67
Carpet is continuous with Hallway							
15 % waste added for Carpet.							
110. Content Manipulation charge -  per hour	1.00 HR		0.00	57.21	0.00	11.44	68.65
Totals: Coat Closet					3.37	23.58	141.48

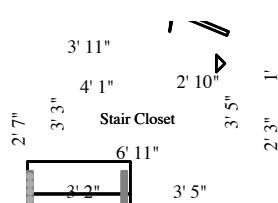


Stair Closet

Height: Sloped

108.76 SF Walls	25.72 SF Ceiling
134.48 SF Walls & Ceiling	22.95 SF Floor
2.55 SY Flooring	17.67 LF Floor Perimeter
19.00 LF Ceil. Perimeter	

Subroom: Room5 (1)

Height: 8'

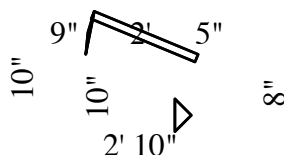

34.61 SF Walls	1.88 SF Ceiling
36.50 SF Walls & Ceiling	1.88 SF Floor
0.21 SY Flooring	4.33 LF Floor Perimeter
4.33 LF Ceil. Perimeter	

Missing Wall


2' 9 15/16" X 8'

Opens into STAIR_CLOSET

DESCRIPTION	QTY	RESET	REMOVE	REPLACE	TAX	O&P	TOTAL
111. 1/2" - drywall per LF - up to 2' tall	4.67 LF		0.00	12.79	0.57	12.06	72.36
112. Texture drywall - light texture	11.68 SF		0.00	1.25	0.08	2.94	17.62
Additional SF needed to blend in with surrounding texture							
113. Seal/prime (1 coat) then paint (2 coats) the walls	143.37 SF		0.00	1.76	3.79	51.22	307.34
114. Baseboard - 3 1/4"	4.67 LF		0.00	3.94	0.73	3.82	22.95
115. Seal (1 coat) & paint (1 coat) baseboard	22.00 LF		0.00	2.08	0.25	9.22	55.23
116. Door opening (jamb & casing) - 32"to36"wide - paint grade	1.00 EA		0.00	179.14	10.40	37.90	227.44
117. Seal & paint door/window trim & jamb - (per side)	2.00 EA		0.00	43.19	0.92	17.46	104.76

CONTINUED - Stair Closet

DESCRIPTION	QTY	RESET	REMOVE	REPLACE	TAX	O&P	TOTAL
118. Door hinges (set of 3) slab - Detach & reset	1.00 EA		0.00	29.94	0.00	5.98	35.92
Door hinges will need to be detached and reset to allow replacement of jamb							
119. On site door prep. for full mortised hinges - Labor only	1.00 EA		0.00	102.27	0.00	20.46	122.73
120. Interior door - Reset - slab only	1.00 EA		0.00	13.77	0.00	2.76	16.53
121. Paint door slab only (per side)	2.00 EA		0.00	50.56	1.45	20.52	123.09
122. Mask wall - plastic, paper, tape (per LF)	23.33 LF		0.00	1.74	0.52	8.22	49.33
123. Floor protection - plastic and tape - 10 mil	4.83 SF		0.00	0.38	0.25	1.94	11.63
124. Carpet pad	24.83 SF		0.00	0.67	1.11	3.54	21.29
125. Carpet	28.56 SF		0.00	3.88	7.02	23.56	141.39
15 % waste added for Carpet.							
126. Content Manipulation charge - per hour	1.00 HR		0.00	57.21	0.00	11.44	68.65
127. Final cleaning - construction Residential	24.83 SF		0.00	0.37	0.91	1.84	11.94
Totals: Stair Closet					28.00	234.88	1,410.20

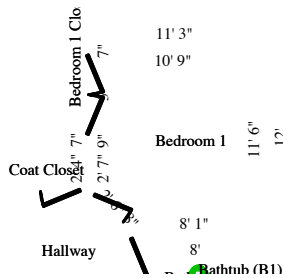

Bedroom 1

Height: 9'

386.52 SF Walls
506.62 SF Walls & Ceiling
13.35 SY Flooring
42.95 LF Ceil. Perimeter


120.11 SF Ceiling
120.11 SF Floor
42.95 LF Floor Perimeter

DESCRIPTION	QTY	RESET	REMOVE	REPLACE	TAX	O&P	TOTAL
128. Batt insulation replacement per LF - 4" - up to 2' tall	2.67 LF		0.00	3.30	0.46	1.86	11.13
129. 1/2" - drywall per LF - up to 2' tall	11.00 LF		0.00	12.79	1.34	28.40	170.43
130. Seal/prime (1 coat) then paint (2 coats) the walls	386.52 SF		0.00	1.76	10.20	138.10	828.58
131. Outlet or switch cover	1.00 EA		0.00	3.69	0.08	0.76	4.53
132. Baseboard - 3 1/4"	11.00 LF		0.00	3.94	1.72	9.00	54.06
133. Seal (1 coat) & paint (1 coat) baseboard	42.95 LF		0.00	2.08	0.50	17.96	107.80
134. Door stop - wall or floor mounted	1.00 EA		0.00	14.52	0.52	3.00	18.04

CONTINUED - Bedroom 1

DESCRIPTION	QTY	RESET	REMOVE	REPLACE	TAX	O&P	TOTAL
135. Paint door/window trim & jamb - Large - 2 coats (per side)	1.00 EA		0.00	50.75	0.54	10.26	61.55
Paint closet door trim in order to achieve a uniform repair with baseboard							
136. Door opening (jamb & casing) - 32"to36"wide - paint grade	1.00 EA		0.00	179.14	10.40	37.90	227.44
137. Seal & paint door/window trim & jamb - (per side)	2.00 EA		0.00	43.19	0.92	17.46	104.76
138. Door hinges (set of 3) - Detach & reset	1.00 EA		0.00	29.94	0.00	5.98	35.92
Door hinges will need to be detached and reset to allow replacement of jamb							
139. On site door prep. for full mortised hinges - Labor only	1.00 EA		0.00	102.27	0.00	20.46	122.73
140. Interior door - Reset - slab only	1.00 EA		0.00	13.77	0.00	2.76	16.53
141. Paint door slab only - (per side)	2.00 EA		0.00	50.56	1.45	20.52	123.09
142. Mask wall - plastic, paper, tape (per LF)	42.95 LF		0.00	1.74	0.96	15.14	90.83
143. Floor protection - plastic and tape - 10 mil	2.95 SF		0.00	0.38	0.42	3.34	20.08
144. Cold air return cover - Detach & reset	1.00 EA		0.00	21.10	0.00	4.22	25.32
Cold air return cover will need to be detached and reset to allow for painting of walls							
145. Remove Carpet	98.61 SF		0.30	0.00	0.00	5.92	35.50
Remove carpet that was not torn out during mitigation							
146. Remove Carpet pad	98.61 SF		0.13	0.00	0.00	2.56	15.38
Remove carpet pad that was not torn out during mitigation							
147. Carpet pad	120.11 SF		0.00	0.67	5.35	17.18	103.00
148. Carpet	138.12 SF		0.00	3.88	33.96	113.98	683.85
Includes 15% waste							
149. Content Manipulation charge - per hour	2.00 HR		0.00	57.21	0.00	22.88	137.30
150. Final cleaning - construction Residential	120.11 SF		0.00	0.37	4.40	8.88	57.72
Totals: Bedroom 1					73.22	508.52	3,055.57

JDR Restoration & Remodeling
- Home Re-Imagined -
E: jdrrestoration.com

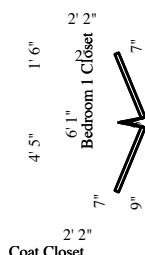


Bedroom 1 Closet

Height: 9'

145.50 SF Walls
157.67 SF Walls & Ceiling
1.35 SY Flooring
16.17 LF Ceil. Perimeter

12.17 SF Ceiling
12.17 SF Floor
16.17 LF Floor Perimeter

DESCRIPTION	QTY	RESET	REMOVE	REPLACE	TAX	O&P	TOTAL
151. R&R Carpet pad	12.17 SF		0.13	0.67	0.54	2.06	12.33
152. Remove Carpet	12.17 SF		0.30	0.00	0.00	0.74	4.39
153. Carpet	13.99 SF		0.00	3.88	3.44	11.54	69.26
Carpet is continuous with Bedroom 1							
15 % waste added for Carpet.							
154. Content Manipulation charge - per hour	1.00 HR		0.00	57.21	0.00	11.44	68.65
Totals: Bedroom 1 Closet					3.98	25.78	154.63

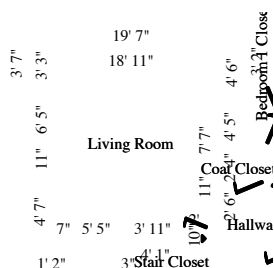

Living Room

Height: 9'

482.95 SF Walls
762.18 SF Walls & Ceiling
31.03 SY Flooring
57.18 LF Ceil. Perimeter


279.23 SF Ceiling
279.23 SF Floor
55.68 LF Floor Perimeter

Missing Wall	4' 6 13/16" X 9'	Opens into Exterior
Missing Wall	2' 8 1/2" X 9'	Opens into Exterior
Missing Wall - Goes to Ceiling	6' 5" X 6'	Opens into Exterior
Missing Wall - Goes to Floor	2' 6" X 6' 8"	Opens into HALLWAY
Missing Wall - Goes to Floor	5' 5" X 6' 8"	Opens into ENTRY

DESCRIPTION	QTY	RESET	REMOVE	REPLACE	TAX	O&P	TOTAL
155. 1/2" - drywall per LF - up to 2' tall	1.17 LF		0.00	12.79	0.14	3.02	18.12
156. Seal/prime (1 coat) then paint (2 coats) the walls	482.95 SF		0.00	1.76	12.75	172.56	1,035.30
157. Baseboard - 3 1/4"	1.17 LF		0.00	3.94	0.18	0.96	5.75
158. Seal (1 coat) & paint (1 coat) baseboard	55.68 LF		0.00	2.08	0.64	23.28	139.73
159. Mask wall - plastic, paper, tape (per LF)	57.18 LF		0.00	1.74	1.27	20.16	120.92

CONTINUED - Living Room

DESCRIPTION	QTY	RESET	REMOVE	REPLACE	TAX	O&P	TOTAL
160. Floor protection - plastic and tape - 10 mil	5.68 SF		0.00	0.38	0.55	4.36	26.07
161. Window drapery - hardware Detach & reset	3.00 EA		0.00	35.25	0.00	21.16	126.91
162. R&R Carpet pad	279.23 SF		0.13	0.67	12.44	47.16	282.98
163. Remove Carpet	279.23 SF		0.30	0.00	0.00	16.76	100.53
164. Carpet	321.11 SF		0.00	3.88	78.95	264.98	1,589.84
Carpet is continuous with Hallway							
15 % waste added for Carpet.							
165. Content Manipulation charge - per hour	2.00 HR		0.00	57.21	0.00	22.88	137.30
166. Content Manipulation (Bid Item)	1.00 EA		0.00	0.00	0.00	0.00	0.00
Bid item to remove and reset piano							
167. Final cleaning - construction Residential	279.23 SF		0.00	0.37	10.22	20.66	134.20
Totals: Living Room					117.14	617.94	3,717.65

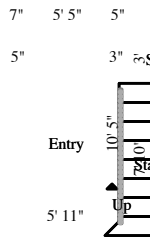

Entry

Height: 9'

160.64 SF Walls
223.64 SF Walls & Ceiling
7.00 SY Flooring
26.93 LF Ceil. Perimeter

63.00 SF Ceiling
63.00 SF Floor
21.51 LF Floor Perimeter

Missing Wall

5' 11 3/16" X 9'


Opens into Exterior

Missing Wall - Goes to Floor

5' 5" X 6' 8"

Opens into LIVING_ROOM2

DESCRIPTION	QTY	RESET	REMOVE	REPLACE	TAX	O&P	TOTAL
168. R&R Carpet pad	63.00 SF		0.13	0.67	2.81	10.64	63.85
169. Remove Carpet	63.00 SF		0.30	0.00	0.00	3.78	22.68
170. Carpet	72.45 SF		0.00	3.88	17.81	59.78	358.70
Carpet is continuous with Living Room							
15 % waste added for Carpet.							
171. Content Manipulation charge - per hour	1.00 HR		0.00	57.21	0.00	11.44	68.65
Totals: Entry					20.62	85.64	513.88

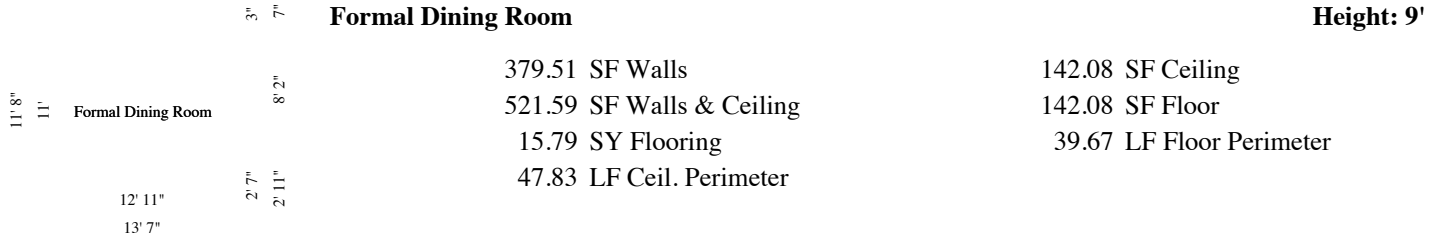

Missing Wall - Goes to Floor

8' 2" X 6' 8"

Opens into Exterior

DESCRIPTION	QTY	RESET	REMOVE	REPLACE	TAX	O&P	TOTAL
172. R&R Carpet pad	142.08 SF		0.13	0.67	6.33	24.00	143.99
173. Remove Carpet	142.08 SF		0.30	0.00	0.00	8.52	51.14
174. Carpet	163.40 SF		0.00	3.88	40.17	134.84	809.00
Carpet is identical with that which is installed in Living Room, Hallway and Bedroom 1							
15 % waste added for Carpet.							
175. Content Manipulation charge - per hour	1.00 HR		0.00	57.21	0.00	11.44	68.65
Totals: Formal Dining Room					46.50	178.80	1,072.78
Total: Main Level					631.88	4,970.28	29,858.03

Debris Removal

DESCRIPTION	QTY	RESET	REMOVE	REPLACE	TAX	O&P	TOTAL
176. Tandem axle dump trailer - per load - including dump fees	1.00 EA		385.00	0.00	0.00	77.00	462.00
Totals: Debris Removal					0.00	77.00	462.00

Labor Minimums Applied

DESCRIPTION	QTY	RESET	REMOVE	REPLACE	TAX	O&P	TOTAL
177. Insulation labor minimum	1.00 EA		0.00	130.72	0.00	26.14	156.86
178. Cabinetry labor minimum	1.00 EA		0.00	67.15	0.00	13.44	80.59
179. Mirror/shower door labor minimum	1.00 EA		0.00	93.59	0.00	18.72	112.31
180. Heat, vent, & air cond. labor minimum	1.00 EA		0.00	216.03	0.00	43.20	259.23
181. Window treatment repair	1.00 EA		0.00	42.21	0.00	8.44	50.65
Totals: Labor Minimums Applied					0.00	109.94	659.64



JDR Restoration & Remodeling

JDR Restoration & Remodeling
- Home Re-Imagined -
E: jdrrestoration.com

Line Item Totals:

631.88

5,157.22

30,979.67

Grand Total Areas:

3,300.97	SF Walls	1,202.89	SF Ceiling	4,503.86	SF Walls and Ceiling
1,209.29	SF Floor	134.37	SY Flooring	370.19	LF Floor Perimeter
0.00	SF Long Wall	0.00	SF Short Wall	402.17	LF Ceil. Perimeter
1,209.29	Floor Area	1,311.28	Total Area	3,094.93	Interior Wall Area
1,934.03	Exterior Wall Area	214.39	Exterior Perimeter of Walls		
0.00	Surface Area	0.00	Number of Squares	0.00	Total Perimeter Length
0.00	Total Ridge Length	0.00	Total Hip Length		






JDR Restoration & Remodeling

JDR Restoration & Remodeling
- Home Re-Imagined -
E: jdrrestoration.com

Summary for Dwelling

Line Item Total	25,190.57
Material Sales Tax	586.16
Cleaning Mtl Tax	8.81
Subtotal	25,785.54
Overhead	2,578.61
Profit	2,578.61
Cleaning Sales Tax	36.91
Replacement Cost Value	\$30,979.67
Net Claim	\$30,979.67



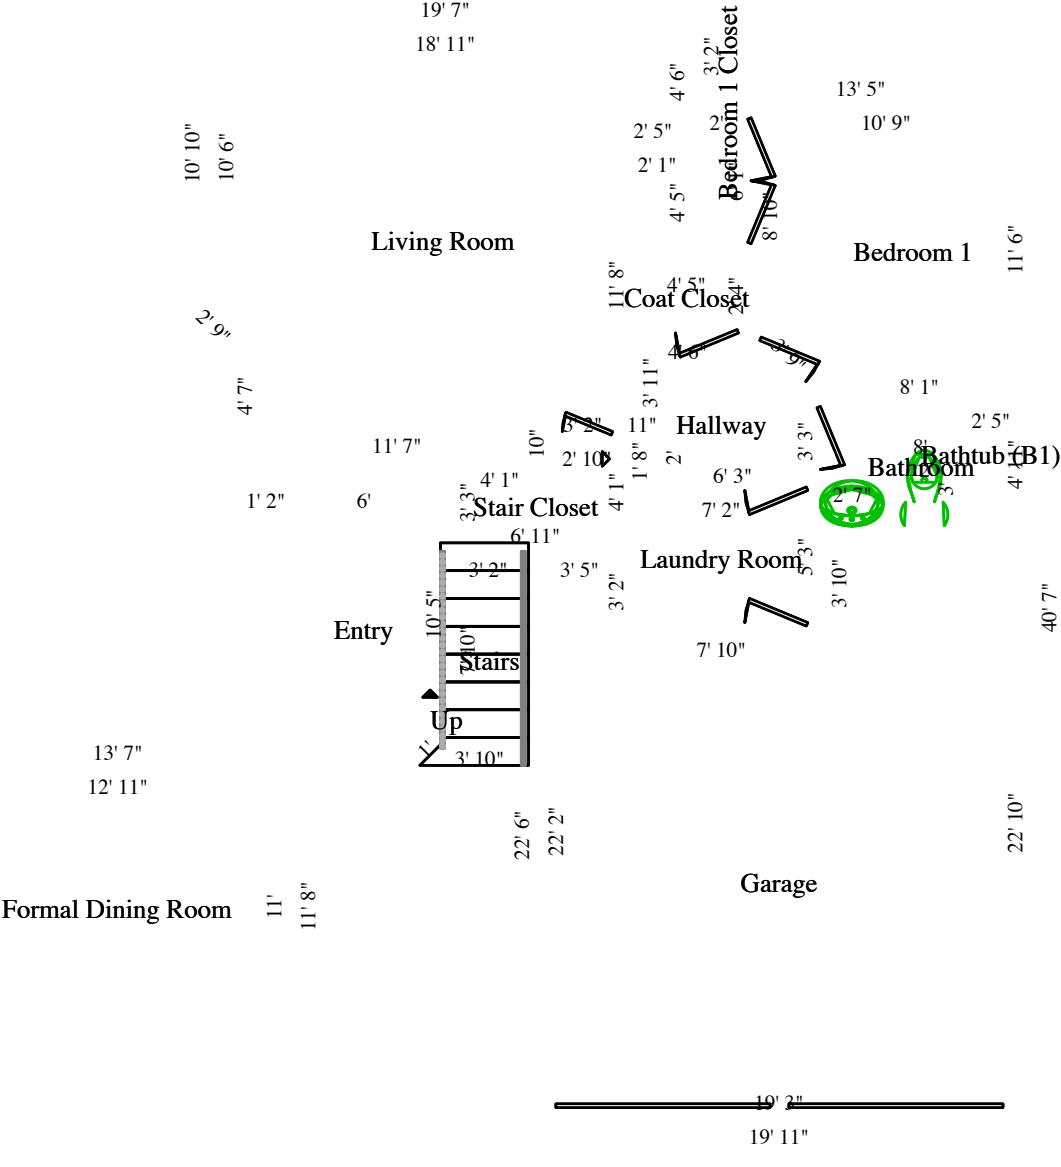

Main Level

Ciridae — Comparison Summary

Status	Count	Meaning
Green	4	Exact match (scope + metadata within $\pm 2\%$)
Orange	31	Same scope; metadata differs beyond $\pm 2\%$
Blue	137	JDR-only: not found in insurance estimate
Nuggets	113	Insurance-only: present in insurer's scope, not in JDR
Dollar gap	\$808.62	JDR total \$5,331.51 vs Insurance \$4,522.89

Insurance-Only Items (Nuggets)

These items appear in the insurance estimate but are absent from the JDR. JDR can often add them directly since the insurer has already agreed to them.

Room (Insurance)	Description	Amount
APPLIANCES	Detach & Reset Dryer - Electric	\$55.23
APPLIANCES	Detach & Reset Washer/Washing Machine - Front-loading	\$71.64
APPLIANCES	Freezer - Remove & reset	\$73.64
BRM Closet	Carpet - per specs from independent carpet analysis	\$228.66
CABINETRY	Cabinetry labor minimum	\$83.35
CARPET	Carpet - per specs from independent carpet analysis	\$395.56
CARPET	Carpet pad - per specs from independent pad analysis	\$27.83
CLEANING	Cleaning labor minimum	\$152.87
CLEANING	Final cleaning - construction - Residential	\$38.44
CONTENT MANIPULATION	Contents - move out then reset	\$100.75
CONTENT MANIPULATION	Contents - move out then reset - Large room	\$151.10
CONTENT MANIPULATION	Contents - move out then reset - Large room (Grand Piano is in Living Room)	\$151.10
CONTENT MANIPULATION	Contents - move out then reset - Small room	\$75.62
Coverage A - Dwelling - 37 ...	Cleaning Sales Tax	\$14.57
Coverage A - Dwelling - 37 ...	General Contractor Overhead	\$1,616.33
Coverage A - Dwelling - 37 ...	General Contractor Profit	\$1,616.33
Coverage A - Dwelling - 37 ...	Less Deductible	\$-3,101.00
Coverage A - Dwelling - 37 ...	Less Depreciation (Including Taxes)	\$-7,129.87
Coverage A - Dwelling - 37 ...	Less General Contractor Overhead & Profit on Recoverable & Non-recoverable Depreciation	\$-1,426.02

Coverage A - Dwelling - 37 ...	Line Item Total	\$15,650.48
Coverage A - Dwelling - 37 ...	Material Sales Tax	\$512.16
Coverage A - Dwelling - 37 ...	Net Actual Cash Value Payment	\$7,752.98
Coverage A - Dwelling - 37 ...	Replacement Cost Value (Including General Contractor Overhead and Profit)	\$19,409.87
Dining Room	Carpet - per specs from independent carpet analysis	\$1,021.27
Dining Room	Contents - move out then reset	\$100.75
DOORS	Interior door - Reset - slab only	\$66.04
DRYWALL	1/2" - drywall per LF - up to 2' tall	\$1,189.41
DRYWALL	1/2" drywall - hung, taped, floated, ready for paint (Tub Surround)	\$240.74
DRYWALL	1/2" water rock (greenboard) hung, taped ready for texture (Tub Surround)	\$224.11
DRYWALL	Tape joint for new to existing drywall - per LF	\$1,116.72
DRYWALL	Texture drywall - light hand texture	\$377.01
DRYWALL	Texture drywall - light hand texture	\$117.61
FINISH CARPENTRY / TRIMWORK	Baseboard - 3 1/4" MDF w/profile	\$368.45
FINISH CARPENTRY / TRIMWORK	Detach & Reset Shelving - 12" - in place	\$72.26
FINISH CARPENTRY / TRIMWORK	Door opening (jamb & casing) - 32"to36"wide - paint grade	\$909.44
FLOOR COVERING - CARPET	Carpet - per specs from independent carpet analysis	\$5,344.48
FLOOR COVERING - CARPET	Carpet pad - per specs from independent pad analysis	\$65.71
FLOOR COVERING - CARPET	Remove Carpet	\$52.92
FLOOR COVERING - CARPET	Remove Carpet	\$6.01
FLOOR COVERING - CARPET	Remove Carpet (Some carpet and pad was removed by mitigation company)	\$163.00
FLOOR COVERING - CERAMIC TILE	Floor leveling cement - Average	\$257.65
FLOOR COVERING - CERAMIC TILE	Tile floor covering	\$1,095.43
FLOORING	Floor leveling cement - Average	\$139.55
FLOORING	Tile floor covering	\$593.30
Garage	Baseboard - 3 1/4" MDF w/profile	\$81.35
Garage	Contents - move out then reset - Large room	\$151.10
Garage	Freezer - Remove & reset	\$73.64
Garage	Includes the drywall around the water heater plate form.	-
Garage	Paint baseboard - two coats (For replace baseboard)	\$41.06
Garage	Tape joint for new to existing drywall - per LF	\$231.51

GENERAL DEMOLITION	Haul debris - per pickup truck load - including dump fees	\$288.60
Hall Bathroom	1/2" drywall - hung, taped, floated, ready for paint (Tub Surround)	\$240.74
Hall Bathroom	1/2" water rock (greenboard) hung, taped ready for texture (Tub Surround)	\$224.11
Hall Bathroom	Batt insulation - 4" - R11- unfaced batt	\$49.83
Hall Bathroom	Ceramic/porcelain tile (Tub Surround)	\$1,008.74
Hall Bathroom	Final cleaning - construction - Residential	\$20.81
Hall Bathroom	Includes the drywall around the water heater plate form. 45. Part of the walls and ceil...	\$237.33
Hall Bathroom	Install Bathtub	\$631.71
Hall Bathroom	Install Toilet	\$293.26
Hall Bathroom	Picture-frame method used up to 4 ' tall to texture the wall in the water heater offset...	\$221.36
Hall Bathroom	Tape joint for new to existing drywall - per LF	\$263.26
Hall Bathroom	Texture drywall - light hand texture	\$117.61
Hall Closet	Carpet - per specs from independent carpet analysis	\$170.86
INSULATION	Batt insulation - 4" - R11- unfaced batt	\$63.15
INSULATION	Insulation labor minimum	\$216.51
Laundry Room	Floor leveling cement - Average	\$118.10
Living Room	Carpet - per specs from independent carpet analysis	\$2,290.14
Living Room	Remove Carpet (Some carpet and pad was removed by mitigation company)	\$115.56
Main Level	Haul debris - per pickup truck load - including dump fees	\$288.60
Offset	1/2" - drywall per LF - up to 2' tall	\$108.14
Offset	Includes the drywall around the water heater plate form.	-
Offset	Paint the walls - one coat	\$217.03
Offset	Picture-frame method used up to 4 ' tall to texture the wall in the water heater offset	-
Offset	Tape joint for new to existing drywall - per LF	\$95.32
Offset	Texture drywall - light hand texture	\$42.22
PAINTING	Paint baseboard - one coat	\$179.12
PAINTING	Paint baseboard - one coat (Undamaged baseboards)	\$23.51
PAINTING	Paint baseboard - two coats (For replace baseboard)	\$187.22
PAINTING	Paint door or window opening - 2 coats (per side)	\$208.32
PAINTING	Paint door slab only - 2 coats (per side)	\$245.04
PAINTING	Paint {V} - one coat	\$2,480.48
PAINTING	Seal & paint wood shelving, 12"- 24" width	\$52.46
PLUMBING	Install Bathtub	\$631.71
PLUMBING	Install Toilet	\$293.26
Stair Closet	* 78. Remove Carpet (Some carpet and pad was removed by mitigation company)	\$5.43
Stair Closet	Carpet - per specs from independent carpet analysis	\$270.51

TILE	Ceramic/porcelain tile (Tub Surround)	\$1,008.74
TRIM/DOORS	Baseboard - 3 1/4" MDF w/profile	\$118.03
TRIM/DOORS	Baseboard - 3 1/4" MDF w/profile	\$68.57
TRIM/DOORS	Baseboard - 3 1/4" MDF w/profile	\$67.01
TRIM/DOORS	Baseboard - 3 1/4" MDF w/profile	\$33.49
TRIM/DOORS	Door opening (jamb & casing) - 32"to36"wide - paint grade	\$227.36
TRIM/DOORS	Interior door - Reset - slab only	\$16.51
TRIM/DOORS	Paint baseboard - one coat	\$39.63
TRIM/DOORS	Paint baseboard - one coat	\$51.10
TRIM/DOORS	Paint baseboard - one coat (Undamaged baseboards)	\$23.51
TRIM/DOORS	Paint baseboard - two coats (For replace baseboard)	\$59.59
TRIM/DOORS	Paint baseboard - two coats (For replace baseboard)	\$16.91
TRIM/DOORS	Paint baseboard - two coats (For replace baseboard)	\$35.84
TRIM/DOORS	Paint baseboard - two coats (For replace baseboard)	\$33.82
TRIM/DOORS	Paint door or window opening - 2 coats (per side)	\$52.08
TRIM/DOORS	Paint door slab only - 2 coats (per side)	\$61.26
WALLS	1/2" - drywall per LF - up to 2' tall	\$381.05
WALLS	1/2" - drywall per LF - up to 2' tall	\$216.25
WALLS	Batt insulation - 4" - R11- unfaced batt	\$6.66
WALLS	Detach & Reset Shelving - 12" - in place	\$72.26
WALLS	Paint the walls and ceiling - one coat	\$276.74
WALLS	Paint the walls and ceiling - one coat	\$537.55
WALLS	Seal & paint wood shelving, 12"- 24" width	\$52.46
WALLS	Tape joint for new to existing drywall - per LF	\$335.97
WALLS	Tape joint for new to existing drywall - per LF	\$190.66
WALLS	Texture drywall - light hand texture	\$147.79
WALLS	Texture drywall - light hand texture	\$84.45